

CARLINK CONSULTANCY


60 Hillside Drive
Singapore 549009

Tel : 62856178

Fax : 62874788

ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT

Our Ref: CL 12243 YP 5507 S

1 REFERENCE			
Date of request	: 3rd December 2020		
Requested by	: M/S Edmund Vehicle Rental Pte Ltd 279 Balestier Road, #02-27 Balestier Point Singapore 329727		
Type of claim	: Third party		
Workshop	: M/S Ngee Ngee Motor Blk K, No. 22 Pandan Loop Singapore 128240		
Date of survey	: 3rd December 2020		
Accident date	: 13th November 2020		
2 DETAILS OF VEHICLE			
Registration No.	: YP 5507 S		
Make & Model	: Mitsubishi Canter FEB21ER4SDEB (CBU)		
Date of registration	: 12th January 2017		
Engine No.	: 4P10B97593		
Chassis No.	: FEB21EA20185		
Speedometer reading	: 101343 Km		
Transmission	: Manual		
Colour	: White		
3 STATIC CHECK			
Steering	: see annex(es)	Paintwork	: Good
Footbrake	: see annex(es)	Modification	: Nil
Handbrake	: see annex(es)	General condition	: Good
4 TYRE CONDITION			
	<u>Nearside/Make</u>	<u>Offside/Make</u>	<u>Size</u>
Front tyre	: 7mm/Yokohama	7mm/Yokohama	: 195/85 R15
Rear tyre	: 7mm/Yokohama	7mm/Yokohama	: 195/85 R15
5 POINT OF IMPACT			
See Annex(es) and Motor Accident Reports			
6 REMARK			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

*Result.
Paper Survey*

Annex A : Assesment / Adjustment on Spare Parts

YP 5507 S

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)
List Items						
1	Front bumper	Repair	1	\$895.00	100%	\$0.00 <i>XR</i>
2	Front bumper side cover LH <i>XSVL</i>	Necessary	1	\$334.00	25%	\$250.50 <i>X</i>
3	Front bumper side cover RH <i>XSVL</i>	Necessary	1	\$334.00	25%	\$250.50 <i>X</i>
4	Front bumper bracket L/R	Repair	1	\$36.40	100%	\$0.00 <i>XR</i>
5	Head lamp RH <i>XSVL</i>	Grazed/shifted/cracked	1	\$10.00	25%	\$7.50 <i>X</i>
6	Head lamp LH	Grazed/shifted/cracked	1	\$610.00	25%	\$457.50 ✓
7	Side lamp garnish RH <i>XSVL</i>	Cracked	1	\$218.80	25%	\$164.10 <i>X</i>
8	Side lamp garnish LH <i>XSVL</i>	Cracked	1	\$218.80	25%	\$164.10 <i>X</i>
9	Signal lamp RH <i>XSVL</i>	Grazed/shifted/cracked	1	\$325.65	25%	\$244.24 <i>X</i>
10	Signal lamp LH	Grazed/shifted/cracked	1	\$325.65	25%	\$244.24 ✓
11	Front panel	Buckled	1	\$3,046.00	25%	\$2,284.50 <i>1451</i>
12	Front panel FUSO emblem	Necessary	1	\$152.00	25%	\$114.00 ✓
13	Front grille badge	Necessary	1	\$57.00	25%	\$42.75 ✓
14	Front grille assy	Distorted/cracked	1	\$959.50	25%	\$719.63 ✓
15	Front corner panel RH <i>XSVL</i>	Cracked	1	\$383.15	25%	\$287.36 <i>X</i>
16	Front corner panel clips RH <i>XAN</i>	Necessary	2	\$12.00	25%	\$9.00 <i>X</i>
17	Front corner panel LH <i>XSVL</i>	Cracked	1	\$383.15	25%	\$287.36 <i>X</i>
18	Front corner panel clips LH <i>XAN</i>	Necessary	2	\$12.00	25%	\$9.00 <i>X</i>
19	Front LH mirror stay <i>XSVL</i>	Bent	1	\$415.00	25%	\$311.25 <i>X</i>
20	Front LH mirror (round)	Distorted/cracked	1	\$125.00	25%	\$93.75 ✓

Total for Spare Parts : \$8,853.10 \$5,941.28

3122.87

Annex B : Adjustment on Labour and Spray Painting

YP 5507 S

Item	Job Description	Workshop Est. (\$)	Adjusted Cost (\$)
1	Anti rust treatment	\$150.00	\$120.00 40
2	To check wiring system & lights	\$100.00	\$80.00 30
3	To respray affected areas	\$1,200.00	\$950.00 600
4	To renew damaged parts, straighten/repair front bumper & bracket & aligned all parts	\$1,800.00	\$1,400.00 600
TOTAL FOR LABOUR & SPRAY PAINTING :		\$3,250.00	\$2,550.00

1270

Summary

	Workshop Est. (\$)	Adjusted Cost (\$)
TOTAL FOR SPARE PARTS :	\$8,853.10	\$5,941.28
TOTAL FOR LABOUR & SPRAY PAINTING :	\$3,250.00	\$2,550.00
TOTAL REPAIR COSTS :	\$12,103.10	\$8,491.28

3122.87

1270.00

4392.87

20%

3514.29

4/5-3,500

5 days

CARLINK CONSULTANCY

YP 5507 S

Annex C: Recommendation

We have inspected thoroughly the actual damages found on the vehicle and our assessment is appended in the Annex(es) attached. The condition and age of the vehicle was considered before we reached our recommendation as to whether the parts need replacement or repair.

M/S Ngee Ngee Motor estimated repair cost is **S\$12,103.10** and we have adjusted it to **S\$8,491.28** on a part by part basis. However, taking into consideration the age of the vehicle and the availability of used/recondition components. We, therefore recommend a contract lump sum repair cost.

The repairer have agreed to undertake the repairs on a contract lump sum of **S\$7,200.00**, according to acceptable quality and standard. (Repairer discretion to repair parts, to replace with old parts, or to replace with OEM or genuine parts).


The entire repair of the damaged vehicle should be completed within a reasonable period of **7** working days.

We have advised the repairer that the inspection was conducted strictly on a WITHOUT PREJUDICE basis and we have not given any instruction and authorisation to proceed with the repair of the vehicle.

We are reverting the matter to you for your discretion and enclosed is our invoice for service rendered.

Yours faithfully,

CARLINK CONSULTANCY

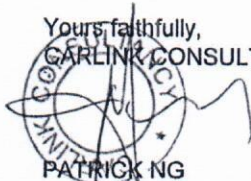

PATRICK NG

Automotive Engineer Assessor

MIMI, MIRTE, LCGI, I ENG, LAE, CGLI FTC.