



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103432

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 17/05/2021
Reference CC3/CTI21003704/T1ea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 6392T
Insured Veh. SMT 5798P
Claim No. SNM21D201635
Policy No. DMPCSNW00109112000
Accident Date 20/03/2021
Inspection Date 23/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21003704/T1ea3q2 Date: 17/05/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMT 5798P	Veh. Inspected	SHC 6392T
	Policy No.	DMPCSNW00109112000	Coverage (\$)	0.00
	Claim No.	SNM21D201635	Excess (\$)	0.00
	Assign From		Assign Date	23/03/2021
2. Vehicle Particulars & Condition				
	Make & Model	KIA OPTIMA	c.c	1685
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	KNAGM414MF5574975	Colour	SILVER
	Odometer	566133 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/60 R15	MAXXIS	6 mm
	L/H Front Tyre	205/60 R15	MAXXIS	6 mm
	R/H Rear Tyre	205/60 R15	MAXXIS	6 mm
	L/H Rear Tyre	205/60 R15	MAXXIS	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	20/03/2021	Inspection Date	23/03/2021
	Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 6392T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
2	FRONT N/S & O/S HEAD LAMP @\$1028.00	N/S NOT NECESSARY / O/S CRACKED	2,056.00	1,028.00
1	FRONT BUMPER EMBLEM	NOT NECESSARY	44.00	-
1	FRONT BUMPER	DEFORMED	531.00	531.00
2	FRONT BUMPER N/S & O/S SIDE RETAINER @\$16.00	N/S NOT NECESSARY / O/S NECESSARY	32.00	16.00
2	FRONT BUMPER N/S & O/S UPPER BRACKET @\$16.00	NOT NECESSARY	32.00	-
2	FRONT BUMPER N/S & O/S SUPPORT BRACKET @\$16.00	NOT NECESSARY	32.00	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	328.00	-
1	FRONT BUMPER SPONGE	NOT NECESSARY	110.00	-
1	FRONT BUMPER O/S PROTECTOR @\$51.00	CUT	51.00	51.00
1	FRONT BUMPER O/S FOG LAMP COVER @\$66.00	CUT	66.00	66.00
1	FRONT BUMPER LOWER STIFFER	NOT NECESSARY	134.00	-
1	FRONT BUMPER CENTRE GRILLE	NOT NECESSARY	174.00	-
1	SUPPORT PANEL	NOT NECESSARY	645.00	-
1	BONNET GRILLE	NOT NECESSARY	385.00	-
1	FRONT O/S FENDER	NOT NECESSARY	384.00	-
1	FRONT O/S FENDER INNER SHIELD	NOT NECESSARY	120.00	-
1	FRONT O/S RIM	NOT NECESSARY	246.00	-
1	FRONT O/S WHEEL COVER	NOT NECESSARY	116.00	-
	LESS 10% DISCOUNT		-548.60	-169.20
			4,937.40	1,522.80
<u>SPECIAL NETT ITEMS</u>				
1	FRONT NO.PLATE WITH CASING (SN)	NOT NECESSARY	30.00	-
1	SET FRONT N/S FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	28.00	-
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	48.00	30.00
1	FRONT O/S FENDER STICKER (SN)	NOT NECESSARY	60.00	-
2	FRONT N/S & O/S HEAD LAMP LOWER CLIP (SN)	NOT NECESSARY	12.00	-
2	FRONT N/S & O/S HEAD LAMP SIDE CLIP (SN)	NOT NECESSARY	6.00	-

Report Ref No. CC3/CTI21003704/T1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TYRE (TYRE BRAND ACHILLES) (SN)	NOT NECESSARY	200.00	-
			384.00	30.00
	LABOUR			
	TO CHECK WHEEL ALIGNMENT .	NOT NECESSARY	80.00	-
	TO DISMANTLE /REFIT THE INNER GARNISHES ,INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ,ETC TO FACILITATE REPAIRS .	NOT NECESSARY	180.00	-
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS.INCLUDING KNOCK -OUT ,STRAIGHTEN ,REPAIR,RESHAPE AND ADJUST OF THE SAME ETC.		800.00	200.00
	TO PUTTY AND SPRAY PAINTING ON FRONT BUMPER ,BONNET ,BONNET ,GRILLE ,FRONT O/S FENDER .		800.00	200.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.	NOT NECESSARY	120.00	-
			1,980.00	400.00
GRAND TOTAL			7,301.40	1,952.80
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,550.00

Report Ref No. CC3/CTI21003704/T1ea3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 6392T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

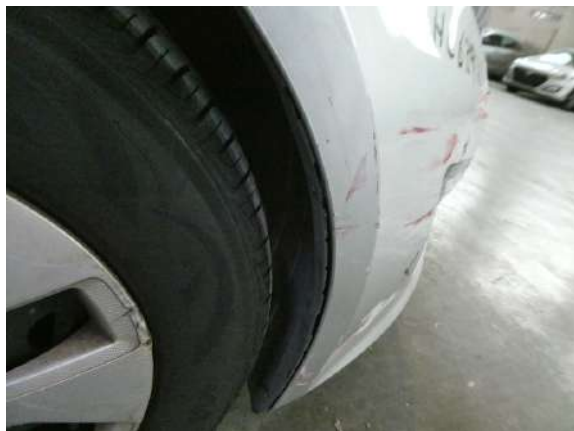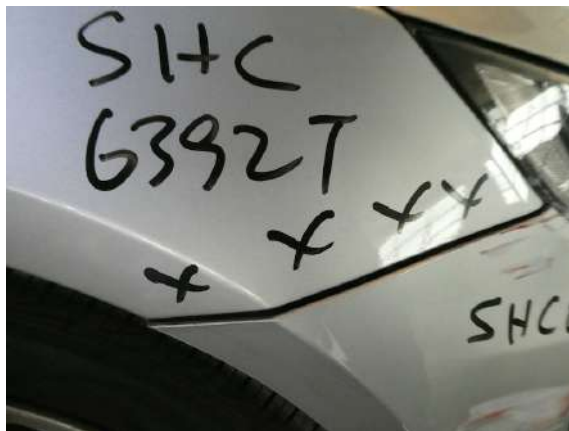



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 6392T

RE-INSPECTION

