



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2104750

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 06/07/2021
Reference CC6/CTI21003734/Uea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMG 1792A
Insured Veh. SMU 6810A
Claim No. SNM21D201649/C02
Policy No. DMHCSNW00005482000
Accident Date 23/03/2021
Inspection Date 22/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21003734/Uea3q2	
			Date: 06/07/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMU 6810A	Veh. Inspected	SMG 1792A	
Policy No.	DMHCSNW00005482000	Coverage (\$)	0.00	
Claim No.	SNM21D201649/C02	Excess (\$)	0.00	
Assign From		Assign Date	22/03/2021	
2. Vehicle Particulars & Condition				
Make & Model	MITSUBISHI ATTRAGE (A)	c.c	1193	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	MMBSTA13AJH004354	Colour	RED	
Odometer	320508 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/50 R15	FALKEN	5 mm	
L/H Front Tyre	195/50 R15	FALKEN	5 mm	
R/H Rear Tyre	195/50 R15	FALKEN	5 mm	
L/H Rear Tyre	195/50 R15	FALKEN	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.THE CHASSIS FRAME AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/03/2021	Inspection Date	22/03/2021	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMG 1792A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	BUCKLED	1,215.00	732.50
2	BONNET HINGES @\$115.00	BENT	230.00	190.00
1	BONNET INSULATOR	TORN	288.20	142.00
1	SET BONNET INSULATOR CLIPS	NECESSARY	40.00	40.00
1	BONNET LOCK	TWISTED	315.00	97.00
1	BONNET LOCK CABLE	JAMMED	350.00	155.00
1	BONNET LOCK GARNISH	NO SUCH PARTS	166.20	-
1	BONNET RUBBER	NECESSARY	86.00	60.00
1	FRONT GRILLE CHROME	NO SUCH PARTS	540.00	-
1	FRONT GRILLE	CRACKED	585.00	548.00
1	FRONT GRILLE LOGO	NECESSARY	45.00	45.00
1	FRONT BUMPER	DISTORTED	1,260.00	696.00
1	FRONT BUMPER CENTRE GARNISH	DISTORTED	488.00	245.00
1	SET FRONT BUMPER LOWER SPOILER KIT	BROKEN	1,820.00	1,200.00
1	FRONT BUMPER UNDER COVER	NOT NECESSARY	366.20	-
1	SET FRONT BUMPER UNDER COVER CLIPS	NOT NECESSARY	50.00	-
1	FRONT BUMPER UNDER TRAY	NOT NECESSARY	315.00	-
1	FRONT BUMPER TOW COVER	NOT NECESSARY	30.00	-
2	FRONT BUMPER FOG LAMPS @\$350.00	O/S CRACKED	700.00	325.00
2	FRONT BUMPER FOG LAMP GARNISHS @\$115.00	O/S DISTORTED	230.00	115.00
2	FRONT BUMPER SIDE RETAINERS @\$35.00	BENT	70.00	50.00
1	FRONT BUMPER REINFORCEMENT	DISTORTED	455.00	455.00
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	50.00
1	FRONT SUPPORT PANEL	DISTORTED	1,106.20	936.00
1	FRONT SUPPORT PANEL TOP GARNISH (INNER)	DISTORTED	311.80	182.00
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS	NECESSARY	35.00	35.00
2	HEADLAMPS @\$900.00	N/S CRACKED / O/S BROKEN	1,800.00	1,308.00
1	AIR CON CONDENSER	BENT / PUNCTURE	1,490.00	758.00
1	AIR CON SUCTION HOSE	NOT NECESSARY	399.90	-
1	AIR CON DISCHARGE HOSE	NOT NECESSARY	415.10	-

Report Ref No. CC6/CTI21003734/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR CON LIQUID PIPE	NOT NECESSARY	359.20	-
2	AIR CON SIDE GARNISHS @\$80.00	O/S TORN	160.00	80.00
1	RADIATOR	CRACKED / PUNCTURE	1,845.20	967.00
1	RADIATOR FAN MOTOR ASSY	CRACKED / JAMMED	820.00	605.00
1	AIR INTAKE MANIFOLD	NOT NECESSARY	2,285.20	-
1	AIR INTAKE MANIFOLD HOSE	NOT NECESSARY	65.00	-
1	AIR DUCT	CRACKED	211.90	205.00
1	AIR DUCT HOSE	TWISTED	350.00	68.00
1	HORN UNIT	BENT	105.00	102.00
1	MANIFOLD INLET	NOT NECESSARY	998.00	-
2	FRONT FENDERS @\$715.00	BENT / BUCKLED	1,430.00	916.00
2	FRONT FENDER INNER SHIELDS @\$190.00	O/S TORN	380.00	162.00
2	FRONT FENDER EMBLEMS @\$85.00	NECESSARY	170.00	120.00
1	SET FRONT FENDER INNER SHIELD CLIPS	NECESSARY	50.00	50.00
1	FRONT FENDER INNER PANEL O/S	TO REPAIR SEE LABOUR	620.00	-
1	FRONT FENDER INNER ARCH PANEL O/S	TO REPAIR SEE LABOUR	688.00	-
1	FRONT WHEEL HOUSING PANEL O/S	TO REPAIR SEE LABOUR	915.00	-
1	WIPER PANEL TOP GARNISH	DISTORTED	388.00	245.00
1	SET WIPER PANEL TOP GARNISH CLIPS	NECESSARY	50.00	50.00
1	ALTERNATOR	BENT / JAMMED	2,100.00	1,520.00
1	AIR CON COMPRESSOR	BENT / JAMMED	2,080.00	1,680.00
1	WATER PUMP PULLEY	DAMAGED / JAMMED	820.00	292.00
1	ABS PUMP	DAMAGED / CRACKED	2,500.00	1,750.00
1	FRONT LOWER ARM O/S	NOT NECESSARY	699.20	-
1	FRONT KNUCKLE ARM O/S	NOT NECESSARY	588.20	-
1	FRONT KNUCKLE ARM BEARING O/S	NOT NECESSARY	350.00	-
1	FRONT SHOCK ABSORBER O/S	NOT NECESSARY	399.20	-
1	FRONT DRIVE SHAFT O/S	NOT NECESSARY	1,280.00	-
1	FRONT STEERING RACK ASSY	NOT NECESSARY	2,125.00	-

Report Ref No. CC6/CTI21003734/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ENGINE CROSS MEMBER	NOT NECESSARY	1,800.00	-
1	FRONT STABILIZER BAR	NOT NECESSARY	388.00	-
1	FRONT DOOR O/S	TO REPAIR SEE LABOUR	845.00	-
1	ROCKER PANEL GARNISH O/S	TO REPAIR SEE LABOUR	680.00	-
1	FRONT DOOR OUTER PILLAR O/S	NOT NECESSARY	699.20	-
1	DRIVER AIR BAG	NOT NECESSARY	2,100.00	-
1	DRIVER SPIRAL SENSOR	NOT NECESSARY	328.00	-
1	PASSENGER AIR BAG	NOT NECESSARY	2,890.00	-
1	DASHBOARD	NOT NECESSARY	1,600.00	-
2	FRONT SEATBELTS @\$745.00	NOT NECESSARY	1,490.00	-
1	AIR BAG CONTROL UNIT	NOT NECESSARY	900.00	-
1	WIPER WASHER TANK	DISTORTED	185.00	148.00
1	WIPER WASHER TANK MOTOR	JAMMED	115.00	115.00
1	ENGINE MOUNTING O/S	BENT	485.00	305.00
1	FRONT CHASSIS MEMBER O/S	BENT / TWISTED	1,100.00	820.00
	LESS 10% DISCOUNT		-	-1,856.45
			55,689.90	16,708.05
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT LICENCE PLATE (SN)	BENT	50.00	40.00
1	BOL RADIATOR COOLANT (SN)	NECESSARY	50.00	30.00
1	BOL AIR CON OIL (SN)	NECESSARY	50.00	30.00
1	FRONT SPORT RIM (SN)	NOT NECESSARY	850.00	-
1	FRONT TYRE (SN)	NOT NECESSARY	200.00	-
			1,200.00	100.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		80.00	30.00
	TO PRAY RUST PROOFING .		180.00	120.00
	TO CONDUCT WHEEL ALIGNMENT .		120.00	60.00
	TO R&R FRONT UNDER CARRIAGE .		500.00	350.00
	TO R&R ENGINE ,GEARBOX .		500.00	350.00
	TO R&R FRONT WINDSCREEN .	NOT NECESSARY	120.00	-

Report Ref No. CC6/CTI21003734/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO R&R INLET MANIFOLD.	NOT NECESSARY	100.00	-
	TO R&R FRONT DASHBOARD .	NOT NECESSARY	380.00	-
	TO R & R AIR BAG SYSTEM.	NOT NECESSARY	500.00	-
	TO SET & REPROGRAMME AIR BAG.	NOT NECESSARY	500.00	-
	TO MOUNT VEHICLE ON CAR O-LINER .	NOT NECESSARY	380.00	-
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF FRONT FENDER INNER PANEL O/S,FRONT FENDER INNER ARCH PANEL O/S ,FRONT WHEEL HOUSING PANEL O/S ,FRONT DOOR O/S AND ROCKER PANEL GARNISH O/S .		3,000.00	1,600.00
	TO PUTTY & SPRAY PAINTING .		2,500.00	1,400.00
			8,860.00	3,910.00
GRAND TOTAL			65,749.90	20,718.05
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				16,500.00

Report Ref No. CC6/CTI21003734/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 1792A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 1792A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 1792A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMG 1792A

RE-INSPECTION

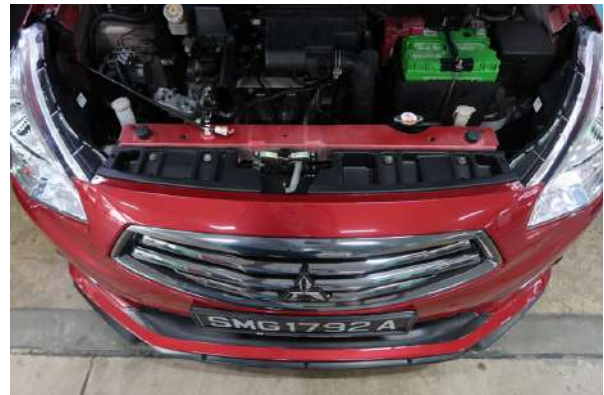



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

