

## CARLINK CONSULTANCY

60 Hillside Drive, Singapore 549009  
Fax: 62874788 Tel: 62856178

## INVOICE

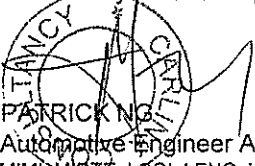
GLOBALEE SDN BHD  
C/o Kaki Bukit Autohub  
2 Kaki Bukit Avenue 2, #01-17  
Singapore 417921

Invoice No: CLM13040TP/T

Date: 9th April 2016

S/N	DESCRIPTION	QTY	UNIT PRICE (\$)	AMOUNT (\$)
1	<u>Vehicle No: BJN 8800</u> Charges for accident vehicle inspection and appraisal report, transportation, photographs & misc*** (photographs - 214 copies)			\$1,494.00
			<b>Total:</b>	<b>\$1,494.00</b>

We thank you for the opportunity to serve you and assure you of our best at all times

  
PATRICK NG  
Automotive Engineer Assessor  
MIMI, MIRTE, LCGI, I ENG, LAE, CGLI FTC.

Note: Payment by cheque should be crossed and made payable to "CARLINK CONSULTANCY"

# CARLINK CONSULTANCY

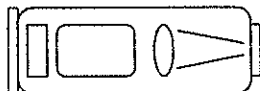
60 Hillside Drive  
Singapore 549009

Tel : 62856178

Fax : 62874788

## ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT

Our Ref: CLM13040TP/T

<b>1 REFERENCE</b>			
Date of request	:	22nd October 2015	
Requested by	:	GLOBALEE SDN BHD C/o Kaki Bukit Autohub, 2 Kaki Bukit Avenue 2, #01-17 Singapore 417921	
Type of claim	:	Third party	
Workshop	:	M/S Twincar Automotive Pte Ltd Kaki Bukit Autohub, 2 Kaki Bukit Avenue 2, #01-17 Singapore 417921	
Date of survey	:	22nd October 2015	
Accident date	:	19th October 2015	
<b>2 DETAILS OF VEHICLE</b>			
Registration No.	:	BJN 8800	
Make & Model	:	Scania R124 (RB/EPB ACH)	
Engine No.	:	DC1201L016155513	
Chassis No.	:	XLER6X20004466028	
Year of Registration	:	10th September 2007	
Transmission	:	Manual	
Colour	:	White	
<b>3 STATIC CHECK</b>			
Steering	:	see annex(es)	Paintwork : Good
Footbrake	:	see annex(es)	Modification : Nil
Handbrake	:	see annex(es)	General condition : Good
<b>4 TYRE CONDITION</b>			
		<u>Nearside/Make</u>	<u>Offside/Make</u> <u>Size</u>
Front axle	:	10mm/Copartner	10mm/Copartner : 295/80 R22.5
2nd axle	:	10mm/Copartner	10mm/Copartner : 295/80 R22.5
3rd axle	:	10mm/Copartner	10mm/Copartner : 295/80 R22.5
Rear axle	:	10mm/Copartner	10mm/Copartner : 295/80 R22.5
<b>5 POINT OF IMPACT</b>			
See Annex(es) and Motor Accident Reports			
<b>6 REMARK</b>			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

Report No.

CLM13040TP/T

Vehicle No. BJN8800

**Parts and Labour Assessment****PARTS**

Description of part	Repairer's Qty	Qty	Condition	Repairer's estimate	Our adjustment
HOT LINE SPAD (STICKER)	2	2	NECESSARY	12.00	12.00
MALAYSIA SPEED LIMIT STICKER	2	2	NECESSARY	12.00	12.00
REAR BOGIE AXLE	1	1	DISTORTED/CRACKED	12,800.00	12,800.00
REAR BOGIE AXLE BRAKE DRUM RH	1	1	SHIFTED/JAMMED	1,680.00	1,680.00
REAR BOGIE AXLE WHEEL BEARING (INNER) RH	1	1	DISTORTED/JAMMED	198.00	198.00
REAR BOGIE AXLE WHEEL BEARING (OUTER) RH	1	1	DISTORTED/JAMMED	198.00	198.00
REAR BOGIE AXLE WHEEL BEARING LC & WASHER RH	1	1	NECESSARY	35.00	35.00
REAR BOGIE AXLE WHEEL BEARING OIL SEAL	1	1	LEAKED	40.00	40.00
REAR CRASH GUARD ASSY	1	1	BUCKLED	5,800.00	5,800.00
REAR LEAVE SPRING ASSY L/R	2	2	DISTORTED/SLACK	980.00	980.00
REAR LEAVE SPRING EQUALIZER ASSY RH	1	1	DISTORTED/JAMMED	3,900.00	3,900.00
REAR LEAVE SPRING EQUALIZER BRACKET CROSS MEMBER	1	1	CRACKED/BENT	1,800.00	1,800.00
REAR LEAVE SPRING U CLAMP L/R	4	4	BENT	500.00	500.00
REAR LEAVE SPRING U CLAMP SEAL GUIDE L/R	2	2	CRACKED	248.00	248.00
REAR REFLECTIVE STICKER	2	2	NECESSARY	140.00	140.00
REAR RH MARKER LAP	1	1	CRACKED	85.00	85.00
REAR RH MUDFLAP	1	1	CUT	120.00	120.00
REAR RH MUDGUARD	1	1	DENTED/BENT	560.00	560.00
REAR RH NUMBER PLATE	1	1	DENTED/BENT	35.00	35.00
REAR RH SIDE BOARD	1	1	CRACKED	2,300.00	2,300.00
REAR RH TYRE (INNER)	1	1	CUT/LEAKED	880.00	880.00
REAR RH TYRE (OUTER)	1	1	CUT/LEAKED	880.00	880.00
REAR RH WHEEL RIM (INNER)	1	1	WARPED	1,850.00	1,850.00
REAR RH WHEEL RIM (OUTER)	1	1	DENTED/BENT/CUT	1,850.00	1,850.00
REAR TORQUE ROD BRACKET RH	1	1	BENT	899.00	899.00
REAR TORQUE ROD RH	1	1	BENT	490.00	490.00
SIDE BOARD CHAIN LOCK	1	1	BENT/JAMMED	60.00	60.00
SIDE BOARD HINGES	4	4	BENT/SHIFTED	840.00	840.00
TAIL BOARD ANGLE IRON LOCK BEAM	1	1	DENTED/BENT	300.00	300.00
TAIL BOARD ASSY	1	1	CRACKED/BENT	2,100.00	2,100.00

TAIL BOARD CHAIN LOCK HOOK	2	2	BENT	120.00	120.00
TAIL BOARD HINGES	4	4	BENT	840.00	840.00
TAIL BOARD SUPORT PILLAR RH	1	1	DENTED/BENT	680.00	680.00
TAILLAMP PANEL RH	1	1	BENT	128.00	128.00
TAILLAMP RH (LOWER)	1	1	CRACKED	250.00	250.00
TAILLAMP RH (TOP)	1	1	CRACKED	210.00	210.00
Subtotal before discount				S\$ 43,820.00	S\$ 43,820.00
Percentage discount 0% and 0%				S\$ 0.00	S\$ 0.00
<b>Sub-total</b>				<b>S\$ 43,820.00</b>	<b>S\$ 43,820.00</b>
<b>Parts-total</b>				<b>S\$ 43,820.00</b>	<b>S\$ 43,820.00</b>

## LABOUR

To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	2,100.00	1,800.00
To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and realign body structure, body alignments and damaged consistent to the accident.	2,800.00	2,100.00
To spray anti rust undercarriage coating.	250.00	200.00
To remove, replace rear axle housing, rear haft shaft, oil seal, u bolt, clamp, rear leave spring and etc	1,800.00	1,200.00
To check wiring system and light.	120.00	60.00
<b>Labour Total</b>	<b>S\$ 7,070.00</b>	<b>S\$ 5,360.00</b>
<b>Parts &amp; Labour Total</b>	<b>S\$ 50,890.00</b>	<b>S\$ 49,180.00</b>

Results of inspection of the accident vehicle are as shown above,

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : S\$ 41,800.00  
and the recommended number of working days for the repairs is within 10 day(s).

  
PATRICK (SURVEYOR)  
Automotive Appraiser