

ASS. REC. BY:

REF:

CS/LAW21003956/Aqf3

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. **LIH/962157/NTUC**

Sum Insured: \_\_\_\_\_

Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_

Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_

Consistent? : Yes or No

Est. Repairs: **9**

days

Res.: Yes or No

Lum Sum: \_\_\_\_\_

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_

Person Contacted: \_\_\_\_\_

Veh No: **SKT1456B**Yr Regd: **2015 May**Type: **M. Car** / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: **Toyota Estima.**C.C. **2362**Colour: **Grey.**

A/C: Insured / Std / Nil / NA

Sp. Reading: **120037**

T/Radio: Insured / Std / Nil / NA

Eng/No: \_\_\_\_\_

C/No: **ACR500188296**Gen. Cond: **Good** / Fair / Poor / BurntSteering: **In order** / Jammed / Leaked / Burnt orBrake: **In order** / Jammed / Leaked / Burnt orModi: Nil / **S/Rim** / STD A/Rim orTyre Size: F: **225/50R18**R: **225/50R18**

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or **Continental.**

Front

Rear

R/Bal. **06**

mm

R/Bal. **06**

mm

L/Bal. **06**

mm

L/Bal. **06**

mm

D.O.A. \_\_\_\_\_

D.O.I. **24/05/21**Survey held at **25 Corporation Walk.**Des. of Damages: **FR** / **REAR** / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

**TP Reinspection**

MV:

PV:

Nett:

SJE-RI

Date/Time, File Pass to?

☐

Preli. Report

1) **01/07 Typist**☐

Final Report

Date/Time, File Return to?

Days Of Repair: **9**

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee:

Transportation:

S + P \_\_\_\_\_ \$

Photo:

Other:

P331

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech. Insp (\$)

☐

Week end (\$)

Report Format:

**SJE-RI**Lump Sum / Net: **7600**

## Sincere Appraisal Services

81 Ubi Avenue 4 #06-28 UB.One Singapore 408830  
Tel : 6636 4628 Fax : 6636 4638 E-mail : sincereappraisal@gmail.com  
Company Registration No. 53159958B

### VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 226/TP/2016

Date: 29/6/2016

#### REFERENCE

Date of loss: 12/6/2016  
Claimant: Liong Chiew Woei

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKT1456B	Make &	Toyota
Reg date:	25/5/2015	Model	Estima Aeras Premium 2.4
Colour:	Silver	Engine No:	2AZJ137879
Type:	Motor Car	Chassis No:	ACR500188296
Type of Claims:	Third Party	Odometer No:	22665km
		Engine Cap:	2362cc

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

##### (STATIC ONLY)

General Condition: Good	Steering: Good	Engine Modification: Nil
Paint work: Good	Handbrake: Good	Pre-accident
	Footbrake: Good	Damage: Nil

#### CONDITION OF TYRES

Front Left Size: Dunlop 225/50R18 70%	Front Right Size: Dunlop 225/50R18 70%
Rear Left Size: Dunlop 225/50R18 70%	Rear Right Size: Dunlop 225/50R18 70%

*The above percentages represent the remaining life of the tyre threads*

#### COST OF REPAIRS

Parts	Repairer S\$ 10,492.53	Adjuster S\$ 9,381.48
Labour	S\$ 6,740.00	S\$ 5,790.00
Calculated Cost (S\$) :	<u>S\$ 25,146.60</u>	<u>S\$ 22,454.20</u>


**Recommended Lump Sum Repair Cost (S\$) : S\$ 18,000.00**

Date of Assignment: 14/6/2016  
Date Inspected: 14/6/2016  
Est. repair Period: 12 days

Inspected At: JEC Auto Service  
No 1 Kaki Bukit Avenue 6  
#02-11 Autobay  
Singapore 417883



### POINT OF IMPACT

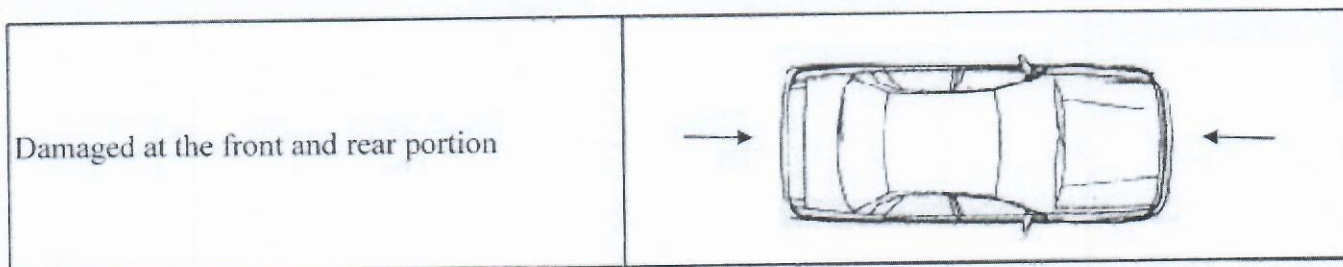

### BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's vehicle along PIE Expressway towards Tuas.

### GENERAL DESCRIPTION OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are at the front and rear portion.

### SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$25,146.60. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$18,000.

We have not authorised the repair. Under normal circumstances, estimated 12 working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



**Dave Chang**  
Automotive Appraiser  
AUTO. ENG, CAE, CGI  
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

*Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.*

## ANNEX A

## REPAIR DETAILS

## Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
1	1	Front bumper assy	warped/necessary/cracked	\$ 1,463.10	\$ 1,463.10
2	2	Front bumper bracket	bent/necessary	\$ 176.00	\$ 176.00
3	2	Front bumper retainer	bent/necessary	\$ 183.20	\$ 183.20
4	1	Front bumper left tow cover	warped/necessary	\$ 78.00	\$ 78.00
5	1	Front bumper right tow cover	warped/necessary	\$ 78.00	\$ 78.00
6	1	Front bumper reinforcement	warped/dented	\$ 483.20	\$ 483.20
7	1	Front bumper sponge	warped/necessary/cracked	\$ 271.20	\$ 271.20
8	1	Front bumper left fog lamp	cracked	\$ 379.60	\$ 379.60
9	1	Front bumper left fog lamp garnish	cracked	\$ 190.60	\$ 190.60
10	1	Front bumper lower grille assy	cracked	\$ 455.30	\$ 455.30
11	1	Front grille assy	cracked	\$ 587.30	\$ 587.30
12	1	Front grille emblem	necessary	\$ 125.00	\$ 125.00
13	1	Front right HID headlamp	cracked	\$ 2,479.90	\$ 2,479.90
14	1	Front left HID headlamp	cracked	\$ 2,479.90	\$ 2,479.90
15	1	Front support panel	repair	\$ 841.80	\$ -
				\$ 10,272.10	\$ 9,430.30
Less 25%				\$ 2,568.03	\$ 2,357.58
				\$ 7,704.08	\$ 7,072.73
<u>Special Nett Items</u>					
1	12	Front bumper clips	necessary	\$ 60.00	\$ 60.00
2	4	Front bumper left fog lamp garnish clips	necessary	\$ 10.00	\$ 10.00
3	6	Front bumper lower grille clips	necessary	\$ 30.00	\$ 30.00
4	6	Front grille clips	necessary	\$ 30.00	\$ 30.00
5	1	Front no plate with garnish	necessary	\$ 80.00	\$ 80.00
				\$ 210.00	\$ 210.00
Total parts				\$ 7,914.08	\$ 7,282.73



## ANNEX A

## REPAIR DETAILS

## Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
1	1	Rear bumper assy	deformed	\$ 1,417.80	\$ 1,417.80
2	1	Rear bumper right bracket	bent/necessary	\$ 86.50	\$ 86.50
3	1	Rear bumper left bracket	bent/necessary	\$ 86.50	\$ 86.50
4	1	Rear bumper right retainer	bent/necessary	\$ 88.90	\$ 88.90
5	1	Rear bumper left retainer	bent/necessary	\$ 88.90	\$ 88.90
6	2	Rear bumper reflector	cracked	\$ 166.40	\$ 166.40
7	2	Rear bumper sponge	cracked	\$ 281.20	\$ 281.20
8	2	Rear bumper tow cover	warped/necessary	\$ 156.00	\$ 156.00
9	1	Rear tailgate assy	deformed	\$ 2,812.60	\$ 2,812.60
10	2	Rear tailgate rubber stopper	necessary	\$ 66.80	\$ 66.80
11	2	Rear tailgate hinges	necessary	\$ 188.40	\$ 188.40
12	1	Rear tailgate weatherstrip	warped	\$ 288.20	\$ 288.20
13	1	Rear tailgate inner handle	necessary	\$ 121.30	\$ 121.30
14	1	Rear tailgate lock mechanism	bent	\$ 581.40	\$ 581.40
15	1	Rear tailgate lock catch	bent	\$ 87.30	\$ 87.30
16	1	Rear tailgate solenoid lock switch	malfunction	\$ 605.00	\$ 605.00
17	1	Rear left fender inner garnish	cracked	\$ 876.20	\$ 876.20
18	1	Rear tailgate centre logo	necessary	\$ 125.00	\$ 125.00
19	1	Rear tailgate 'Estima' emblem	necessary	\$ 118.00	\$ 118.00
20	1	Rear tailgate 'Aeras' emblem	necessary	\$ 116.00	\$ 116.00
21	1	Rear left taillamp	cracked	\$ 723.30	\$ 723.30
22	1	Rear end inner panel	deformed	\$ 681.60	\$ 681.60
23	1	Rear end outer panel	deformed	\$ 787.40	\$ 787.40
24	1	Rear end lower panel top garnish	cut/cracked	\$ 257.80	\$ 257.80
25	1	Rear end lower panel inner garnish	cut/cracked	\$ 198.30	\$ 198.30
26	1	Rear floor panel	repair	\$ 1,481.40	\$ -
27	1	Rear windscreen moulding	necessary	\$ 288.50	\$ 288.50
				\$ 12,776.70	\$ 11,295.30
Less 25%				\$ 3,194.18	\$ 2,823.83
				\$ 9,582.53	\$ 8,471.48

## Special Nett Items

1	12	Rear bumper clips	necessary	\$ 60.00	\$ 60.00
2	16	Rear left fender inner garnish clips	necessary	\$ 40.00	\$ 40.00
3	6	Rear end lower panel top garnish clips	necessary	\$ 30.00	\$ 30.00
4	6	Rear end lower panel inner garnish clips	necessary	\$ 30.00	\$ 30.00
5	1	Rear end lower panel sealant	necessary	\$ 120.00	\$ 120.00
6	1	Rear no plate with garnish	necessary	\$ 80.00	\$ 80.00
7	2	Rear bumper reverse sensor	malfunction	\$ 250.00	\$ 250.00
8	1	Rear view camera	malfunction	\$ 300.00	\$ 300.00
				\$ 910.00	\$ 910.00

## Total parts

\$ 10,492.53 \$ 9,381.48



## ANNEX B

### REPAIR DETAILS

#### Recommended Labour

No	Description	Repairer's Amount	Adjuster's Amount
1	Labour for panel beating, cut, weld, straighten front affected area and replace front damaged parts.	\$ 800.00	\$ 600.00
2	To putty and spray painting front portion.	\$ 800.00	\$ 600.00
3	To check wiring and focus front headlamp.	\$ 50.00	\$ 30.00
4	To remove and install front bonnet lock mechanism.	\$ 80.00	\$ 60.00
5	To apply anti rust proofing to front affected area.	\$ 120.00	\$ 100.00
6	Labour for panel beating, cut, weld, straighten rear affected area and replace rear damaged part.	\$ 1,600.00	\$ 1,500.00
7	To putty and spray painting rear portion.	\$ 1,600.00	\$ 1,500.00
8	To check rear lighting and wiring.	\$ 50.00	\$ 30.00
9	To remove and install rear tailgate lock mechanism.	\$ 80.00	\$ 60.00
10	To remove and install rear inner garnish and trim to facilitate the repair.	\$ 180.00	\$ 150.00
11	To apply anti rust proofing to rear affected area.	\$ 140.00	\$ 120.00
12	To remove and install rear bumper reverse sensor.	\$ 80.00	\$ 60.00
13	To remove and install rear windscreen to facilitate the repair.	\$ 140.00	\$ 120.00
14	To remove and install rear view camera	\$ 80.00	\$ 60.00
15	To repair, straighten and align both rear door panel.	\$ 350.00	\$ 300.00
16	To repair, straighten and align both rear fender assy.	\$ 350.00	\$ 300.00
17	To remove and repair rear exhaust muffler assy.	\$ 140.00	\$ 120.00
18	Towing service.	\$ 100.00	\$ 80.00
<b>Total labour :</b>		<b>\$ 6,740.00</b>	<b>\$ 5,790.00</b>

## ANNEX C

### REPAIR DETAILS

#### Adjusted Repair Cost

	Repairer's Amount	Adjuster's Amount
Total parts :	\$ 18,406.60	\$ 16,664.20
Total labour :	\$ 6,740.00	\$ 5,790.00
<b>Total repair cost :</b>	<b>\$ 25,146.60</b>	<b>\$ 22,454.20</b>

**Adjusted Repair Cost (Lump Sum Repair)**

**\$ 18,000.00**