

PAR Automotive Consultancy

Regn. No: 52986974L

*Tauklich
paper survey.*

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel: 645 31173, Fax: 645 36131.

Report No: 0123-20-TCA

24 August 2020

Shieh Wei Sian Allan
Blk 661B Edgedale Plains #02-632
Singapore 822661

INVOICE No. 0123-20-TCA


Vehicle No. SLA4387K

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$639.00
Total amount payable		<u>\$639.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

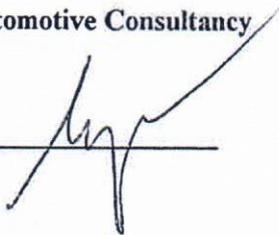

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0123-20-TCA

24 August 2020

ACCIDENT VEHICLE SURVEY REPORT

Shieh Wei Sian Allan
Blk 661B Edgedale Plains #02-632
Singapore 822661

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SLA4387K	<i>Odometer:</i>	71016km
<i>Make & Model:</i>	Hyundai Tucson 2.0GLS	<i>Colour:</i>	Brown
<i>Chassis number:</i>	KMHJ3813MGU183482	<i>Date of accident:</i>	07/05/2019
<i>Year of Regn.:</i>	01/03/2016	<i>Date inspected:</i>	09/05/2019
<i>Repairer at:</i>	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921	<i>Date inspected (After Repair):</i>	15/05/2019

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	6mm/Nexen	6mm/Nexen	225/55R18
<i>Rear:</i>	6mm/Nexen	6mm/Nexen	225/55R18

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
FRONT BUMPER	1	squashed	463.00	463.00 <i>de</i>
FRONT BUMPER DAYLIGHT L/R <i>@9629.50 each</i>	2	fractured	1,410.60	1,410.60 <i>cur/1259</i>
FRONT BUMPER FOGLAMP GARNISH L/R	2	fractured	102.00	102.00 <i>cur</i>
FRONT BUMPER FOGLAMP L/R	2	fractured	254.00	254.00 <i>cur</i>
FRONT BUMPER LOWER GRILLE	1	fractured	58.50	58.50 <i>cur</i>
FRONT BUMPER LOWER LID	1	deformed	357.00	357.00 <i>de</i>
FRONT BUMPER NUMBER PLATE GARNISH	1	deformed	98.70	98.70 <i>de</i>
FRONT BUMPER REINFORCEMENT	1	bent	234.00	234.00 <i>bt</i>
FRONT BUMPER SIDE RETAINER L/R	2	necessary	57.00	57.00 <i>nee</i>
FRONT BUMPER SPONGE	1	deformed	168.90	168.90 <i>de</i>
FRONT BUMPER TOW HOOK COVER	1	reuse	48.00	0.00 <i>x n n</i>
FRONT GRILLE	1	abraded	428.60	428.60 <i>cur</i>
FRONT GRILLE 'LOGO' EMBLEM	1	necessary	32.00	32.00 <i>nee</i>
FRONT HEADLAMP L/R	2	fractured	1,219.40	1,219.40 <i>cur</i>
FRONT HEADLAMP LOWER BRACKET L/R	2	bent	50.00	50.00 <i>bt</i>
Subtotal before discount			S\$ 4,981.70	S\$ 4,933.70 <i>4782.10</i>
Percentage discount 20% and 20%			S\$ 996.34	S\$ 986.74 <i>3825.68</i>
Sub-total 1			S\$ 3,985.36	S\$ 3,946.96
FRONT BUMPER CLIPS - SET	1	necessary	100.00	100.00 <i>30</i>
FRONT BUMPER LOWER SPOILER	1	deformed	800.00	800.00 <i>650.</i>
FRONT BUMPER NUMBER PLATE	1	bent	25.00	25.00 <i>} 45</i>
FRONT BUMPER NUMBER PLATE HOLDER	1	bent	50.00	50.00 <i>} 45</i>
FRONT GRILLE CLIPS - SET	1	necessary	50.00	50.00 <i>20</i>
Subtotal before discount			S\$ 1,025.00	S\$ 1,025.00 <i>745</i>
Sub-total 2			S\$ 1,025.00	S\$ 1,025.00
Parts-total			S\$ 5,010.36	S\$ 4,971.96

LABOUR

To remove, reinstall electrical wiring harness, check lighting and resetting headlamp focussing. (to FR)	100.00	60.00 <i>30</i>
To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	800.00	500.00 <i>400.</i>
To provide labour, workmanship to change the above damaged bodyparts, repair, reconstruct and re-align body structure, body alignments and damaged consistent to the accident.	600.00	500.00 <i>400</i>
To apply anti-rust chemical on repaired and replaced panel.	120.00	30.00 <i>x n n.</i>
Labour Total	S\$ 1,620.00	S\$ 1,090.00 <i>830</i>
Parts & Labour Total	S\$ 6,630.36	S\$ 6,061.96

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : S\$ 5,200.00
and the recommended number of working days for the repairs is within 5 day(s).



B J Loi (Eng, MIMI, AIRTE)
Automotive Appraiser

95 400-68

1/5 \$ 4300

o 4days