



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105992

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 25/08/2021
Reference CC6/CTI21004184/Aes3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJS 6204X
Insured Veh. GQ 8913R
Claim No. SNM21D201775/C02
Policy No. DMCVSNW00040482000
Accident Date 28/03/2021
Inspection Date 29/03/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21004184/Aes3q2	
			Date: 25/08/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GQ 8913R	Veh. Inspected	SJS 6204X	
Policy No.	DMCVSNW00040482000	Coverage (\$)	0.00	
Claim No.	SNM21D201775/C02	Excess (\$)	0.00	
Assign From		Assign Date	29/03/2021	
2. Vehicle Particulars & Condition				
Make & Model	KIA CERATO FORTE	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	KNAFW411MA5113659	Colour	WHITE	
Odometer	167524 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/45 R17	DUNLOP	6 mm	
L/H Front Tyre	215/45 R17	DUNLOP	6 mm	
R/H Rear Tyre	215/45 R17	DUNLOP	6 mm	
L/H Rear Tyre	215/45 R17	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	28/03/2021	Inspection Date	29/03/2021	
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJS 6204X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BONNET	DENTED	830.50	830.50
1	FRONT BUMPER	DEFORMED	620.00	620.00
2	FRONT BUMPER SIDE RETAINER @\$62.40	N/S NECESSARY	124.80	62.40
1	HEADLAMP LH	CUT	588.60	588.60
1	HEADLAMP LOWER BRACKET LH	BENT	32.50	32.50
1	FRONT FENDER LH	DENTED	433.50	433.50
1	FRONT FENDER INNER PANEL LH	TO REPAIR SEE LABOUR	366.50	-
1	FRONT FENDER COWLING LH	TORN	155.90	155.90
1	FRONT SHOCK ABSORBER LH	BENT	322.50	322.50
1	FRONT KNUCKLE ARM LH	DAMAGED	346.00	346.00
1	FRONT KNUCKLE ARM BEARING LH	DAMAGED	180.30	180.30
1	FRONT LOWER ARM LH	BENT	366.80	366.80
1	FRONT LINK STABILIZER ARM LH	NOT NECESSARY	199.40	-
1	FRONT STEERING TIE ROD END LH	NOT NECESSARY	103.00	-
1	STEERING RACK AND OPINION	NOT NECESSARY	1,855.90	-
1	FRONT DRIVESHAFT ASSEMBLY LH	DAMAGED	1,533.30	1,034.00
1	FRONT DOOR LH	NOT NECESSARY	1,155.30	-
1	SUPPORT PANEL (ADDITIONAL)	CRACKED	788.30	688.00
	LESS 10% DISCOUNT		-1,000.31	-566.10
			9,002.79	5,094.90
<u>SPECIAL NETT ITEMS</u>				
1	FRONT BUMPER CLIP (SN)	NECESSARY	22.00	22.00
1	FRONT FENDER COWLING CLIP (SN)	NECESSARY	20.00	20.00
1	FRONT WHEEL RIM (SN)	CUT	850.00	400.00
1	FRONT WHEEL TYRE (SN)	NOT NECESSARY	450.00	-
			1,342.00	442.00
<u>LABOUR</u>				
	PANEL BEATING ,REMOVING AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT FENDER INNER PANEL LH .		1,400.00	600.00

Report Ref No. CC6/CTI21004184/Aes3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINTING TO AFFECTED AREA.		1,400.00	800.00
	TUFF COAT.		250.00	40.00
	WIRING CHECK .		180.00	30.00
	REFOCUS HEADLAMP BEAM .	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIX FRONT UNDERCARRIAGE .		350.00	220.00
	WHEEL ALIGNMENT.		120.00	80.00
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	180.00	-
	REMOVE AND REFIX AIRCON CONDENSER AND REFILL AIRCON GAS.(ADDITIONAL)		140.00	60.00
	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST.(ADDITIONAL)		120.00	60.00
			4,260.00	1,890.00
GRAND TOTAL			14,604.79	7,426.90

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,900.00
---	--	--	-----------------

Report Ref No. CC6/CTI21004184/Aes3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 6204X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 6204X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

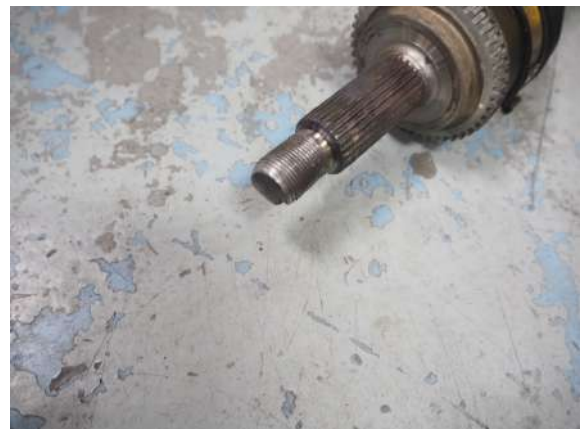



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

