



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2106305
3 ANSON ROAD #16-00	INV Date	09/09/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21004433/Ars3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	GBH 6737C
Insured Veh.	YP 9912D
Claim No.	SNM21D201958/LKKDS
Policy No.	DMCVSNW00122122000
Accident Date	05/04/2021
Inspection Date	08/04/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21004433/Ars3q2 Date: 09/09/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YP 9912D	Veh. Inspected	GBH 6737C
Policy No.	DMCVSNW00122122000	Coverage (\$)	0.00
Claim No.	SNM21D201958/LKKDS	Excess (\$)	0.00
Assign From		Assign Date	08/04/2021
2. Vehicle Particulars & Condition			
Make & Model	NISSAN NV350	c.c	2488
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JN1MC2E26Z0030443	Colour	WHITE
Odometer	7520 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195 R15C	TOURADOR	6 mm
L/H Front Tyre	195 R15C	TOURADOR	6 mm
R/H Rear Tyre	195 R15C	TOURADOR	6 mm
L/H Rear Tyre	195 R15C	TOURADOR	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	05/04/2021	Inspection Date	08/04/2021
Survey held at	KT MOTORWERK 3012 BEDOK INDUSTRIAL PARK E, #01-2020, BEDOK INDUSTRIAL PARK E, SINGAPORE 489978		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBH 6737C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	TAILGATE	DISTORTED	2,648.50	1,816.00
1	REAR BUMPER	DEFORMED	798.50	667.00
1	END PANEL (OUTER)	DENTED	458.90	458.90
1	END PANEL (INNER)	DENTED	585.60	585.60
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,589.60	-
1	REAR FLOOR PANEL TOP INSULATOR CLOTH	NOT NECESSARY	784.30	-
1	TAILGATE BADGE	NECESSARY	95.30	95.30
1	TAILGATE EMBLEM (URVAN)	NECESSARY	98.70	98.70
1	TAILGATE EMBLEM (NV350)	NECESSARY	95.60	95.60
1	TAILGATE WINDSCREEN INNER SEAL	NECESSARY	65.00	65.00
1	TAILGATE WINDSCREEN	CUT	785.80	785.80
1	TAILGATE OUTER CHROME MOULDING	CUT	460.20	460.20
1	SET TAILGATE OUTER CHROME MOULDING CLIP	NECESSARY	40.00	20.00
2	TAILGATE NUMBER PLATE LAMPS @\$85.90	NOT NECESSARY	171.80	-
1	TAILGATE INNER LOCK	DAMAGED	325.90	261.00
1	TAILGATE LOCK COVER	CRACKED	98.50	98.50
1	TAILGATE LOCK CATCH	NOT NECESSARY	68.70	-
1	TAILGATE WEATHERSTRIP	CUT	236.50	236.50
2	TAILGATE SIDE STOPPER (MALE) @\$38.20	NOT NECESSARY	76.40	-
2	TAILGATE SIDE STOPPER (FEMALE) @\$36.00	NOT NECESSARY	72.00	-
1	TAILGATE INNER TRIM BOARD	DEFORMED	385.90	131.00
1	SET TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	40.00	20.00
1	TAILGATE INNER COVER PLATE	NOT NECESSARY	98.50	-
2	TAILGATE HINGES @\$65.00	NOT NECESSARY	130.00	-
2	TAILGATE ABSORBER @\$254.80	NOT NECESSARY	509.60	-
2	TAILLAMPS @\$356.30	N/S CUT / O/S CRACKED	712.60	449.60
2	TAILLAMPS INNER SEALER @\$45.00	NOT NECESSARY	90.00	-
2	SET TAILLAMPS CLIPS @\$25.00	NECESSARY	50.00	20.00
2	REAR BUMPER SIDE RETAINERS @\$69.80	NECESSARY	139.60	139.60

Report Ref No. CC6/CTI21004433/Ars3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	30.00
1	REAR BUMPER STEP PANEL	DENTED	358.90	358.90
1	END PANEL TOP PLATE	DENTED	258.90	258.90
1	REAR EXHAUST PIPE	NOT NECESSARY	890.10	-
2	REAR EXHAUST MOUNTINGS @\$65.90	NOT NECESSARY	131.80	-
1	REAR EXHAUST GASKET	NOT NECESSARY	59.80	-
1	SPARE TYRE CARRIER	NOT NECESSARY	385.70	-
1	REAR AIR VENT RH	NOT NECESSARY	85.30	-
	LESS 10% DISCOUNT		-1,393.25	-715.21
			12,539.25	6,436.89
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
1	TAILGATE STICKER 70KM/H (SN)	NECESSARY	20.00	10.00
1	TAILGATE STICKER 4 PAX (SN)	NECESSARY	20.00	10.00
1	SET BODY PANEL JOINT SEALANT (SN)	NECESSARY	150.00	60.00
1	SET REAR FLOOR PANEL CARPET (SN)	NOT NECESSARY	450.00	-
1	SET REAR FLOOR PANEL WOODEN BOARD (SN)	NOT NECESSARY	800.00	-
1	SET REAR FLOOR PANEL ALUMINIUM PLATE (SN)	REPEATED	600.00	-
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SPARE TYRE (SN)	NOT NECESSARY	280.00	-
1	SET REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
1	REAR CAMERA (SN)	DAMAGED	400.00	300.00
			3,100.00	640.00
	<b><u>LABOUR</u></b>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL .		2,000.00	800.00
	SPRAY PAINTING .		1,800.00	800.00
	CHECK WIRING ON REAR TAILLAMPS .		120.00	30.00
	ANTI RUST .		100.00	60.00
	REMOVE AND INSTALL REAR WINDSCREEN .		150.00	120.00
	REMOVE AND INSTALL TAILGATE PARTS.		150.00	80.00
	REMOVE AND INSTALL CARPET AND INTERIOR.		250.00	60.00
	REMOVE AND INSTALL REVERSE SENSOR .		120.00	50.00

Report Ref No. CC6/CTI21004433/Ars3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND INSTALL REAR EXHAUST .	NOT NECESSARY	150.00	-
			4,840.00	2,000.00
	<b>GRAND TOTAL</b>		<b>20,479.25</b>	<b>9,076.89</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>7,200.00</b>

Report Ref No. CC6/CTI21004433/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. GBH 6737C

## INSPECTION

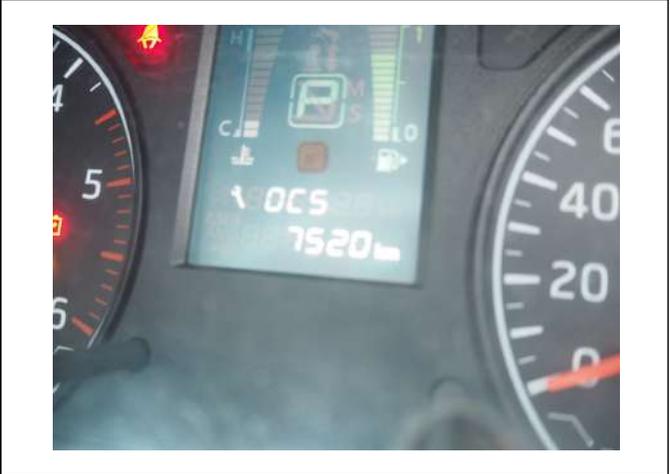



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

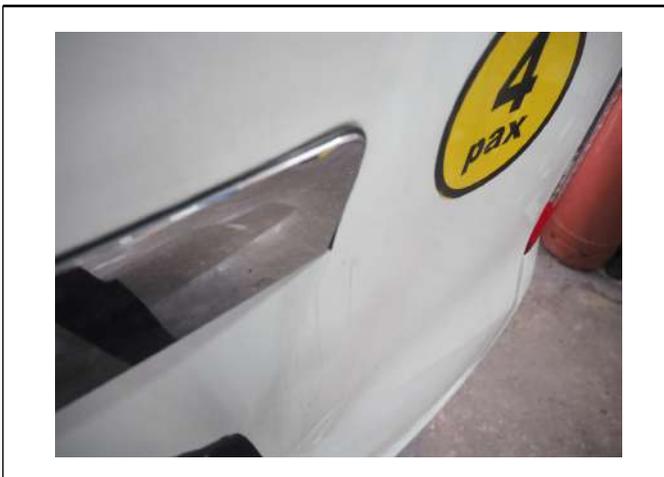






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

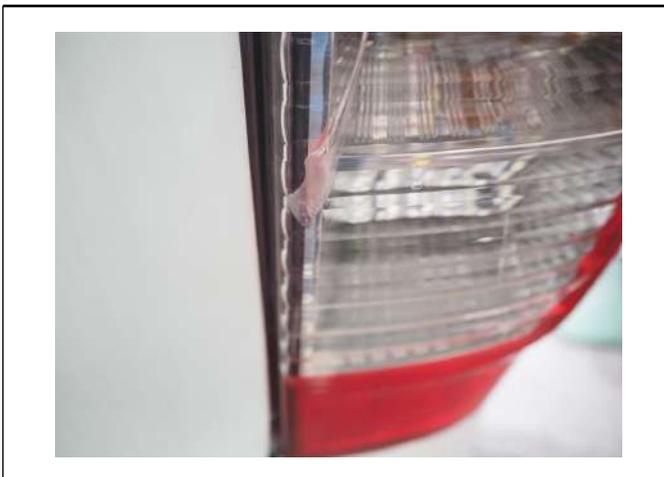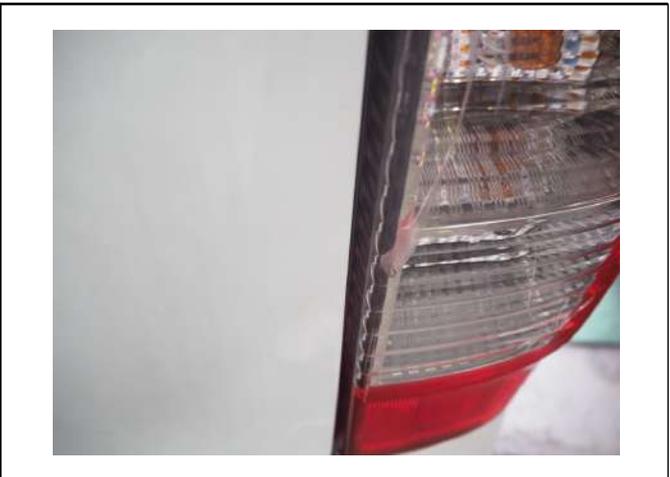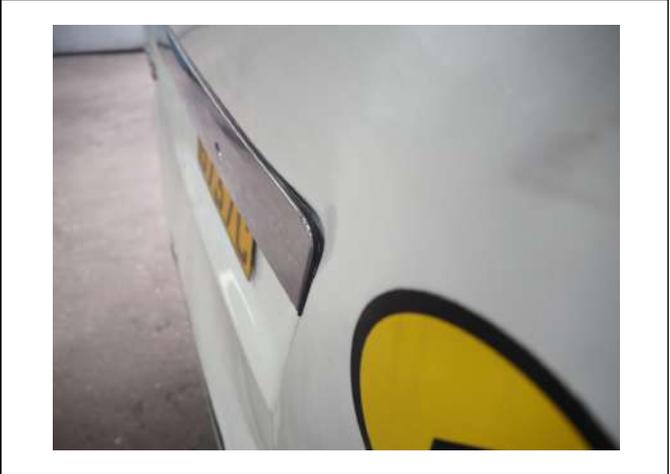




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

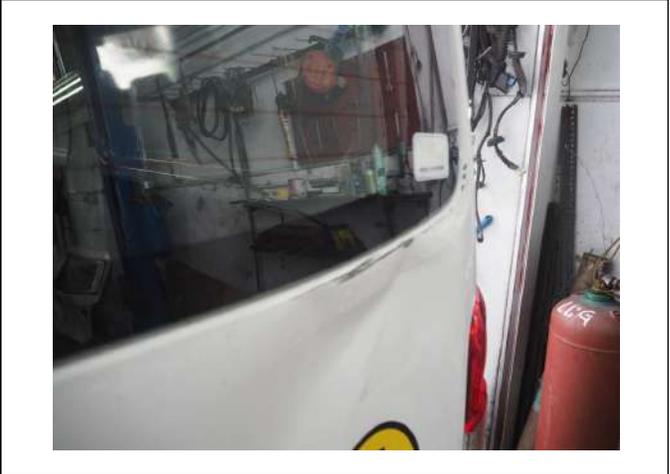




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

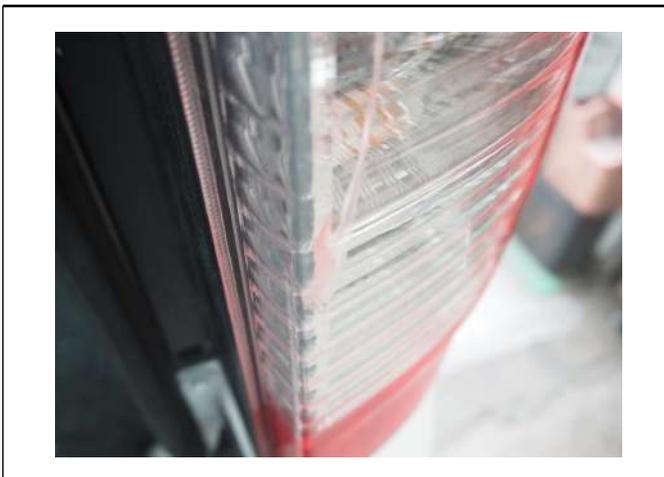



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. GBH 6737C

## RE-INSPECTION





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

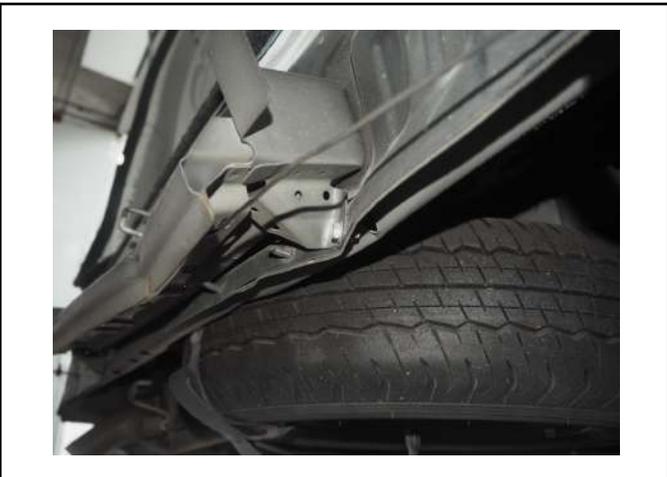



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

