



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2105603
3 ANSON ROAD #16-00	INV Date	10/08/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21004574/Aea3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMM 3265K
Insured Veh.	PC 9417S
Claim No.	SNM21D202050/C02
Policy No.	DMB1SNA00007262000
Accident Date	08/04/2021
Inspection Date	09/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21004574/Aea3q2 Date: 10/08/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	PC 9417S	Veh. Inspected	SMM 3265K
Policy No.	DMB1SNA00007262000	Coverage (\$)	0.00
Claim No.	SNM21D202050/C02	Excess (\$)	0.00
Assign From		Assign Date	09/04/2021
2. Vehicle Particulars & Condition			
Make & Model	MERCEDES BENZ E200	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	WDD2130802A654840	Colour	WHITE
Odometer	31333 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	245/45 R18	PIRELLI	6 mm
L/H Front Tyre	245/45 R18	PIRELLI	6 mm
R/H Rear Tyre	245/45 R18	PIRELLI	6 mm
L/H Rear Tyre	245/45 R18	PIRELLI	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	08/04/2021	Inspection Date	09/04/2021
Survey held at	51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park		
Repairer	NEW HOCK TECK MOTOR PTE LTD		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMM 3265K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT L/H HEAD LAMP	CRUSHED	5,189.00	3,337.00
1	FRONT L/H HEAD LAMP PANEL	NOT NECESSARY	453.10	-
1	FRONT L/H HEAD LAMP PANEL LOCK	NOT NECESSARY	341.60	-
1	FRONT L/H HEAD LAMP LOWER BRACKET	NOT NECESSARY	136.40	-
1	FRONT BUMPER	DEFORMED	1,520.00	1,385.00
10	FRONT BUMPER CLIP @\$6.50	NECESSARY	65.00	30.00
1	FRONT L/H BUMPER SIDE RETAINER	DAMAGED	75.00	75.00
1	FRONT BUMPER NUMBER PLATE	NOT NECESSARY	50.00	-
1	FRONT BUMPER TOWING COVER	NOT NECESSARY	98.00	-
1	FRONT BUMPER LOWER CENTER GARNISH	NOT NECESSARY	215.00	-
1	FRONT L/H BUMPER FOG LAMP COVER	DEFORMED	60.00	60.00
1	FRONT L/H BUMPER FOG LAMP COVER CHROME	NOT NECESSARY	105.00	-
3	FRONT BUMPER INNER FOAM @\$56.00	N/S CRACKED	168.00	56.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	348.70	-
2	FRONT BUMPER REINFORCEMENT BRACKET	NOT NECESSARY	146.40	-
1	FRONT L/H FENDER	DENTED	1,088.00	1,088.00
1	FRONT L/H FENDER COWLING	DEFORMED	217.00	217.00
8	FRONT FENDER COWLING CLIP @\$6.50	NECESSARY	52.00	30.00
1	FRONT R/H LOWER ARM	NOT NECESSARY	622.00	-
1	FRONT L/H STABILIZER BAR	NOT NECESSARY	462.00	-
1	FRONT R/H KNUCKLE ARM	NOT NECESSARY	1,344.00	-
1	FRONT R/H KNUCKLE ARM BEARING	NOT NECESSARY	862.00	-
1	FRONT R/H SHOCK ABSORBER	NOT NECESSARY	1,386.00	-
1	FRONT L/H SHOCK ABSORBER MOUNTING	NOT NECESSARY	225.00	-
1	FRONT L/H RIM	CUT	1,080.00	1,080.00
2	FRONT L/H TYRE	NOT NECESSARY	400.00	-
	LESS 10% DISCOUNT		-	-735.80
			16,709.20	6,622.20
<u>LABOUR</u>				
	TO CHECK WIRING .		100.00	30.00

Report Ref No. CC6/CTI21004574/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE & RENEW RH FRONT UNDERCARRIAGE.	NOT NECESSARY	300.00	-
	TO CONDUCT ALL WHEEL ALIGNMENT .		300.00	80.00
	PANEL BEATING.		1,600.00	400.00
	SPRAY PAINTING.		1,400.00	400.00
			3,700.00	910.00
	GRAND TOTAL		20,409.20	7,532.20
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,000.00

Report Ref No. CC6/CTI21004574/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 3265K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

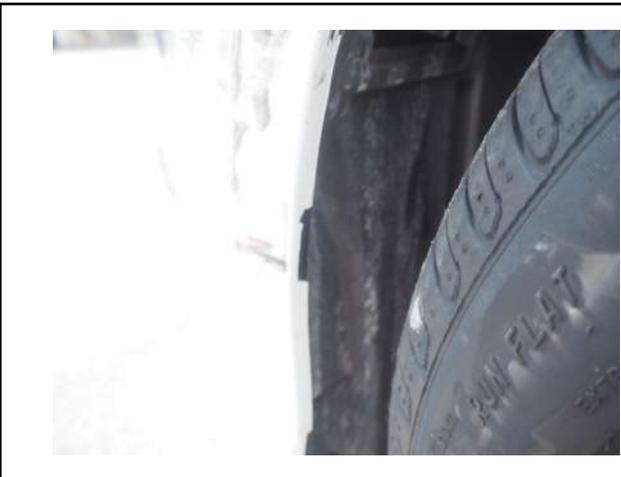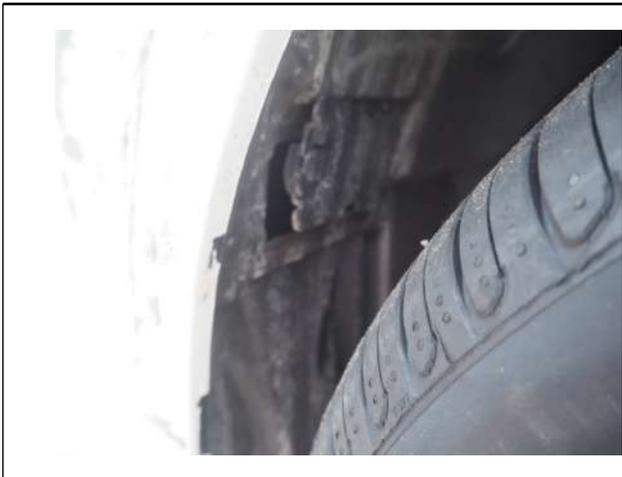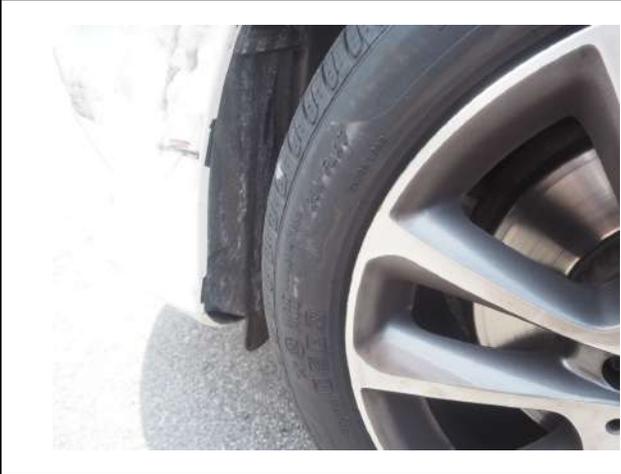



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

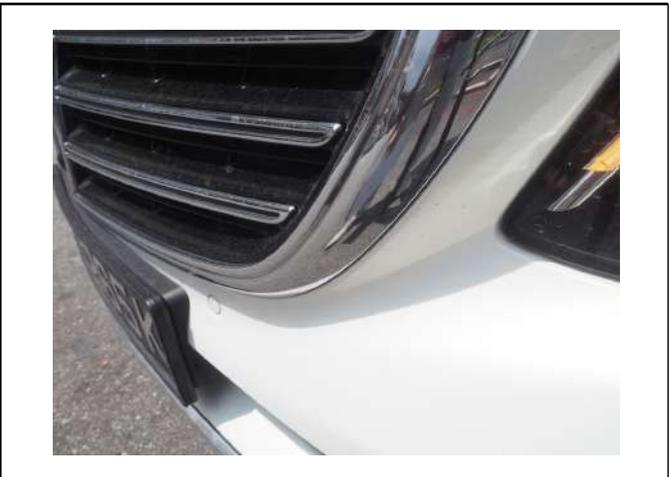



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 3265K

RE-INSPECTION

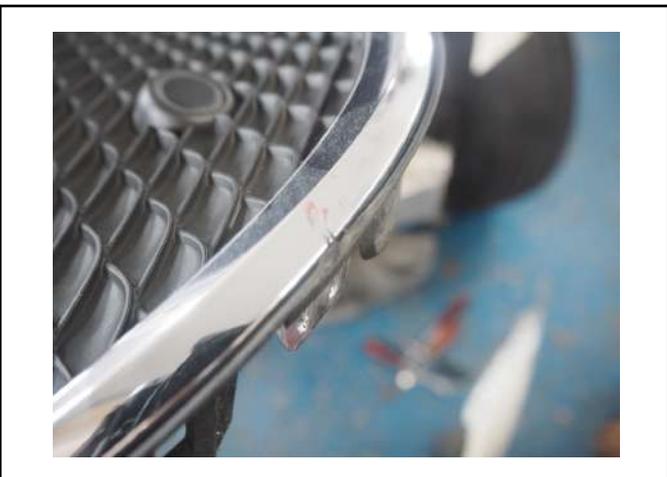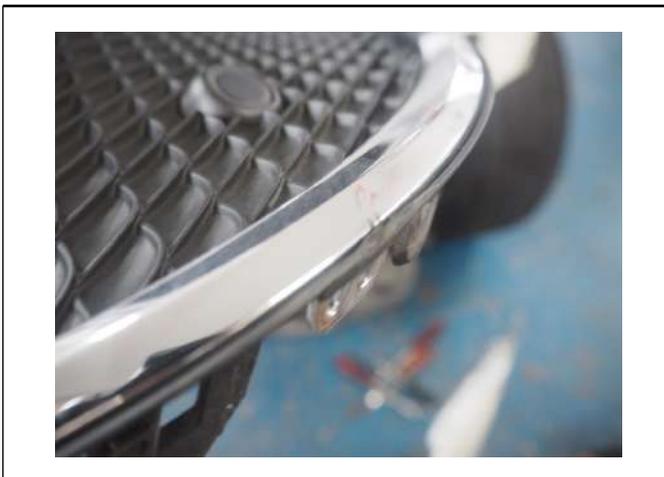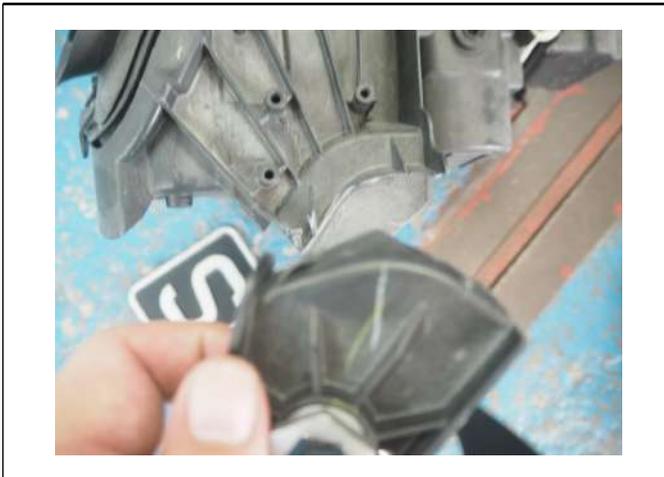



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

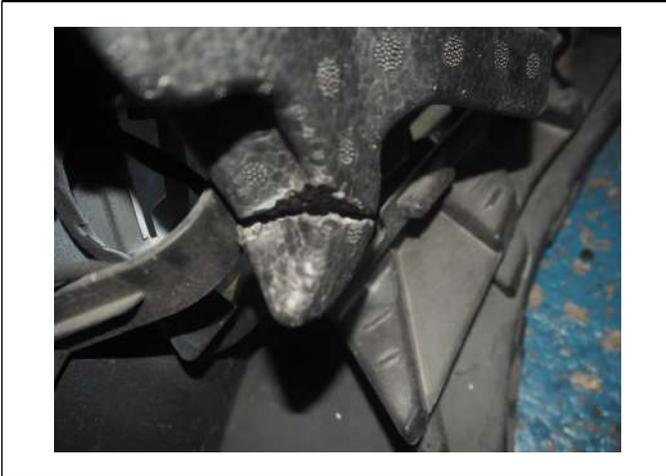



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

