



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2107591

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 03/11/2021
Reference CC4/FCI21004631/Ars3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMJ 4647B
Insured Veh. SG 5438B
Claim No. D21001128MFBP/1
Policy No. D-20096309MFBP
Accident Date 07/04/2021
Inspection Date 12/04/2021

Description	Total
Survey Inspection	511.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	511.00
GST (7%)	35.77
Grand Total	546.77

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21004631/Ars3q2	
			Date: 03/11/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SG 5438B	Veh. Inspected	SMJ 4647B	
Policy No.	D-20096309MFBP	Coverage (\$)	0.00	
Claim No.	D21001128MFBP/1	Excess (\$)	0.00	
Assign From	RACHEL WU	Assign Date	12/04/2021	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. 523i (A)	c.c	2497	
Engine No.	HIDDEN	Year of Reg.	2011	
Chassis No.	WBAFP32050C865305	Colour	WHITE	
Odometer	224596 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	275/35 R19	RADAR	6 mm	
L/H Front Tyre	275/35 R19	RADAR	6 mm	
R/H Rear Tyre	275/35 R19	RADAR	6 mm	
L/H Rear Tyre	275/35 R19	RADAR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	07/04/2021	Inspection Date	12/04/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMJ 4647B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOT LID	DENTED	1,645.80	1,645.80
1	BOOT LID BADGE	NECESSARY	95.60	95.60
1	BOOT LID EMBLEM 523I	NECESSARY	96.20	96.20
1	BOOT LID OPENER SWITCH	DAMAGED	186.90	186.90
2	BOOT LID LAMPS @\$685.70	CRACKED	1,371.40	840.00
2	BOOT LID LAMPS INNER SEALER @\$40.00	NECESSARY	80.00	80.00
2	SET BOOT LID LAMPS CLIPS @\$30.00	NECESSARY	60.00	20.00
1	BOOT LID INNER LOCK	DAMAGED	425.40	425.40
1	BOOT LID LOCK CATCH	NOT NECESSARY	60.00	-
1	BOOT LID WEATHERSTRIP	CUT	192.20	192.20
2	BOOT LID STOPPERS @\$35.00	NOT NECESSARY	70.00	-
1	REAR BUMPER	DEFORMED	1,431.40	1,431.40
2	REAR BUMPER SIDE RETAINERS @\$185.60	NOT NECESSARY	371.20	-
2	REAR BUMPER ATTACHMENT RETAINERS @\$135.80	CRACKED	271.60	271.60
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	30.00
1	REAR BUMPER CENTER RETAINER	CRACKED	232.80	232.80
1	REAR BUMPER FOOT SCAN SENSOR	NOT NECESSARY	451.50	-
1	REAR BUMPER FOOT SCAN SENSOR GARNISH	CRACKED	89.20	89.20
4	REAR BUMPER REVERSE SENSOR @\$231.10	DAMAGED (2 PCS ONLY)	924.40	462.20
4	REAR BUMPER REVERSE SENSOR HOLDER @\$62.50	NOT NECESSARY	250.00	-
1	REAR BUMPER REINFORCEMENT	DENTED	696.80	696.80
1	REAR BUMPER REINFORCEMENT TOWING COVER	NOT NECESSARY	32.00	-
2	REAR BUMPER REFLECTORS @\$69.00	NOT NECESSARY	138.00	-
2	REAR BUMPER LOWER	DEFORMED	358.70	358.70
1	REAR BUMPER LOWER CENTER COVER	NOT NECESSARY	89.60	-
2	REAR BUMPER LOWER SIDE COVER @\$158.90	NOT NECESSARY	317.80	-
1	SET REAR BUMPER LOWER COVER CLIPS	NOT NECESSARY	30.00	-
1	END PANEL	DENTED	865.90	865.90
1	END PANEL TOP TRIM	CRACKED	198.80	198.80
1	SET END PANEL TOP TRIM CLIPS	NECESSARY	30.00	30.00

Report Ref No. CC4/FCI21004631/Ars3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SPARE TYRE PANEL TOP BOARD	NOT NECESSARY	666.80	-
1	REAR KEY ANTENNA SENSOR	NOT NECESSARY	139.20	-
2	TAILLAMPS @\$653.80	NOT NECESSARY	1,307.60	-
2	TAILLAMPS INNER SEALER @\$38.00	NOT NECESSARY	76.00	-
2	SET TAILLAMPS CLIPS @\$30.00	NOT NECESSARY	60.00	-
2	REAR FENDER INNER TRIM @\$385.70	NOT NECESSARY	771.40	-
2	SET REAR FENDER INNER TRIM CLIPS @\$30.00	NOT NECESSARY	60.00	-
1	REAR EXHAUST SILENCER	NOT NECESSARY	1,220.90	-
2	REAR EXHAUST MOUNTINGS @\$38.00	NOT NECESSARY	76.00	-
1	REAR EXHAUST MOUNTINGS BRACKET	NOT NECESSARY	111.60	-
1	REAR EXHAUST GASKET	NOT NECESSARY	60.60	-
1	REAR EXHAUST HEAT PIPE	NOT NECESSARY	156.70	-
	LESS 10% DISCOUNT		-	-824.95
			15,820.00	7,424.55
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE WITH COVER (SN)	DENTED	50.00	50.00
1	SET BODY PANEL JOINT SEALANT (SN)	NECESSARY	120.00	60.00
2	REAR EXHAUST CHROME PIPE @\$160.00 (SN)	NOT NECESSARY	320.00	-
			490.00	110.00
	<u>LABOUR</u>			
	PANEL BEATING.		1,800.00	1,000.00
	SPRAY PAINTING.		1,800.00	1,000.00
	CHECK WIRING ON TAILLAMPS .		120.00	30.00
	ANTI RUST.		100.00	60.00
	REMOVE AND INSTALL REVERSE SENSOR .		120.00	50.00
	REMOVE AND INSTALL CARPET AND SEAT.		120.00	60.00
	REMOVE AND INSTALL REAR EXHAUST SILENCER.	NOT NECESSARY	150.00	-
			4,210.00	2,200.00
	GRAND TOTAL		20,520.00	9,734.55

Report Ref No. CC4/FCI21004631/Ars3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,000.00
---	--	--	----------

Report Ref No. CC4/FCI21004631/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 4647B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 4647B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

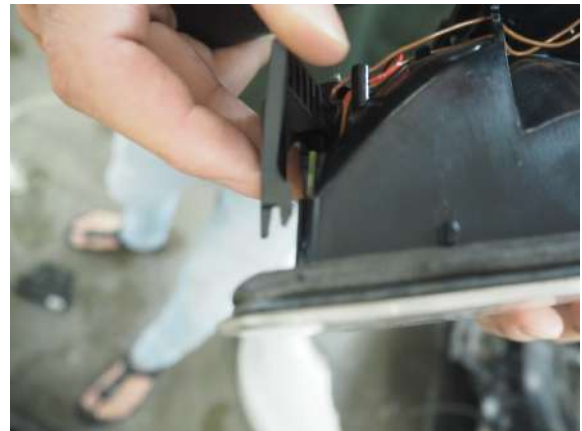



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

