



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103399

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 14/05/2021
Reference CC4/FCI21005055/Ues3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. PC 184Y
Insured Veh. GBJ 2214K
Claim No. D21001296MFCV/1
Policy No. D-20095634MFCV
Accident Date 20/04/2021
Inspection Date 23/04/2021

Description	Total
Survey Inspection	1,006.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Less: Discount	-426.00
Subtotal	580.00
GST (7%)	40.60
Grand Total	620.60

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI21005055/Ues3q2 Date: 14/05/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBJ 2214K	Veh. Inspected	PC 184Y
Policy No.	D-20095634MFCV	Coverage (\$)	0.00
Claim No.	D21001296MFCV/1	Excess (\$)	0.00
Assign From	ESTHER	Assign Date	22/04/2021
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA HIACE HIROOF (A)	c.c	2982
Engine No.	HIDDEN	Year of Reg.	2011
Chassis No.	JTFST22P700009730	Colour	SILVER
Odometer	560179 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195 R15	MICHELIN	6 mm
L/H Front Tyre	195 R15	MICHELIN	6 mm
R/H Rear Tyre	195 R15	MICHELIN	6 mm
L/H Rear Tyre	195 R15	MICHELIN	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	20/04/2021	Inspection Date	23/04/2021
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. PC 184Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR WINDSCREEN	NOT NECESSARY	1,488.10	-
1	REAR WINDSCREEN MOULDING	NO SUCH PARTS	110.00	-
1	TAILGATE	BADLY DENTED	2,450.70	2,150.70
1	TAILGATE LOCK ACTUATOR	SHORTED	399.10	388.10
1	TAILGATE INNER LOCK	SHORTED / DAMAGED	395.60	395.60
1	TAILGATE LOCK STRICKER	NOT NECESSARY	40.10	-
1	TAILGATE INNER TRIM BOARD	DEFORMED / TORN	385.20	385.20
1	SET TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	50.00	50.00
1	TAILGATE OUTER HANDLE	BENT / CRACKED	366.50	366.50
1	TAILGATE REAR LOGO	NECESSARY	45.90	45.90
1	TAILGATE WEATHERSTRIP	TWISTED	395.10	381.10
2	TAILLAMPS @\$393.10	CRACKED	786.20	732.20
2	TAILLAMP LOWER APRON GARNISHS @\$169.30	O/S DEFORMED	338.60	169.30
2	TAILLAMP FILTER PANELS @\$545.10	BENT / TWISTED	1,090.20	810.40
1	REAR BUMPER	DISTORTED	699.30	599.30
4	REAR BUMPER LOWER BRACKETS @\$45.00	BENT	180.00	180.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR END PANEL OUTER	BADLY DENTED	899.50	622.10
1	REAR END PANEL INNER	BADLY DENTED	1,012.10	654.30
1	REAR END PANEL TOP STEEL PLATE	BENT	369.10	269.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	2,410.10	-
1	REAR SPARE TYRE BRACKET	BENT	263.50	263.50
1	REAR SPARE TYRE BRACKET HOOK	NOT NECESSARY	66.50	-
2	REAR BUMPER SIDE HOLDERS @\$115.00	CRACKED	230.00	230.00
1	REAR EXHAUST PIPE	NOT NECESSARY	971.00	-
2	REAR EXHAUST PIPE MOUNTINGS @\$65.00	NOT NECESSARY	130.00	-
2	REAR FENDERS @\$2450.00	TO REPAIR SEE LABOUR	4,900.00	-
1	REAR THIRD BRAKE LIGHT	NOT NECESSARY	355.30	-
1	REAR WIPER ARM	NOT NECESSARY	195.80	-

Report Ref No. CC4/FCI21005055/Ues3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WIPER MOTOR	NOT NECESSARY	645.10	-
1	REAR WIPER BLADE	NOT NECESSARY	86.50	-
2	TAILLAMP INNER RAIL PANELS @\$489.60	TO REPAIR SEE LABOUR	979.20	-
1	REAR AIR VENT	NOT NECESSARY	95.50	-
1	BONNET	DENTED / BENT	1,066.10	606.25
1	BONNET LOGO	NECESSARY	68.10	68.10
1	BONNET LOCK	TWISTED	145.00	145.00
2	BONNET HINGES @\$88.50	NOT NECESSARY	177.00	-
2	FRONT CORNER PANELS @\$366.50	TO REPAIR SEE LABOUR	733.00	-
1	FRONT GRILLE TOP	CRACKED	610.10	479.10
1	FRONT GRILLE CENTRE (INNER)	CRACKED	605.90	311.20
1	FRONT BUMPER	TORN	855.10	654.00
1	FRONT BUMPER TOW COVER	MISSING	60.00	30.00
1	FRONT BUMPER CENTRE GRILLE	TORN	162.45	145.80
1	FRONT BUMPER TOP BEAM	BENT	199.90	199.90
2	FRONT BUMPER REINFORCEMENT STAYS @\$155.00	O/S BENT	310.00	155.00
1	FRONT BUMPER REINFORCEMENT	BENT	650.10	397.10
2	FRONT BUMPER SIDE HOLDERS @\$106.50	CRACKED	213.00	213.00
2	HEADLAMPS @\$1067.00	CRACKED	2,134.00	1,798.80
1	FRONT SUPPORT PANEL	BENT	951.00	395.20
1	FRONT BRACE PANEL	BENT	151.00	151.00
1	AIR CON CONDENSER SIDE GARNISH	TORN	205.20	166.50
1	AIR CON CONDENSER	BENT / TWISTED	1,886.20	1,431.95
1	AIR CON DISCHARGE HOSE	NOT NECESSARY	333.90	-
1	AIR CON SUCTION HOSE	NOT NECESSARY	352.10	-
1	AIR CON LIQUID PIPE	NOT NECESSARY	122.90	-
1	RADIATOR	BENT / TWISTED	2,110.80	1,815.10
1	RADIATOR FAN COWLING	NOT NECESSARY	545.20	-
1	RADIATOR FAN MOTOR	NOT NECESSARY	650.00	-
1	WASHER TANK	NOT NECESSARY	245.20	-
1	RADIATOR SUB TANK	NOT NECESSARY	225.10	-
1	INTER COOLER	PUNCTURE / BENT	1,280.20	1,225.10

Report Ref No. CC4/FCI21005055/Ues3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR CLEANER ASSY	NOT NECESSARY	862.10	-
2	FRONT DOORS @\$1845.10	TO REPAIR SEE LABOUR	3,690.20	-
	LESS 25% DISCOUNT		-11,120.16	-4,782.83
			33,360.49	14,348.47
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	50.00	30.00
1	REAR LICENCE PLATE (SN)	SERVICEABLE	50.00	-
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	REAR FLOOR PANEL TOP PLYWOOD (SN)	CRACKED	850.00	400.00
1	TAILGATE 70KM/H STICKER (SN)	NECESSARY	20.00	10.00
1	SET REAR REVERSE CAMERA (SN)	NOT NECESSARY	380.00	-
1	FRONT LICENCE PLATE (SN)	BROKEN	50.00	40.00
1	BOL RADIATOR COOLANT (SN)	NECESSARY	50.00	30.00
1	SET FRONT DOOR OUTER PROTECTOR STRIP (SN)	NECESSARY	200.00	50.00
			2,030.00	850.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		80.00	30.00
	TO DISMANTLE & REPLACING REVERSE SENSOR .		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN .		150.00	100.00
	TO TRANSFER TAILGATE COMPONENTS.		100.00	60.00
	TO DISMANTLE & REPLACING REVERSE CAMERA.	NOT NECESSARY	100.00	-
	TO REFILL AIR CON GAS.		120.00	100.00
	TO DISMANTLE & REFIX SEAT CUSHION UPHOLSTERY .		300.00	100.00
	TO SPRAY RUST PROOFING .		220.00	120.00
	TO DISMANTLE & REFIX REAR EXHAUST .	NOT NECESSARY	100.00	-
	LABOUR FOR PANEL BEATING ,CUT ,WELD ,STRAIGHTEN & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT DOORS,REAR FLOOR PANEL,REAR FENDERS,TAILLAMP INNER RAIL PANELS AND FRONT CORNER PANELS.		4,000.00	2,200.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PUTTY & SPRAY PAINTING .		2,800.00	1,600.00
			8,050.00	4,360.00
	GRAND TOTAL		43,440.49	19,558.47
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				15,500.00

Report Ref No. CC4/FCI21005055/Ues3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 184Y

INSPECTION

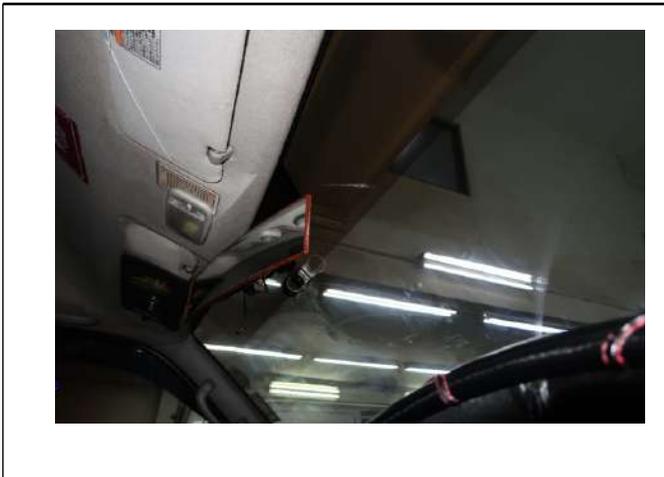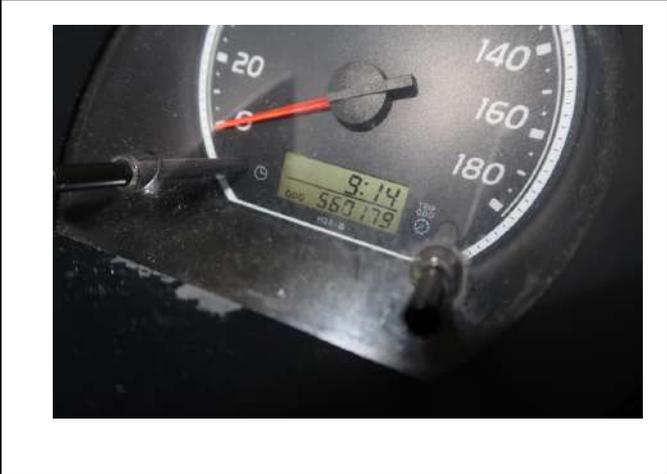



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

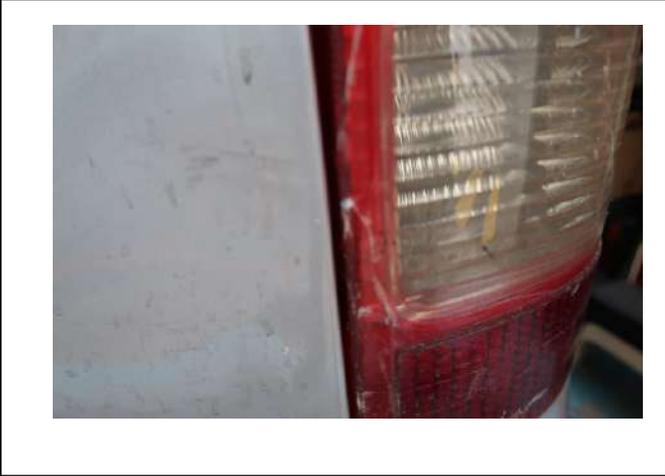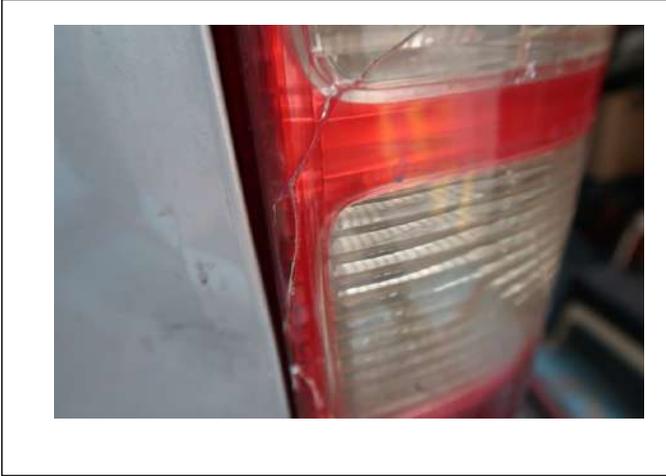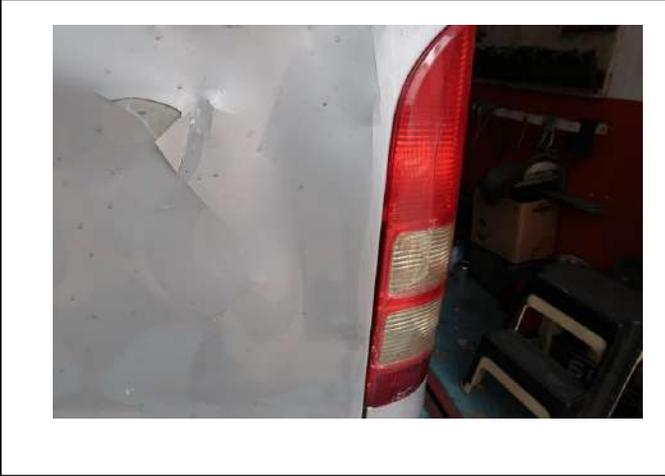



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 184Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

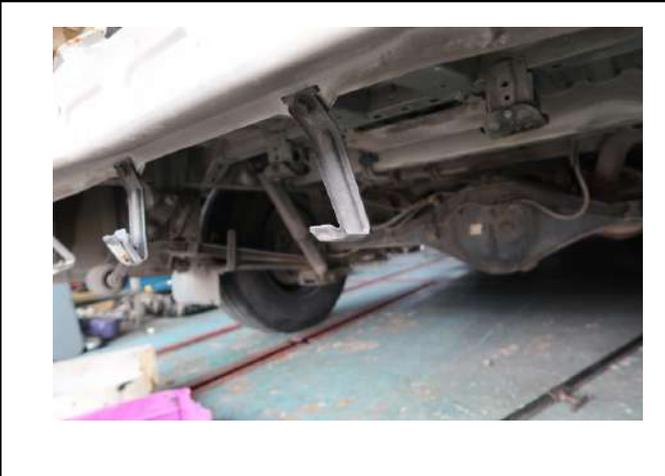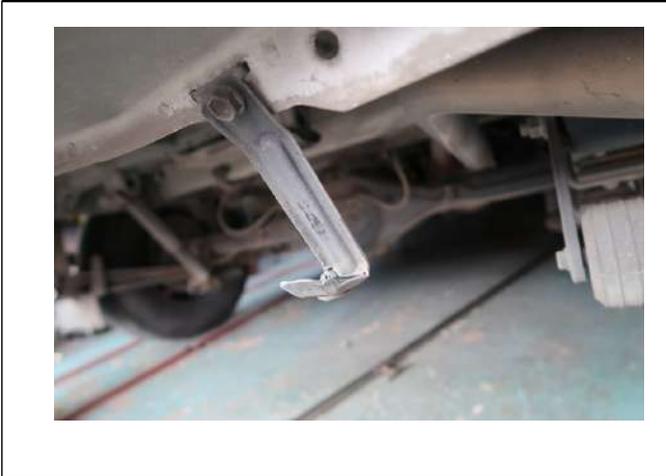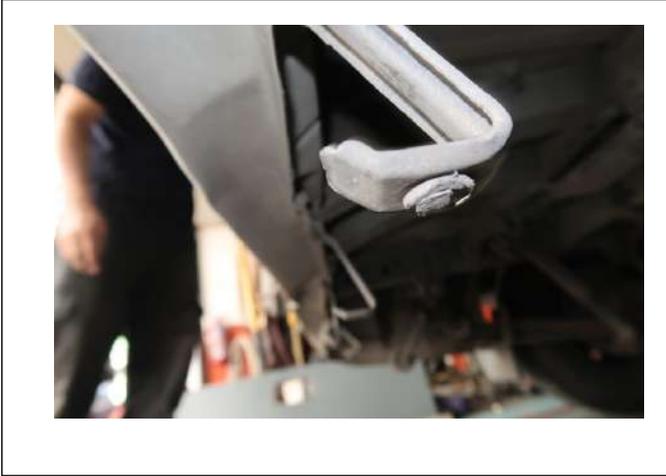



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

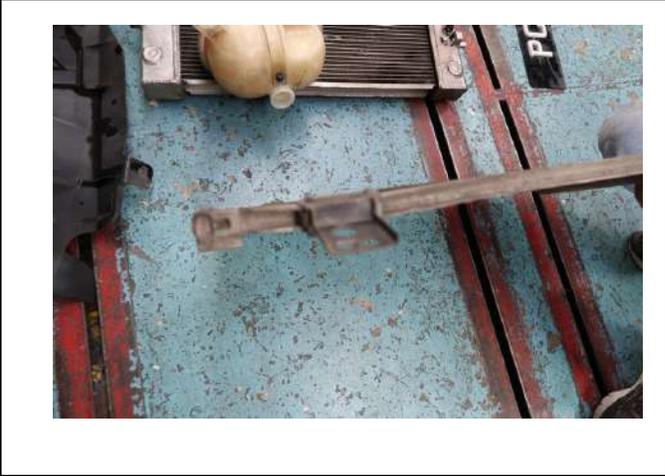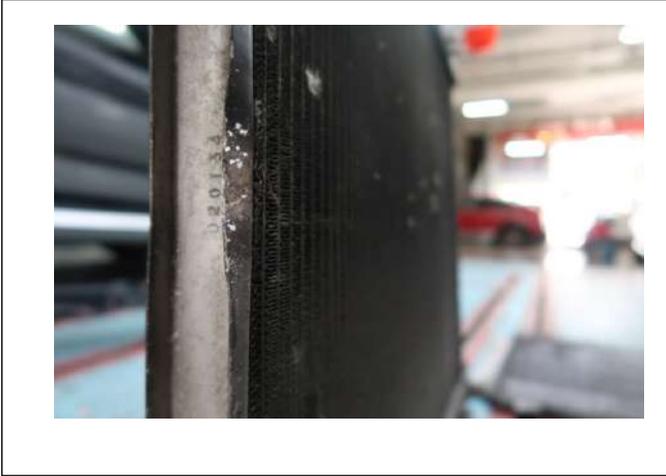



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 184Y

RE-INSPECTION

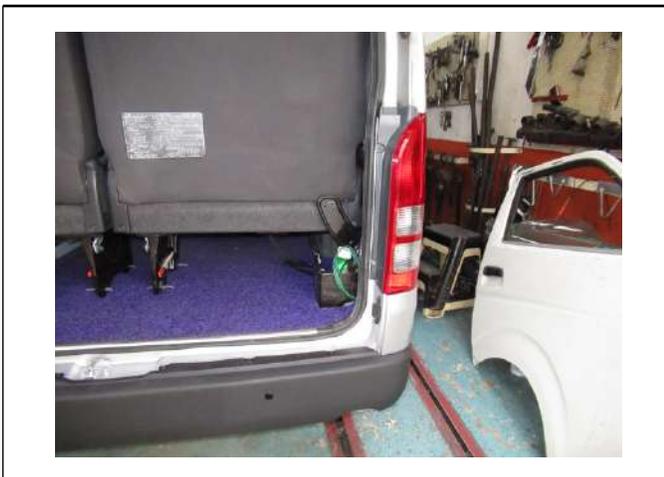



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

