



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200321

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 14/01/2022
Reference CC6/CTI21005090/Ues3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJP 7733U
Insured Veh. SLR 8703R
Claim No. SNM21D202331/C02
Policy No. DMPCSNW00145562000
Accident Date 22/04/2021
Inspection Date 23/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21005090/Ues3q2 Date: 14/01/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLR 8703R	Veh. Inspected	SJP 7733U	
Policy No.	DMPCSNW00145562000	Coverage (\$)	0.00	
Claim No.	SNM21D202331/C02	Excess (\$)	0.00	
Assign From		Assign Date	23/04/2021	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. X1 SDRIVE20i (A)	c.c	1997	
Engine No.	HIDDEN	Year of Reg.	2012	
Chassis No.	WBAVL92010VL60537	Colour	BLACK	
Odometer	131511 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45Z R18	CONTINENTAL	6 mm	
L/H Front Tyre	225/45Z R18	CONTINENTAL	6 mm	
R/H Rear Tyre	225/45Z R18	HEADKING	6 mm	
L/H Rear Tyre	225/45Z R18	HEADKING	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	22/04/2021	Inspection Date	23/04/2021	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJP 7733U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN MOULDING	NECESSARY	110.35	110.35
1	TAILGATE	DENTED / BUCKLED	1,985.20	1,745.20
1	TAILGATE REAR LOGO	NECESSARY	55.80	55.80
1	TAILGATE 'X1' EMBLEM	NECESSARY	58.35	58.35
1	TAILGATE INNER LOCK	TWISTED	266.02	266.02
1	TAILGATE INNER TRIM BOARD	NOT NECESSARY	388.90	-
1	SET TAILGATE INNER TRIM BOARD CLIPS	NOT NECESSARY	50.00	-
1	TAILGATE OUTER GARNISH	NOT NECESSARY	210.30	-
1	TAILGATE WEATHERSTRIP	TWISTED	199.80	199.80
2	TAILGATE REFLECTORS @\$322.30	NOT NECESSARY	644.60	-
1	TAILGATE LICENCE LAMP	NOT NECESSARY	105.00	-
1	REAR BUMPER	DISTORTED	1,403.40	1,203.40
1	REAR BUMPER LOWER	DISTORTED	855.60	755.60
1	REAR BUMPER CENTRE (BLACK)	DISTORTED	366.00	315.20
1	REAR BUMPER UNDER DIFFUSER (O/S)	TORN	450.50	182.30
1	REAR BUMPER REINFORCEMENT	BENT	896.35	715.20
2	REAR BUMPER SIDE RETAINERS @\$91.00	O/S CRACKED	182.00	91.00
2	REAR BUMPER REFLECTORS @\$65.50	NOT NECESSARY	131.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR BUMPER TOW COVER	DEFORMED	30.00	30.00
4	REAR BUMPER PDC SENSORS @\$197.00	SHORTED (2 PCS ONLY)	788.00	394.00
1	REAR BUMPER PDC SENSOR WIRE	NOT NECESSARY	243.00	-
1	REAR END PANEL	BADLY DENTED / CRACKED	715.80	715.80
1	REAR END PANEL TOP GARNISH	TWISTED	200.80	200.80
1	REAR EXHAUST ASSY	NOT NECESSARY	2,250.00	-
1	REAR EXHAUST HEAT SHIELD	NOT NECESSARY	285.30	-
2	REAR EXHAUST MOUNTINGS @\$38.00	NOT NECESSARY	76.00	-
2	TAILLAMPS @\$588.00	SERVICEABLE	1,176.00	-

Report Ref No. CC6/CTI21005090/Ues3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,145.00	-
1	REAR FLOOR INNER SIDE O/S PANEL	BADLY DENTED	455.20	455.20
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	544.00	-
2	REAR FENDER INNER TRIMS @\$399.20	NOT NECESSARY	798.40	-
1	REAR FENDER OUTER PROTECTOR O/S	NOT NECESSARY	390.00	-
	LESS 5% DISCOUNT		-	-377.20
			17,506.67	7,166.82
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	50.00	40.00
1	REAR LICENCE PLATE W/HOLDER (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	200.00	-
			400.00	130.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		80.00	20.00
	TO DISMANTLE & REPLACED REAR PDC SENSOR .		80.00	50.00
	TO DISMANTLE & REFIX REAR WINDSCREEN .		150.00	120.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		150.00	80.00
	TO RESET & REPROGRAMME FAULT CODE .		500.00	60.00
	TO DISMANTLE & REPLACED REAR EXHAUST ASSY .	NOT NECESSARY	180.00	-
	TO TRANSFER TAILGATE MECHANISM .		100.00	60.00
	TO SPRAY RUST PROOFING .		120.00	80.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL .		1,800.00	1,200.00
	TO PUTTY & SPRAY PAINTING.		1,800.00	1,100.00
			4,960.00	2,770.00
GRAND TOTAL			22,866.67	10,066.82



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,000.00
---	--	--	----------

Report Ref No. CC6/CTI21005090/Ues3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 7733U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

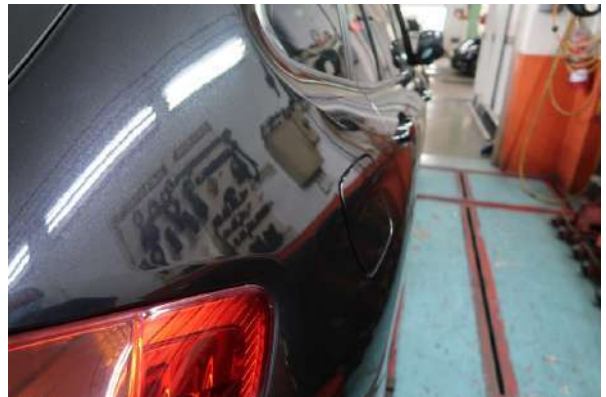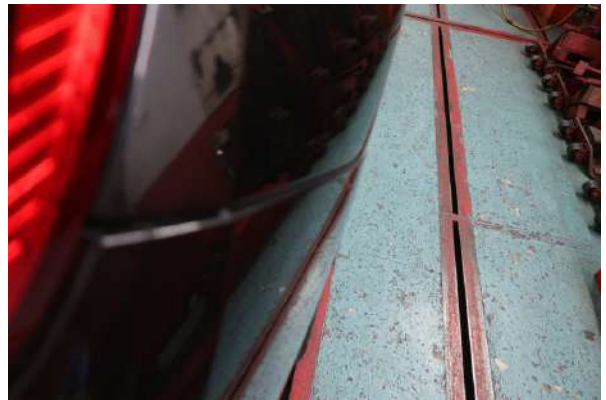



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 7733U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 7733U

RE-INSPECTION

