



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2208030

INV Date 29/12/2022

Reference CC4/LPC21005250/Apa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLT 9281Z
Insured Veh. SJK 2957A
Claim No. 21/21/21/024502
Policy No. Z21VP05028812
Accident Date 27/04/2021
Inspection Date 28/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21005250/Apa3q2 Date: 29/12/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJK 2957A	Veh. Inspected	SLT 9281Z	
Policy No.	Z21VP05028812	Coverage (\$)	0.00	
Claim No.	21/21/21/024502	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	28/04/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ESTIMA	c.c	2362	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	ACR507058213	Colour	SILVER	
Odometer	123120 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	WEST LAKE	6 mm	
L/H Front Tyre	215/55 R17	WEST LAKE	6 mm	
R/H Rear Tyre	215/55 R17	WEST LAKE	6 mm	
L/H Rear Tyre	215/55 R17	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/04/2021	Inspection Date	28/04/2021	
Survey held at	PRO-JEX V2D MOTOR PTE LTD 25 KAKI BUKIT ROAD 4 #03-94 SYNERGY @ KB SINGAPORE 417800			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 9281Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DISTORTED	780.00	780.00
2	REAR BUMPER TOW COVERS @\$50.00	NOT NECESSARY	100.00	-
2	REAR BUMPER SPONGES @\$135.00	CRACKED	270.00	270.00
2	REAR BUMPER BRACKETS @\$90.00	NOT NECESSARY	180.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	80.00	30.00
2	REAR BUMPER SIDE RETAINERS (SMALL) @\$85.00	NECESSARY	170.00	170.00
2	REAR BUMPER SIDE REFLECTORS @\$110.00	N/S CRACKED	220.00	110.00
2	REAR BUMPER SIDE RETAINER (BIG) @\$125.00	NOT NECESSARY	250.00	-
1	REAR END PANEL -OUTER	DENTED	790.00	790.00
1	REAR END PANEL-INNER	NOT NECESSARY	760.00	-
1	REAR END PANEL TRIM	DEFORMED	190.00	190.00
1	REAR END PANEL TOP GARNISH	DEFORMED	210.00	210.00
1	SET REAR END PANEL TRIM CLIPS	NECESSARY	50.00	30.00
2	REAR FENDERS @\$1480.00	TO REPAIR SEE LABOUR	2,960.00	-
2	REAR FENDERS INNER GARNISH @\$850.00	DEFORMED	1,700.00	1,360.00
2	SET REAR FENDER INNER GARNISH CLIPS @\$60.00	NECESSARY	120.00	60.00
2	REAR FENDERS INNER SHIELDS @\$250.00	NOT NECESSARY	500.00	-
2	SET REAR FENDERS INNER SHIELDS CLIPS @\$76.00	NOT NECESSARY	152.00	-
2	TAIL LAMPS @\$650.00	NOT NECESSARY	1,300.00	-
2	SET TAIL LAMPS CLIPS @\$60.00	NOT NECESSARY	120.00	-
1	TAILGATE	DISTORTED	1,490.00	1,490.00
2	TAILGATE HINGES @\$65.00	NOT NECESSARY	130.00	-
1	TAILGATE OUTER HANDLE	CRACKED	105.00	105.00
2	TAILGATE REVERSE LAMPS @\$550.00	CRACKED	1,100.00	674.00
1	TAILGATE CENTRE REFLECTOR	CRACKED	770.00	375.00
1	TAILGATE TRIMBOARD	CRACKED	615.00	565.00
1	SET TAILGATE TRIMBOARD CLIPS	NECESSARY	80.00	30.00
1	TAILGATE WEATHERSTRIP	CUT	360.00	360.00
2	TAILGATE TOP SPOILER	NOT NECESSARY	1,560.00	-
1	SET TAILGATE TOP SPOILER CLIPS	NOT NECESSARY	50.00	-

Report Ref No. CC4/LPC21005250/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	TAILGATE SIDE GARNISHES @\$285.00	NOT NECESSARY	570.00	-
2	SET TAILGATE SIDE GARNISH CLIPS @\$30.00	NOT NECESSARY	60.00	-
1	TAILGATE TOP GARNISH	NOT NECESSARY	350.00	-
1	TAILGATE WIPER BLADE	NOT NECESSARY	38.00	-
1	TAILGATE WIPER ARM	NOT NECESSARY	120.00	-
1	TAILGATE WIPER MOTOR	NOT NECESSARY	380.00	-
1	TAILGATE LOCK	DAMAGED	760.00	355.00
1	TAILGATE LATCH	NOT NECESSARY	60.00	-
1	TAILGATE LOGO	REPEATED	70.00	-
1	TAILGATE EMBLEM -LOGO	NECESSARY	80.00	45.00
1	TAILGATE EMBLEM -ESTIMA	NECESSARY	90.00	60.00
1	TAILGATE EMBLEM 'AERAS'	NECESSARY	90.00	55.00
2	TAILGATE NO PLATE LAMPS @\$160.00	NOT NECESSARY	320.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	100.00	100.00
1	SPARE TYRE COMPARTMENT PANEL	TO REPAIR SEE LABOUR	750.00	-
1	SPARE TYRE COMPARTMENT TOPBOARD	NOT NECESSARY	425.00	-
1	SPARE TYRE COMPARTMENT TOP TRIM	NOT NECESSARY	670.00	-
	LESS 25% DISCOUNT		-5,523.75	-2,053.50
			16,571.25	6,160.50
	<u>SPECIAL NETT ITEMS</u>			
2	ORIGINAL TOYOTA REVERSE SENSORS @\$250.00 (SN)	DAMAGED	500.00	500.00
2	REAR VIEW CAMERA (SN)	DAMAGED	380.00	380.00
1	PANEL SEALANT (SN)	NECESSARY	200.00	60.00
1	REAR WINDSCREEN GLASS GUM (SN)	NECESSARY	100.00	60.00
1	NUMBER PLATE AND FRAME (SN)	BENT	80.00	60.00
			1,260.00	1,060.00
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR FENDERS AND SPARE TYRE COMPARTMENT PANEL .		1,900.00	1,200.00
	SPRAY PAINTING .		1,900.00	1,200.00
	RUSTPROOFING (MPV) .		250.00	80.00
	REMOVE & REFIT REAR WINDSCREEN .		180.00	120.00

Report Ref No. CC4/LPC21005250/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REFIT REVERSE SENSORS AND DRILL HOLES.		100.00	50.00
	REMOVE & REFIT REAR VIEW CAMERA.		100.00	50.00
	CHECK WIRING .		100.00	30.00
	TRANSFER TAILGATE ATTACHMENTS.		100.00	80.00
	CHASSIS ALIGNMENT.	NOT NECESSARY	300.00	-
			4,930.00	2,810.00
GRAND TOTAL			22,761.25	10,030.50

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,000.00
---	--	--	--	-----------------

Report Ref No. CC4/LPC21005250/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 9281Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

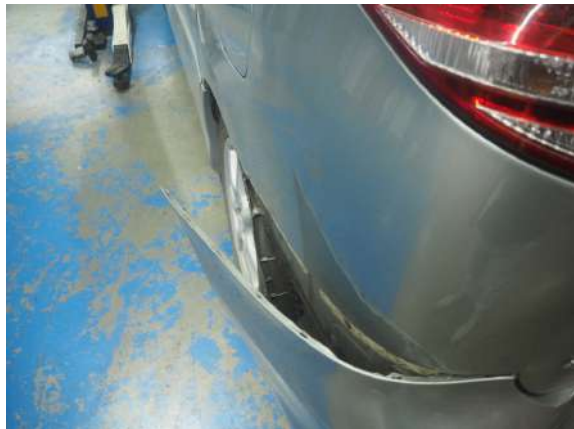



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 9281Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 9281Z

RE-INSPECTION

