



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105337

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/07/2021
Reference CC6/CTI21005354/R1ea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMD 3005S
Insured Veh. SJV 5924S
Claim No. SNM21D202506/C02
Policy No. DMPCSNA00013712101
Accident Date 30/04/2021
Inspection Date 04/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI21005354/R1ea3q2	
			Date: 29/07/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SVJ 5924S		Veh. Inspected	SMD 3005S
Policy No.	DMPCSN00013712101		Coverage (\$)	0.00
Claim No.	SNM21D202506/C02		Excess (\$)	0.00
Assign From			Assign Date	04/05/2021
2. Vehicle Particulars & Condition				
Make & Model	HONDA HRV 1.5 DX CVT		c.c	1496
Engine No.	HIDDEN		Year of Reg.	2018
Chassis No.	JHMRU1810JX200317		Colour	BROWN
Odometer	45082 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	FAIR			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre		215/60 R16	DUNLOP	6 mm
L/H Front Tyre		215/60 R16	DUNLOP	6 mm
R/H Rear Tyre		215/60 R16	DUNLOP	6 mm
L/H Rear Tyre		215/60 R16	DUNLOP	6 mm
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/04/2021		Inspection Date	04/05/2021
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMD 3005S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	880.00	880.00
10	REAR BUMPER CLIP @\$5.00	NECESSARY	50.00	50.00
1	REAR BUMPER RETAINER RH	SERVICEABLE	30.00	-
1	REAR BUMPER RETAINER LH	SERVICEABLE	30.00	-
1	REAR BUMPER REFLECTOR RH	SERVICEABLE	150.00	-
1	REAR UNDERCOVER COVER	DEFORMED	280.00	280.00
1	REAR TAILGATE DOOR	BUCKLED	1,080.00	1,080.00
1	REAR TAILGATE DOOR LOCK	SERVICEABLE	280.00	-
1	REAR TAILGATE DOOR RUBBER SEAL	NECESSARY	120.00	120.00
1	REAR HRV EMBLEM	NECESSARY	80.00	80.00
1	REAR HONDA EMBLEM	NECESSARY	80.00	80.00
1	REAR I-VTEC EMBLEM	NECESSARY	80.00	80.00
1	REAR SPARE TIRE BOARD COVER	SERVICEABLE	350.00	-
1	REAR TOOLS SPONGE BOX/TRAY	CRACKED	250.00	250.00
1	REAR /END PANEL GARNISH	DEFORMED	200.00	200.00
1	REAR END PANEL	BENT	480.00	480.00
1	REAR FLOOR PANEL	BUCKLED	800.00	800.00
1	REAR WINDSCREEN MOLDING	NECESSARY	100.00	100.00
1	REAR BUZZER	CRACKED	110.00	110.00
1	REAR EXHAUST	SERVICEABLE	560.00	-
2	REAR EXHAUST RUBBER MOUNT @\$40.00	SERVICEABLE	80.00	-
1	REAR FENDER ARC LH (ADDITIONAL)	CRACKED	240.00	240.00
	LESS 20% DISCOUNT		-	-966.00
			6,310.00	3,864.00
<u>SPECIAL NETT ITEMS</u>				
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
1	REVERSE SENSOR (SN)	NOT WORKING	200.00	200.00
			240.00	240.00
<u>LABOUR</u>				
	SPRAY PAINTING WHOLE REAR INCLUDE BLENDING.		1,000.00	800.00

Report Ref No. CC6/CTI21005354/R1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACE REAR INCLUDING FITTING ,CUT ,WELD AND RE-ALIGN.		1,000.00	800.00
	REMOVE AND REFIT REAR BUMPER REVERSE SENSOR .		80.00	60.00
	REMOVE AND REFIT REAR EXHAUST PIPE AND SILENCER ,RE-ALIGN.	NOT NECESSARY	80.00	-
	TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR .		80.00	60.00
	REMOVE AND REFIT REAR WINDSCREEN .		120.00	120.00
	APPLY RUST PROOFING ON REPLACED /REPAIRED PANEL.		100.00	80.00
	CHECK AND RECTIFY ELECTRICAL WIRING .	NOT NECESSARY	30.00	-
			2,490.00	1,920.00
GRAND TOTAL			9,040.00	6,024.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,800.00

Report Ref No. CC6/CTI21005354/R1ea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 3005S

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

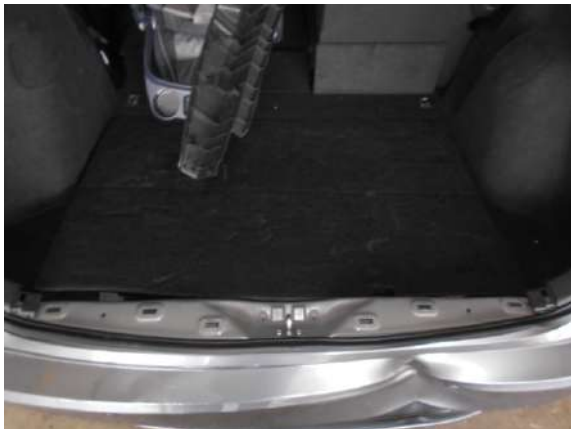



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

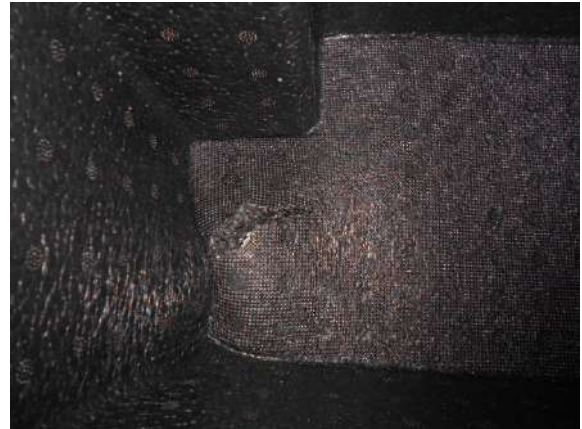



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

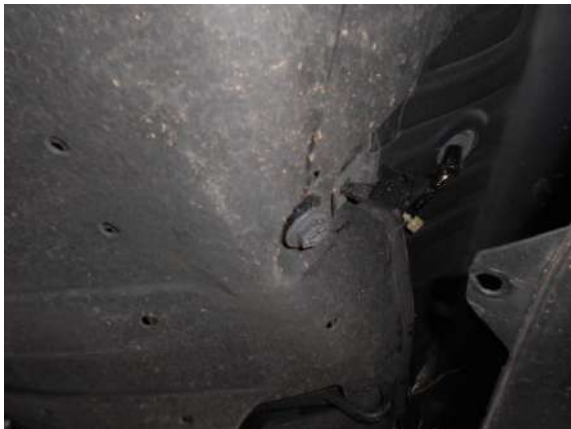



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 3005S

RE-INSPECTION

