

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Yr Regn:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

cor until 24-11-2025 L7A#16596

4/5 & 4/50 (Red to 1741.02, 30%)

28/06/21@2.33pm confirmed with Jouis LS \$4450, 5 days. (Red \$1441.02, 24%)

Date/Time, File Pass to?

1) 28/06 Typist

Date/Time, File Return to?

2)

Report Format :

Lump Sum H.D. (\$ 4450)

☐

: Preli. Report

☐

: Final Report

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

TOTAL

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMW587Z
Repairer Reference: SMW587Z
Date calculated: 06/05/2021 10:32 AM

Full Report
Registration: SMW587Z
Printed: 06/05/2021 10:32 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMW587Z	Date of Incident:	05/05/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	HONDA
Model:	JAZZ(GE6/8:GG1)
Sub Model:	BASE MODEL
Model Sheet Number:	35 AL 01
Registration:	SMW587Z
VIN number:	JHMGE88509
Odometer:	
Model Specs	
TWO COAT METALLIC	PREPARE OFF VEHICLE

*not Authorised
after survey
6/5/21
highlight other repair
1/5 &
5 days*


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

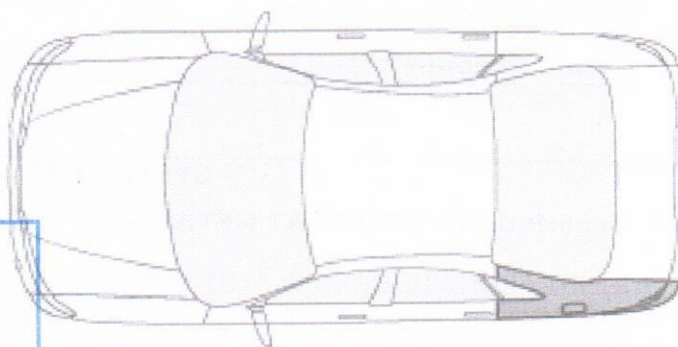

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Labour

Acknowledged by Repairer
Signature:
Date:

Time Base 10 WU/h

Price = 42.00 SGD/h

Code	Description	WU	Price SGD
4161A0)	R + R SUBFRAME	13.0	54.60
843100	R + R LEFT FRONT DOOR TRIM	3.0	12.60
818110)	R + R OUTER LEFT FRONT DOOR HANDLE (DOOR TRIM REMOVED)	2.0	8.40
8161A0	RENEW RIGHT FRONT DOOR INCLUDES: R + R DOOR, CONVERT OR RENEW ALL ATTACHED PARTS AS NECESSARY	27.0	113.40
8221A0	RENEW RIGHT REAR DOOR INCLUDES: R + R DOOR, CONVERT OR RENEW ALL ATTACHED PARTS AS NECESSARY	25.0	105.00
8111A5	RENEW REAR BUMPER	3.0	12.60
7141A5	R + R R/TAILLAMP	2.0	8.40
8341A0)	R + R RIGHT REAR SIDE WINDOW GLASS	10.0	42.00
8131A9	R + R R/R WHEELARCH SHELL	1.0	4.20
823100)	R + R TAILGATE	9.0	37.80
8391A0	R + R TAILGATE SEAL	3.0	12.60
NO NUMBER	RENEW R/RR WING	78.0	327.60
8381A0	R + R R/R DOOR FRAME SEAL	2.0	8.40
8491A9)	R + R R/UPPER C-PILLAR TRIM	1.0	4.20
848140	R + R REAR END PANEL TRIM	1.0	4.20
NO NUMBER	R + R BOOT STORAGE BOX	2.0	8.40
NO NUMBER	R + R REAR PARCEL SHELF TRIM	1.0	4.20
8571C9)	R + R R/R LOWER SIDE PANEL TRIM	2.0	8.40
866100)	R + R RIGHT REAR SEAT BELT	1.0	4.20
4181C8	R + R L/R WHEEL HUB AND WHEEL BEARING	8.0	33.60
8131A3)	R + R L/R BRAKE ANCHOR PLATE	1.0	4.20
421111)	FIT AND BALANCE RIGHT REAR TYRE (WHEEL REMOVED)	5.0	21.00
4181C8	R + R R/R WHEEL HUB AND WHEEL BEARING	8.0	33.60
8131A4)	R + R R/R BRAKE ANCHOR PLATE	1.0	4.20
417105)	R + R RIGHT REAR SHOCK ABSORBER	1.0	4.20
NO NUMBER	BLEED REAR BRAKE SYSTEM	3.0	12.60
413163)	R + R R/REAR ABS SENSOR (WHEEL REMOVED)	3.0	12.60

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	21.60	216.0	907.20
Total of Labour			907.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	RIGHT FRONT DOOR NEW PART PAINTING	15.0
	R/R DOOR NEW PART PAINTING	14.0
	R/RR SIDE PANEL NEW PART PAINTING	24.0
	REAR BUMPER NEW PART PAINT K1R	11.0

Paint Material Per Part

Code	Description	Price SGD
1482	RIGHT FRONT DOOR NEW PART PAINTING	42.83
1782	R/R DOOR NEW PART PAINTING	37.15
3482	R/RR SIDE PANEL NEW PART PAINTING	30.80

Paint Material Per Part

Code	Description	Price SGD
2583	REAR BUMPER NEW PART PAINT K1R	52.64

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		64.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	94.0	394.80

Material Cost - Paint

	Price SGD
New Part Painting	110.78
New Part Painting - Plastic K1R	52.64
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	201.02

Spare Parts

				prices as at 2015-06-01/01	Price SGD
Code	Description	Part Number	Part Source		
1482	RIGHT FRONT DOOR	67010TF0307ZZ	Original	no/Bent ✓	600.00
1565	L/F DOOR OUT HANDLE	72180TF0902ZQ	Original	11 X	175.00
1782	R/R DOOR	67510TF0T90ZZ	Original	no/Bent ✓	600.00
2583	REAR BUMPER	71501TJ5K00ZZ	Original	Torn ✓	380.00
3282	R/R LAMP	33500TF0003	Original	11 X	180.00
3482	R/RR SIDE PANEL	04636TF0E00ZZ	Original	S. 25.00 ✓	480.00
3820	R/R CORNER WDW SEAL	73526TJ5K00	Original	new ✓	18.00
3822	R/R SIDE WINDOW SEAL	73525TF0000		new ✓	0.00
3862	R/S WINDOW BOND KIT	08CRCX016N0		new ✓	0.00
3864	R/SIDE WDW MNTG KIT	USE SINGLE PARTS		new ✓	
7248	R/R ABS SENSOR	57470TF0013	Original	11 X	135.00
9081	REAR AXLE SUBFRAME	42100TJ5T01	Original	Bent/Tw ✓	880.00
9182	R/R WHEEL HUB/BRG	42200TF0N51	Original	Daged ✓	160.00
9202	R/RR SHOCK ABSORBER	52610TJ5T00	Original	Tw ✓	135.00
9552	R/RR WHEEL	42700TF0N02	Original	Cna 300 / S.N ✓	400.00
9566	R/RR TYRE	175/65 R 15 .. T	Original	Daged / 602 72 S.N ✓	120.00
1000	sealant	sealant	Original	new ✓ S.N	25.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings

Subtotal

Fixed Sundry Parts Price

Total

0.00
4,288.00
100.00
4,388.00

Final Calculation

	SGD	SGD
Parts	4,288.00	
Fixed Sundry Parts Price	100.00	
Total Parts		4,388.00
Labour Time Base 10 WU/h		
Total 216.0 WU X 42.00 SGD/h	907.20	
Total of Labour		907.20
Paint Work Time Base 10 WU/h		
Labour Cost 94.0 WU X 42.00 SGD/h	394.80	
Material Cost	201.02	
Total Paint Including Material		595.82
Repair Cost Excludes GST		5,891.02
GST (+7.00%)		412.37
Repair Cost Included GST		6,303.39

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference: SMW587Z
Repairer Reference: SMW587Z
Date calculated: 25/06/2021 12:20 PM

Full Report
Registration: SMW587Z
Printed: 25/06/2021 12:21 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:	SMW587Z	Date of Incident:	05/05/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	JAZZ(GE6/8:GG1)
Sub Model:	BASE MODEL
Model Sheet Number:	35 AL 01
Registration:	SMW587Z
VIN number:	JHMGE88509
Odometer:	

Model Specs

TWO COAT METALLIC	PREPARE OFF VEHICLE
-------------------	---------------------


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

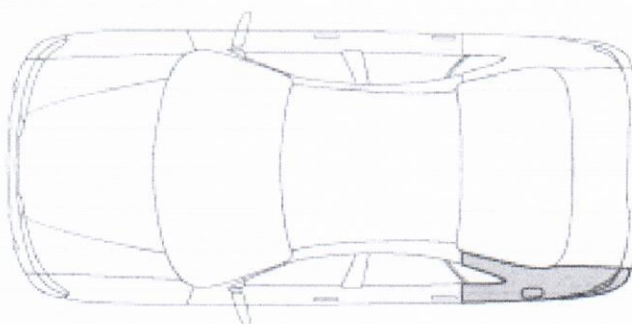

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
4161A0)	R + R SUBFRAME		13.0	54.60
8161A0	RENEW RIGHT FRONT DOOR INCLUDES: R + R DOOR, CONVERT OR RENEW ALL ATTACHED PARTS AS NECESSARY		27.0	113.40
8221A0	RENEW RIGHT REAR DOOR INCLUDES: R + R DOOR, CONVERT OR RENEW ALL ATTACHED PARTS AS NECESSARY		25.0	105.00
8111A5	RENEW REAR BUMPER		3.0	12.60
7141A5	R + R R/TAILLAMP		2.0	8.40
8341A0)	R + R RIGHT REAR SIDE WINDOW GLASS		10.0	42.00
8131A9	R + R R/R WHEELARCH SHELL		1.0	4.20
823100)	R + R TAILGATE		9.0	37.80
8391A0	R + R TAILGATE SEAL		3.0	12.60
NO NUMBER	RENEW R/RR WING		78.0	327.60
8381A0	R + R R/R DOOR FRAME SEAL		2.0	8.40
8491A9)	R + R R/UPPER C-PILLAR TRIM		1.0	4.20
848140	R + R REAR END PANEL TRIM		1.0	4.20
NO NUMBER	R + R BOOT STORAGE BOX		2.0	8.40
NO NUMBER	R + R REAR PARCEL SHELF TRIM		1.0	4.20
8571C9)	R + R R/R LOWER SIDE PANEL TRIM		2.0	8.40
866100)	R + R RIGHT REAR SEAT BELT		1.0	4.20
4181C8	R + R L/R WHEEL HUB AND WHEEL BEARING		8.0	33.60
8131A3)	R + R L/R BRAKE ANCHOR PLATE		1.0	4.20
421111)	FIT AND BALANCE RIGHT REAR TYRE (WHEEL REMOVED)		5.0	21.00
4181C8	R + R R/R WHEEL HUB AND WHEEL BEARING		8.0	33.60
8131A4)	R + R R/R BRAKE ANCHOR PLATE		1.0	4.20
417105)	R + R RIGHT REAR SHOCK ABSORBER		1.0	4.20
NO NUMBER	BLEED REAR BRAKE SYSTEM		3.0	12.60
Labour Cost		Hrs	WU	
Panel / Mechanical Labour		20.80	208.0	873.60
Total of Labour				873.60

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC		WU	Price SGD
	RIGHT FRONT DOOR NEW PART PAINTING		15.0	
	R/R DOOR NEW PART PAINTING		14.0	
	R/RR SIDE PANEL NEW PART PAINTING		24.0	
	REAR BUMPER NEW PART PAINT K1R		11.0	

Paint Material Per Part

Code	Description	Price SGD
1482	RIGHT FRONT DOOR NEW PART PAINTING	42.83
1782	R/R DOOR NEW PART PAINTING	37.15
3482	R/RR SIDE PANEL NEW PART PAINTING	30.80
2583	REAR BUMPER NEW PART PAINT K1R	52.64

Paint Material Per Part

Code	Description	Price SGD
------	-------------	-----------

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		64.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	94.0	394.80

Material Cost - Paint

	Price SGD
New Part Painting	110.78
New Part Painting - Plastic K1R	52.64
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	201.02

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01 Price SGD
1482	RIGHT FRONT DOOR	67010TF0307ZZ	Original	600.00
1782	R/R DOOR	67510TF0T90ZZ	Original	600.00
2583	REAR BUMPER	71501TJ5K00ZZ	Original	380.00
3482	R/RR SIDE PANEL	04636TF0E00ZZ	Original	480.00
3820	R/R CORNER WDW SEAL	73526TJ5K00	Original	18.00
3822	R/R SIDE WINDOW SEAL	73525TF0000		0.00
3862	R/S WINDOW BOND KIT	08CRCX016N0		0.00
3864	R/SIDE WDW MNTG KIT	USE SINGLE PARTS		
9081	REAR AXLE SUBFRAME	42100TJ5T01	Original	880.00
9182	R/R WHEEL HUB/BRG	42200TF0N51	Original	160.00
9202	R/RR SHOCK ABSORBER	52610TJ5T00	Original	135.00
9552	R/RR WHEEL	42700TF0N02	Original	300.00
9566	R/RR TYRE	175/65 R 15 .. T	Original	72.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			3,625.00
u: Used parts	Fixed Sundry Parts Price			100.00
	Total			3,725.00

Extras

Code	Description	Price SGD
1000	sealant sealant	25.00*
	Total Extras	25.00

Final Calculation

	SGD	SGD
Parts	3,625.00	
Fixed Sundry Parts Price	100.00	
Total Parts		3,725.00
Labour Time Base 10 WU/h		
Total 208.0 WU X 42.00 SGD/h	873.60	
Total of Labour		873.60
Total Of Extras		25.00
Paint Work Time Base 10 WU/h		
Labour Cost 94.0 WU X 42.00 SGD/h	394.80	
Material Cost	201.02	
Total Paint Including Material		595.82
Repair Cost Excludes GST		5,219.42
GST (+7.00%)		365.36
Repair Cost Included GST		5,584.78

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.