

WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647.Singapore 542224

Email: Winsongkk@hotmail.com Contact: 9747 0063

Company Register No. 53326249J

Our Ref:	WG/TP/2021-05	
Invoice No:	TP/AUTOBULLOX/2021-05	Date 12 January 2021
Vehicle No:	SLQ7175B	
Attn:	SHEEWIN TRAVELLERS LLP	
Company:	AUTO BULLOX	
Address:	53 Ubi Avenue 1, #01-25 . Paya Ubi Industrial Park. Singapore 408934	

Invoice

Surveyor Fee:	S\$380
Re-inspection Fee:	S\$80
Transport:	S\$60
Photographs:	S\$27/- (@ \$1 per photo, total 27 photos)
Total:	S\$547

Surveyor:	Winson Goh
Signature:	
Date:	12 January 2021

WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647. Singapore 542224
Email: winsongkk@hotmail.com Contact: 9747 0063
Company Register No. 53326249J

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S : SHEEWIN TRAVELLERS LLP
C/O AUTO BULLOX
53 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park. Singapore 408934

Date : 12 January 2021
Our Ref : WG/TP/2021-05

REFERENCE PARTICULARS

Date of Accident : 22 December 2020
Date of Inspection : 30 December 2020

Type of Inspection : Third Party Claim
Date of Re-Inspn : 07 January 2021

VEHICLE PARTICULARS

Registration No : SLQ7175B
Make : KLA
Model : FORTE K3 1.6A
Year : 2017

Engine No : G4FGGH634431
Chassis No : KNAFJ411MH57175
Odometer : 112562km
Colour : Blue

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good
Foot Brake : Serviceable
Hand Brake : Serviceable

General Body Work : Good
Steering : Serviceable
Lightings : Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

	<u>Make</u>	<u>Size</u>
Front Near side	: Bridgestone	195/65R16
Front Off Side	: Bridgestone	195/65R16
Rear Near Side	: Bridgestone	195/65R16
Rear off Side	: Bridgestone	195/65R16

<u>Thread Balance</u>
5 mm
5 mm
5 mm
5 mm

GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the rear right portion.
For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **S\$7,300.00** nett at lump sum basis.(Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Nine (09) working days.

Enclosed Twenty-six (26) photographs depicting damage to the vehicle.

Inspection conducted at : AUTO BULLOX
53 Ubi Avenue 1, #01-25 . Paya Ubi Industrial Park. Singapore 408934

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

VEHICLE NO : SLQ7175B
MODEL : FORTE K3 1.6A

Our Ref : WG/TP/2021-05

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

A)	SPARE PARTS	QTY PC/SET	ASSESSED CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
01	REAR BUMPER ✓	1	CRACKED	\$ 900.00	\$ 688 900.00
02	REAR BUMPER RETAINER X svc	2	NECESSARY	\$ 180.00	\$ 180.00
03	REAR FENDER RH X repair	1	DENTED	\$ 1,530.00	\$ 1,530.00
04	REAR WINDSCREEN MOULDING X svc	1	NECESSARY	\$ 190.00	\$ 190.00
05	REAR DOOR PANEL RH X repair	1	DENTED	\$ 1,430.00	\$ 1,430.00
06	REAR DOOR PROTECTOR RH ✓	1	NECESSARY	\$ 210.00	\$ 74(SN) 210.00
07	FRONT DOOR PANEL RH X repair	1	REPAIR	\$ -	\$ -
08	FRONT DOOR PROTECTOR RH ✓	1	NECESSARY	\$ 210.00	\$ 74(SN) 210.00
				\$ 4,650.00	\$ 4,650.00
				Less 10%	\$ 465.00
				\$ 4,185.00	\$ 4,185.00

619.2

B)	<u>S/NETT ITEM</u>				
09	RIM ✓	1	GRAZED	\$ 1,200.00	\$ 300 900.00
10	REAR BUMPER CLIP ✓	1 SET	NECESSARY	\$ 60.00	\$ 30 50.00
11	JOINT SEALANT X svc	1	NECESSARY	\$ 150.00	\$ 120.00
12	WINDSCREEN SEALANT X svc	1	NECESSARY	\$ 150.00	\$ 120.00
				\$ 1,560.00	\$ 1,190.00

478

Parts Total :

\$ 5,745.00	\$ 5,375.00
-------------	-------------

C)	<u>LABOUR CHARGES & MISC</u>				
13	CHECK REAR WIRING AND LIGHTNING SYSTEM			\$ 60.00	\$ 30 50.00
14	REMOVE AND REFIT REAR LINING, TRIM AND GARNISH			\$ 200.00	\$ 60 180.00
15	COMPUTERISED AND CHECK REAR WHEEL ALIGNMENT			\$ 180.00	\$ 60 150.00
16	REMOVE AND REFIT REAR WINDSCREEN			\$ 180.00	\$ X 150.00
17	TRANSFER PARTS, ATTACHMENT FROM OLD REAR DOOR TO NEW			\$ 250.00	\$ X 200.00
18	PANEL BEATING ON AFFECTED AREAS			\$ 1,800.00	\$ 400 1,500.00
19	SPRAY PAINTING ON AFFECTED AREAS			\$ 1,600.00	\$ 800 1,400.00
20	APPLY ANTI RUST ON AFFECTED AREAS			\$ 120.00	\$ X 100.00
				\$ 4,390.00	\$ 3,730.00

Labour Total :

1350

Total Parts and Laboure :

\$ 10,135.00	\$ 9,105.00
--------------	-------------

FINAL LUMP SUM ADJUSTMENT

\$ 7,300.00

2447.2

-20%: 1950

5 Days

POINT OF IMPACT

The impact was confined to the rear right portion of the vehicle.
The damages appeared to be consistent as per the accident report statement.
Please refer the attached schedule and photographs for details.

ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

CONCLUSION


The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$7,300.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

97

Yours faithfully
WG APPRAISAL SERVICES



Winson Goh
Automotive Appraiser


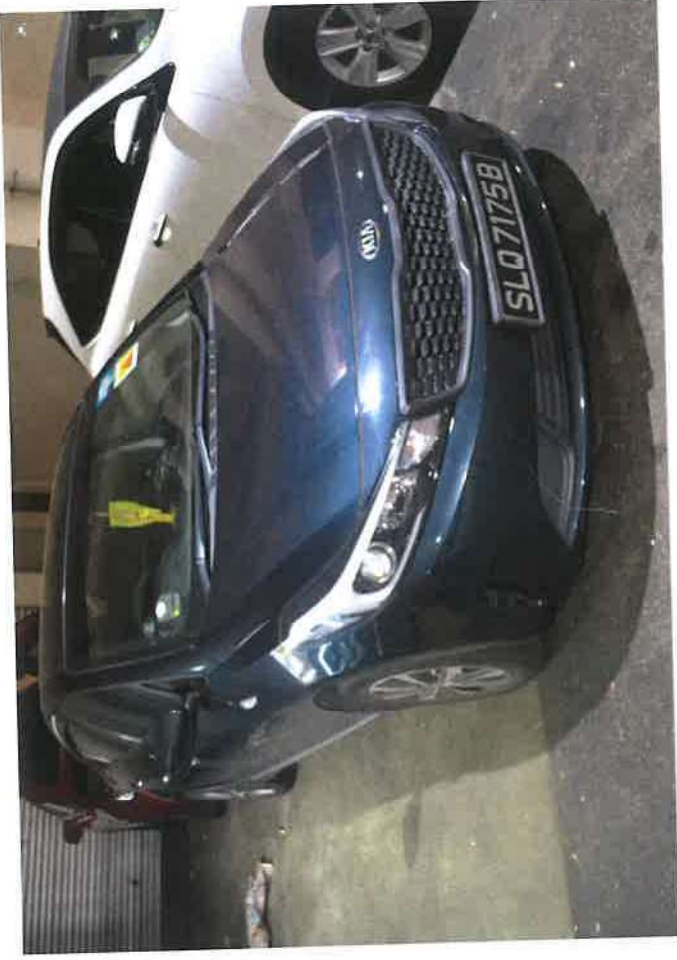










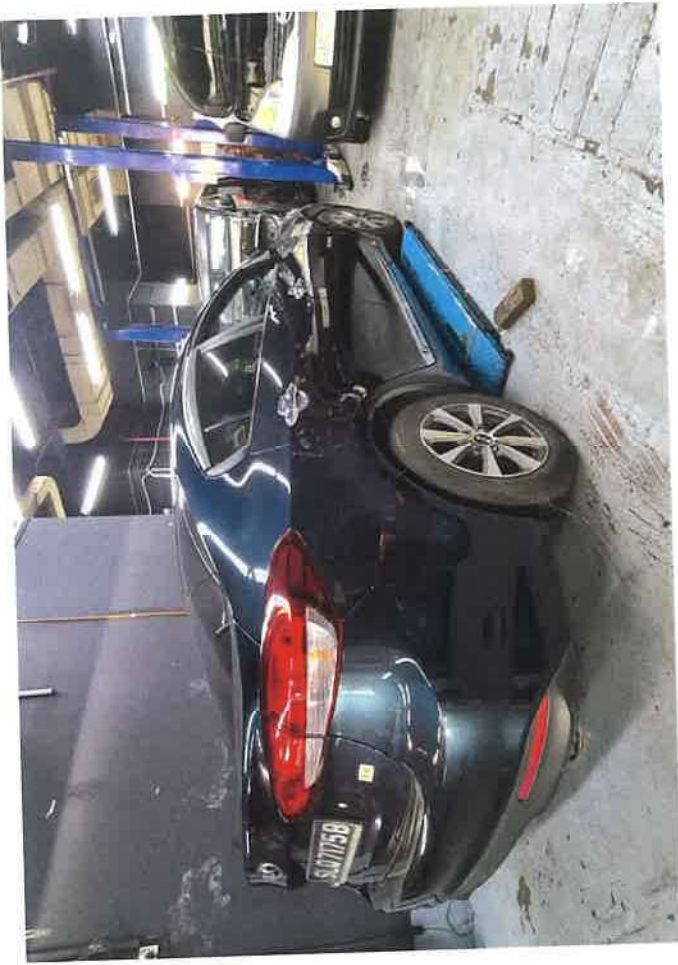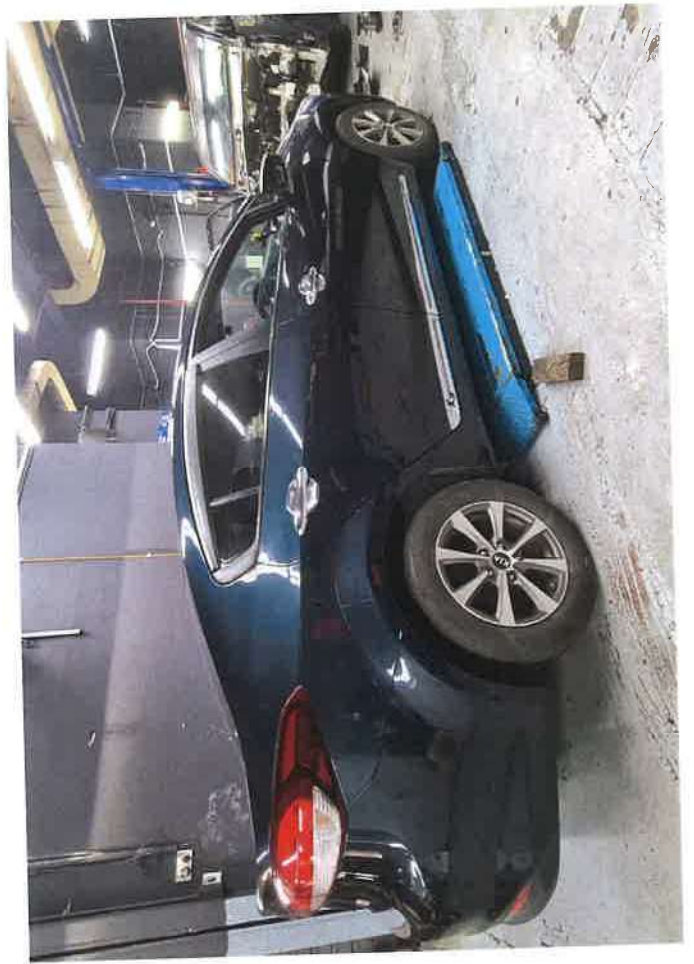



AUTO BULLOX PTE LTD

53 Ubi Avenue 1#01-25, Paya Ubi Industrial Park, Singapore 408934
Tel: 6841 5383 Fax: 6841 6043 Email: motoricarzgarage@gmail.com
Register No.: 201919765N

Date: 15/01/2021

Name: SHEEWIN TRAVELLERS LLP
Address: 331 Bukit Batok Street 33 #05-233
Singapore 650331
Vehicle No: SLQ7175B
Make/Model: Kia Forte K3 1.6A
Accident Date: 22/12/2020

FINAL BILL FOR VEHICLE NO: SLQ7175B

Supply of parts, labour charges, panel beat and spray painting.
(Lump Sum Repair)

\$7,300.00

Total (SGD)

\$7,300.00


AUTO BULLOX PTE LTD