

**PRIORITY SERVICES**  
Insurance Loss Adjusters And Motor Appraisers  
Block 779 Yishun Avenue 2 #01-1545 Singapore 760779  
Tel : 62934822 Fax : 62963283

**VEHICLE INSPECTION REPORT**

Report No. TP/0016/21	Date of Report	: 29 July 21
To : Hong Fong Logistics Pte Ltd	Date of Request	: 26 July 21
	Report requested by	: Hong Fong Logistics Pte Ltd
50 Bukit Batok Street 23	Date of Accident	: 15 May 21
#08-20 Midview Building	Date of Inspection	: 26 July 21
Singapore 659578	Claim No.	: Third Party Claim

**PARTICULARS OF DAMAGED VEHICLE**

Registration Plate No	: XD 2552 E	Odometer Reading	: Not Working
Make	: Nissan	Carrying Capacity	: 50000kg
Model	: GKB45CLBHN Prime Mover	Radio / Cassette / CD	: Yes
Year of Manufacture	: 2008	Air-Conditioner	: Yes
Colour	: White	Wing Mirror	: Yes
Engine Capacity	: 13074cc	Clock	: Yes
Engine No	: --	Seat Belts	: Yes
Chassis / Frame No	: GKB4CLB00251	Others	: Nil

**TYRE CONDITION**

Front Left	: 12mm	Front Right	: 12mm
Make	: Windforce	Make	: Hilo
Rear Left	: 9mm/9mm	Rear Right	: 9mm/9mm
Make	: Inning	Make	: Goldshield
Spare	:	Road Wheels Type	: Standard

(The above represents the approximate remaining life of tyre treads)

Jack & Tools	: -	Spare Tyre	: Intact
--------------	-----	------------	----------

**PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)**

General Body Work	: Good
Paint Work	: Good
Handbrake	: Serviceable
Footbrake	: Serviceable
Steering	: Serviceable
Apparent engine modification	: Nil

*This report is confidential and is given for the use of clients and their agents and any disclosure or publication of it or parts thereof shall be the responsibility of such person and no liability shall be attached to us therefore.*

**ASSESSMENT**

---

	<b><u>Repairer's Estimate (S \$)</u></b>	<b><u>Our Recommendation (S \$)</u></b>
Spare Parts :	39,574.26	20,388.42
Labour Charges :	9,800.00	3,480.00
Paint Work :	800.00	600.00
Towing Charges :	0.00	0.00
Others :	0.00	0.00
Totals :	50,174.26	24,468.42

---

Reduction (S \$) : 0.00

Recommended Reserve (S \$) : (See Reports)

Estimated Normal Period of Repairs : 16 days if undertaken

---

**CONTRIBUTIONS BY INSURED**

Excess (S \$) : N/A

Others : --

## GENERAL REMARKS

WITHOUT PREJUDICE

Continuation Sheet

### The Assignment

The survey was conducted at M/s. ASM Automotive Services Pte Ltd, No. 13 Pioneer Sector 1, Singapore 628424.

### Point of Impact

At the rear portion. (Engine components were also affected)

---

### Damages

The cabin rear end panel, cabin rear end panel windscreen glass, cabin rear locks, cabin rear lock brackets, cabin rear mounting bracket sub frame, cabin rear air bellows, trailer valve air pipe, propeller shaft, intercooler hoses, radiator assy, inlet pipe, air cleaner assy, etc..

Other parts were also found damaged. (see schedule for details)

### Adjustment / Recommendation

We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle and we list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is \$24,468.42

This exclude parts and labour to be checked (about \$20,091.20) and allowance for hidden necessities.

Estimated total repair cost : \$44,559.62

Lump-sum repair if vehicle was to be repaired: \$19,550.00 (minimum), depending on damages for check items and hidden necessities.

### Total Loss Consideration

We have enquired into the pre-accident market value of the vehicle and the price salvage would fetch for the wreck.

We list below our findings :-

1) Pre-Accident Value (with COE) : About \$25,000.00

Date of original registration : 27/05/2008

Number of owners : 3

OMV : \$72,326.00

PARF rebate : N/A

Quota premium : \$17,865.00 (COE Category C expiring 26/05/2023)

COE rebate : \$7,700.00

2) Salvage : a) To owner in the form of COE rebate : About \$7,700.00

... Cont'd Page 2

**GENERAL REMARKS**

WITHOUT PREJUDICE

Continuation Sheet

3) Economical limit to repair : About \$17,300.00


Conclusion

We now revert to you for your decision on repairs..

Assuring you of our best services always.

Very truly yours

**PRIORITY SERVICES**



**JIMMY S. T. LEE-AMSOE, AMIRTE, AMSAE-AUS, MSAAA**  
**Motor Appraiser**

**Surveyed by:**



**LAWRENCE NG, MSAAA**  
**Motor Appraiser**

Encl. Photographs of the damaged vehicle taken by us during inspection.

Replacement of Parts	Condition	Repairer's Estimate (S \$)	Dist. %	Our Recommendation (S \$)	Dist. %
<b>To Supply :</b>					
1pc. Rear end panel	Dented / Repair	1,380.40	10	--	10
1pc. Rear end panel trim	Refit	1,330.00	10	--	10
1pc. Rear windscreen	Shattered	58.80	10	58.80	10
1pc. Rear weatherstrip	Necessary	56.00	10	56.00	10
2pcs. Rear cabin lock LH & RH	RH Cracked / LH Bent	434.00	10	434.00	10
1pc. Front wheel inner fender RH	Cracked	767.90	10	767.90	10
1pc. Steering shaft	To Check	803.60	10	--	10
1pc. Intercooler	To Check	11,182.50	10	--	10
1pc. Intercooler hose (red)	Dented / Bent	845.60	10	845.60	10
1pc. Intercooler hose (black)	Dented / Bent	1,050.00	10	1,050.00	10
1pc. Intercooler hose clamp	Necessary	187.60	10	187.60	10
1pc. Radiator	Cracked	7,637.00	10	7,637.00	10
1pc. Fan shroud assy	To Check	1,027.60	10	--	10
2pcs. Fan shroud rubber	To Check	119.00	10	--	10
2pcs. Fan shroud rubber clamp	Necessary	532.00	10	532.00	10
1pc. Inlet pipe	Cracked	707.70	10	707.70	10
1pc. Engine oil filter assy	To Check	494.00	10	--	10
1pc. Cab tilt cylinder assy	Refit	1,758.40	10	--	10
2pcs. Front engine mounting	To Check	546.00	10	--	10
2pcs. Rear gearbox mounting	To Check	851.20	10	--	10
1pc. Air cleaner assy	Cracked	1,946.00	10	1,946.00	10
1pc. Air cleaner duct	Refit	123.20	10	--	10
1pc. Rear cabin relay box top cover	Refit	46.20	10	--	10
1pc. Rear cabin relay box bottom cover	Refit	88.20	10	--	10
2pcs. Rear cabin lock bracket LH & RH	Bent	704.00	10	704.00	10
1pc. Rear cabin mounting bracket sub frame	Bent	112.00	10	112.00	10
1pc. Rear cabin mounting bracket	To Check	805.70	10	--	10
2pcs. Rear cabin air bellow LH & RH	Bent	445.20	10	445.20	10
2pcs. Rear cabin shock absorber LH & RH	To Check	520.80	10	--	10
1pc. Rear cabin lateral link	To Check	240.80	10	--	10
1pc. Trailer valve air pipe	Broken	170.00	10	170.00	10
1pc. Propeller shaft	Sliding & Slip Yoke Cracked	3,230.00	10	3,230.00	10
<b>Sub-Total :-</b>		<b>40,201.40</b>		<b>18,883.80</b>	
<b>Total Discount :-</b>		<b>4,020.14</b>		<b>1,888.38</b>	
		<b>36,181.26</b>		<b>16,995.42</b>	
<b>Special Nett Items :-</b>					
5litres steering oil	Necessary	50.00		50.00	
25litres radiator coolant	Necessary	250.00		250.00	
10litres engine oil	Necessary	100.00		100.00	

Vehicle No : XD 2552 E Nissan GKB45CLBHNB Prime Mover




TP/0016/21

Workshop : ASM Automotive Services Pte Ltd

Replacement of Parts	Condition	Repairer's Estimate (S \$)	Dist. %	Our Recommendation (S \$)	Dist. %
5litres cabin tilt hydraulic oil	Necessary	75.00		75.00	
1pc. Rear platform	Bent / Cracked	800.00		800.00	
1pc. Fifth wheel assy	Bent	1,300.00		1,300.00	
12pcs. Fifth wheel bolts/nuts/washers	Necessary	18.00		18.00	
1pc. Fifth wheel bottom support	Bent	800.00		800.00	
<b>Total For Parts :-</b>		<b>39,574.26</b>		<b>20,388.42</b>	
<b>Labour Charges :</b>					
To remove and replace damaged parts as above, including dismantle intercooler, radiator, fan assy, engine mounting, gearbox mounting etc. Replace all damaged/necessary parts. Including realign front cabin position.		3,500.00		2,800.00	
To chemical wash oil stain areas.		180.00		150.00	
To knock and straightening main chassis frame. - \$4,500.00 to check		5,500.00		--	
To remove and replace rear platform, new fifth wheel assy and fifth wheel bottom support.		250.00		200.00	
Logo writing on cabin rear panel.		120.00		80.00	
Towing fee (including open shaft and brake).		250.00		250.00	
<b>Spray Painting :</b>					
Spray painting cabin rear panel, main chassis frame and platform.		800.00		600.00	
<b>Grand Total :-</b>		<b>50,174.26</b>		<b>24,468.42</b>	




Surveyed By : Lawrence Ng







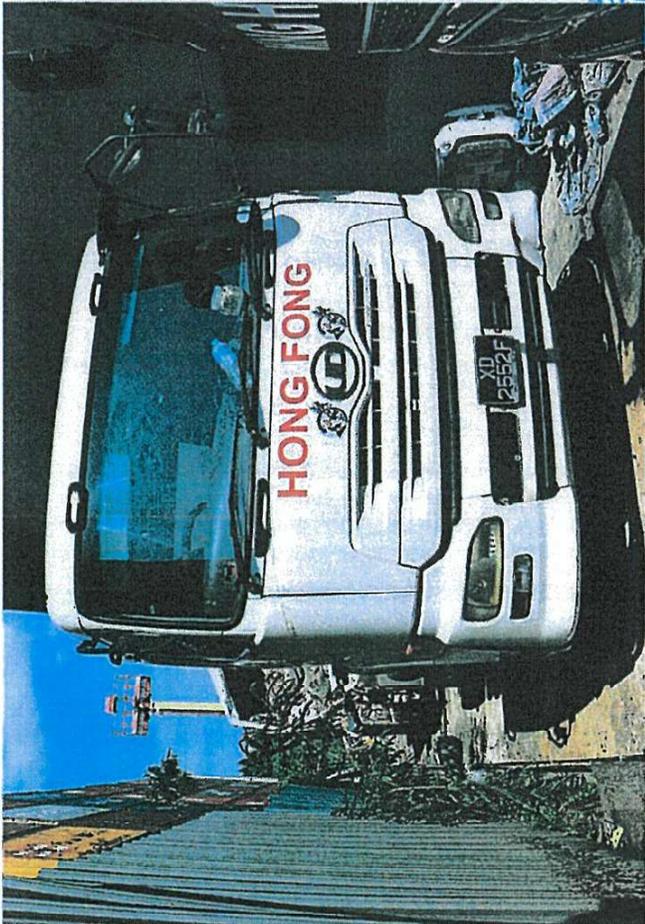
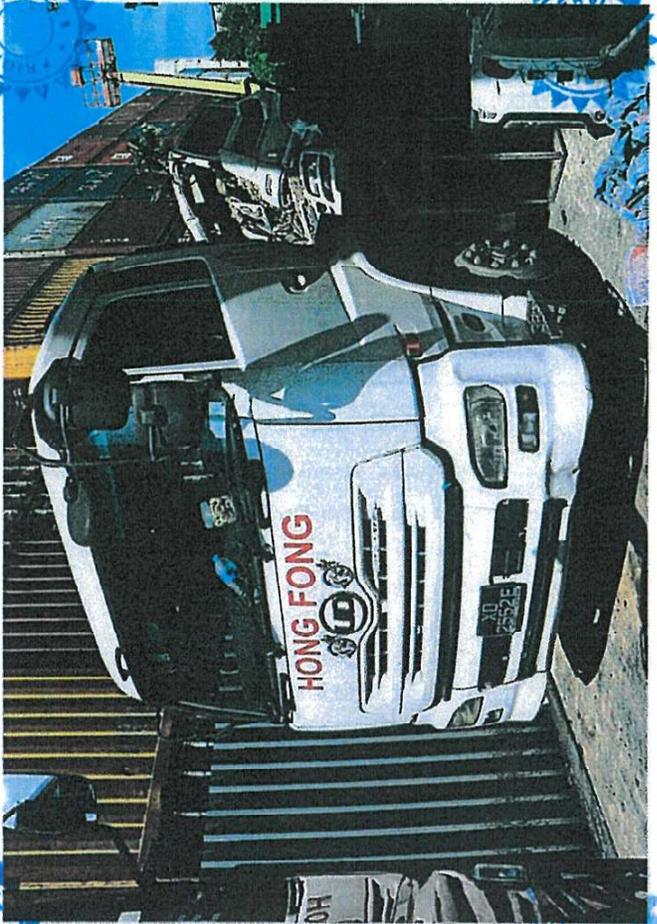
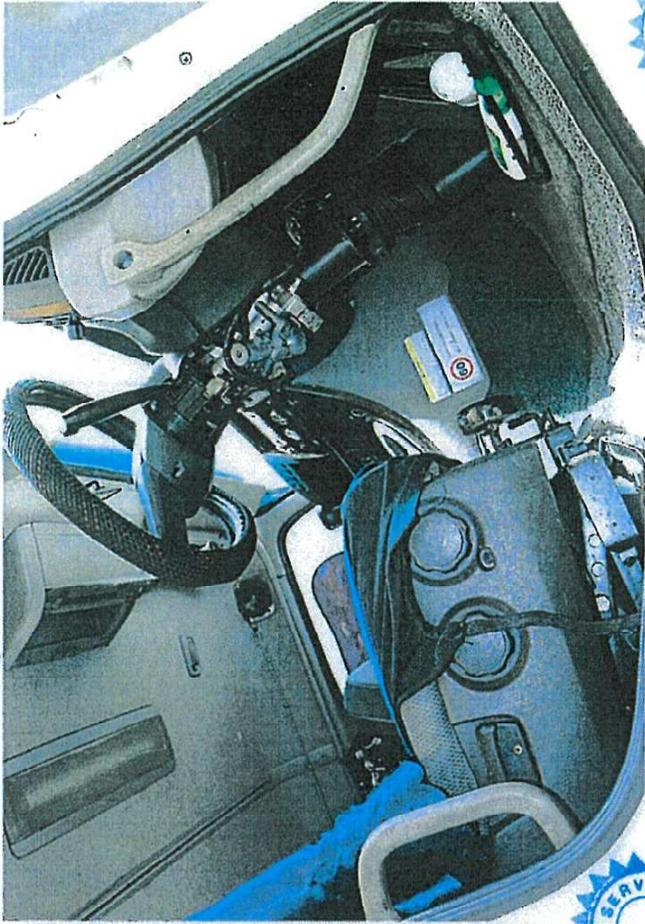





**TEN-CHONG** Ten Chong Industrial Machinery (Pte) Ltd  
 23 Jalan Buroh Singapore 619479  
 Tel: (65) 6662 2222/3 Fax: (65) 6264 1666





Chassis Number	6KE4C1600251
Unladen Weight	6580 Kg
Max Laden Weight	5000 Kg
Passenger Capacity	1 Driver 2 Others
Tyre Size	F 11R x225 x16(S) P 11R x225 x16(D)

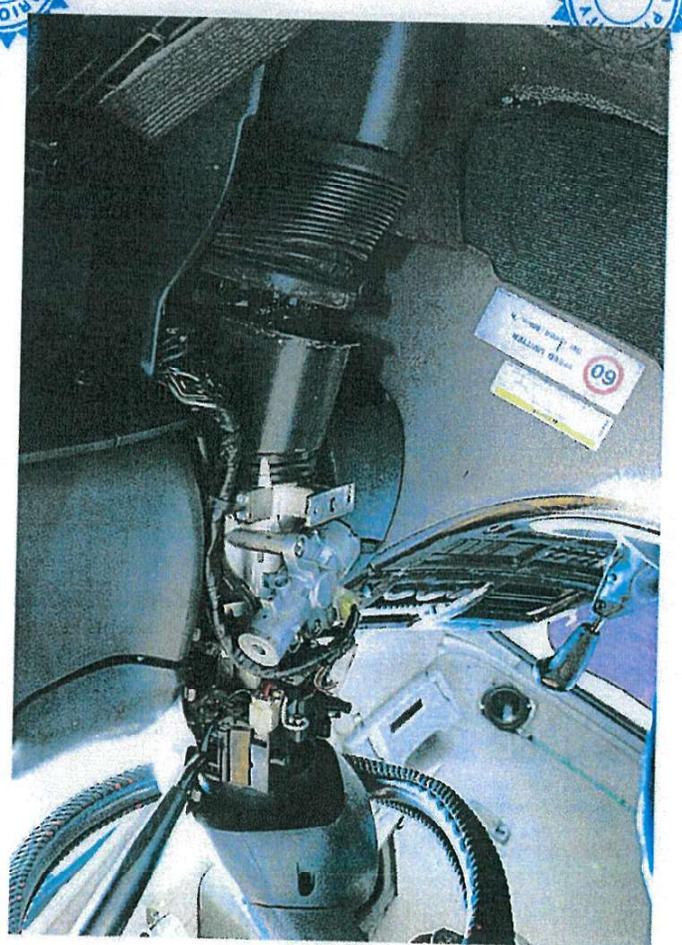
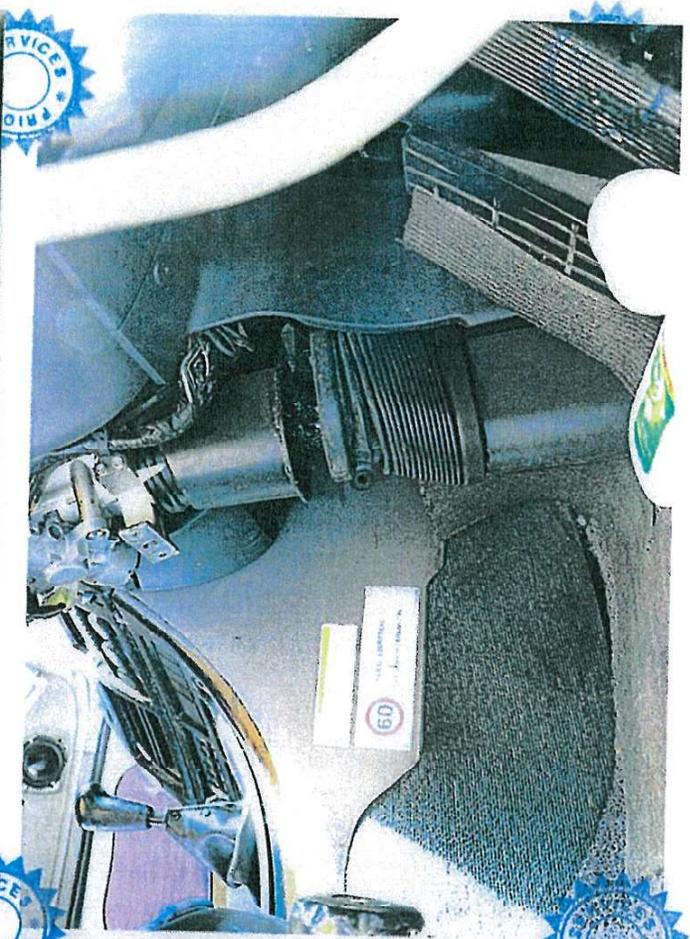
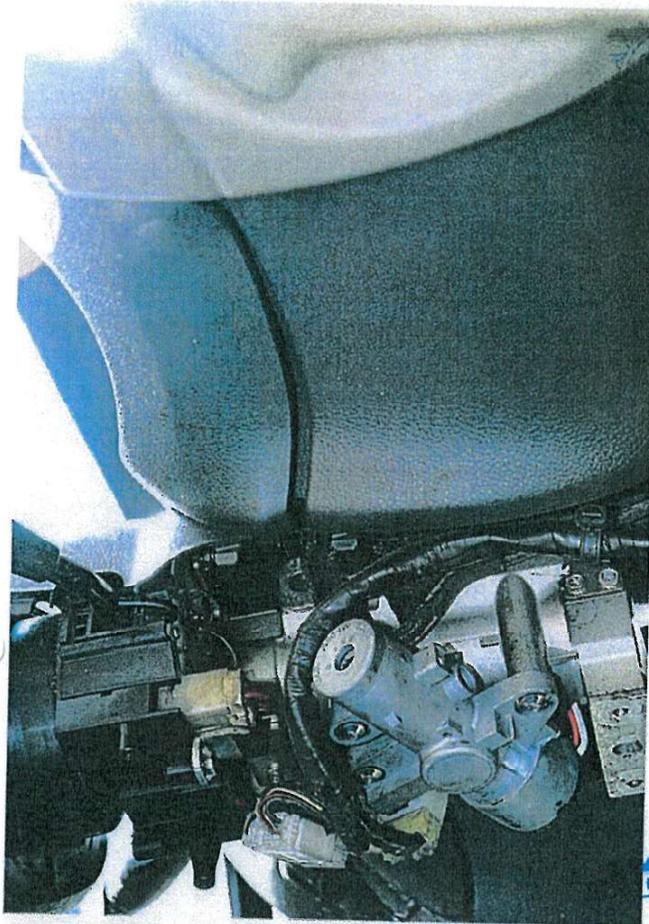



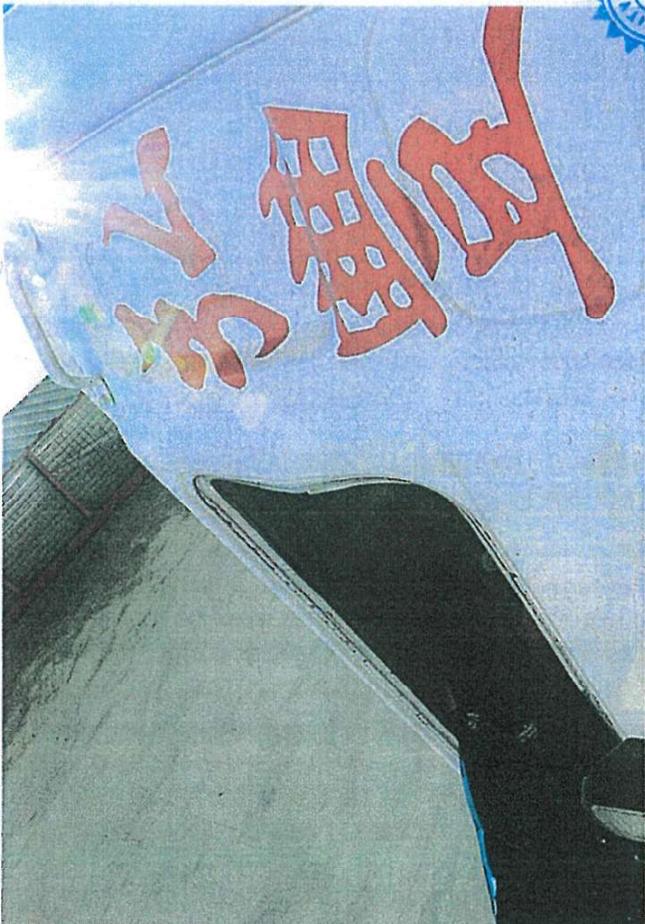
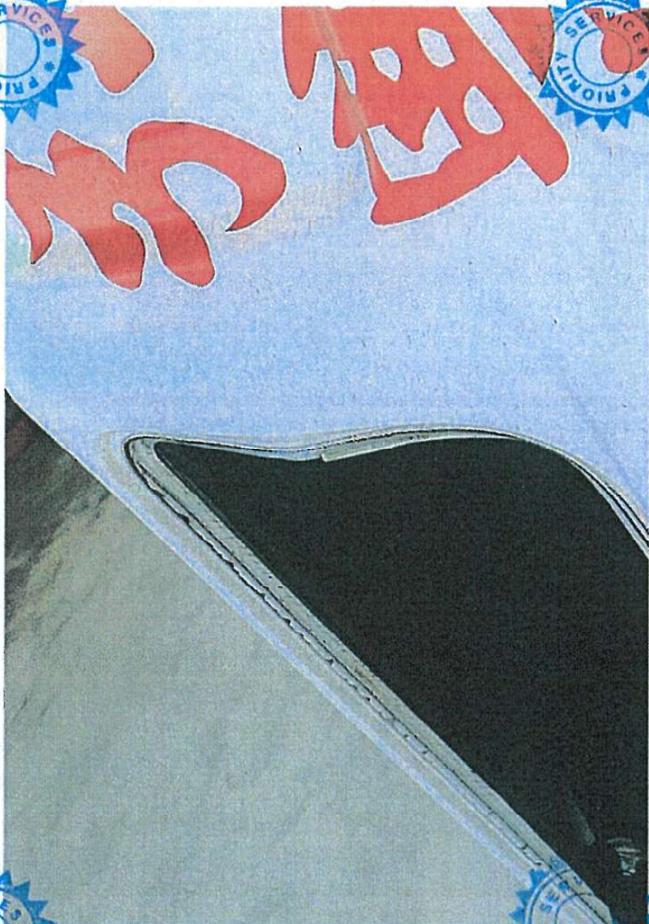
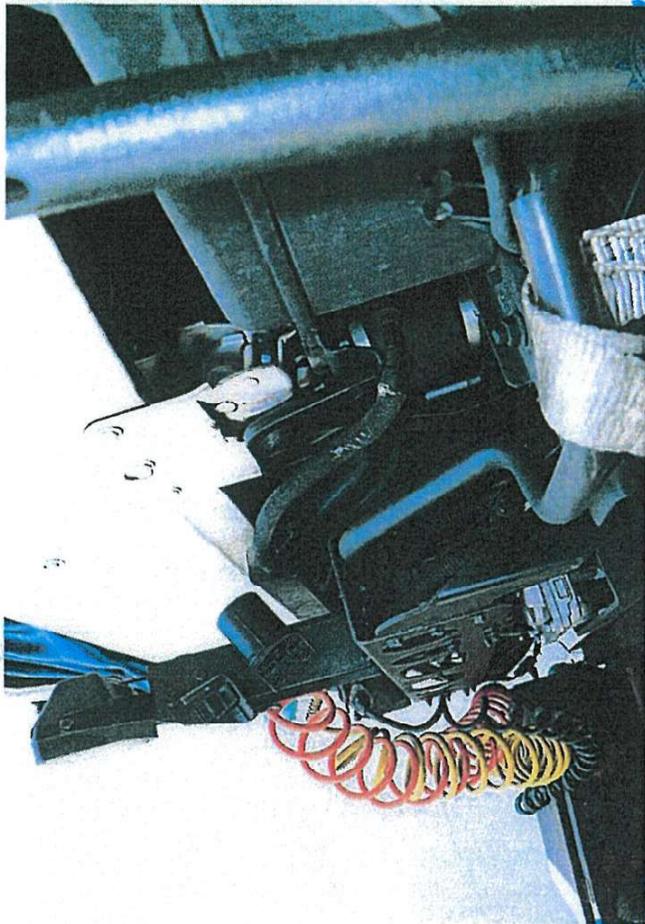


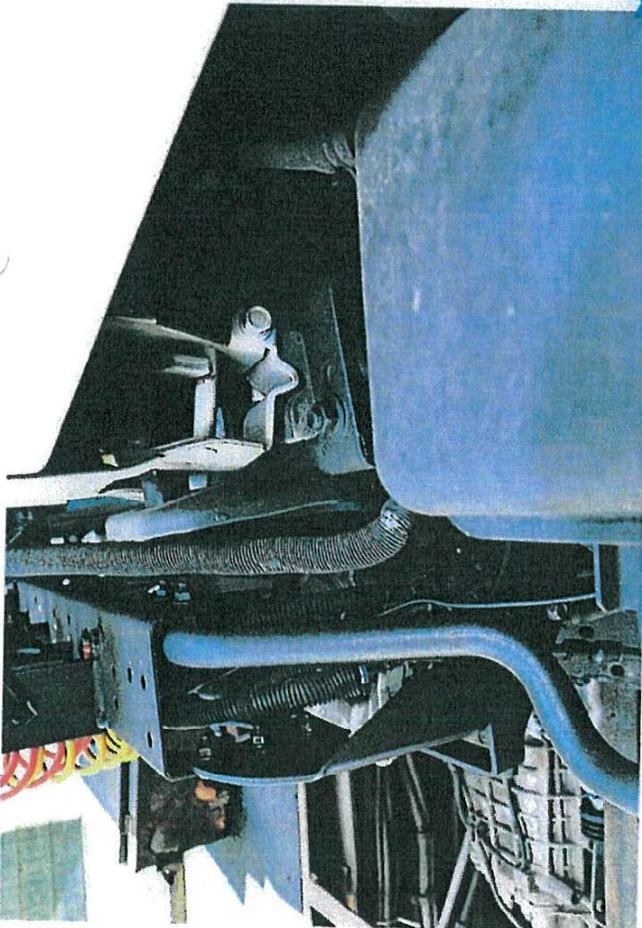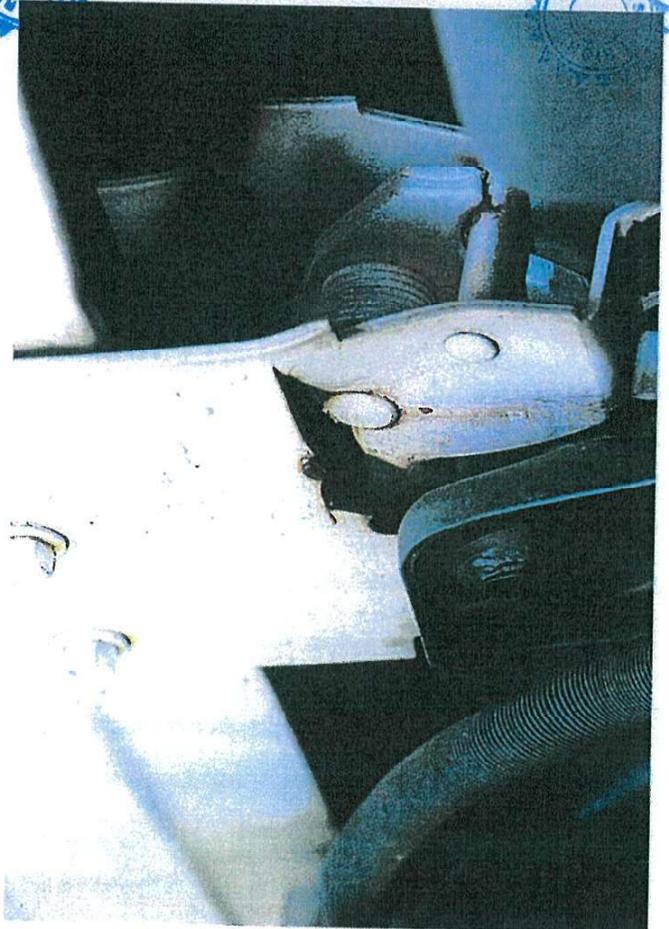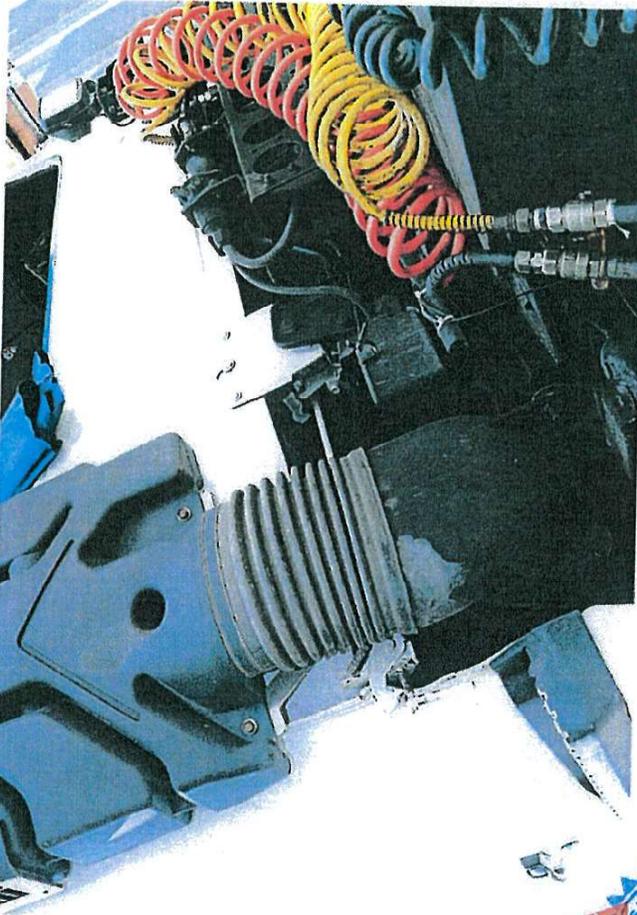
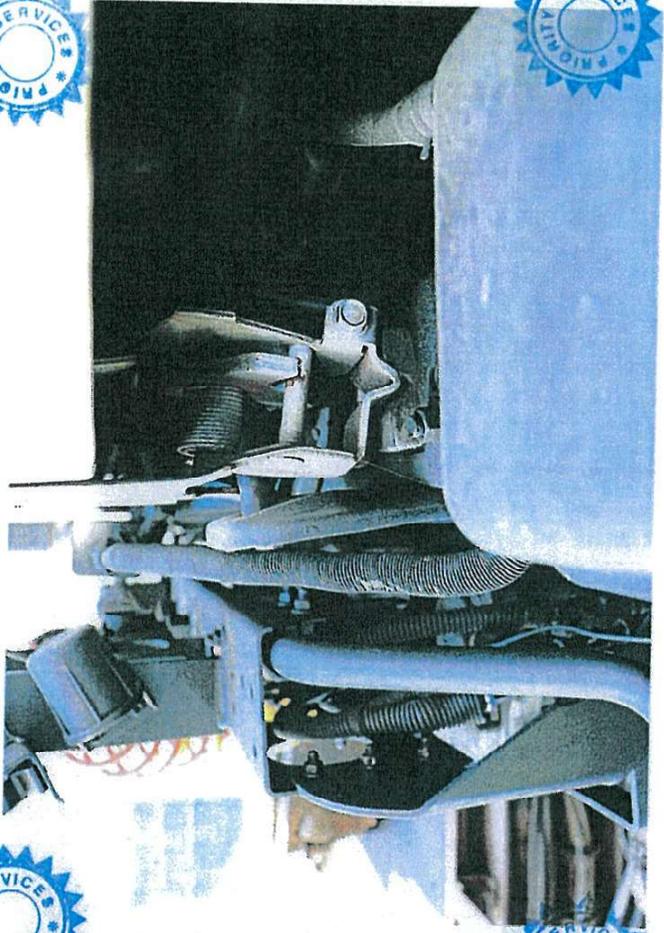



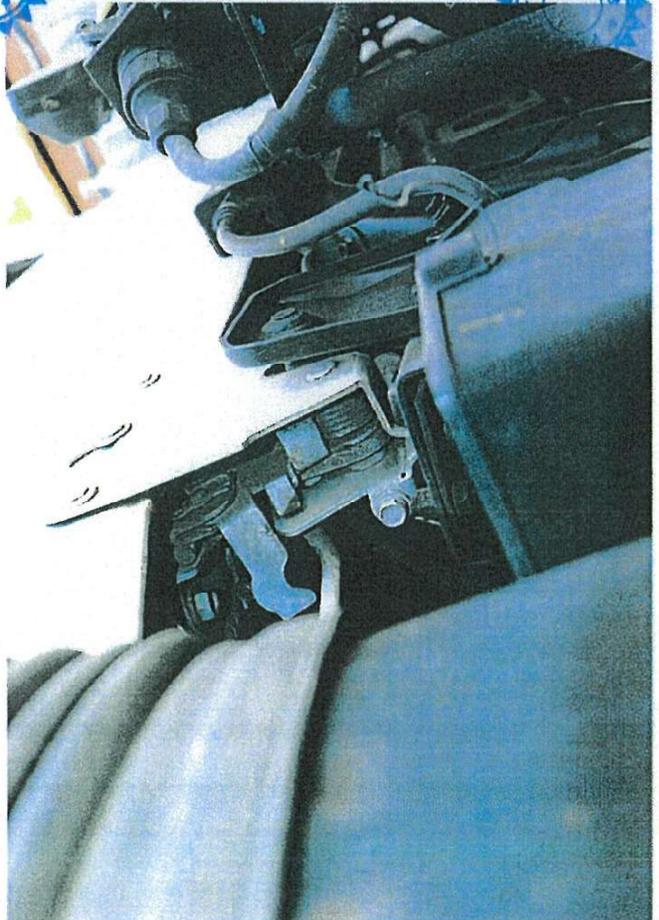
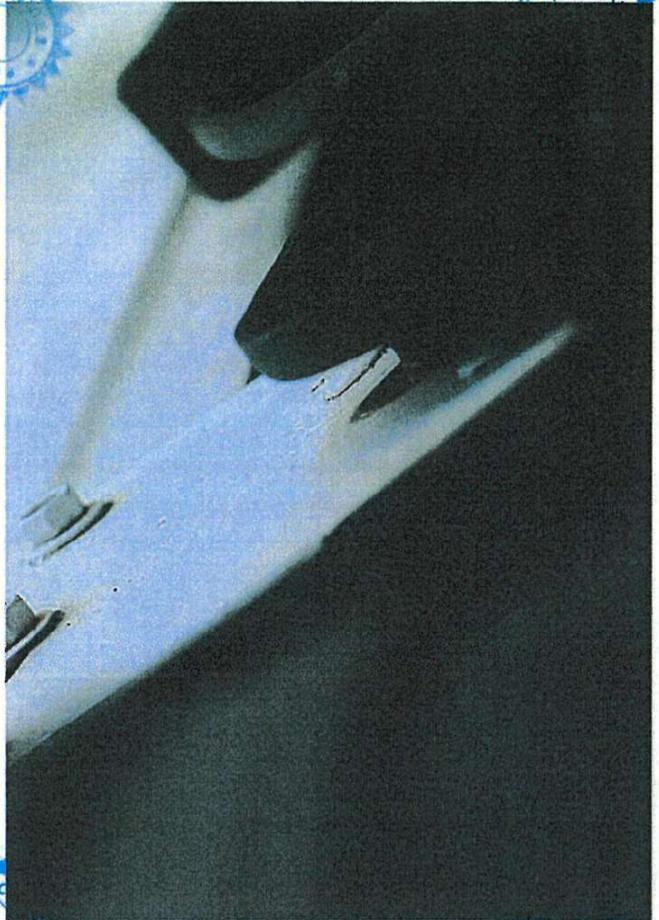
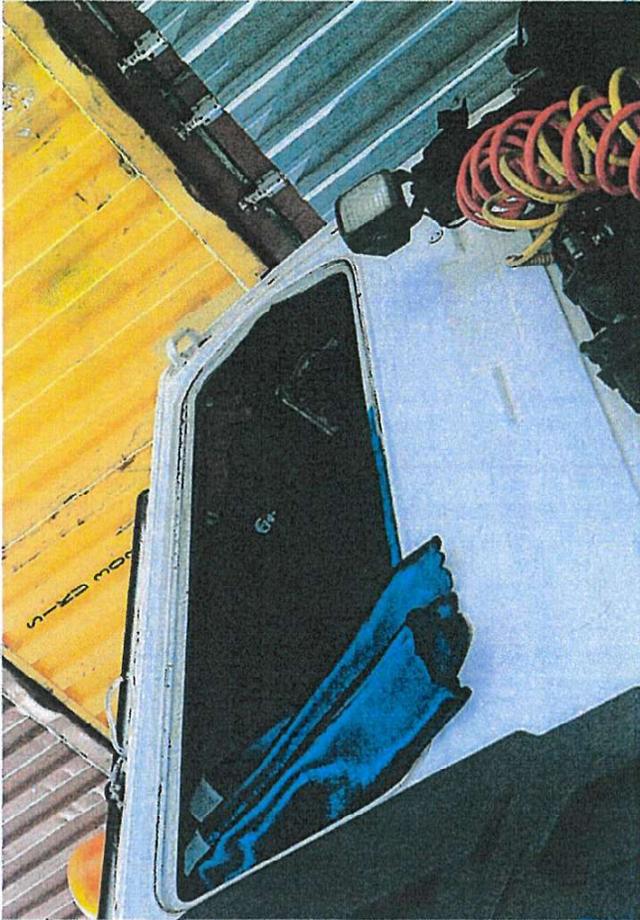


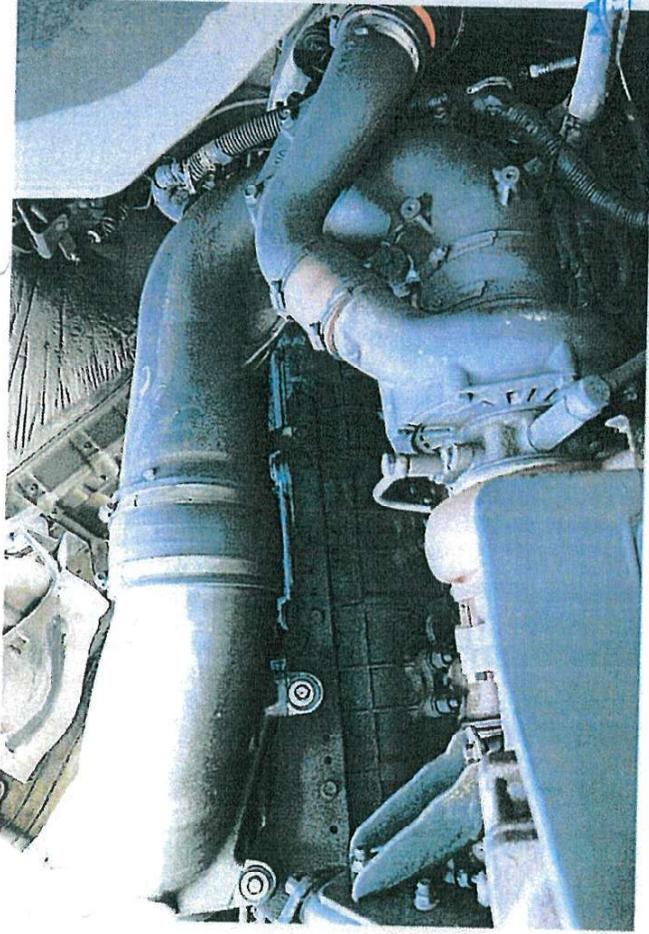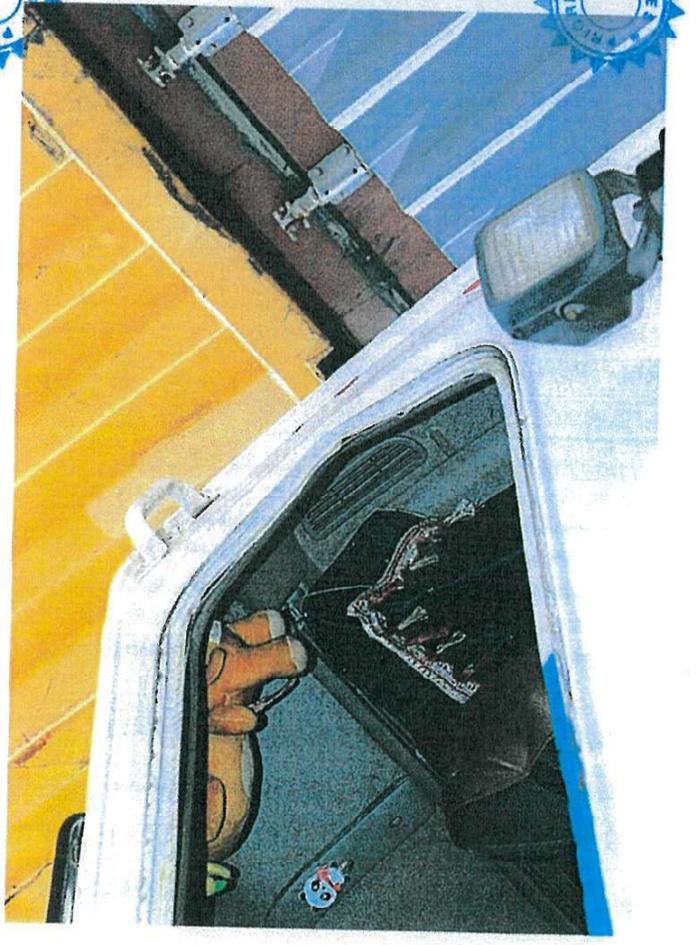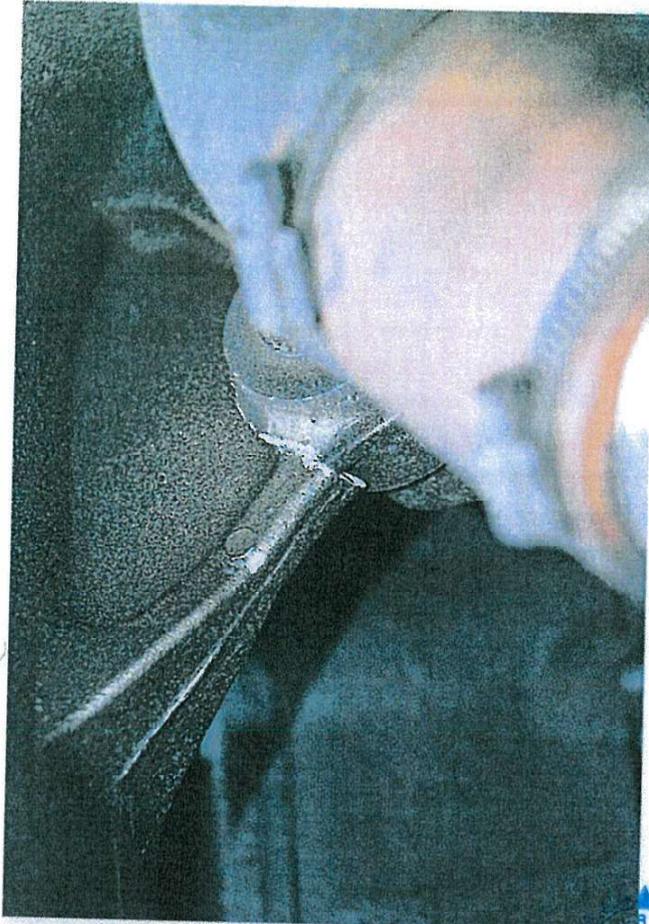
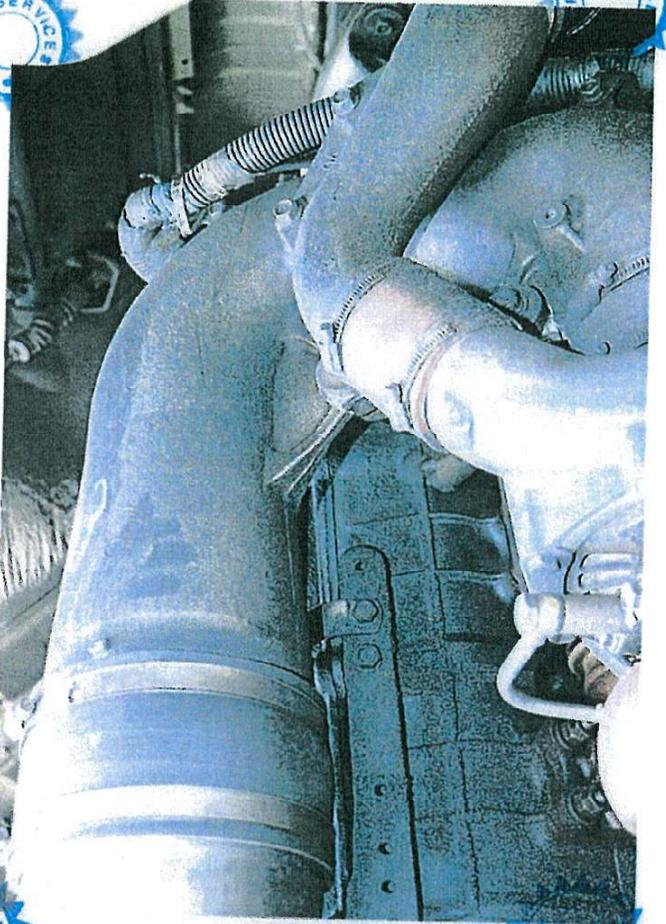


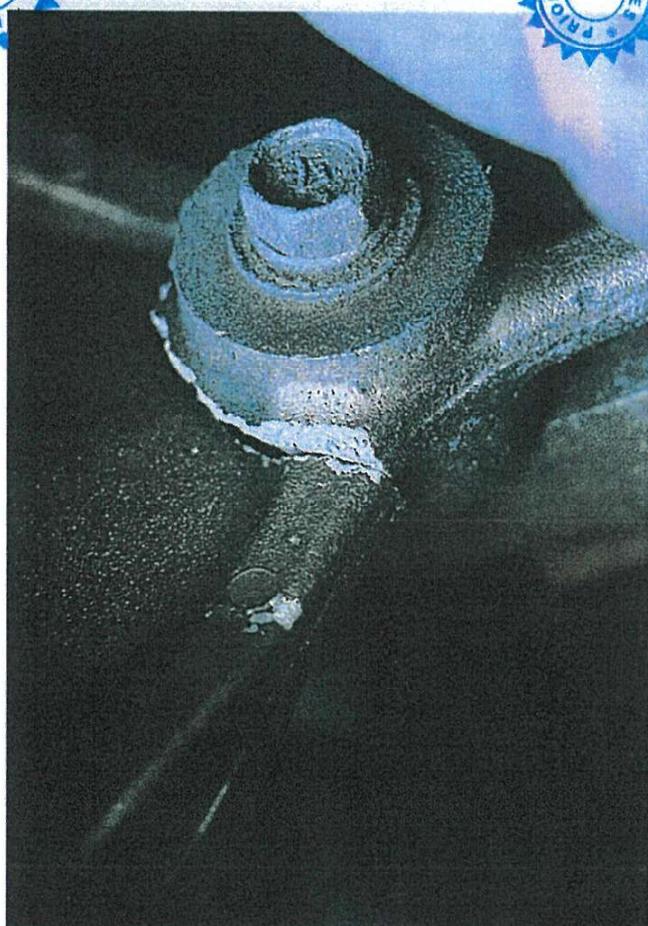
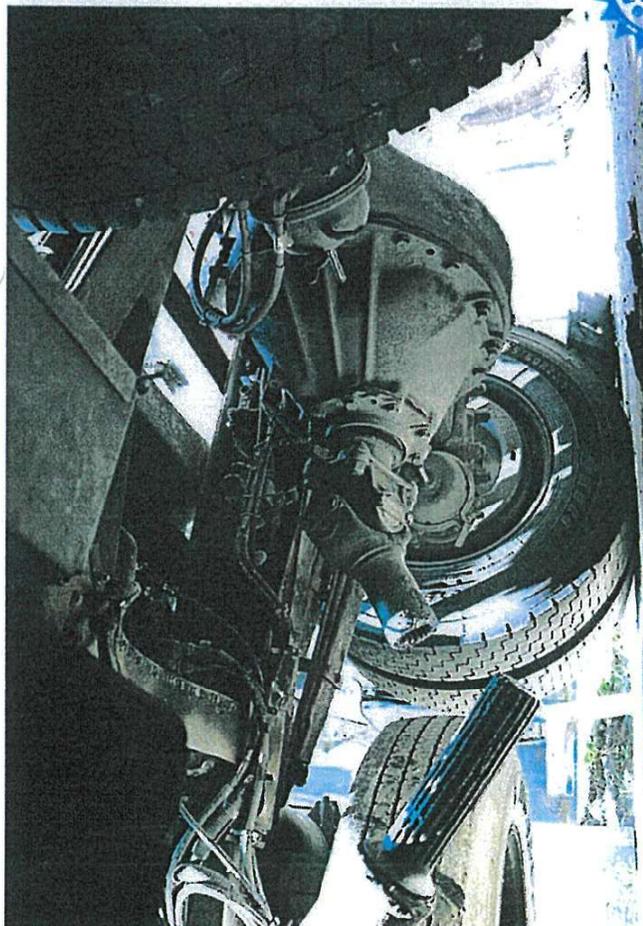
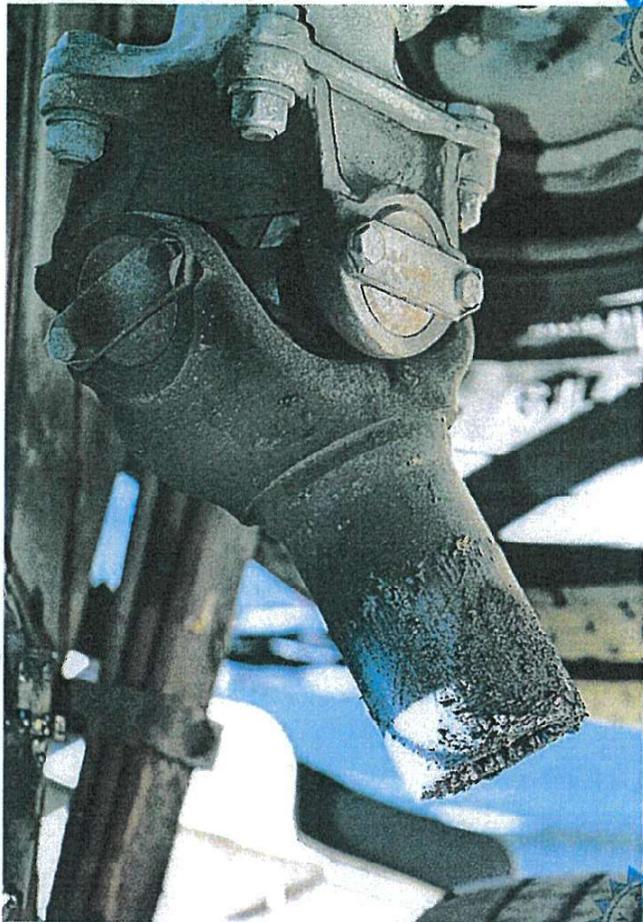


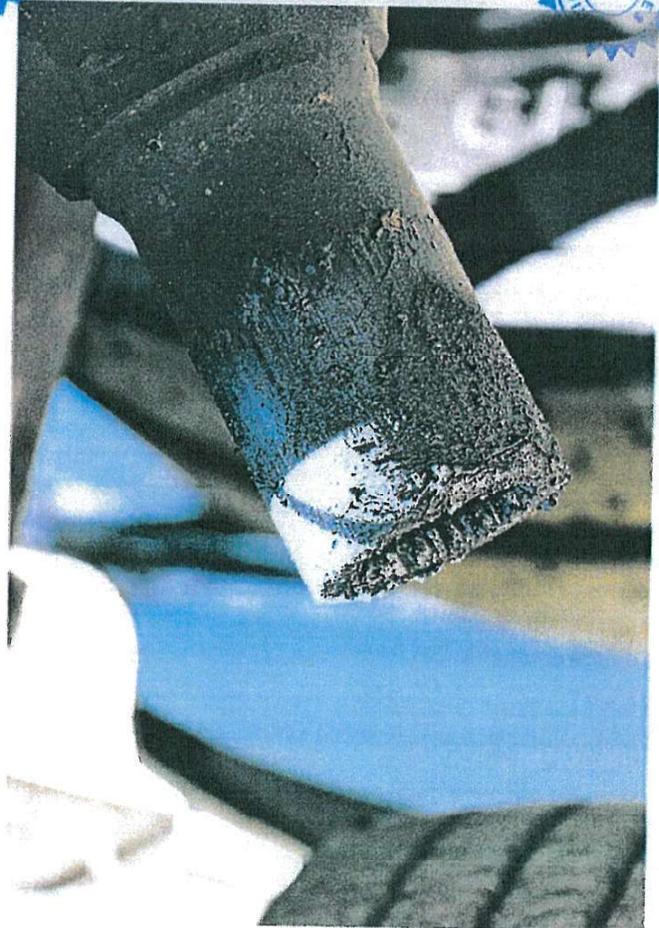
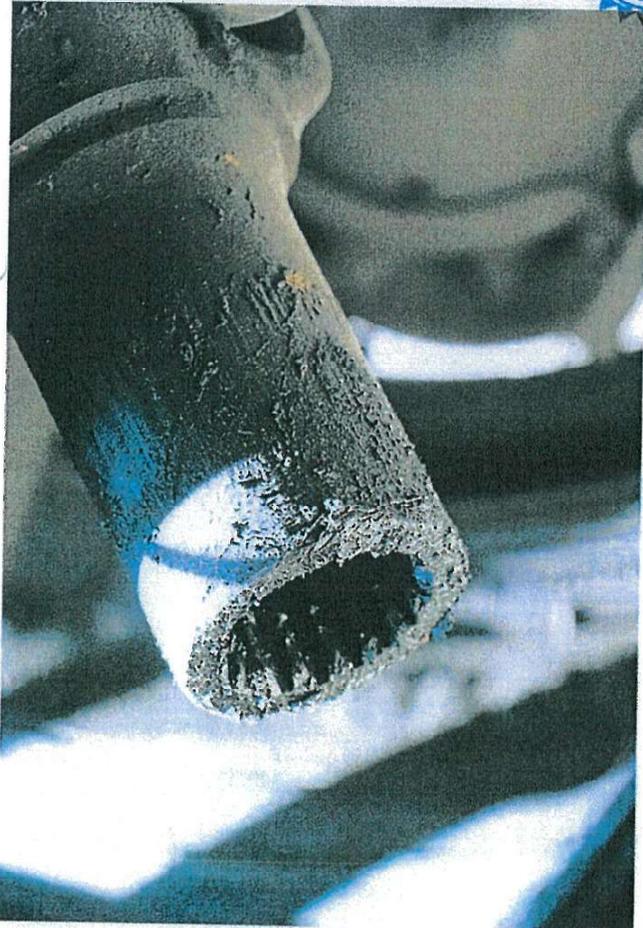
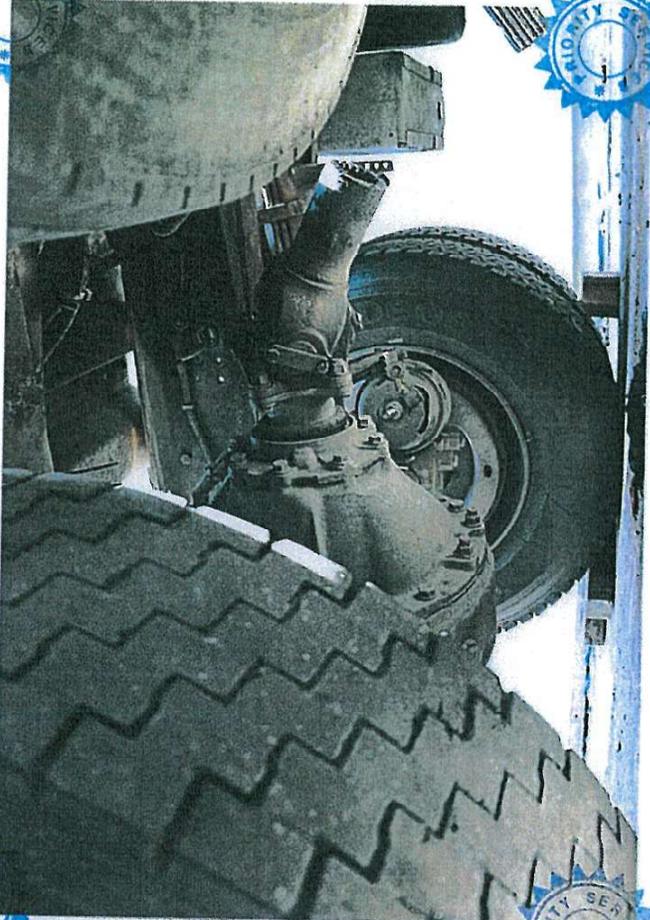
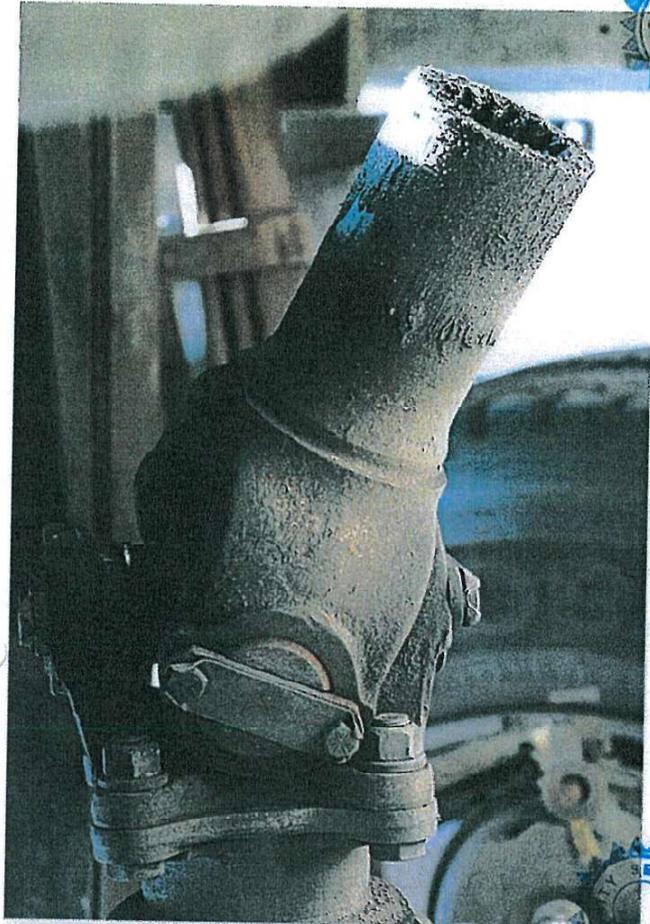




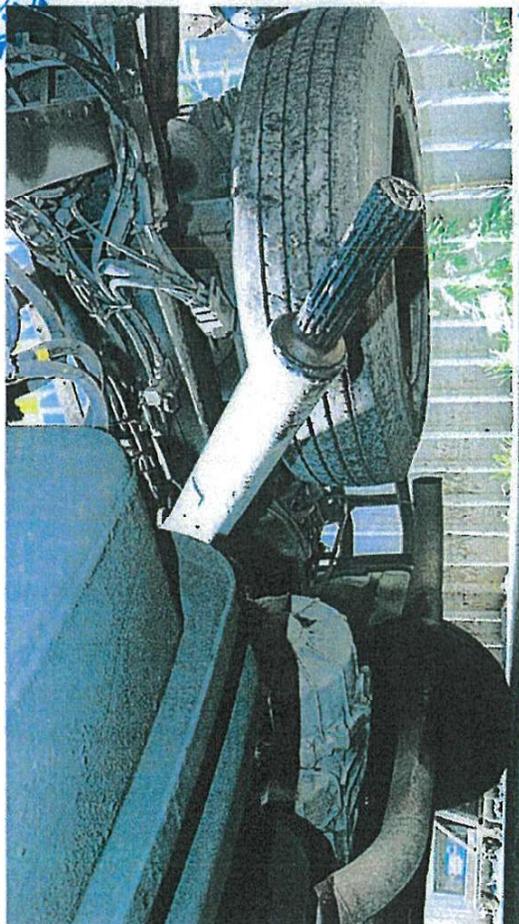
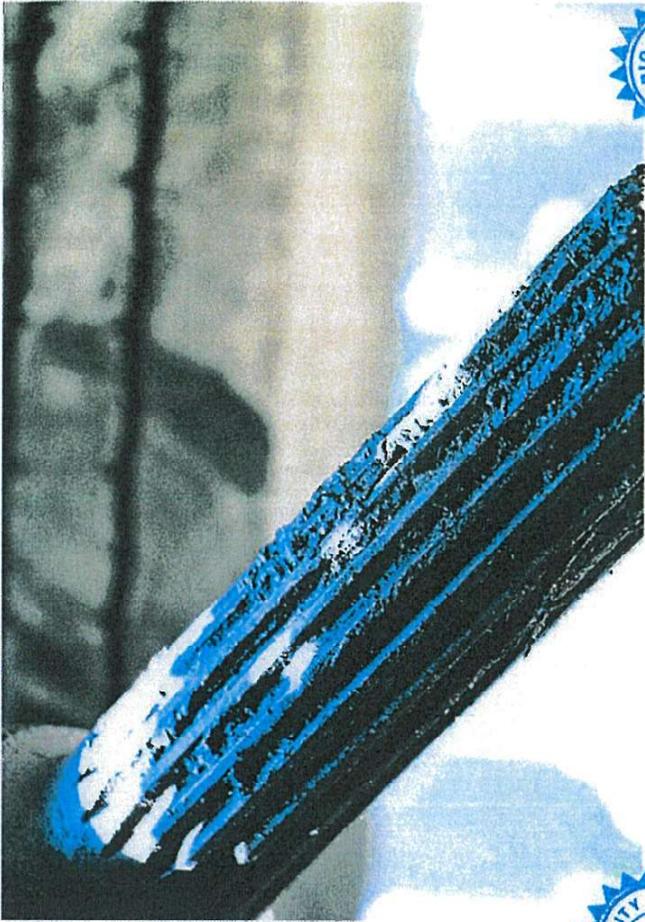


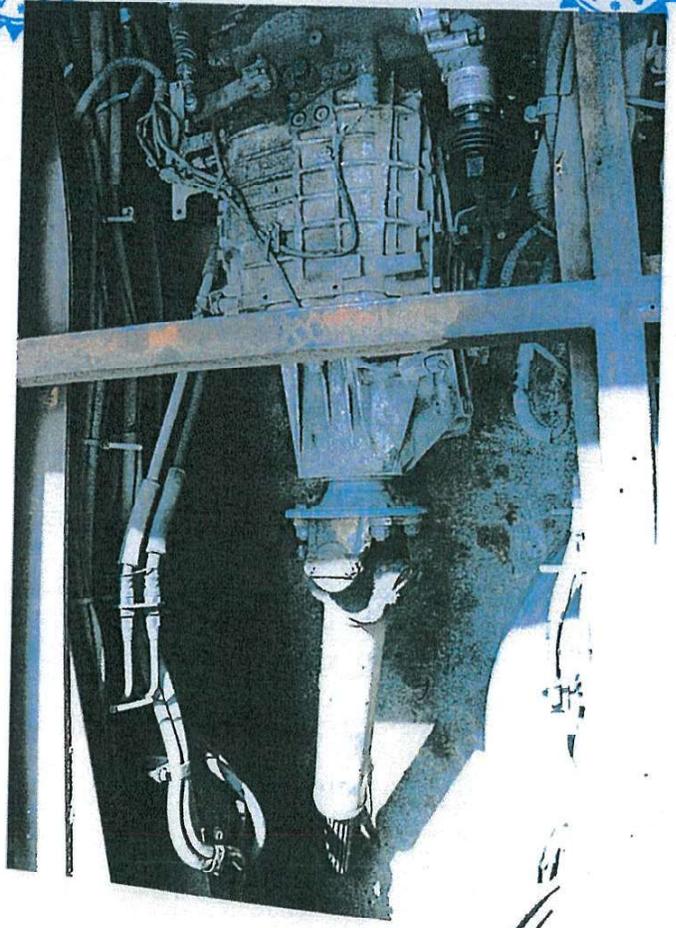
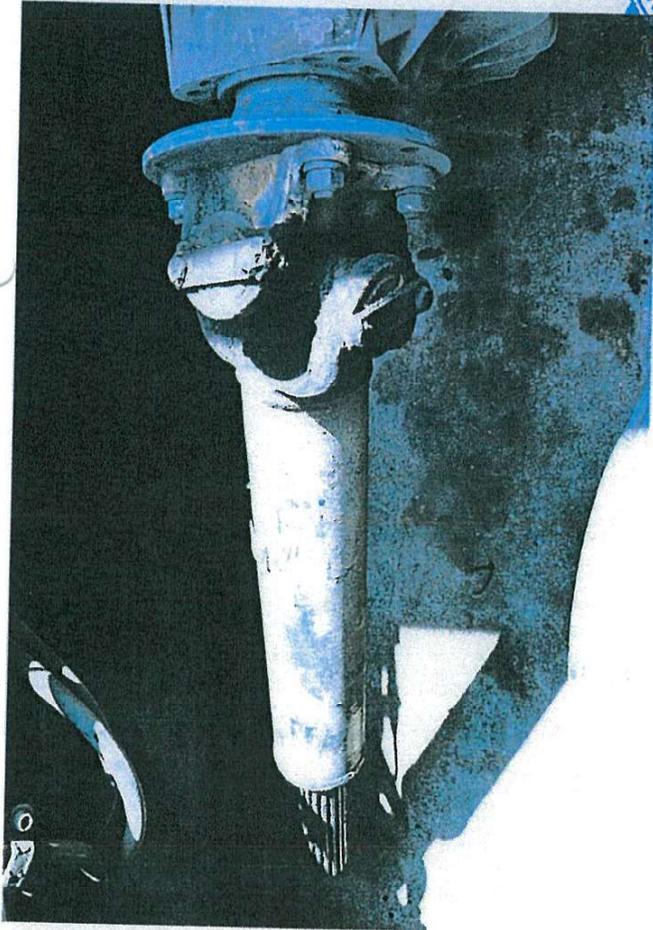
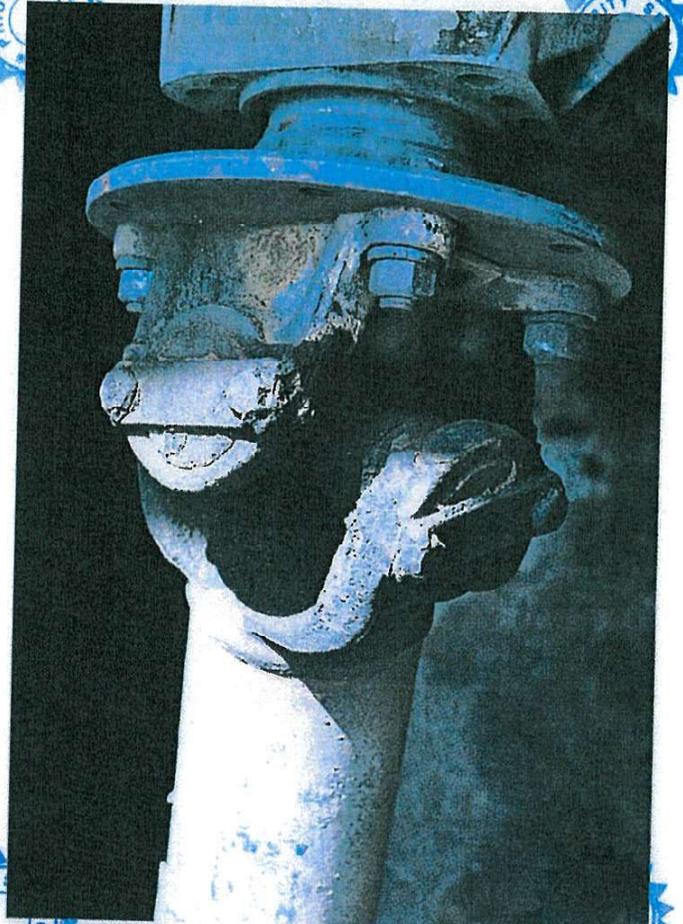
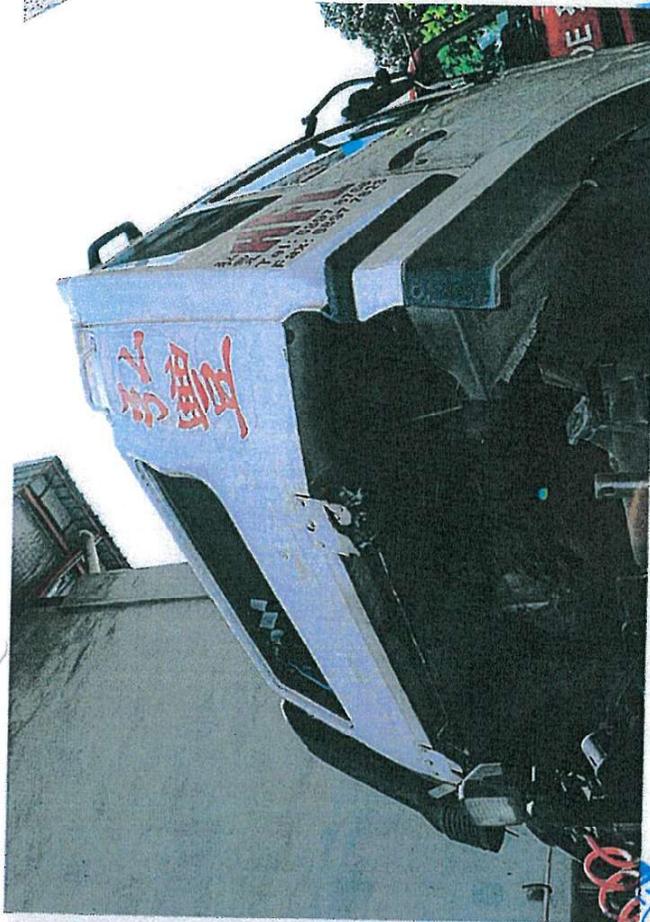




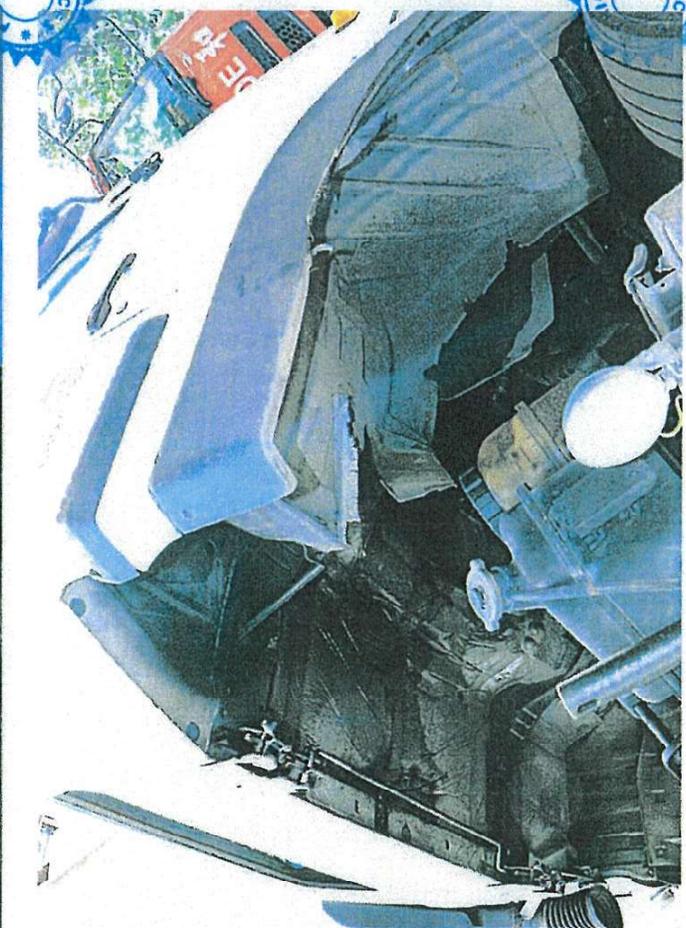
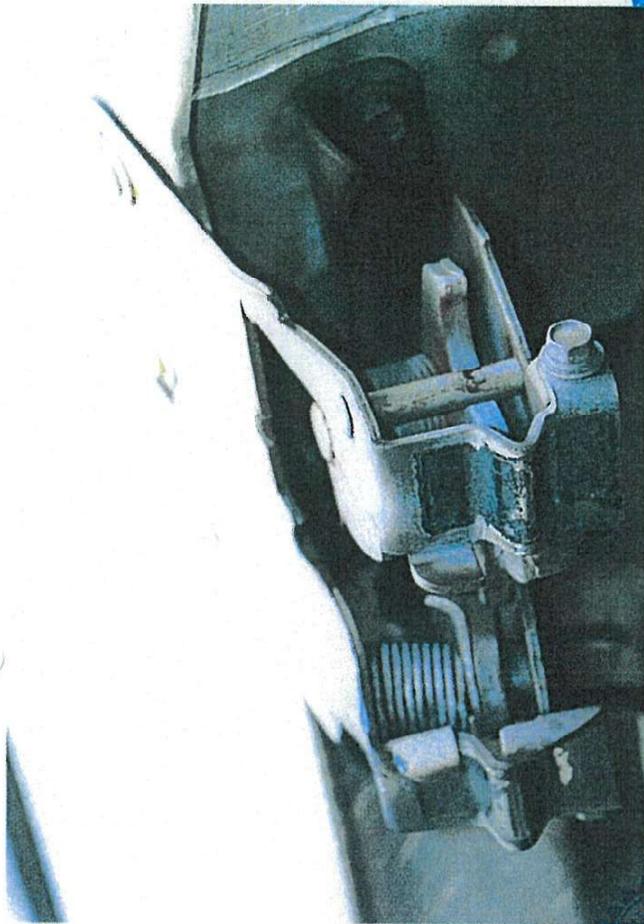



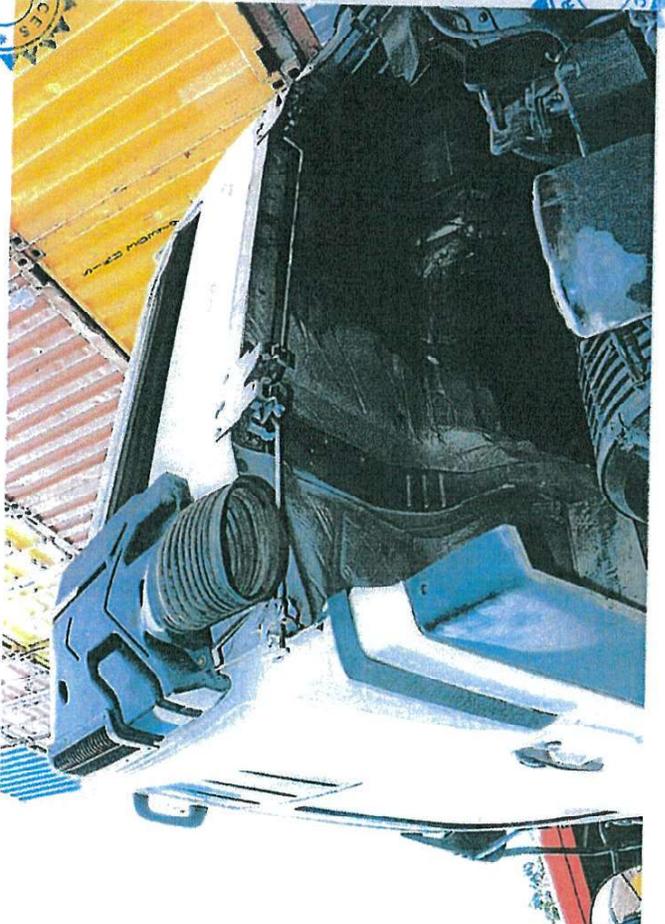
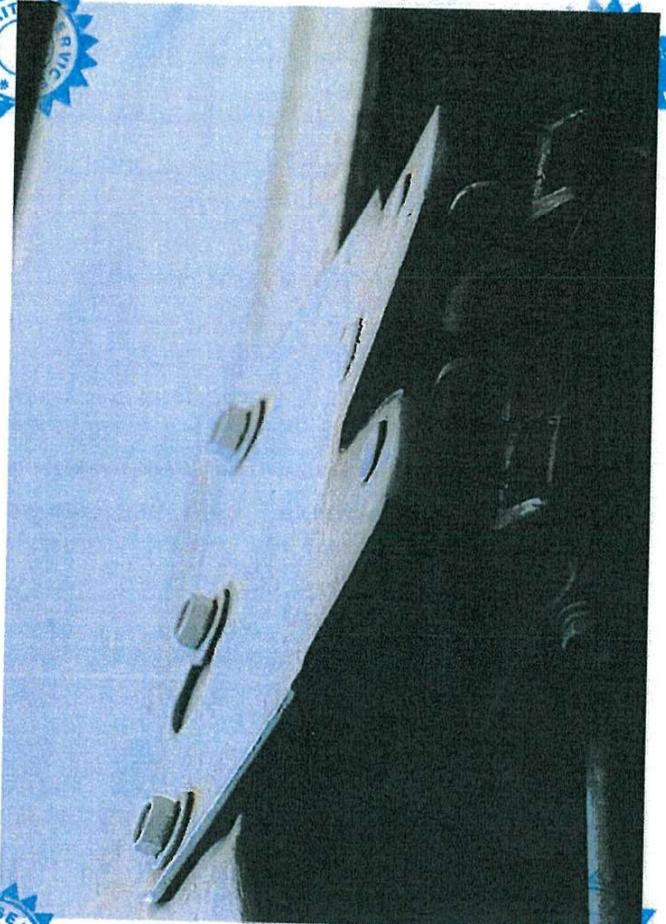
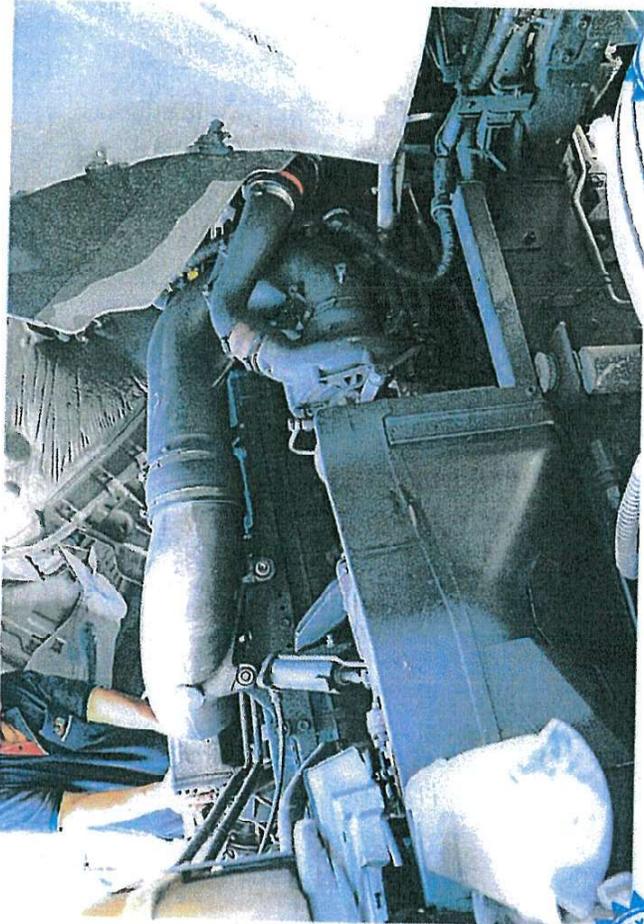


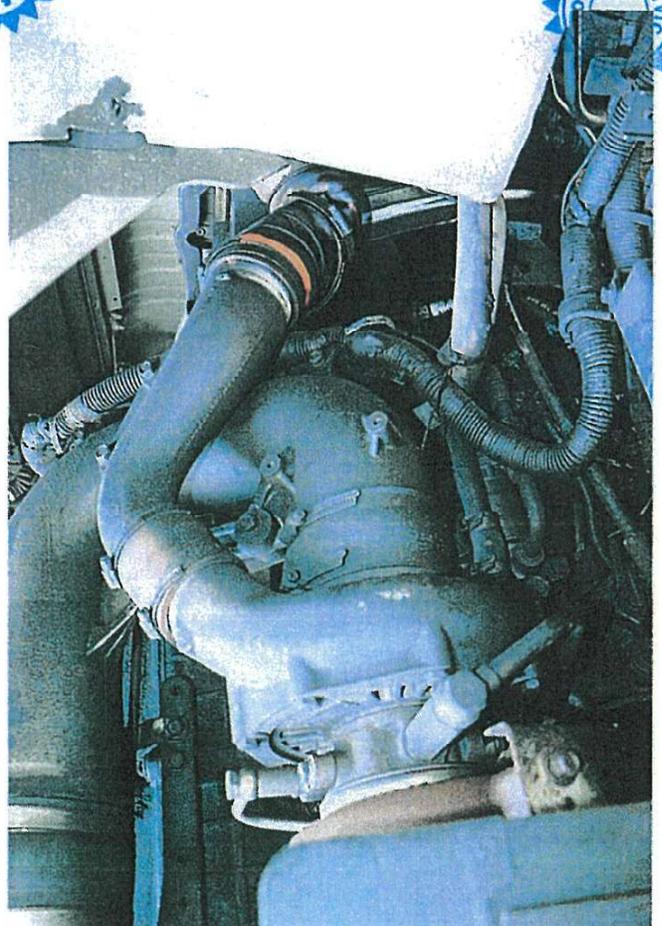
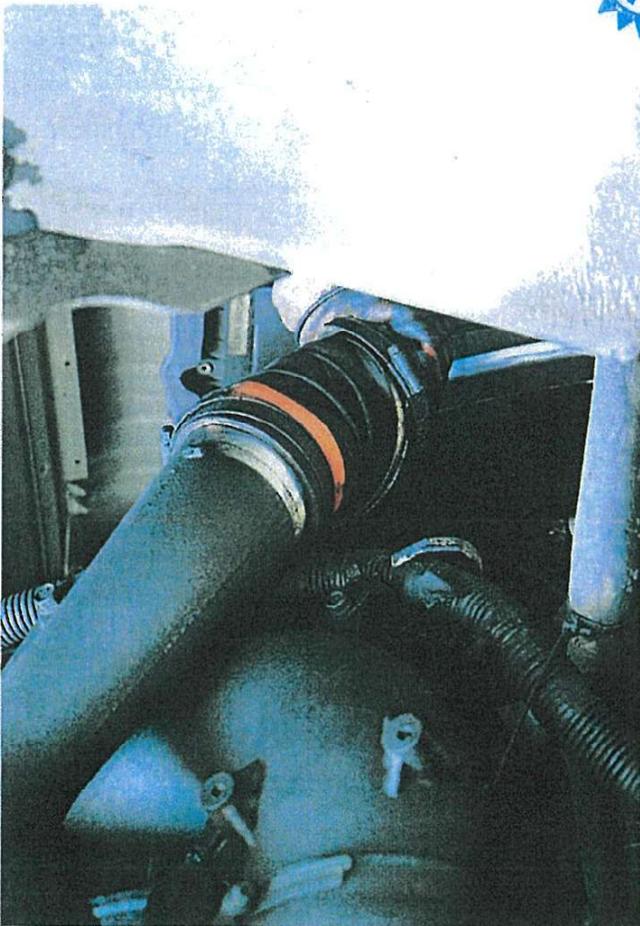
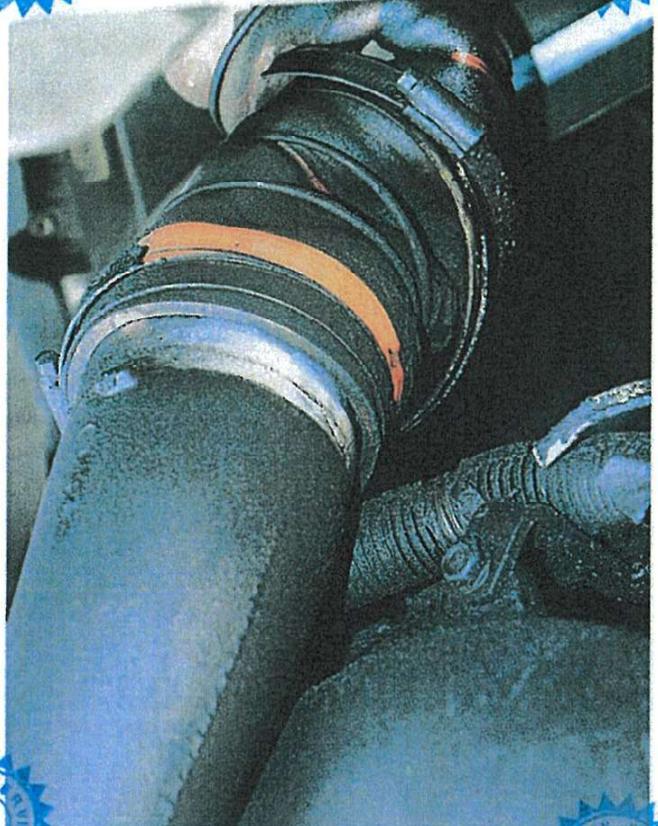
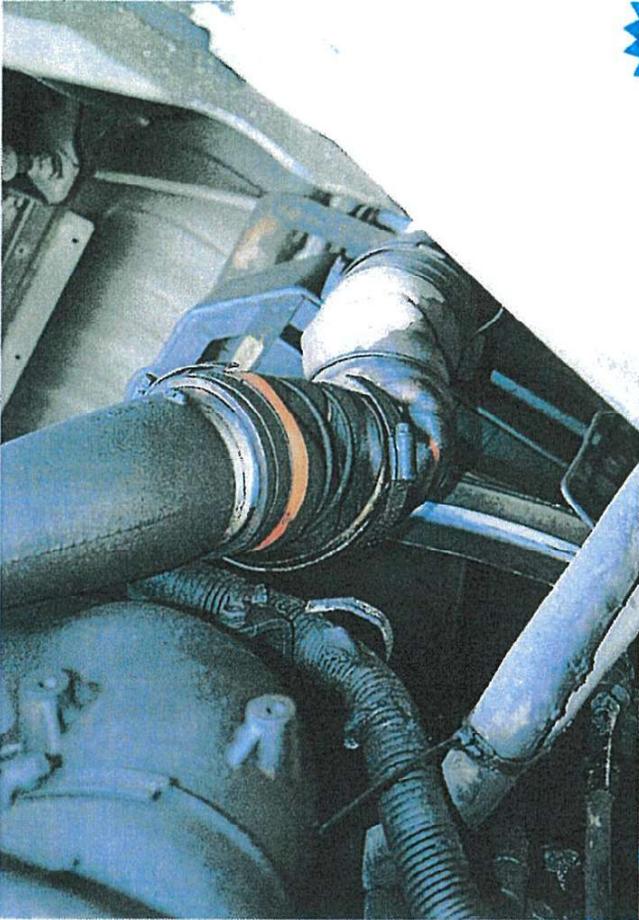


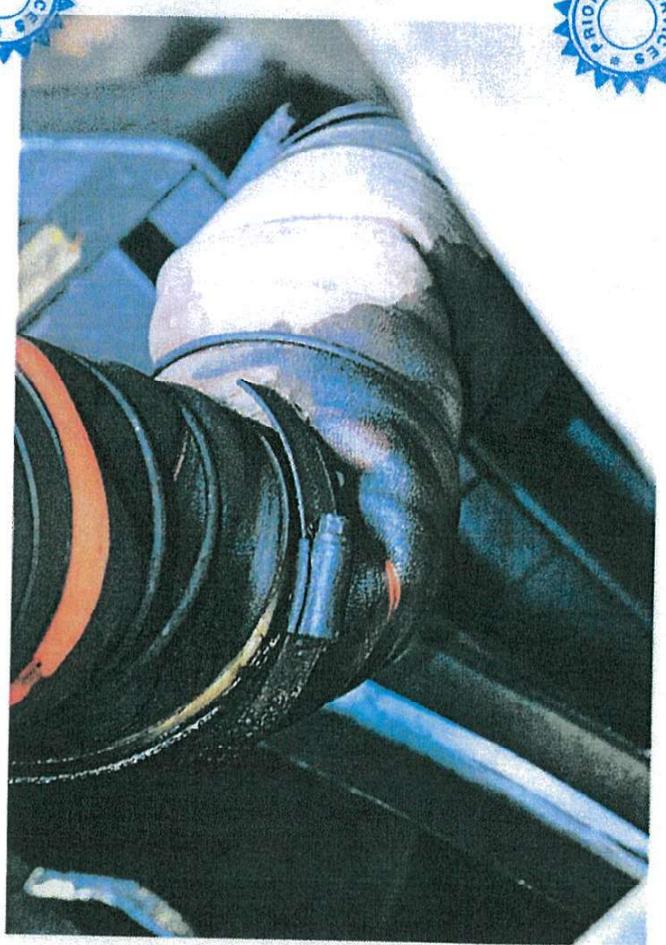
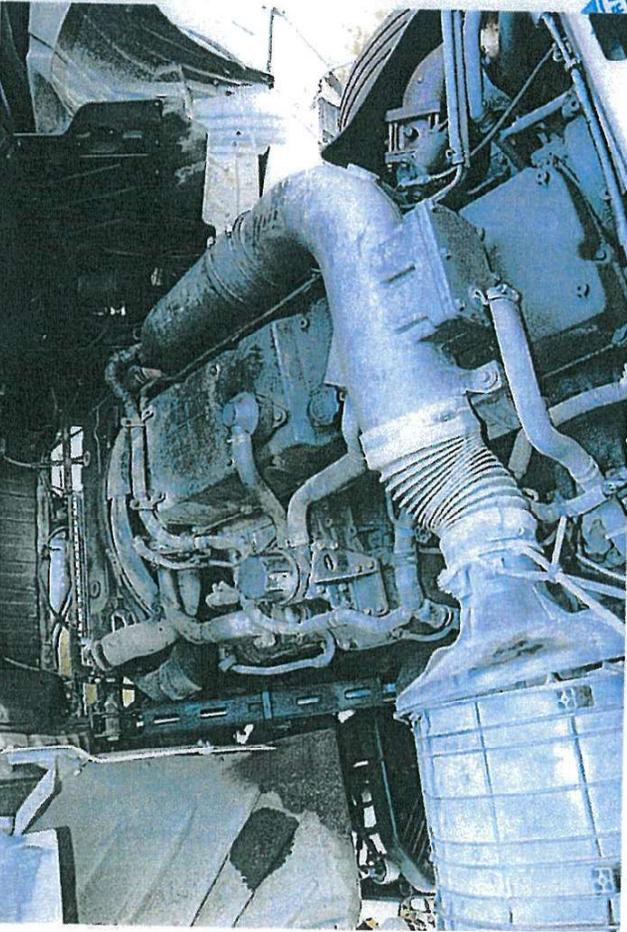
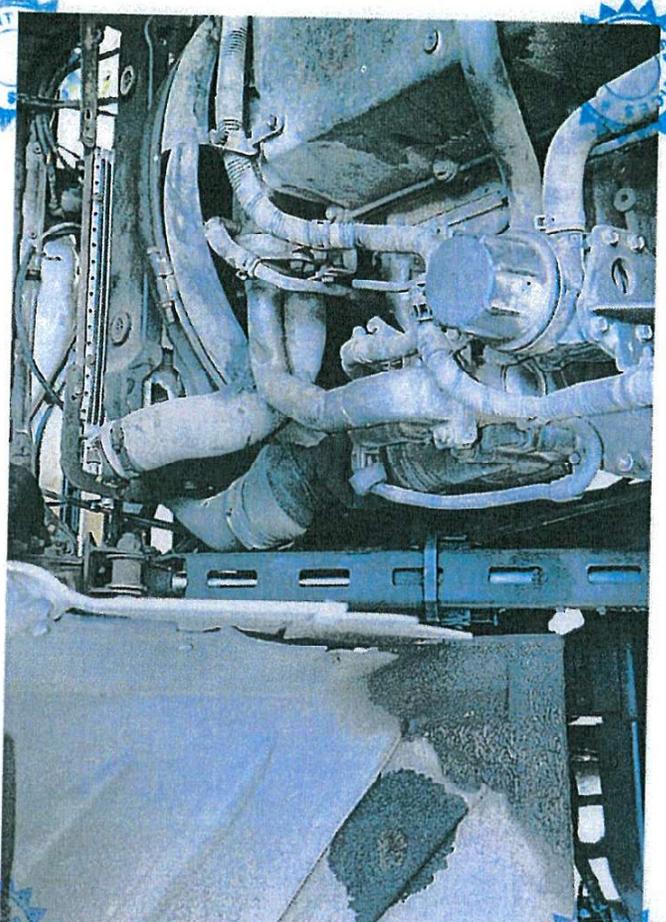
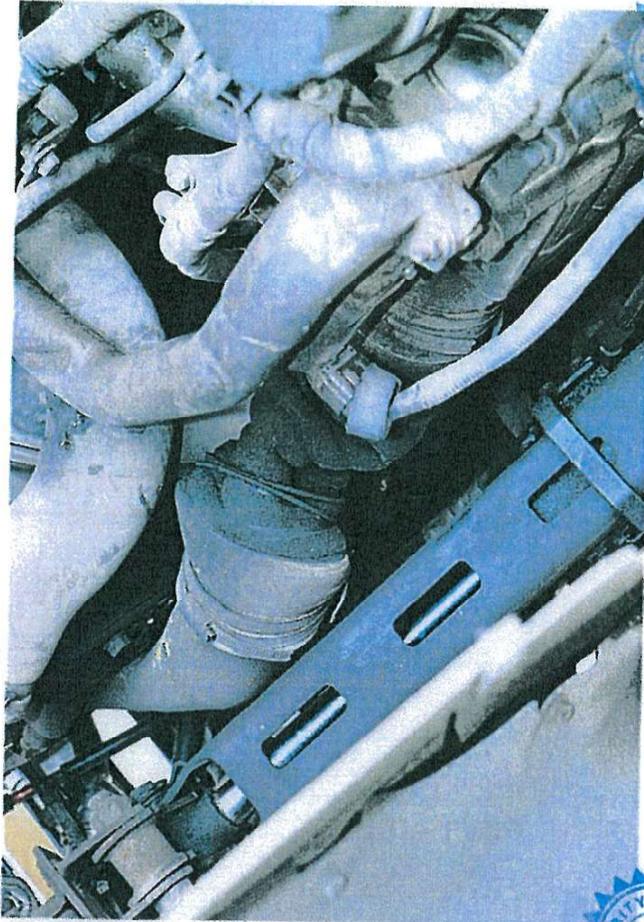


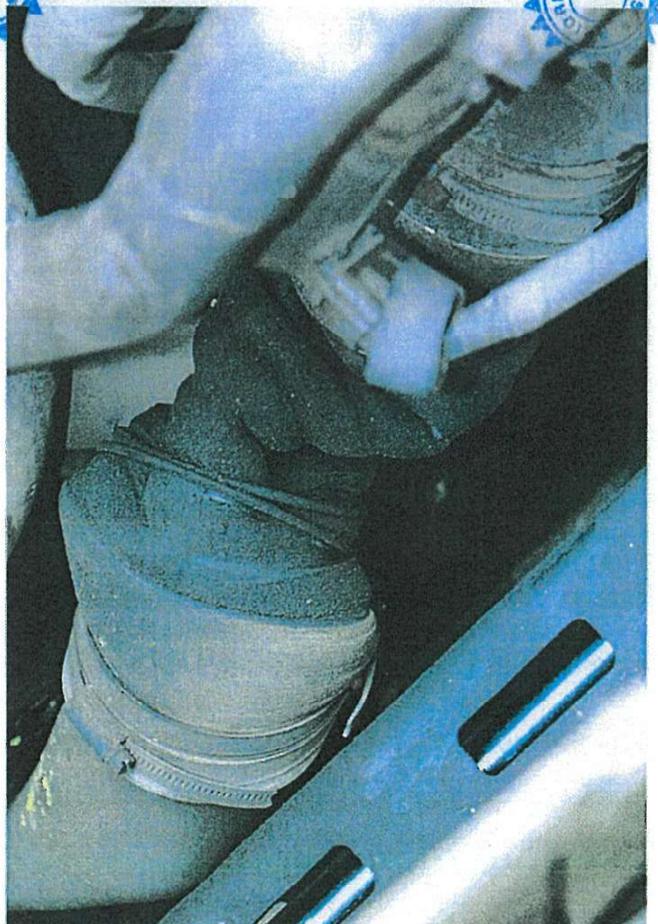
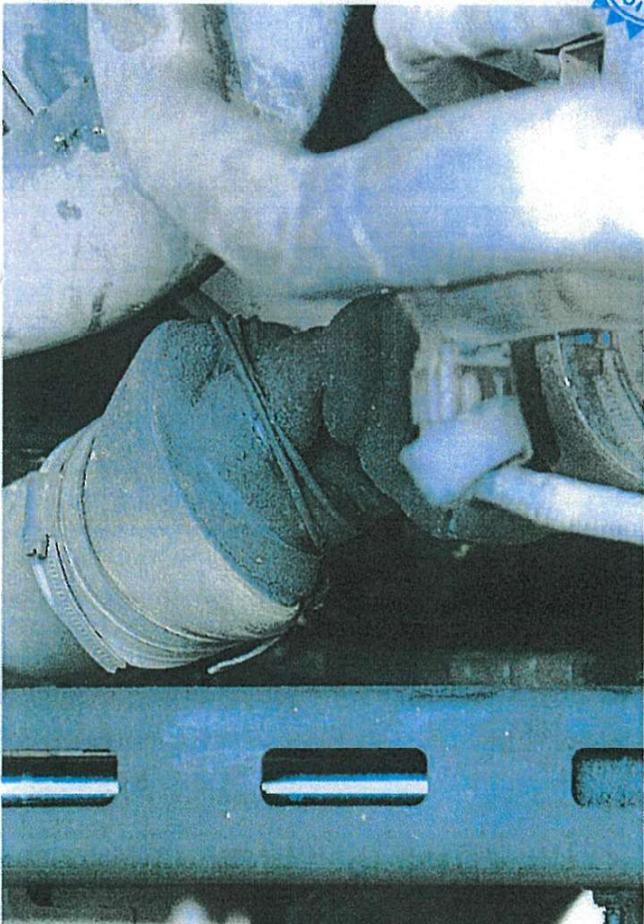
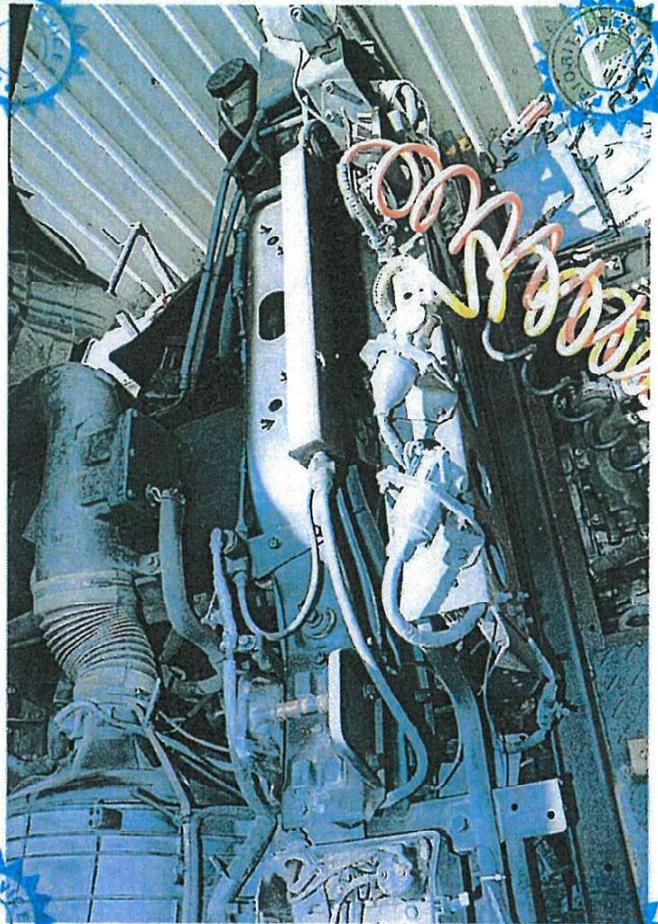
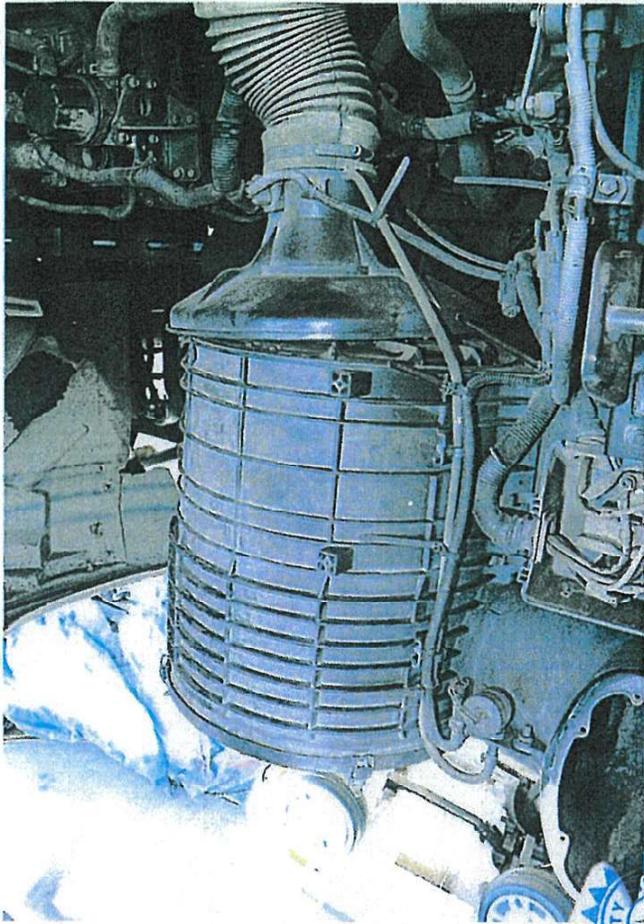


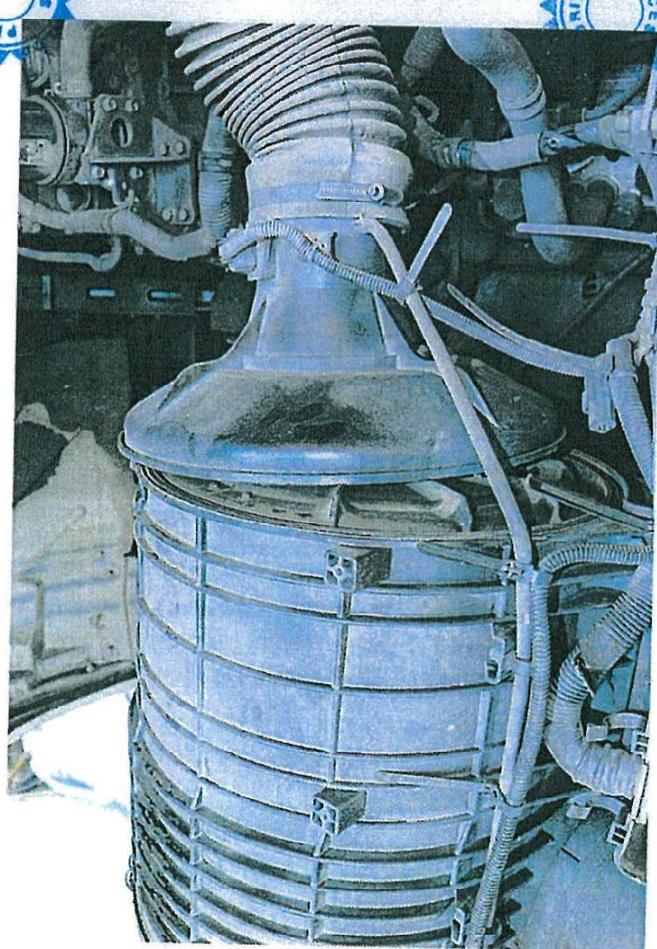
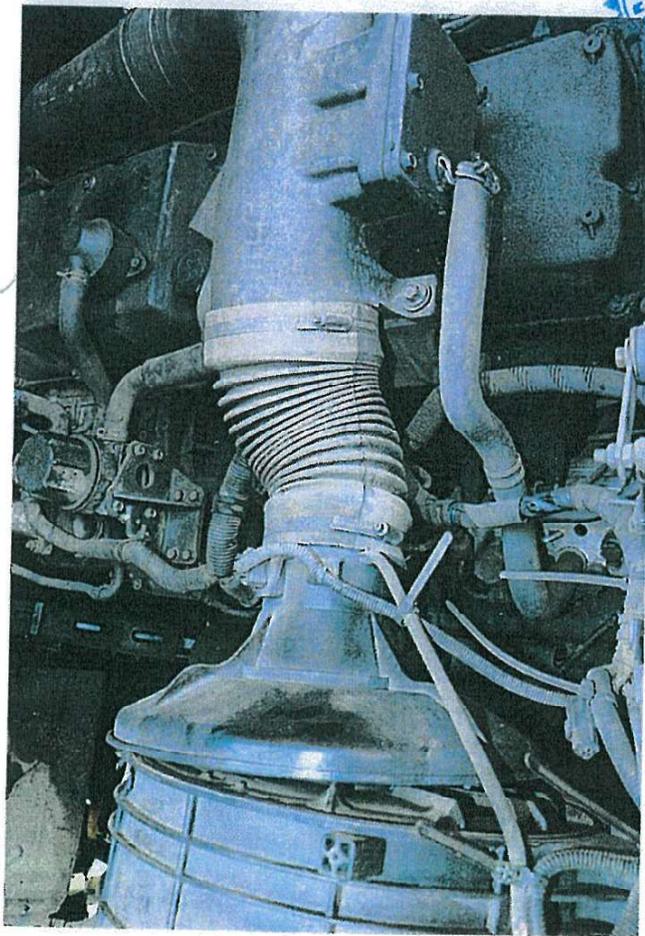
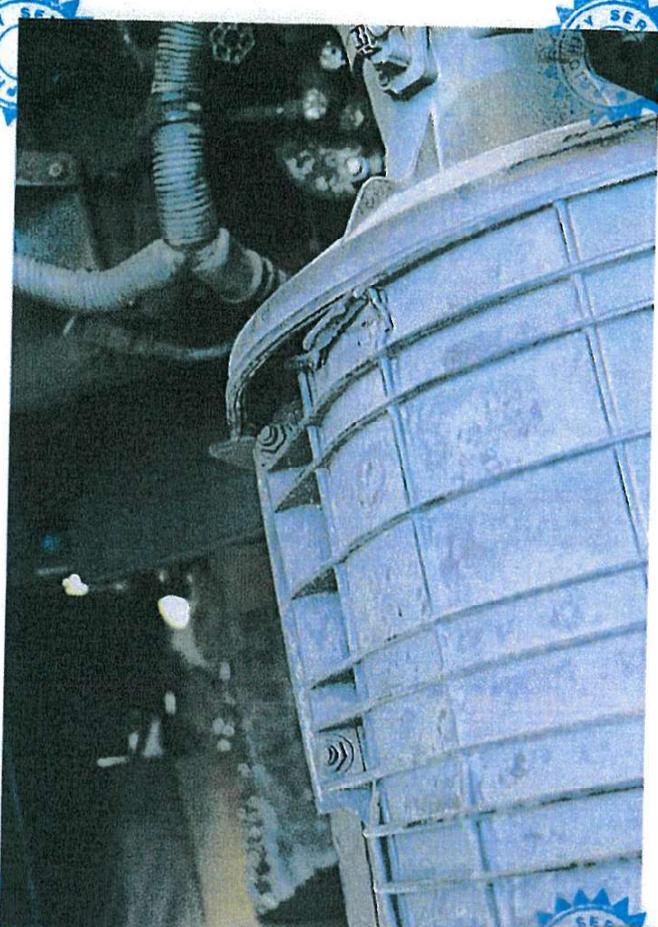
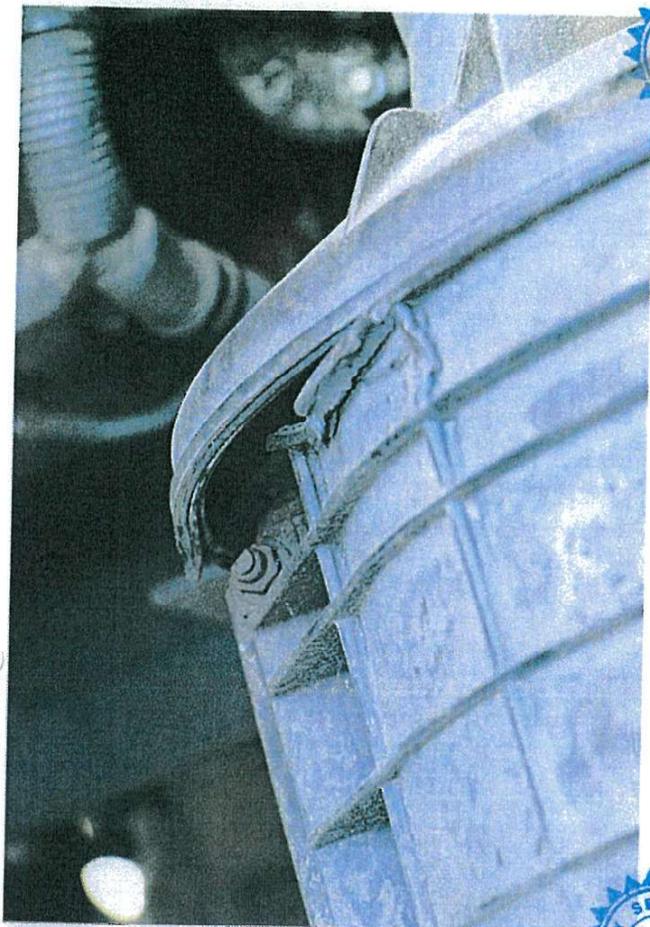


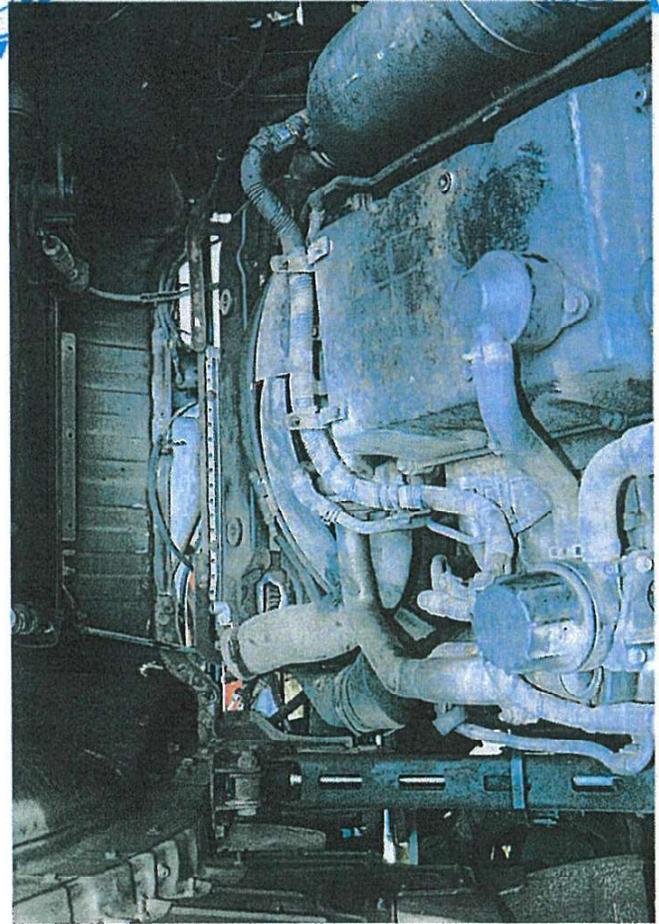
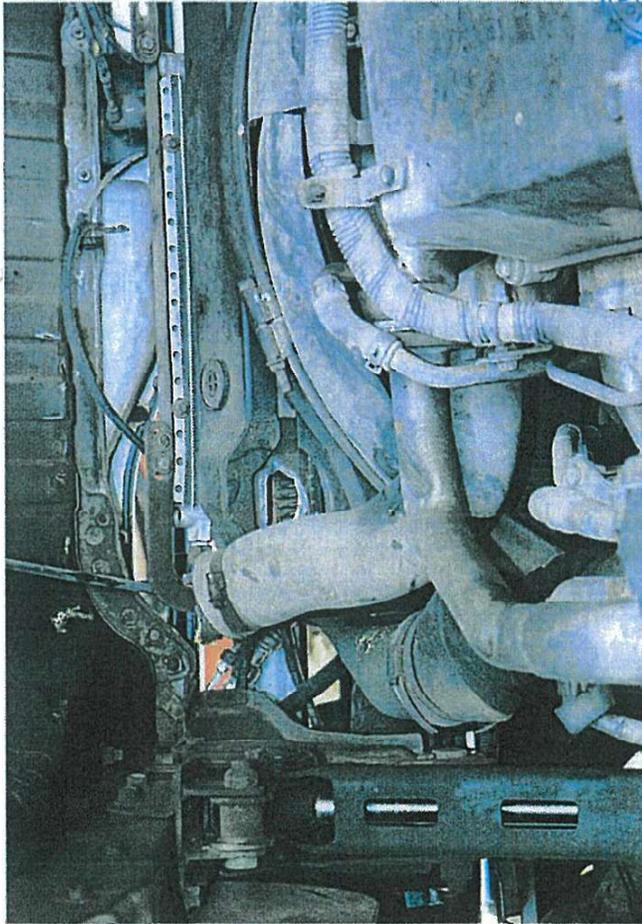
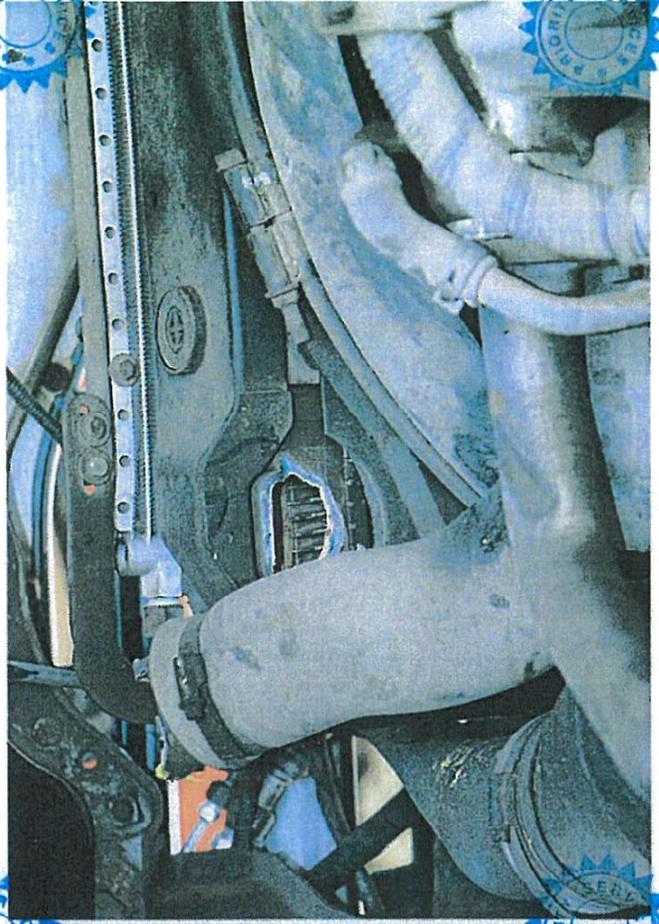
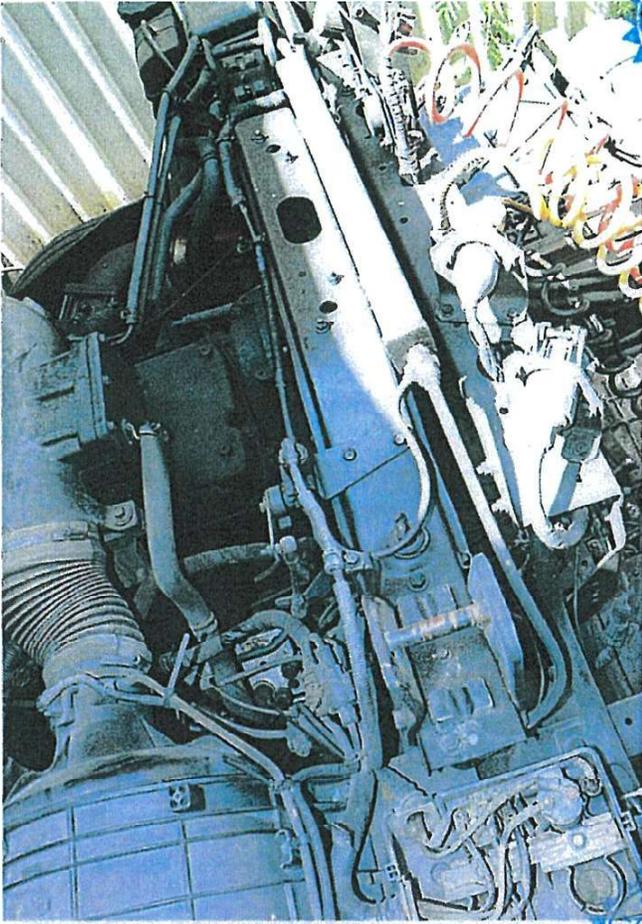


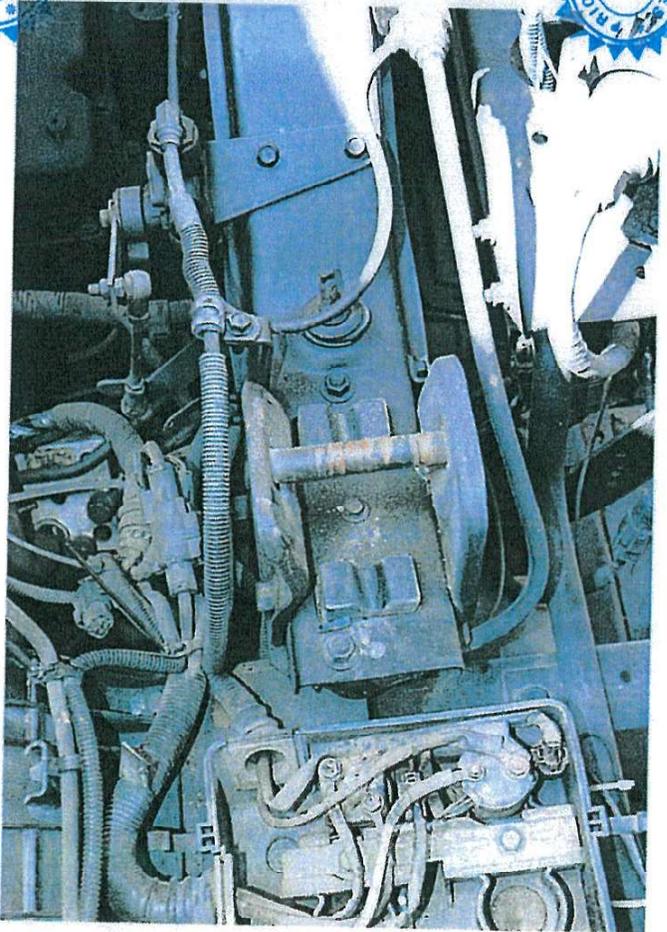
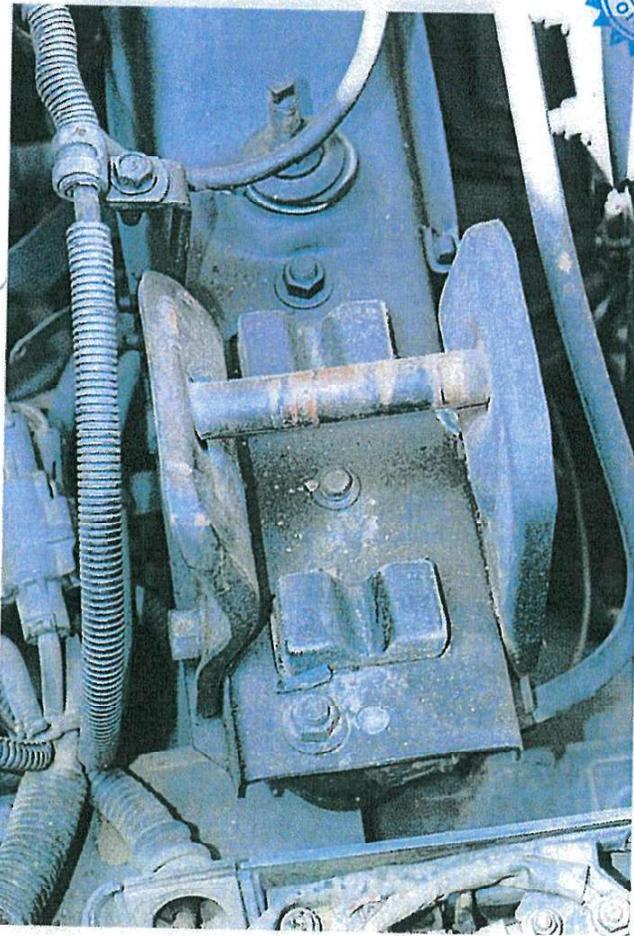
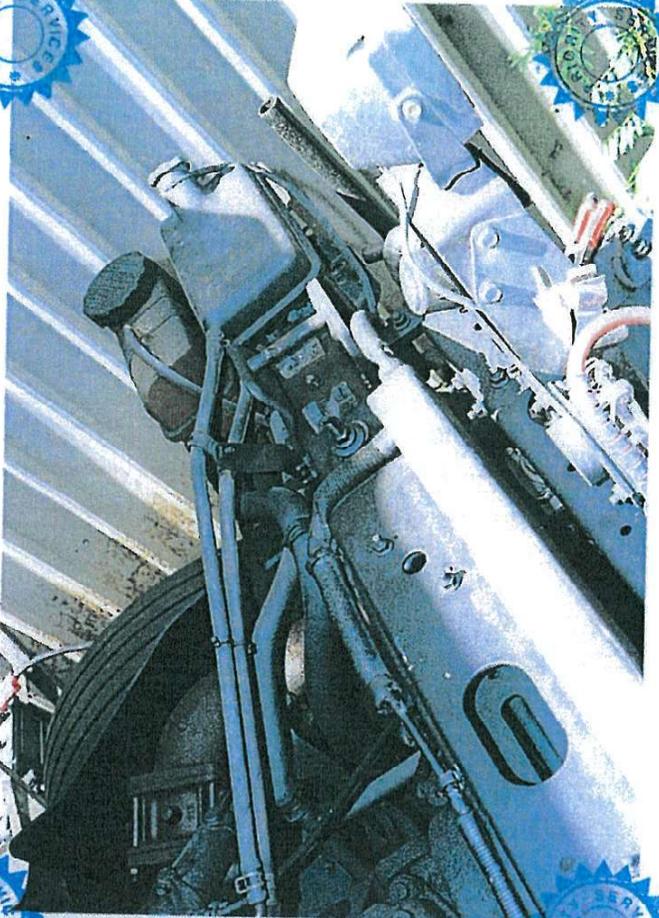
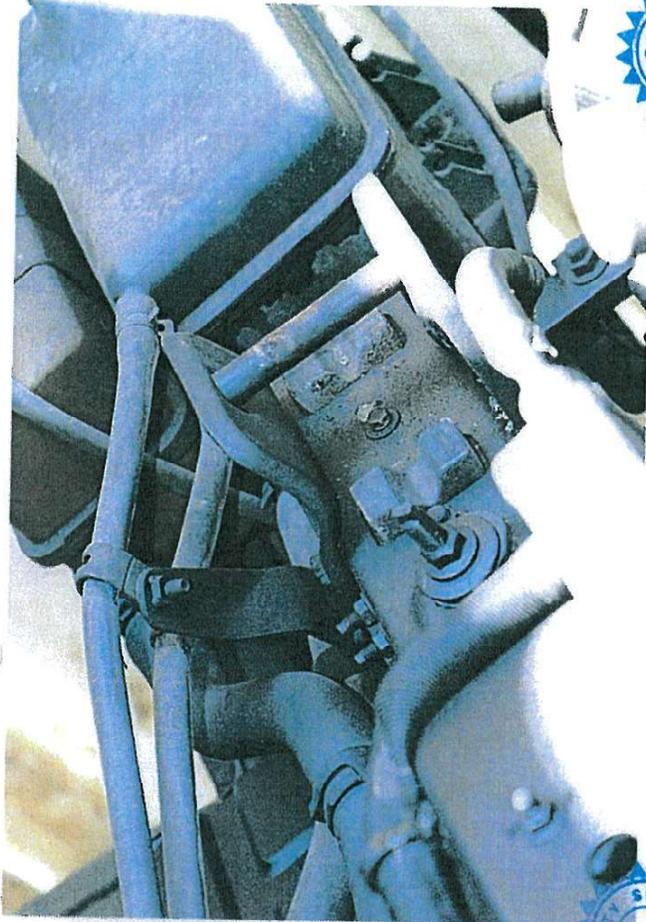


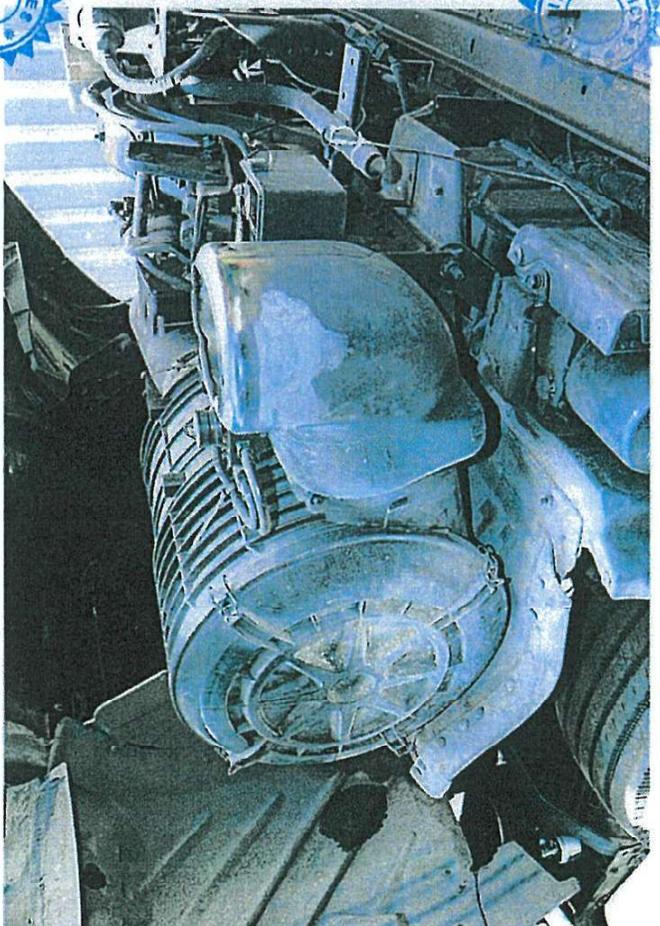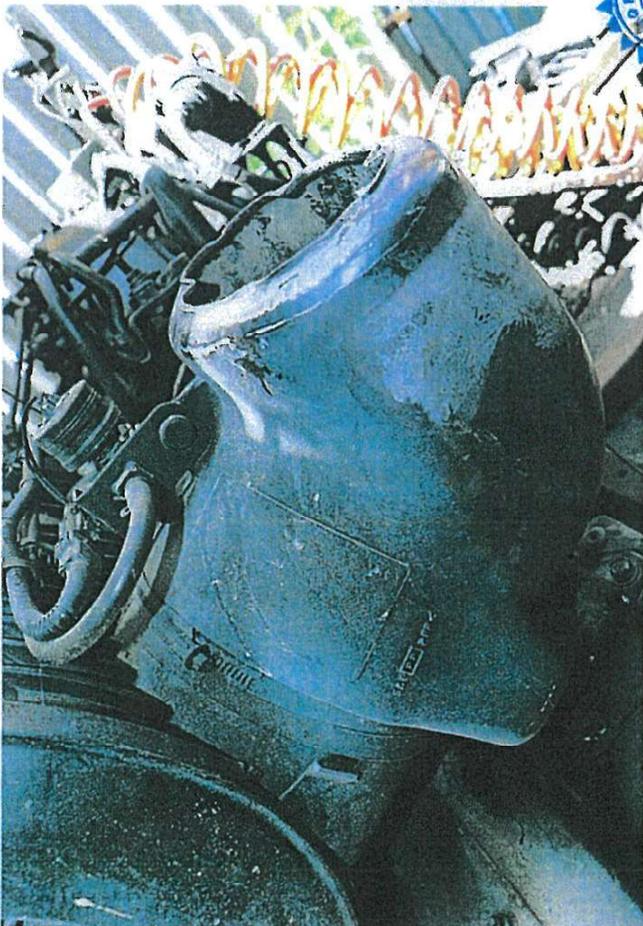
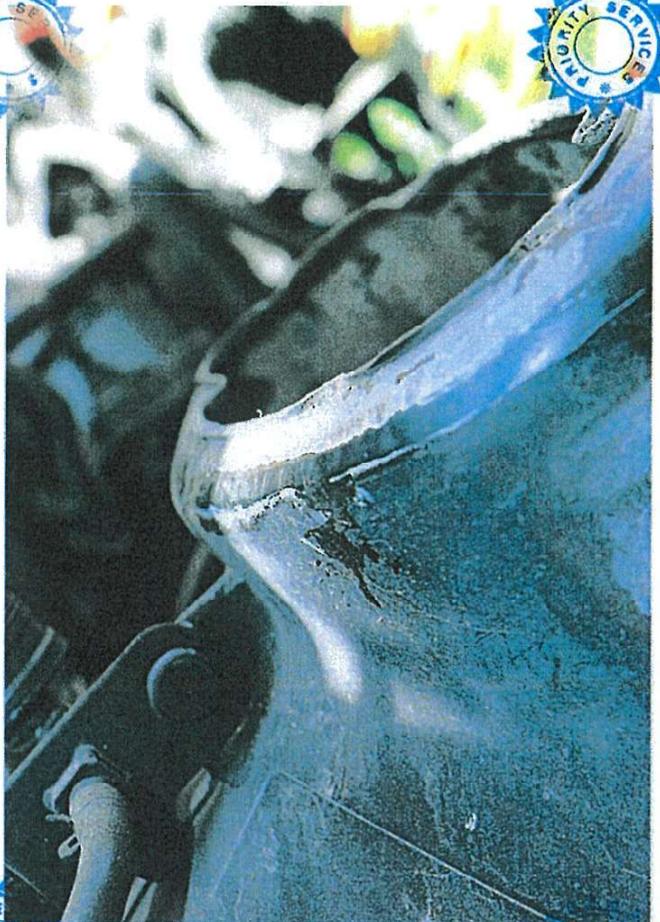
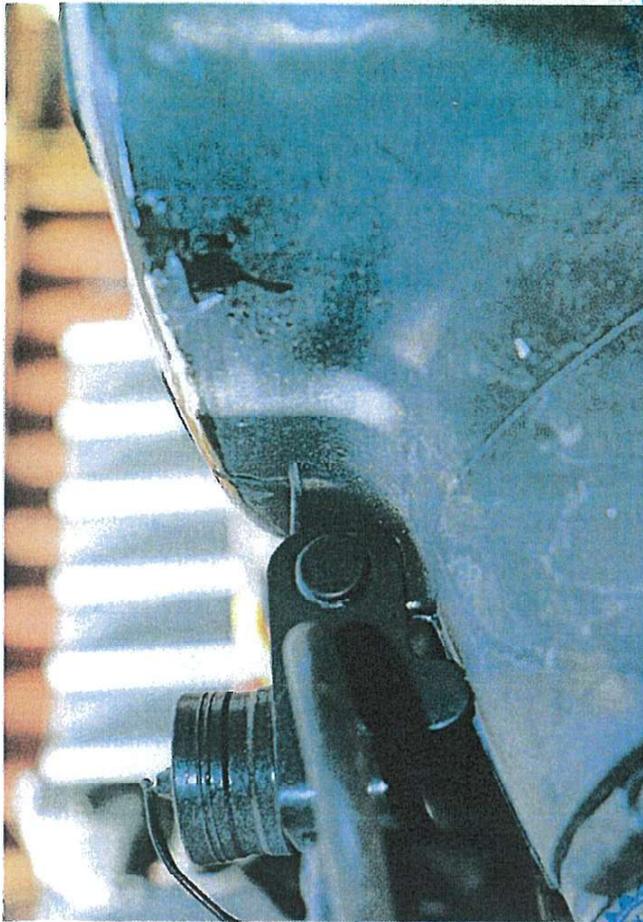


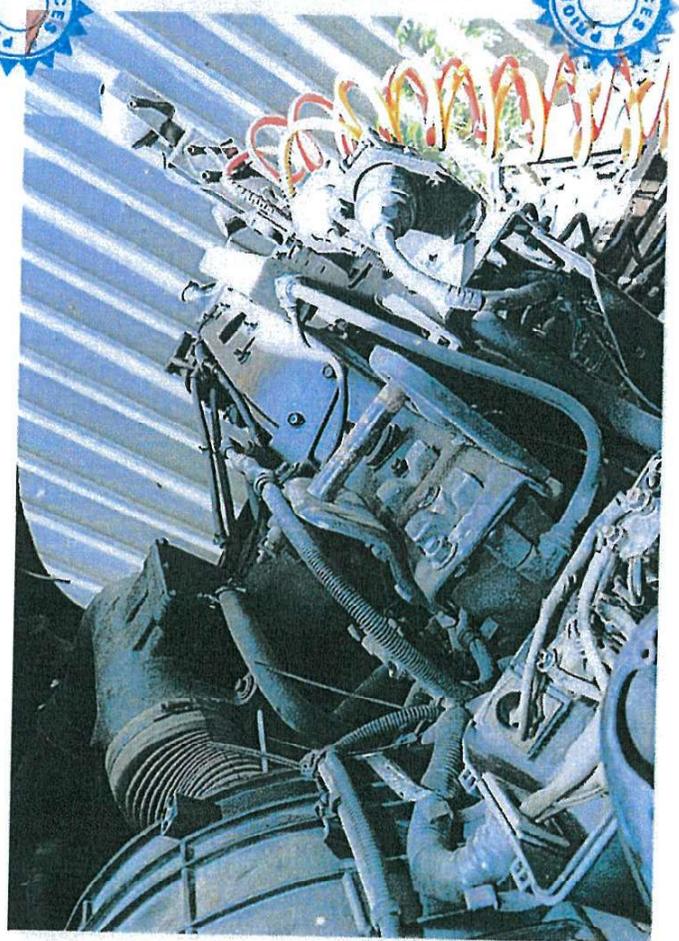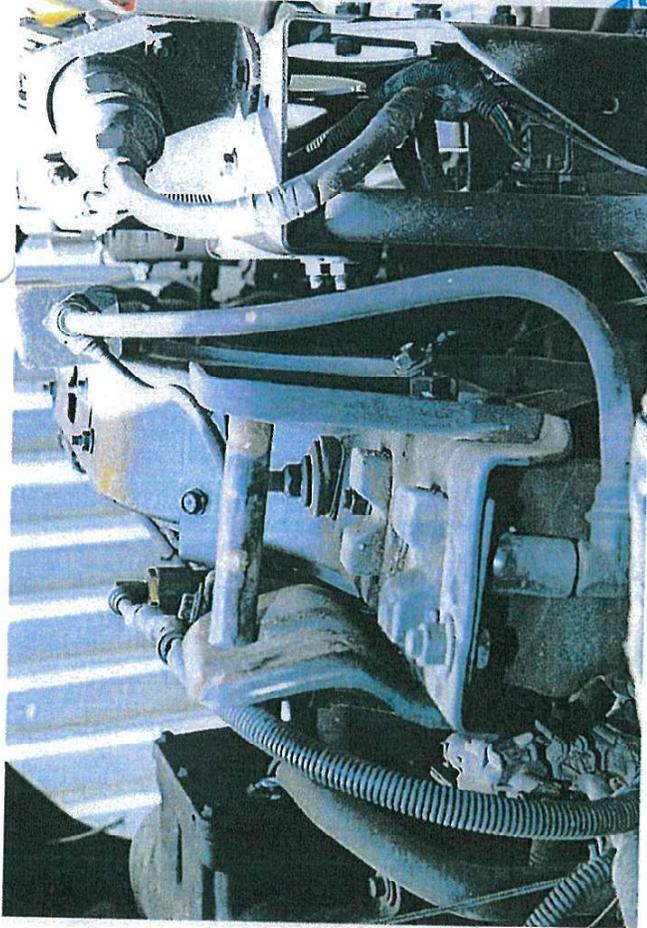
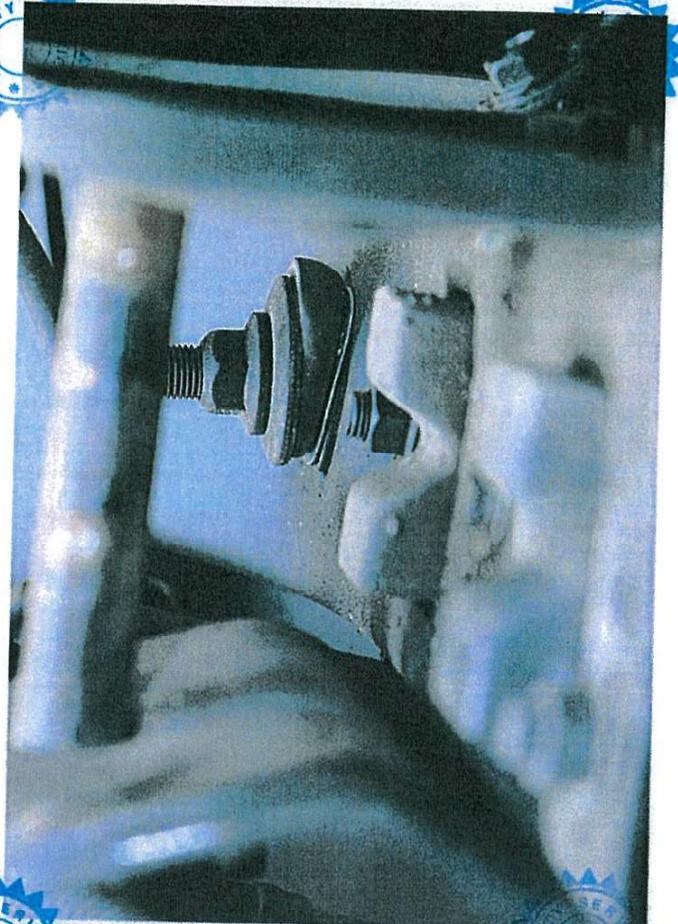
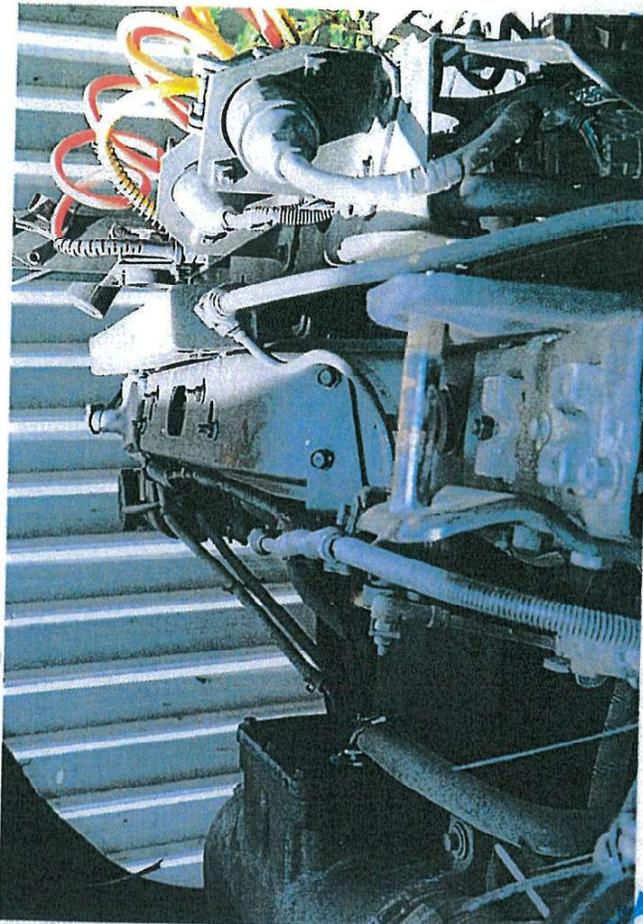


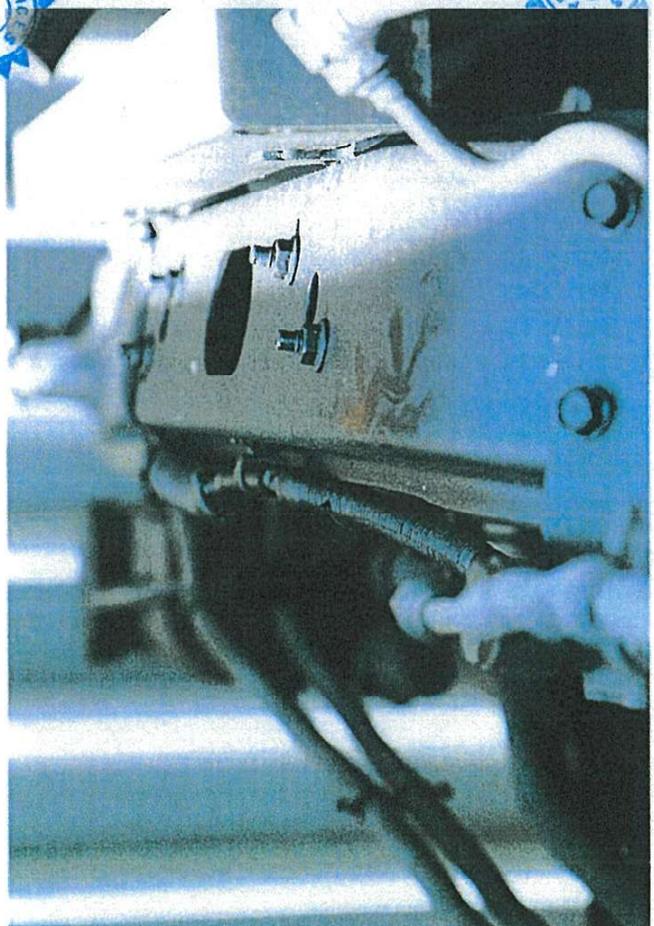
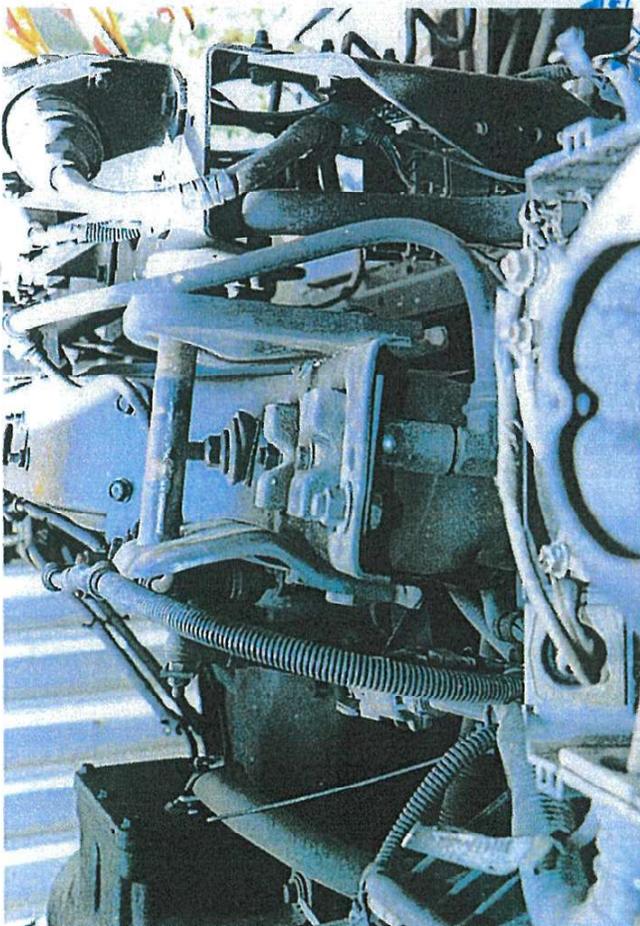
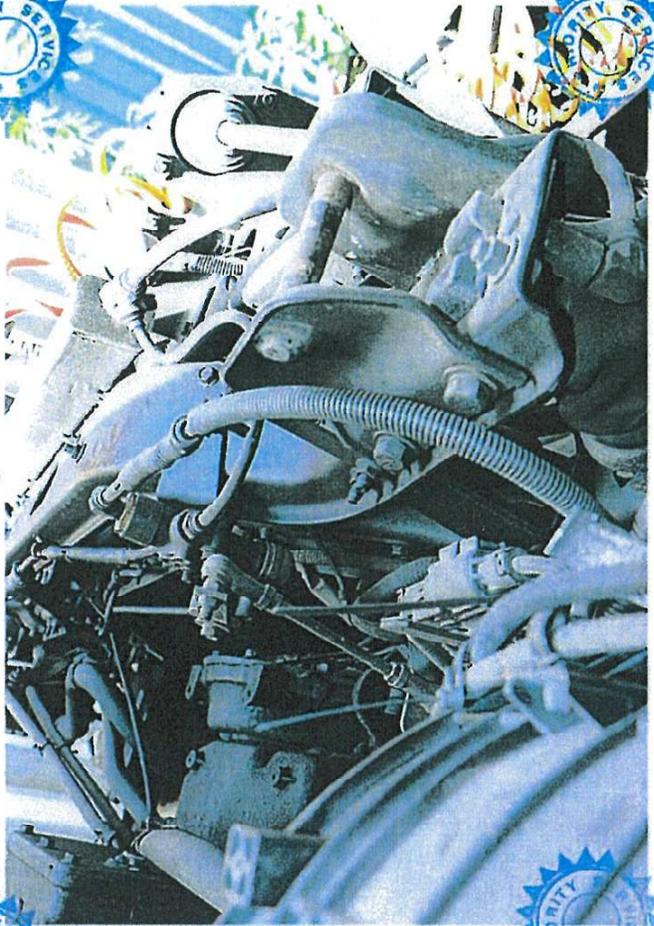
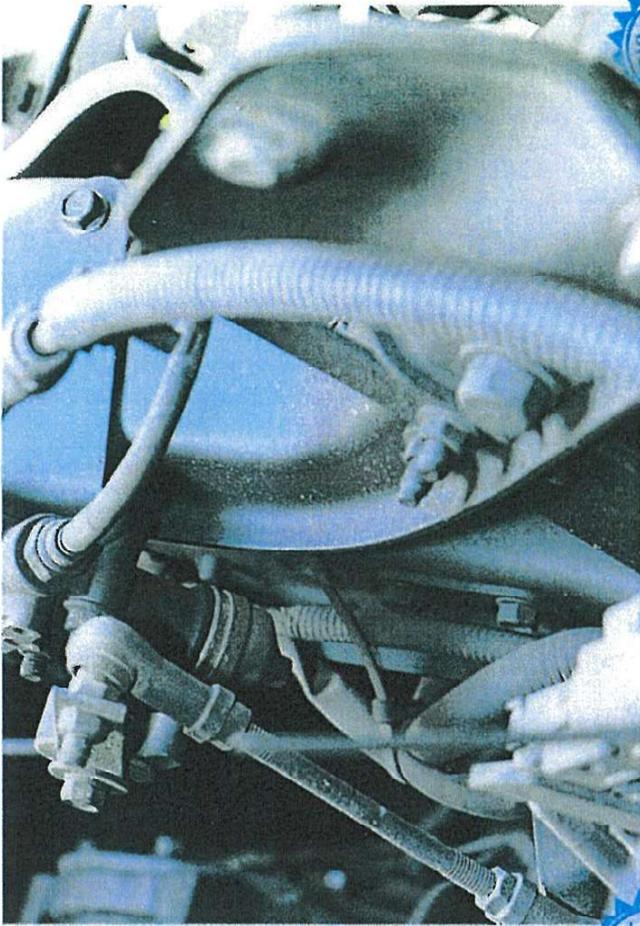


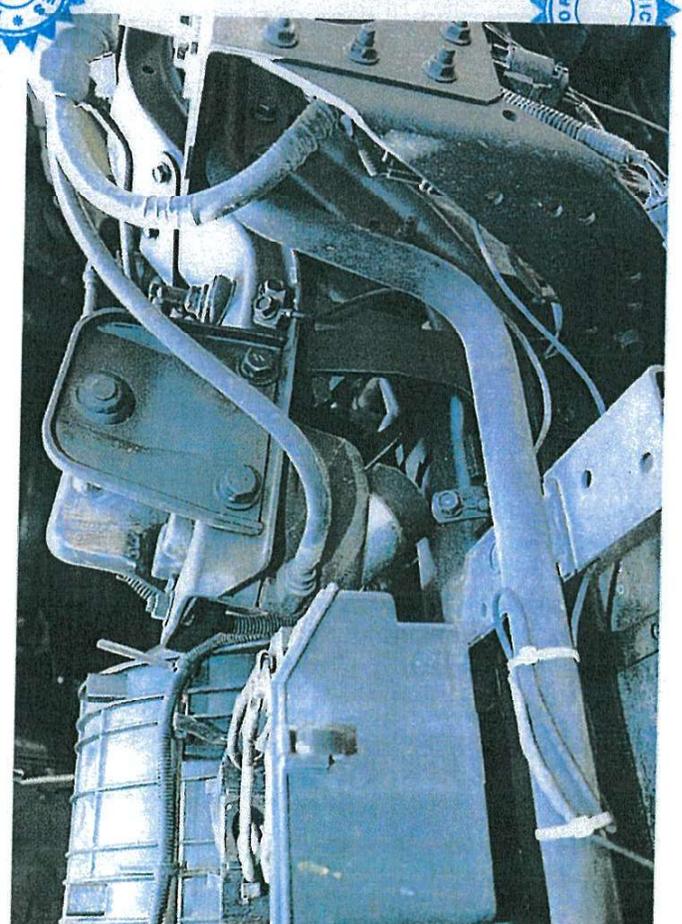
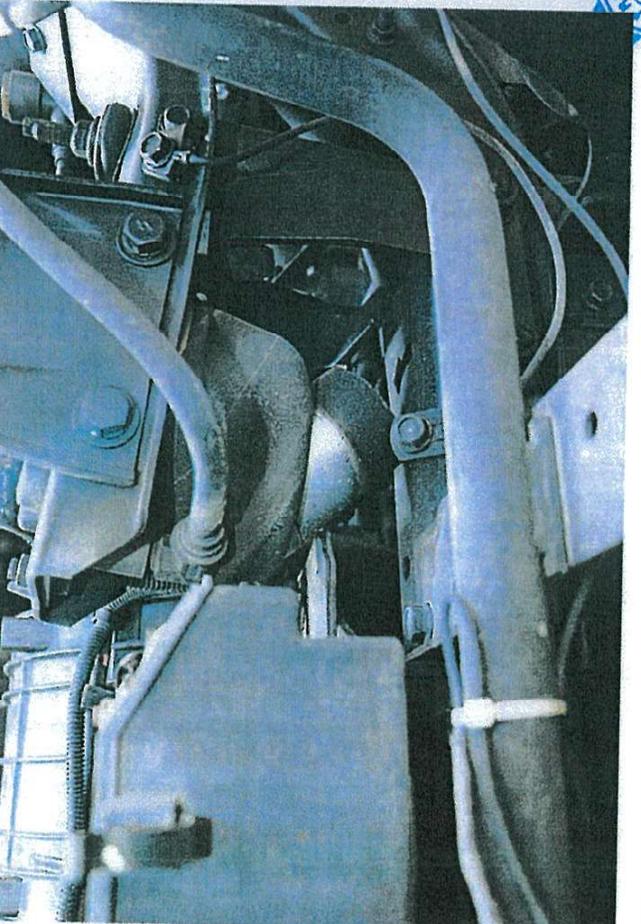
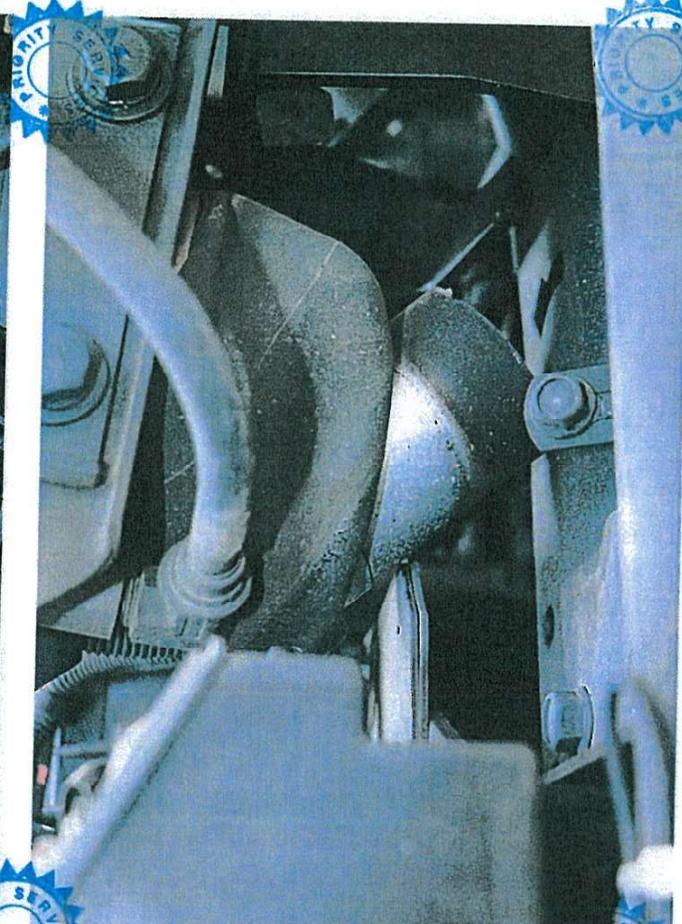
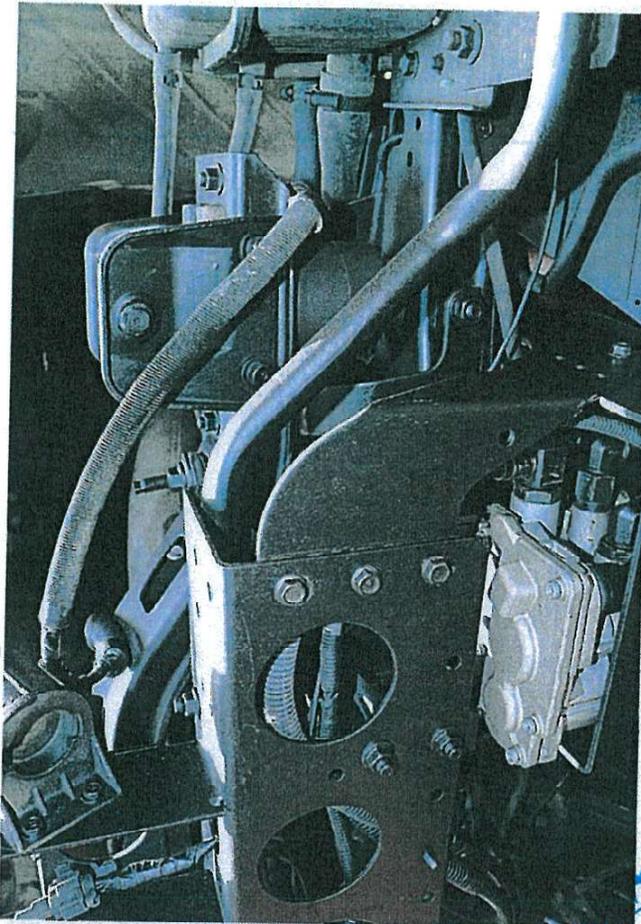


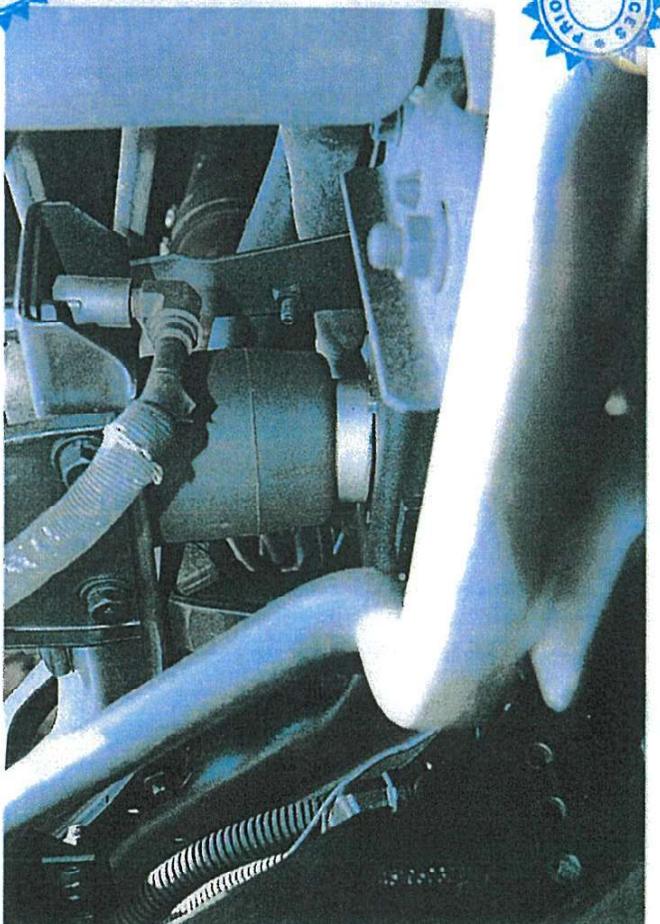
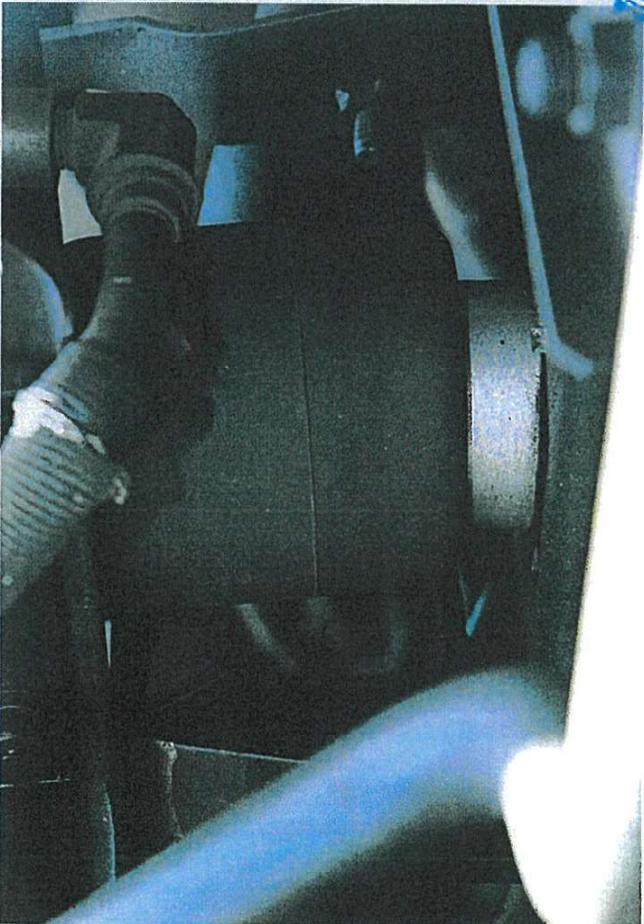
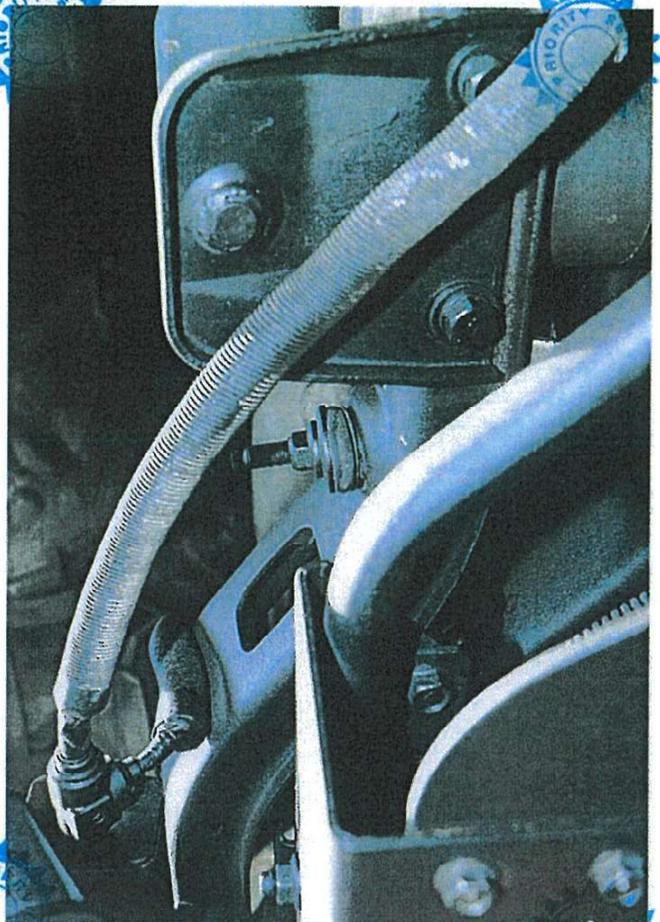
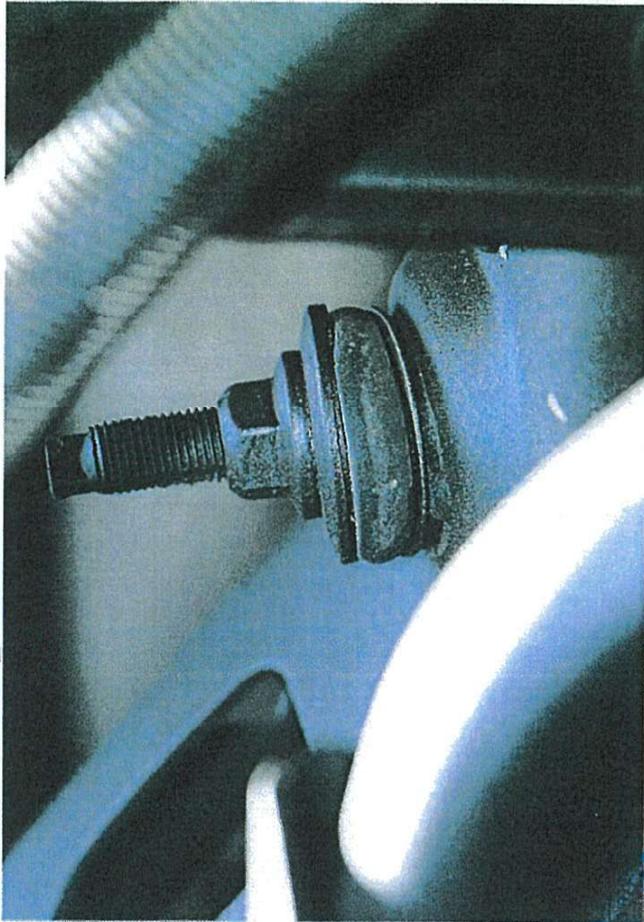



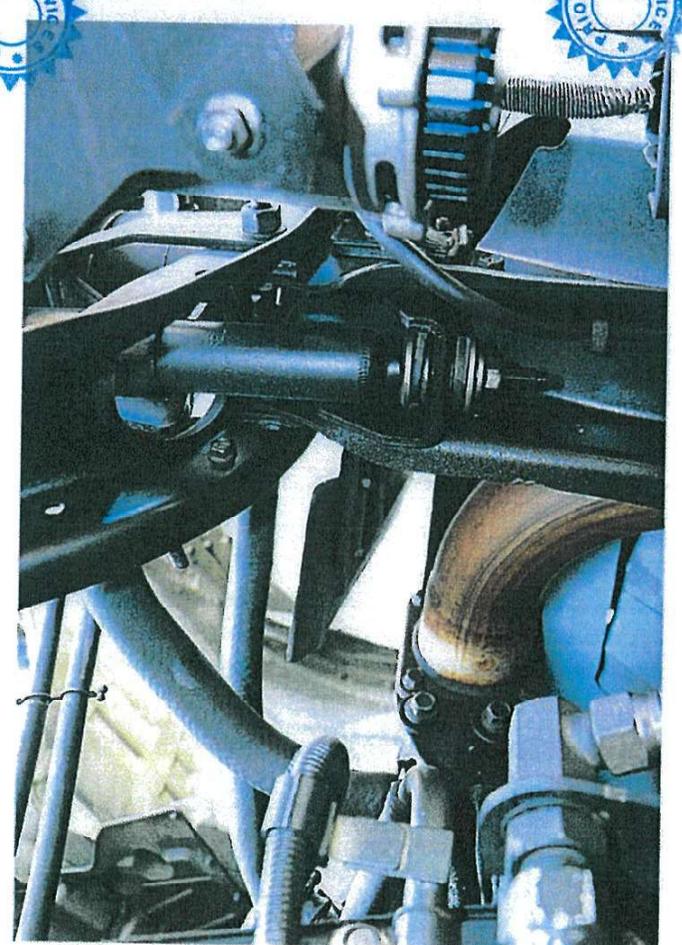
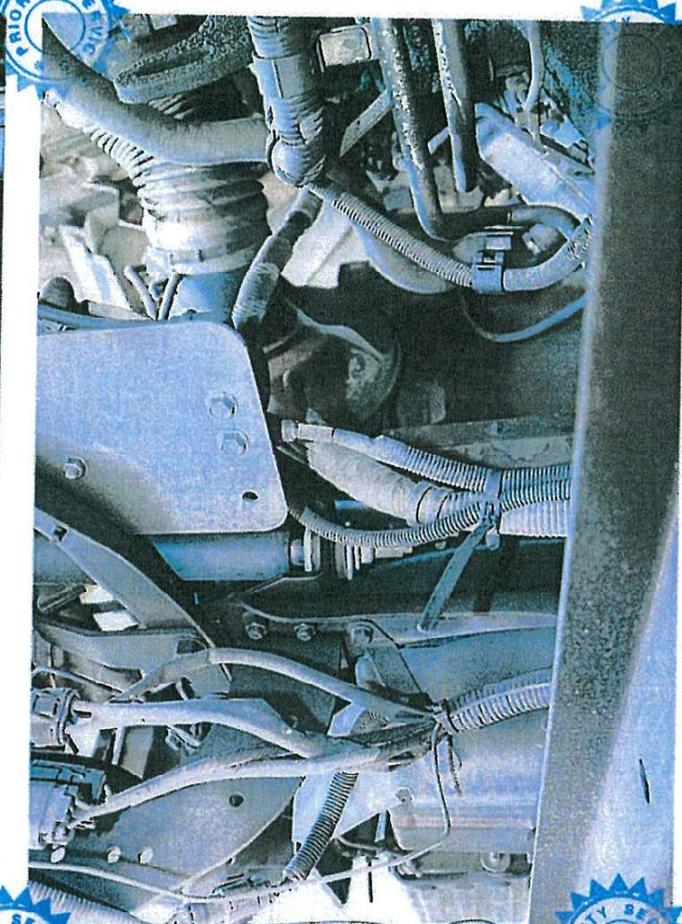
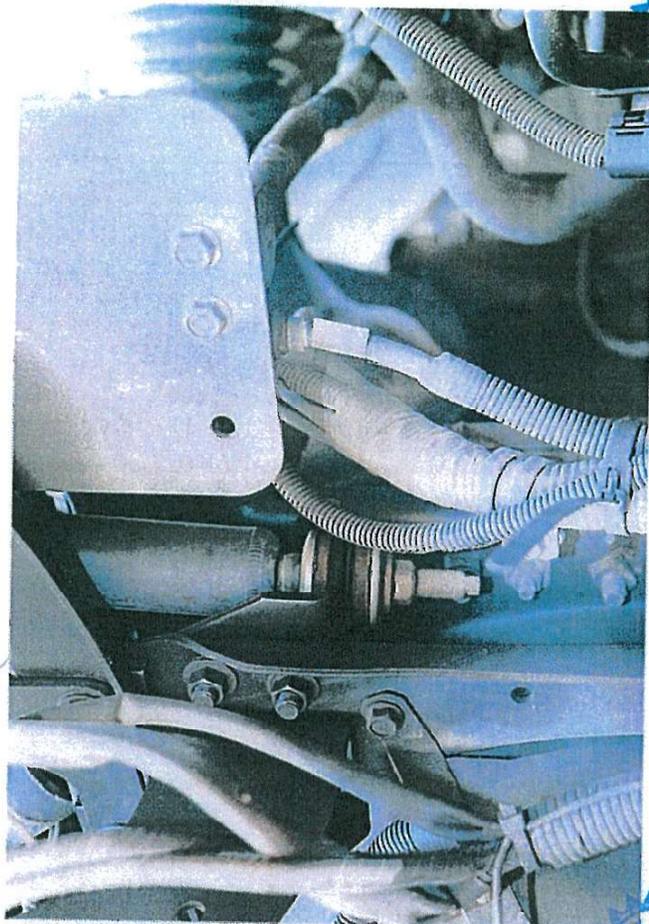


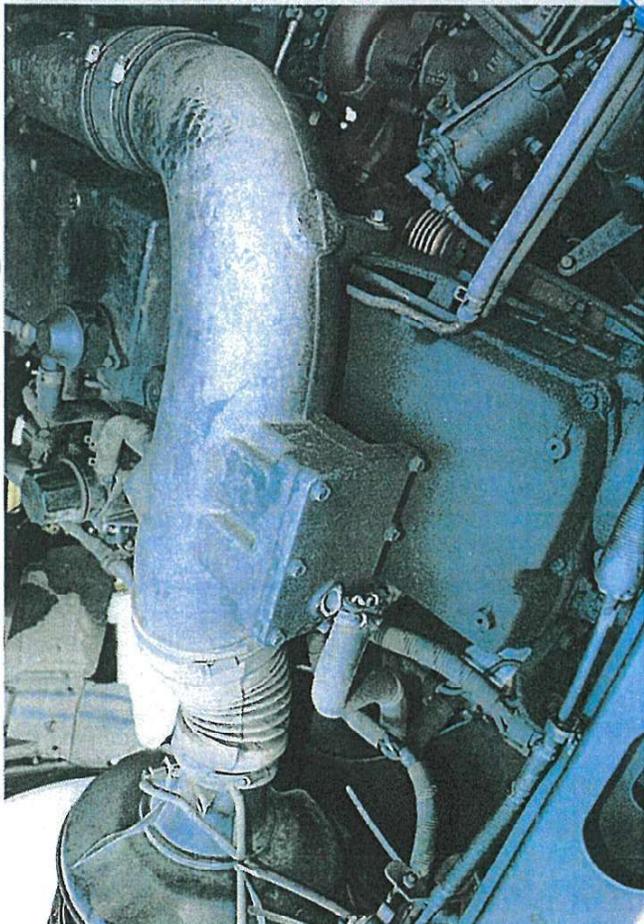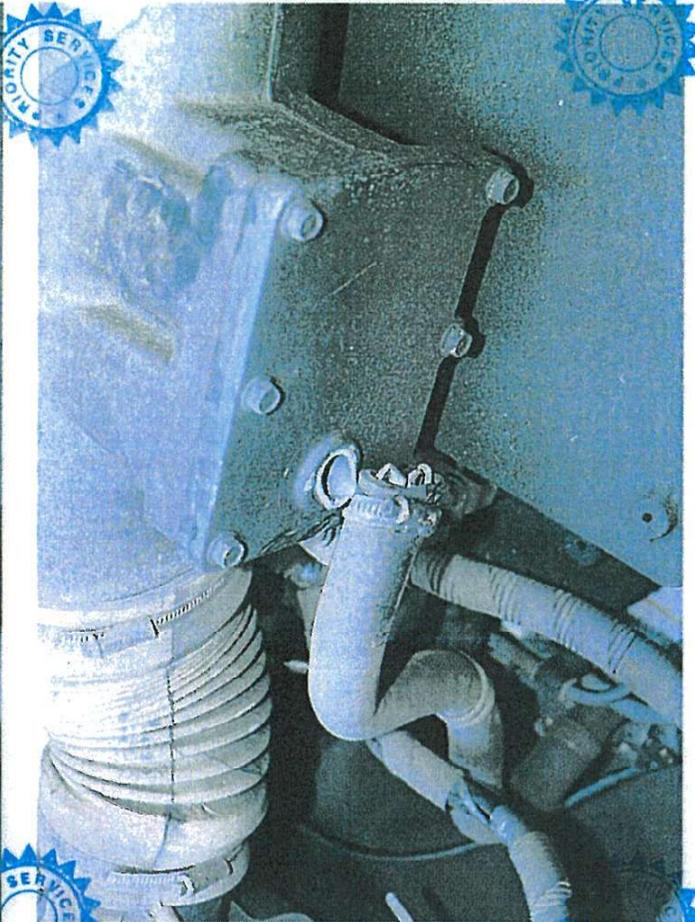
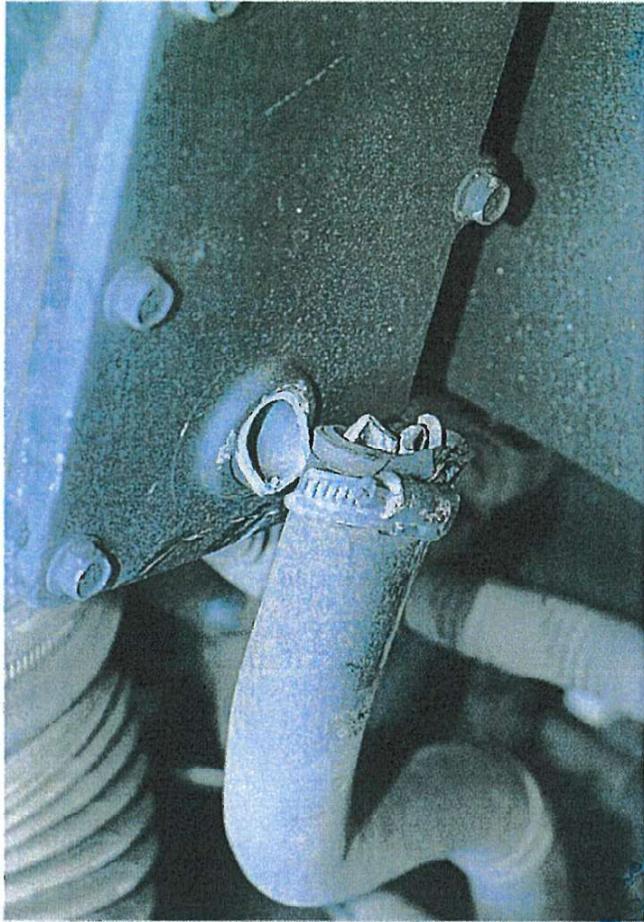


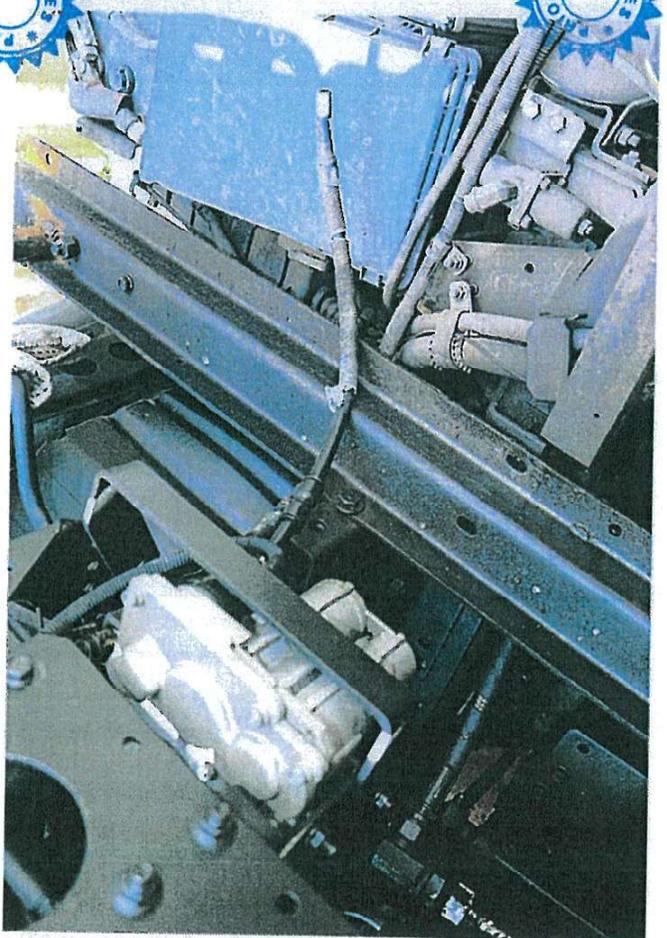
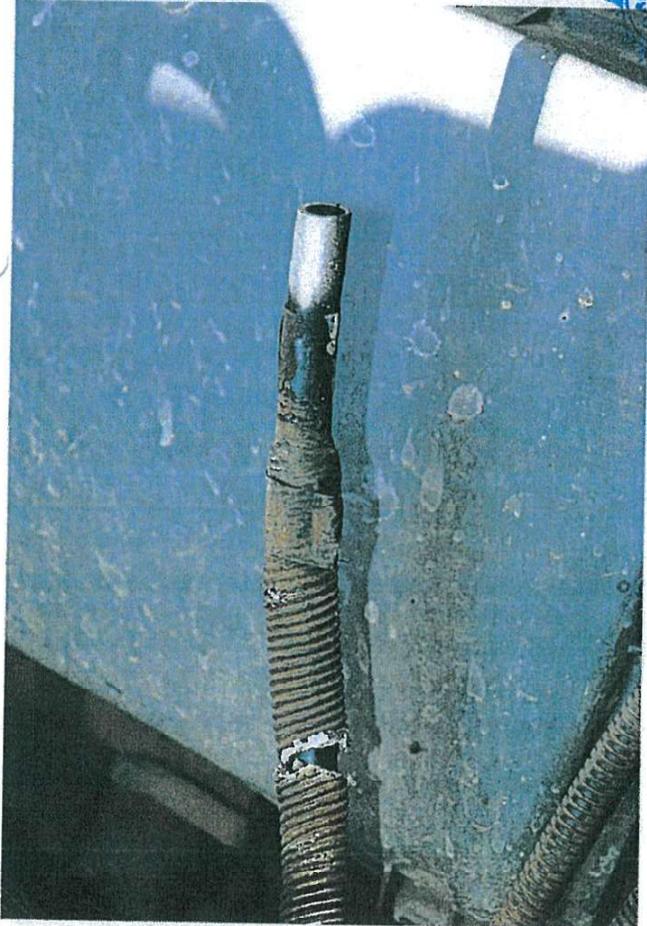
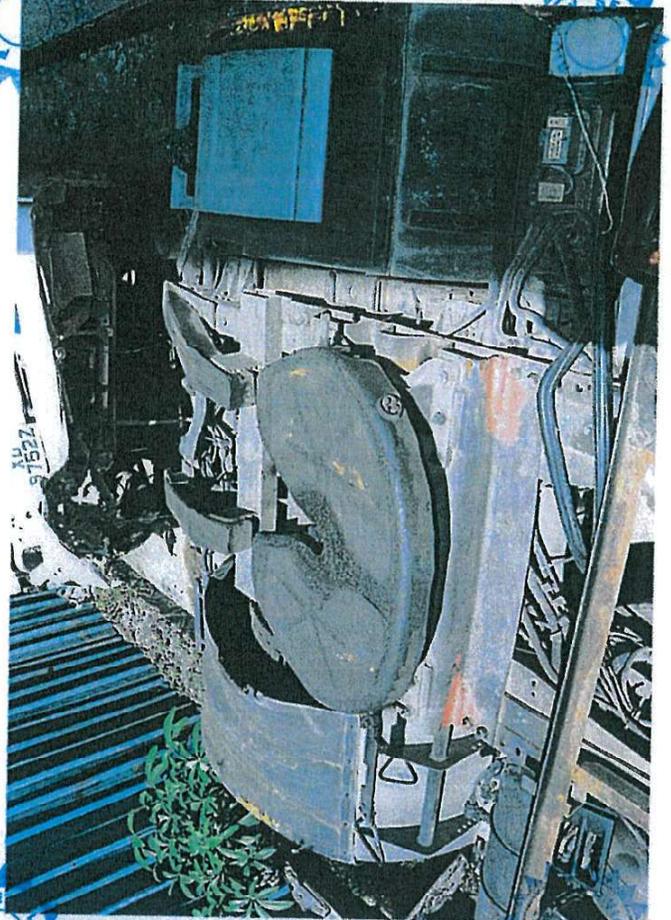
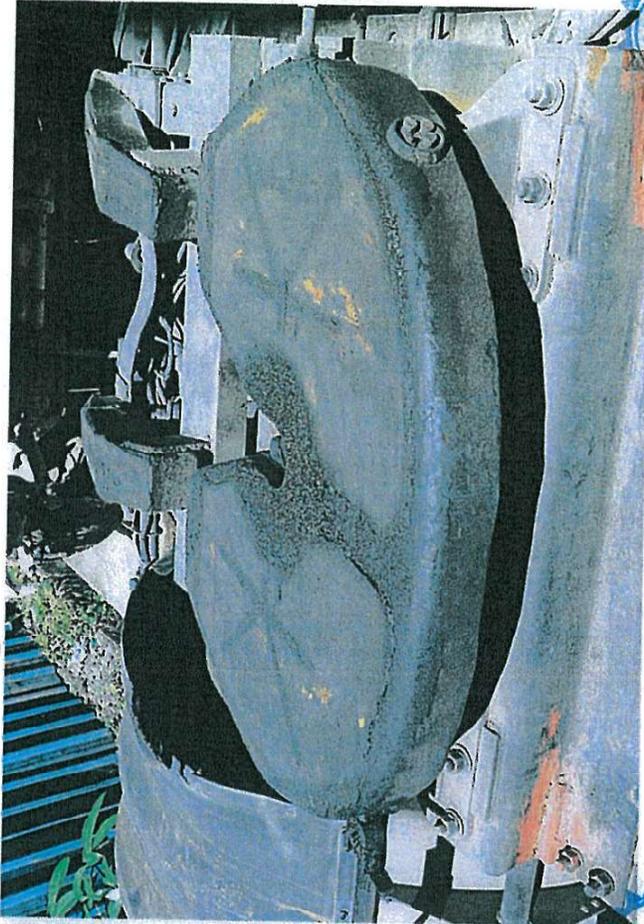


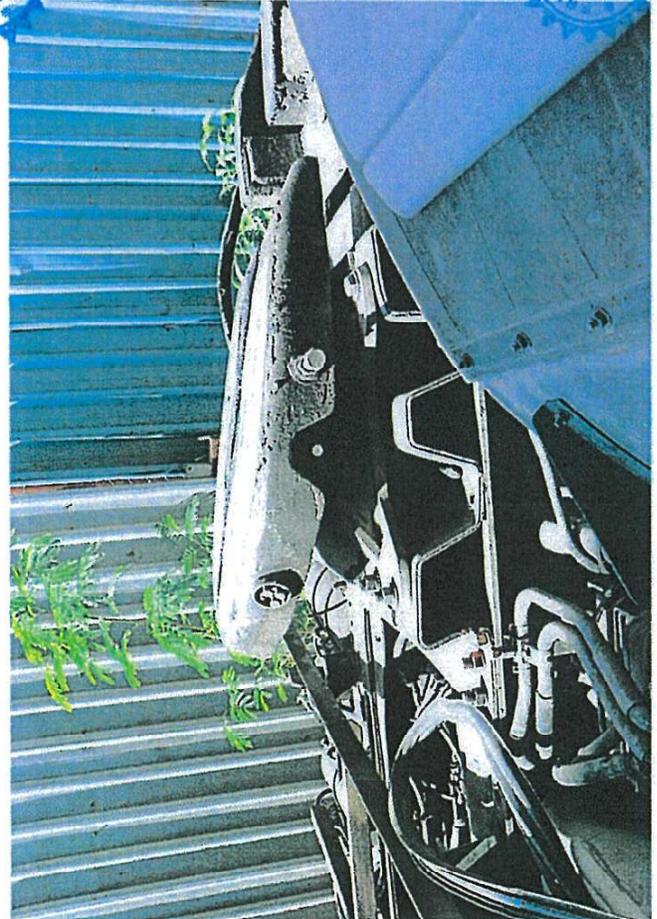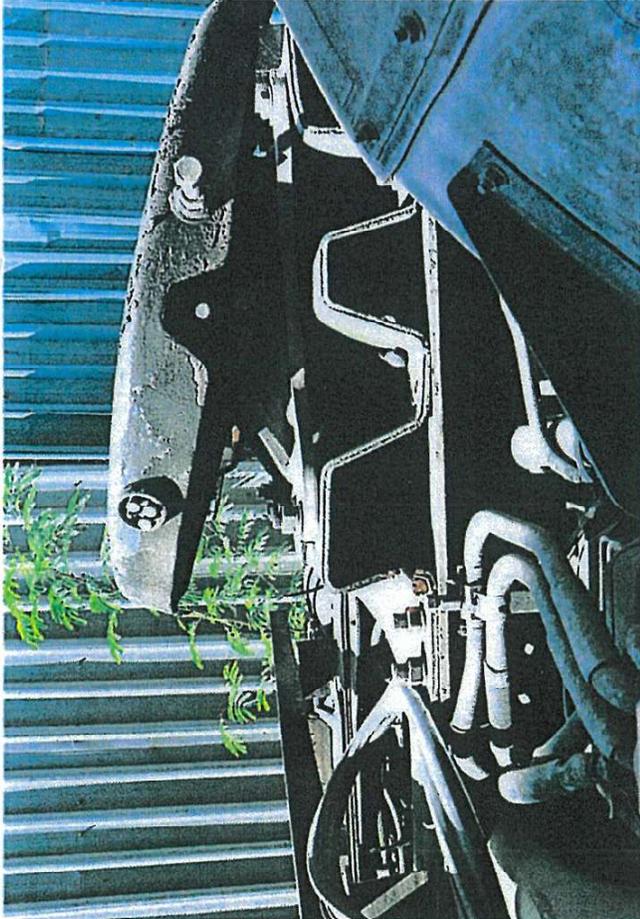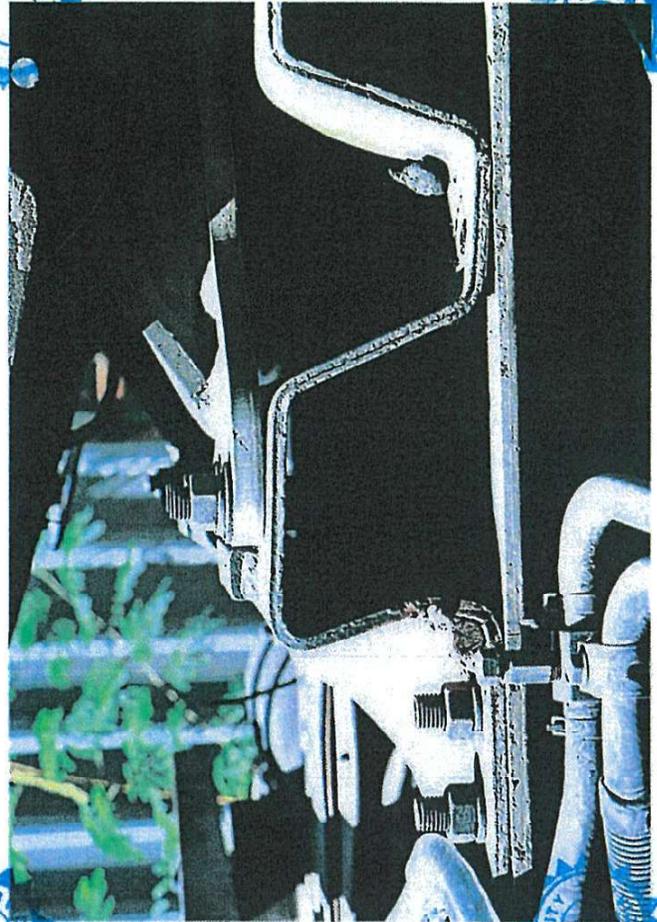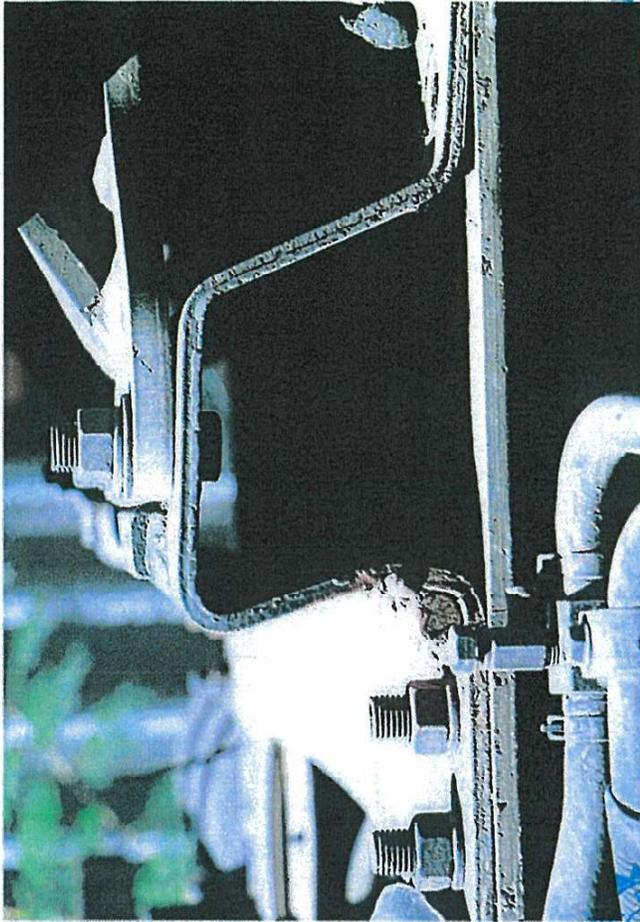


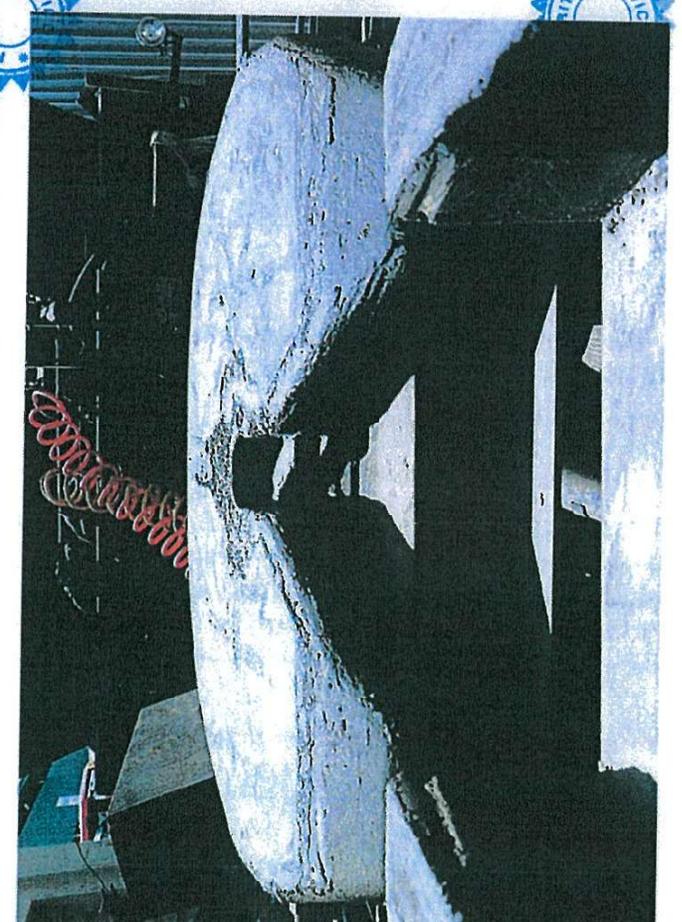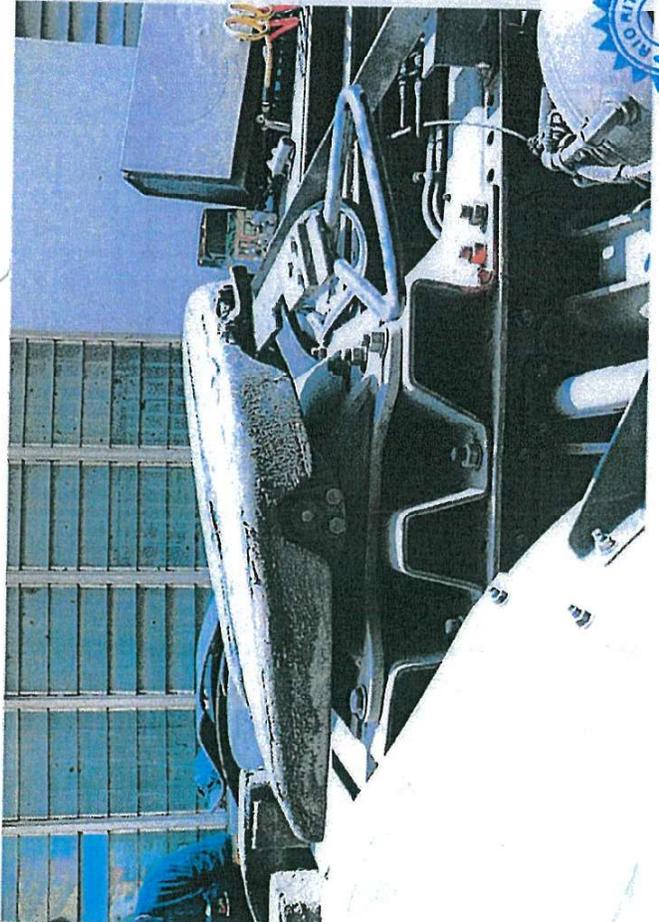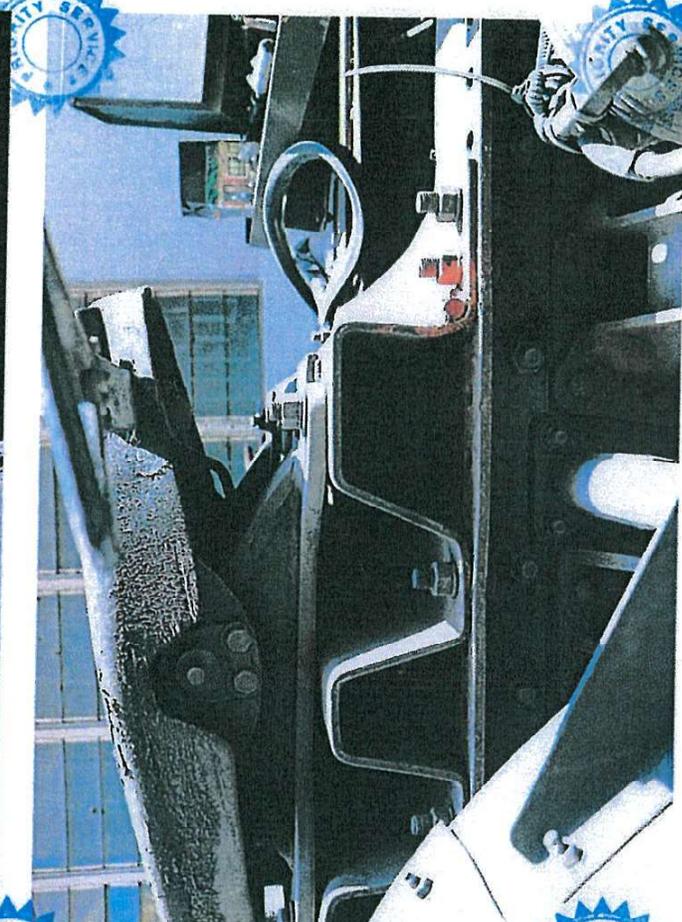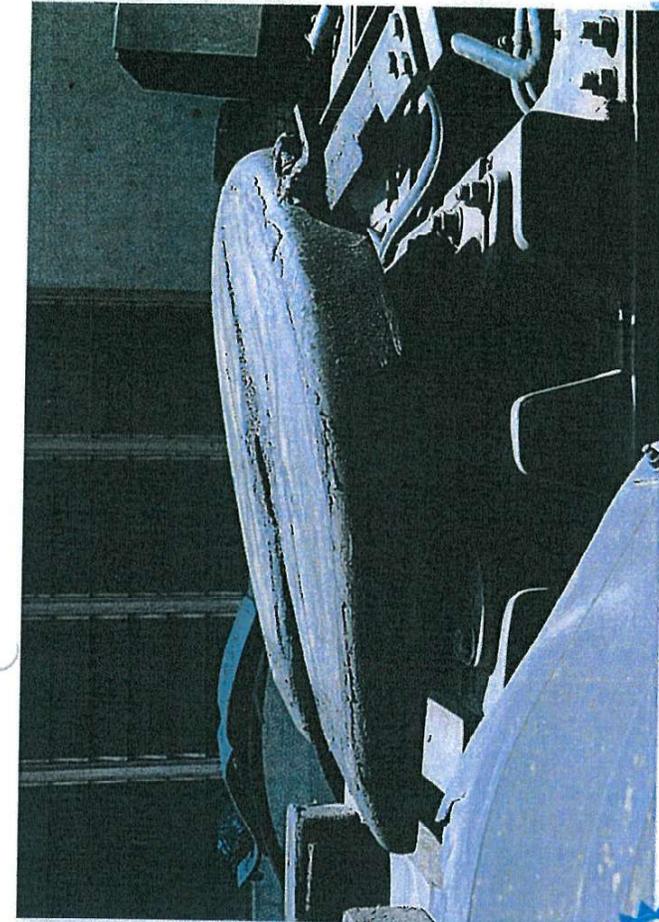

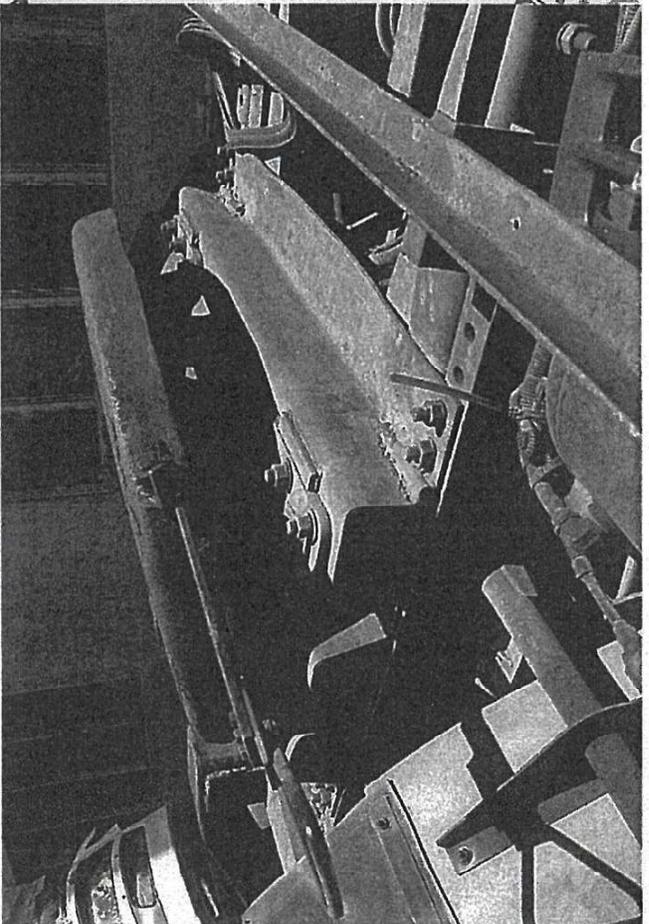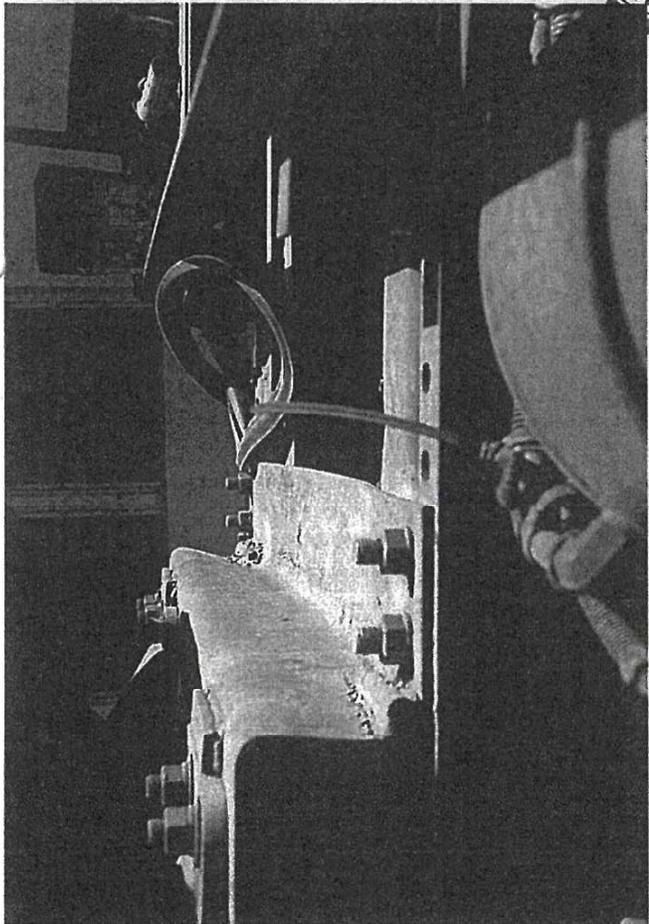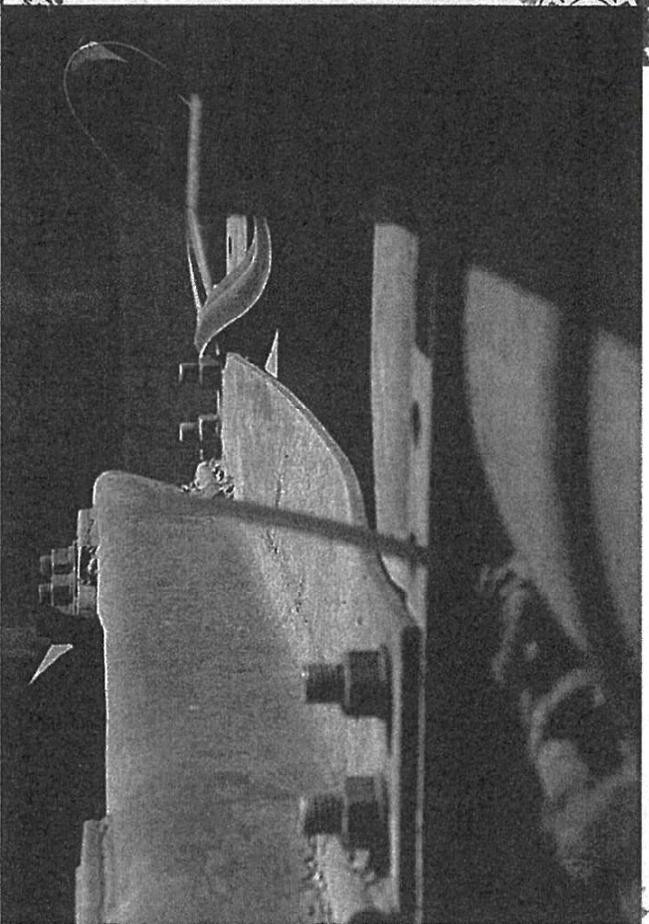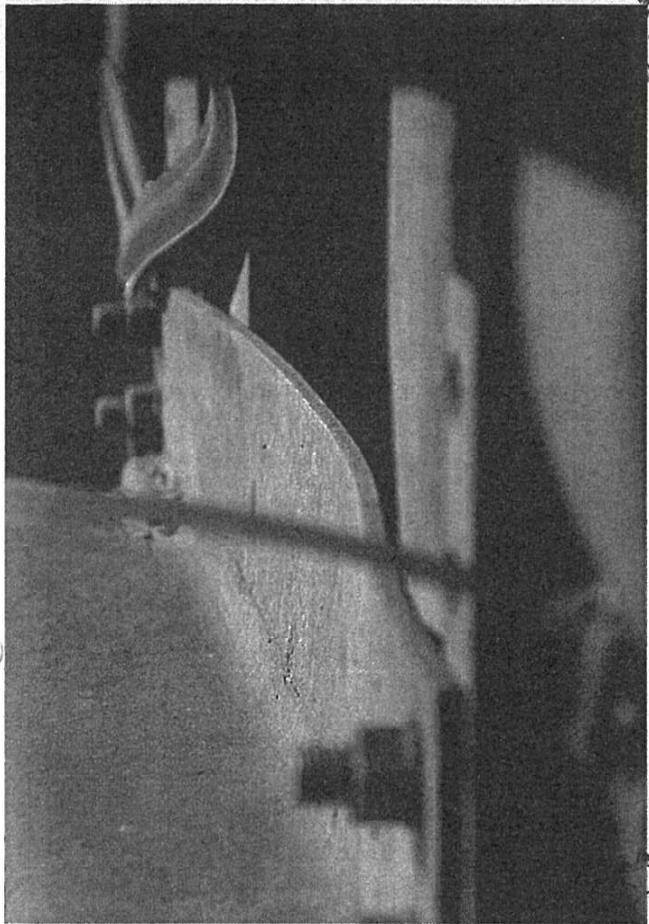

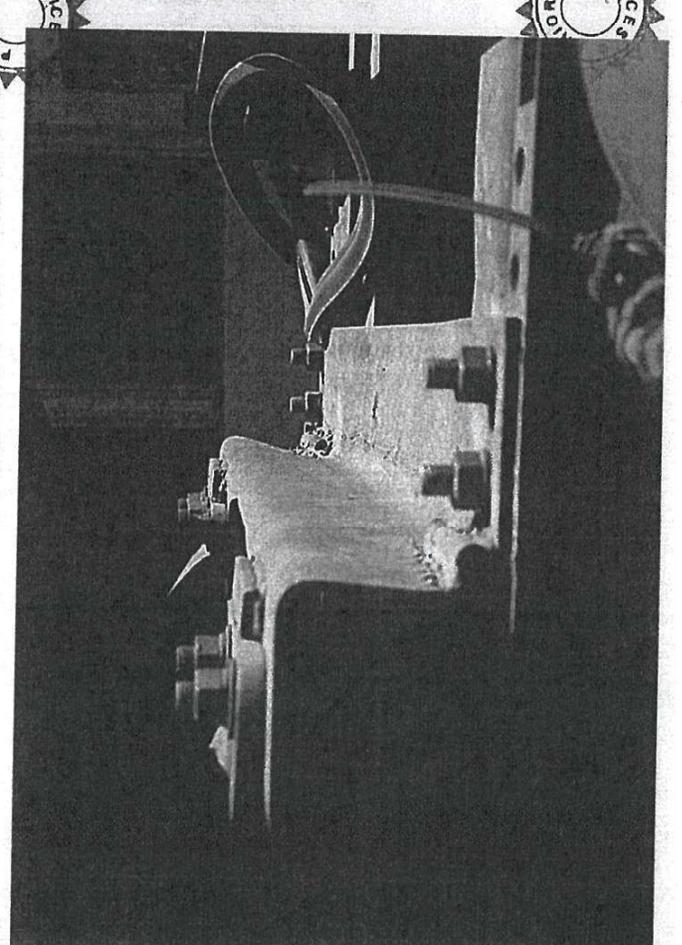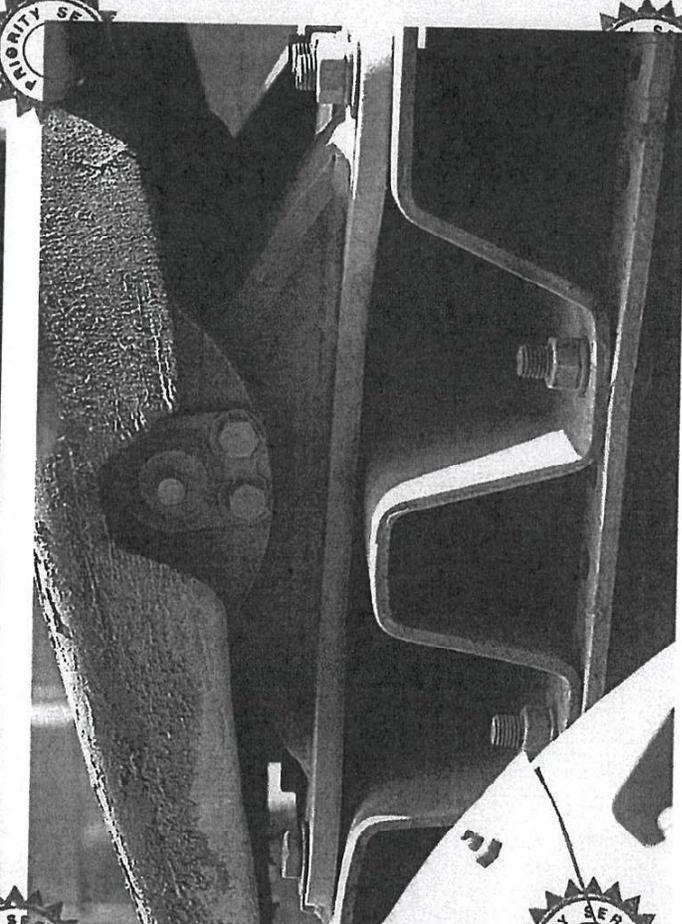

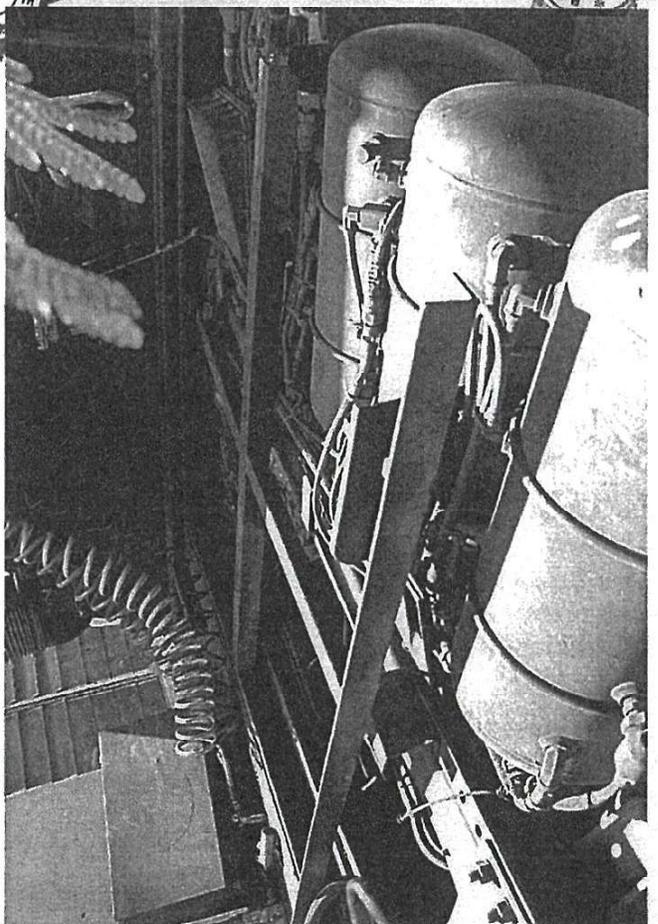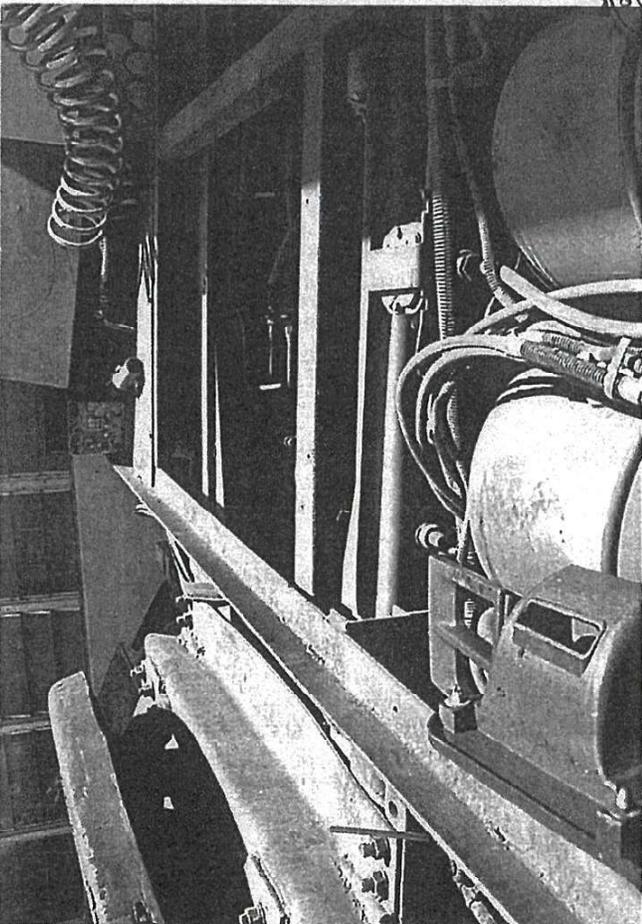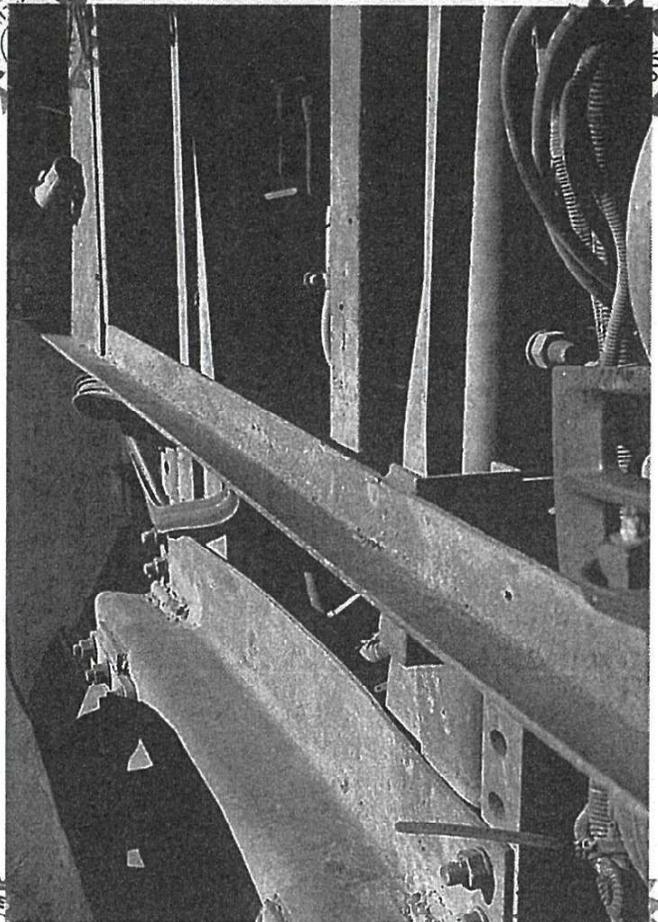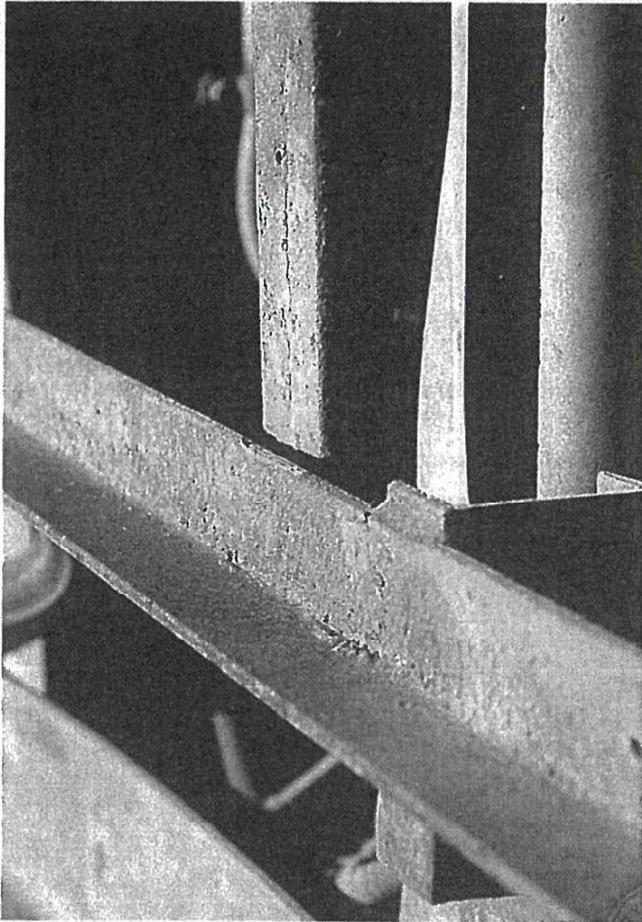

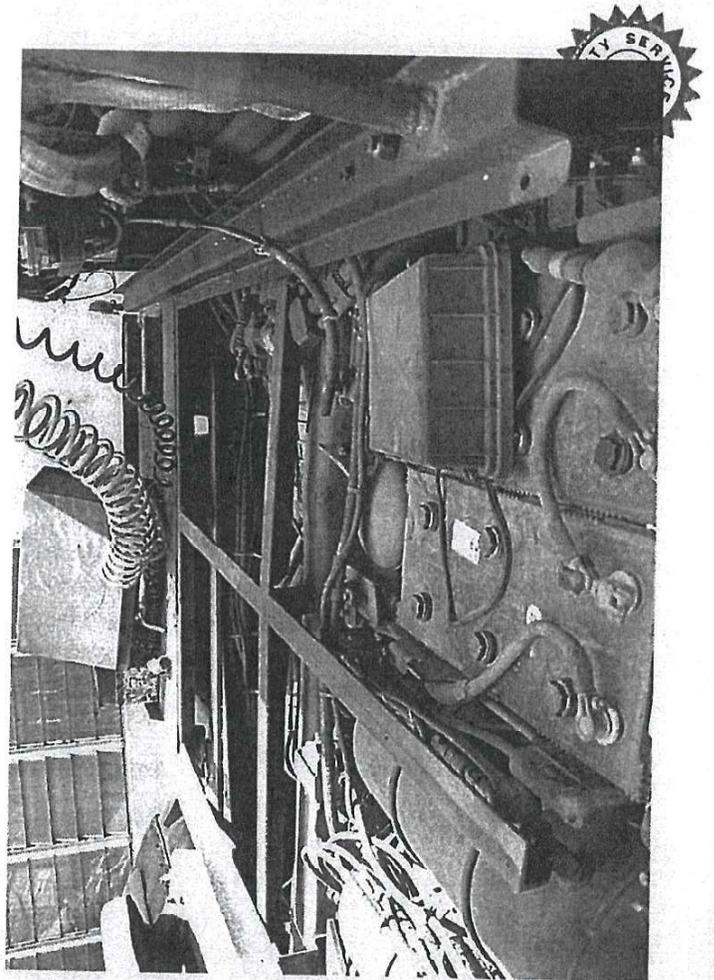

C

C