



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2108374
3 ANSON ROAD #16-00	INV Date	06/12/2021
SPRINGLEAF TOWER	Reference	CC3/CTI21006024/Ers3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SHB 530G
Insured Veh.	SLZ260L
Claim No.	SNM21D202889/LKKDS
Policy No.	DMHCSNA00004942001
Accident Date	13/05/2021
Inspection Date	19/05/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD		Ref:	CC3/CTI21006024/Ers3q2
3 ANSON ROAD #16-00		Date:	06/12/2021
SPRINGLEAF TOWERSINGAPORE 079909		Code:	CTI
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
<b>Insured Veh.</b>	SLZ260L	<b>Veh. Inspected</b>	SHB 530G
<b>Policy No.</b>	DMHCSNA00004942001	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	SNM21D202889/LKKDS	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	19/05/2021
<b>2. Vehicle Particulars &amp; Condition</b>			
<b>Make &amp; Model</b>	TOYOTA PRIUS	<b>c.c</b>	1798
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2014
<b>Chassis No.</b>	JTDKN36U505752950	<b>Colour</b>	MAROON
<b>Odometer</b>	529813 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	FAIR		
<b>3. Conditions of Tyres</b>			
	<b>Size</b>	<b>Make</b>	<b>Balance</b>
<b>R/H Front Tyre</b>	195/50 R15	MICHELIN	5 mm
<b>L/H Front Tyre</b>	195/50 R15	MICHELIN	5 mm
<b>R/H Rear Tyre</b>	195/50 R15	MICHELIN	5 mm
<b>L/H Rear Tyre</b>	195/50 R15	MICHELIN	5 mm
<b>4. Description of Damages</b>			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
<b>5. General Information</b>			
<b>Accident Date</b>	13/05/2021	<b>Inspection Date</b>	19/05/2021
<b>Survey held at</b>	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
<b>5a. Remarks</b>			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
<b>5b. Estimate Days of Repair</b>			
ESTIMATED NORMAL PERIOD FOR REPAIR:		<b>14 Working Days</b>	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 530G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	SOLAR FILM (SN)	NECESSARY	350.00	350.00
1	SOLAR FILM (SN)	NECESSARY	125.00	125.00
1	SOLAR FILM (SN)	NECESSARY	125.00	125.00
1	BUMPER REAR (DISC 25%)	MISSING	458.60	343.95
10	BUMPER CLIPS @\$2.10 (DISC 25%)	NECESSARY	21.00	15.75
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	BUMPER REINFORCEMENT REAR (DISC 25%)	DENTED	205.70	154.28
1	ARM SUB-ASSY ,RR BUMPER RH (DISC 25%)	BENT	139.60	104.70
1	ARM SUB-ASSY ,RR BUMPER LH (DISC 25%)	BENT	139.60	104.70
1	ANTENNA ELECTRICAL LOWER REAR (DISC 10%)	BROKEN	157.40	141.66
1	SENSOR REVERSE (SN)	MISSING	180.00	180.00
1	BUMPER SIDE RETAINER RR/LH (DISC 25%)	BROKEN	94.80	71.10
1	BUMPER SIDE RETAINER RR/RH (DISC 25%)	BROKEN	94.80	71.10
1	BUMPER SEAL ,RR LH (DISC 25%)	MISSING	88.90	66.68
1	BUMPER SEAL ,RR RH	NOT NECESSARY	65.70	-
1	BUMPER LIP COVER RR/LH (DISC 25%)	MISSING	72.20	54.15
1	BUMPER LIP COVER RR/RH (DISC 25%)	MISSING	118.10	88.58
1	BUMPER LIP REAR (DISC 25%)	MISSING	228.90	171.68
1	UNDER COVER SUB-ASSY ,RR FLOOR (DISC 25%)	BROKEN	514.50	385.88
1	UNDER COVER RR SHIELD	NOT NECESSARY	63.90	-
1	END PANEL (DISC 25%)	DENTED	602.10	451.58
1	END PANEL COVER ,DECK TRIM HOLE (DISC 25%)	CRUSHED	46.10	34.58
1	END PANEL COVER ,DECK TRIM ,RR (DISC 25%)	CRUSHED	121.10	90.83
1	SEALANT SIKAFLEX (SN)	NECESSARY	37.00	37.00
1	BOX ,DECK FLOOR ,RR (DISC 25%)	CRUSHED	649.70	487.28
1	BOX ,RR FLOOR BOARD	NOT NECESSARY	679.60	-
1	BOARD ,RR FLOOR	NOT NECESSARY	392.30	-
1	BOX ,DECK FLOOR ,COVER LH	NOT NECESSARY	230.10	-
1	BOX ,DECK FLOOR ,LH (DISC 25%)	CRUSHED	196.80	147.60
1	SPACER ,RR FLOOR	NOT NECESSARY	130.60	-
1	BOARD ASSY ,RR RH	NOT NECESSARY	379.20	-

Report Ref No. CC3/CTI21006024/Ers3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	PANEL ASSY ,DECK LH (DISC 25%)	DENTED	307.00	230.25
1	SPARE TYRE PANEL (DISC 25%)	DENTED	667.70	500.78
1	CUSHION ,SPARE WHEEL	NOT NECESSARY	230.80	-
1	PROTECTOR ,SPARE	NOT NECESSARY	143.70	-
1	BREAKDOWN SIGN	NOT NECESSARY	35.00	-
1	MEMBER SUB-ASSY ,RR LH (DISC 25%)	DENTED	174.10	130.58
1	DUCT ASSY ,QUARTER	NOT NECESSARY	70.40	-
1	WIRE ,FLOOR	NOT NECESSARY	1,675.00	-
1	WIRE ,FLOOR NO.2	NOT NECESSARY	1,305.40	-
1	WIRE ENGINE NO.3	NOT NECESSARY	74.00	-
1	BATTERY ASSY HV	NOT NECESSARY	5,544.40	-
1	WIRE ,FRAME	NOT NECESSARY	1,680.90	-
1	EXHAUST HEAT SHIELD FRT	NOT NECESSARY	153.20	-
1	EXHAUST HEAT SHIELD ,CENTRE	NOT NECESSARY	138.90	-
1	EXHAUST HEAT SHIELD,REAR	NOT NECESSARY	107.40	-
1	EXHAUST TAIL PIPE	NOT NECESSARY	656.20	-
1	SUPPORT EXHAUST PIPE ,NO.4	NOT NECESSARY	40.30	-
1	SUPPORT EXHAUST REAR	NOT NECESSARY	33.60	-
1	EXHAUST PIPE FRT	NOT NECESSARY	4,184.70	-
1	TAILGATE ASY (DISC 25%)	DENTED	1,007.90	755.93
1	TAILGATE DOOR GLASS MOULDING RH (DISC 25%)	BROKEN	29.40	22.05
1	TAILGATE DOOR GLASS MOULDING LH (DISC 25%)	NECESSARY	29.40	22.05
1	TAILGATE DOOR GLASS (DISC 25%)	BROKEN	1,090.90	818.18
1	MOULDING BACK WINDOW LOWER NO.1 (DISC 25%)	NECESSARY	29.40	22.05
1	MOULDING BACK WINDOW , LOWER NO.2 (DISC 25%)	NECESSARY	29.40	22.05
1	TAILGATE LOWER WINDOW GLASS (DISC 25%)	BROKEN	721.30	540.98
1	DAM,BACK DOOR GLASS ADHESIVE .NO.1 (DISC 25%)	NECESSARY	27.30	20.48
1	DAM ,BACK DOOR GLASS ADHESIVE NO.2 (DISC 25%)	NECESSARY	17.40	13.05
2	BUSH ,RR CROSS MEMBER @\$148.50 (DISC 25%)	NECESSARY	297.00	222.75
1	SHOCK ABSORBER REAR (DISC 25%)	BENT	112.30	84.23
1	CYLINDER ASSY ,BRAKE CAPLIER LH	NOT NECESSARY	882.20	-
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555888(SN)	NECESSARY	21.60	21.60

Report Ref No. CC3/CTI21006024/Ers3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	3RD BRAKE LAMP	NOT NECESSARY	231.30	-
1	SPOILER REAR	NOT NECESSARY	953.70	-
1	DOOR RR/LH	TO REPAIR SEE LABOUR	954.50	-
1	HINGE LOWER LHF ,DOOR	NOT NECESSARY	90.10	-
1	HINGE UPPER LHF ,DOOR	NOT NECESSARY	80.50	-
1	CHECK ASSY ,FR DOOR	NOT NECESSARY	150.30	-
1	FENDER RR/RH	NOT NECESSARY	766.80	-
1	SMRT LOGO	NOT NECESSARY	7.80	-
1	STICKER DECAL 65558888	NOT NECESSARY	21.60	-
1	TAIL LAMP BRACKET ,RH	NOT NECESSARY	30.70	-
1	TAIL LAMP RH	NOT NECESSARY	557.80	-
1	FENDER RR/LH	DENTED	766.80	575.10
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	QUARTER GLASS RR/LH (DISC 25%)	NECESSARY	168.10	126.08
1	FENDER LINER R/LH (DISC 25%)	CRUSHED	141.30	105.98
1	SILL MEMBER PLATE RR/LH	NOT NECESSARY	57.50	-
1	TROUGH BACK DOOR LH (DISC 25%)	DENTED	110.90	83.18
1	TAIL LAMP BRACKET ,LH (DISC 25%)	BROKEN	30.70	23.03
1	TAIL LAMP LH (DISC 10%)	BROKEN	548.40	493.56
1	WHEEL HOUSE OUTER LH REAR	NOT NECESSARY	326.10	-
1	DUCT ASSY QUARTER (DISC 25%)	MISSING	70.40	52.80
1	PANEL SUB-ASSY ,QTR WHEEL HOUSE	NOT NECESSARY	588.40	-
1	RAIL ROOF SIDE OUTER LH	TO REPAIR SEE LABOUR	463.80	-
1	EXTENSION ,QUARTER PANEL FRONT LH	TO REPAIR SEE LABOUR	83.50	-
1	REINFORCEMENT ,BACK DOOR SIDE LH	TO REPAIR SEE LABOUR	89.50	-
1	REINFORCEMENT ROOF SIDE INNER LH	TO REPAIR SEE LABOUR	60.30	-
1	TYRE (SN)	CRUSHED	126.74	126.74
1	WHEEL DISC (DISC 25%)	BROKEN	1,484.20	1,113.15
1	WHEEL HUB REAR	NOT NECESSARY	489.40	-

Report Ref No. CC3/CTI21006024/Ers3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LID ASSY ,FUEL	NOT NECESSARY	102.00	-
1	TUBE FUEL TANK	NOT NECESSARY	36.10	-
1	CABLE SUB-ASSY ,FUEL LID	NOT NECESSARY	63.90	-
1	RETAINER FUEL LID CABLE	NOT NECESSARY	5.90	-
1	PIPE SUB-ASSY ,FUEL NECK	NOT NECESSARY	230.80	-
1	PIPE, FUEL DELIVERY	NOT NECESSARY	186.10	-
1	CAP ASSY ,FUEL TANK	NOT NECESSARY	68.10	-
1	FUEL TANK SUPPORT BAR LH	NOT NECESSARY	76.40	-
1	FUEL TANK SUPPORT BAR RH	NOT NECESSARY	91.20	-
1	TANK SUB-ASSY ,FUEL	NOT NECESSARY	745.10	-
1	BRACE SUB-ASSY ,REAR SUSPENSION	NOT NECESSARY	307.00	-
1	REAR CROSS MEMBER	NOT NECESSARY	2,621.50	-
1	TROUGH BACK DOOR	NOT NECESSARY	110.90	-
3	SEALANT W/SCREEN @\$37.00(SN)	NECESSARY	111.00	111.00
1	ARM ,RR WIPER	NOT NECESSARY	84.70	-
1	MOTOR ASSY ,RR WIPER	NOT NECESSARY	734.60	-
1	BLADE ASSY REAR WIPER	NOT NECESSARY	55.00	-
1	WIRE BACK DOOR NO.1	NOT NECESSARY	582.40	-
2	TAILGATE DOOR HINGE LH/RH	NOT NECESSARY	58.30	-
1	TAILGATE DOOR STAY LH	NOT NECESSARY	241.50	-
1	TAILGATE DOOR STAY RH	NOT NECESSARY	241.50	-
1	TAILGATE DOOR LOCK (DISC 25%)	JAMMED	444.10	333.08
1	TAILGATE LOCK COVER (DISC 25%)	CRUSHED	15.70	11.78
1	STRIKER BACK DOOR	NOT NECESSARY	48.90	-
1	TAILGATE DOOR WEATHERSTRIP	NOT NECESSARY	353.40	-
1	TAILGATE TRIM LH	NOT NECESSARY	85.90	-
1	TAILGATE TRIM RH (DISC 25%)	NOT NECESSARY	88.30	66.23
1	TAILGATE TRIM LOWER	NOT NECESSARY	180.70	-
1	TAILGATE TRIM UPPER	NOT NECESSARY	49.60	-
1	TAILGATE BOARD ASSY (DISC 25%)	CRUSHED	246.90	185.18
1	TAILGATE OUTSIDE GARNISH (DISC 25%)	BROKEN	504.90	378.68
1	EMBLEM REAR (DISC 25%)	NECESSARY	60.30	45.23
1	CAMERA ASSY ,TELEVISION ,RR	NOT NECESSARY	1,436.60	-

Report Ref No. CC3/CTI21006024/Ers3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	NAME PLATE (PRUIS) (DISC 25%)	NECESSARY	60.80	45.60
1	NAME PLATE (TOYOTA) (DISC 25%)	NECESSARY	51.90	38.93
1	NUMBER PLATE (SN)	CUT	15.00	15.00
1	NUMBER PLATE FRAME (SN)	CUT	12.00	12.00
1	MLDG DRIP LH ROOF	NOT NECESSARY	78.80	-
1	PROTECTOR ,SPARE (DISC 25%)	BROKEN	143.70	107.78
1	BATTERY ASSY ,HV (DISC 10%)	DENTED	5,544.40	4,989.96
1	TAILGATE DOOR WEATHERSTRIP (DISC 25%)	TORN	353.40	265.05
1	TROUGH BACK DOOR LH (DISC 25%)	DENTED	110.90	83.18
1	WHEEL HUB REAR (DISC 25%)	JAMMED	489.40	367.05
1	CAP ASSY ,FUEL TANK (DISC 25%)	BROKEN	68.10	51.08
1	REAR CROSS MEMBER (DISC 25%)	BENT	2,621.50	1,966.13
1	CYLINDER ASSY ,BRAKE CAPLIER LH (DISC 25%)	BENT	882.20	661.65
1	MLDG DRIP LH ROOF	NOT NECESSARY	78.80	-
1	TAIL LAMP PANEL LH (SN)	BENT	121.30	121.30
			<b>58,788.24</b>	<b>19,981.73</b>
	<b>LABOUR</b>			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF DOOR RR/LH,RAIL ROOF SIDE OUTER LH,EXTENSION,QUARTER PANEL FRONT LH,REINFORCEMENT BACK DOOR SIDE LH AND REINFORCEMENT ,ROOF SIDE INNER LH.		1,921.00	1,600.00
	SPRAY PAINT.		3,510.00	1,280.00
	TO REMOVE AND REFIT REAR CROSSMEMBER .		300.00	150.00
	TO BLEEDING OUT THE AIR FROM BRAKE SYSTEM.		150.00	30.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	20.00
	TO REMOVE AND REFIX REAR WINDSCREEN .		120.00	100.00
	TO REMOVE AND REFIX TAILGATE GLASS .		120.00	100.00
	TO TRANSFER REAR TAILGATE MECHANISM .		120.00	30.00
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR .		120.00	30.00
	TO REMOVE AND REFIT TYRE RIM (SRAYING PURPOSE).	NOT NECESSARY	120.00	-
	TO DO WHEEL ALIGNMENT /TYRE BALANCING.		120.00	60.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE & REFIT EXHAUST .	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIT WIRE HARDESS.	NOT NECESSARY	120.00	-
	TO REMOVE & REFIT FUEL TANK .	NOT NECESSARY	120.00	-
	TO REPLACE SUNDRY PARTS.		100.00	20.00
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	30.00
	TO CHECK & RESET SYSTEM FUNCTION .	NOT NECESSARY	80.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
	TOWING CHARGE.		126.00	126.00
			7,527.00	3,576.00
	<b>GRAND TOTAL</b>		<b>66,315.24</b>	<b>23,557.73</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>11,900.00</b>

Report Ref No. CC3/CT121006024/Ers3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SHB 530G

## INSPECTION

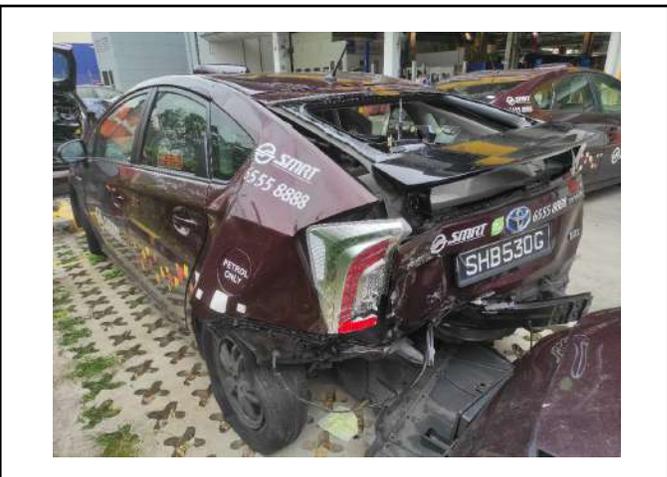




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

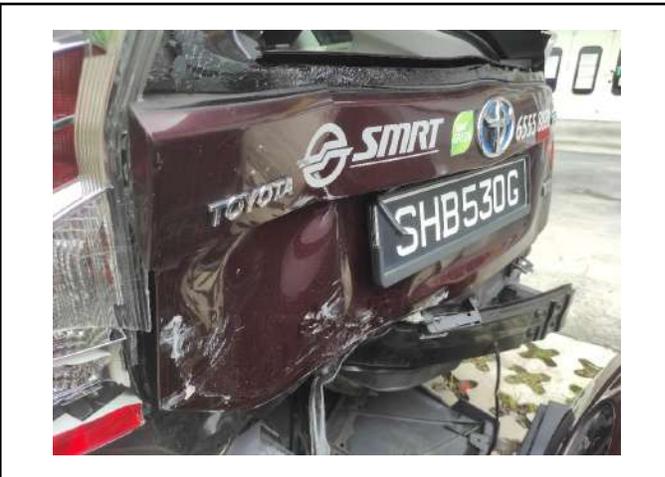






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

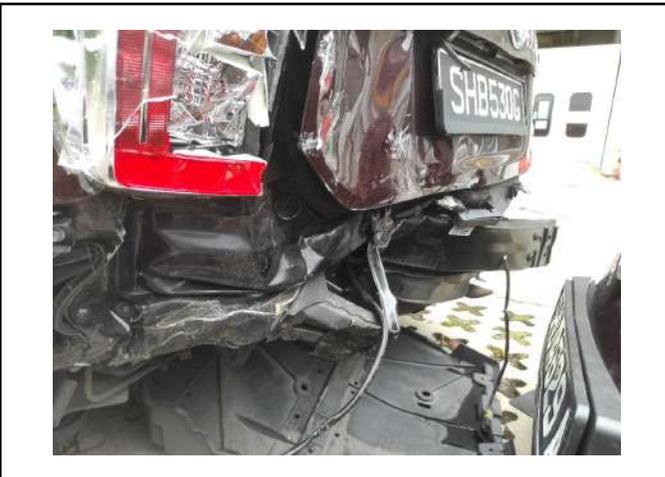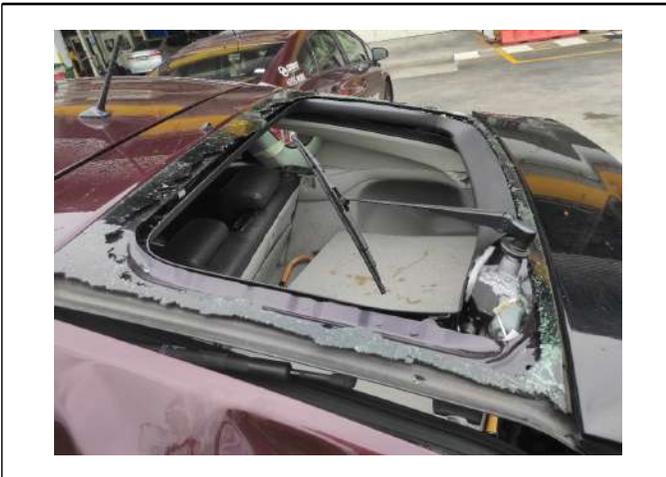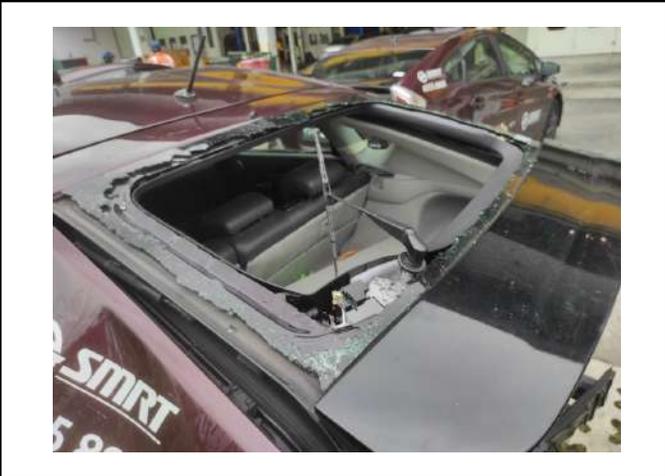



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

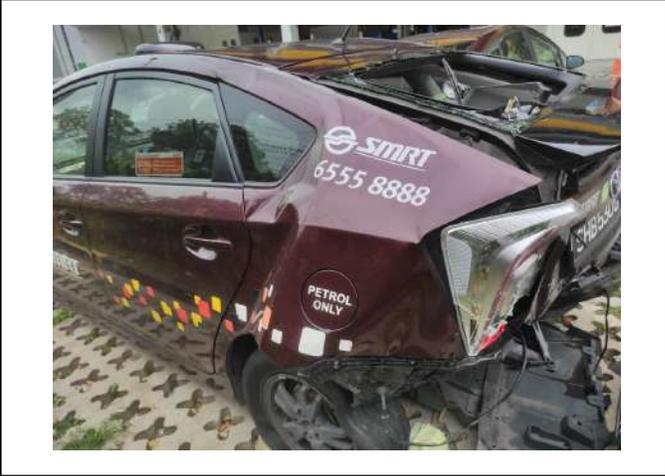





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

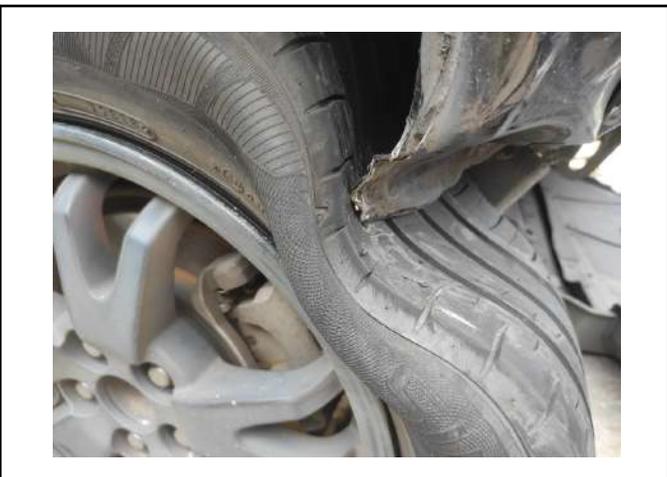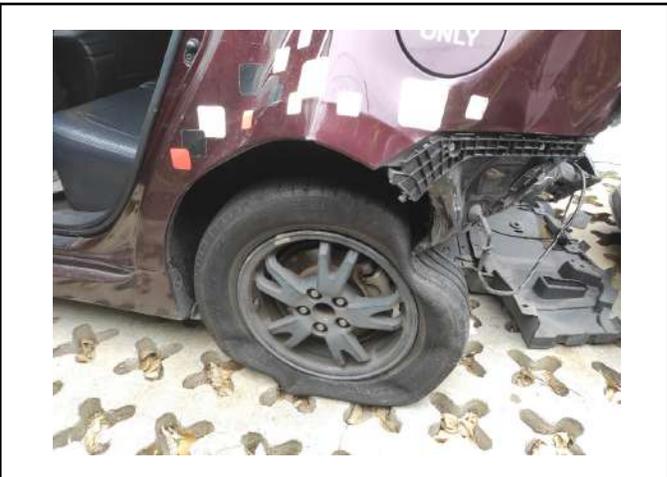





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

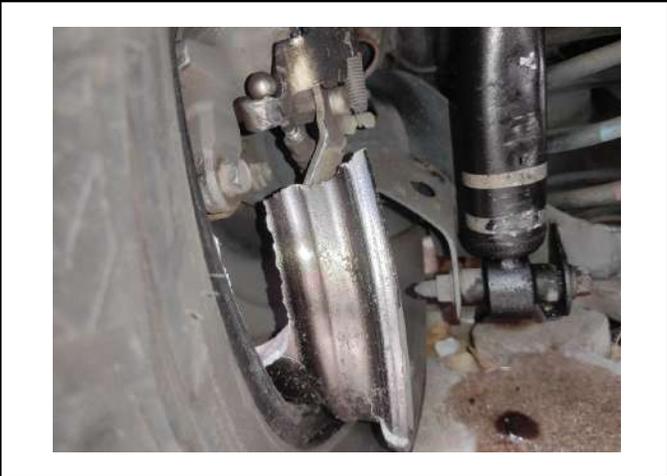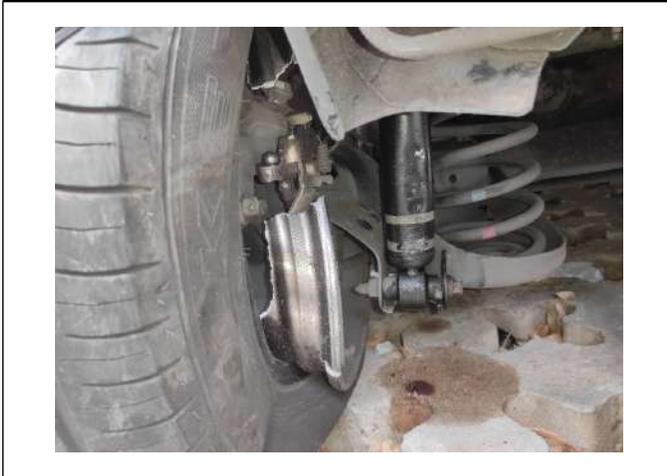



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

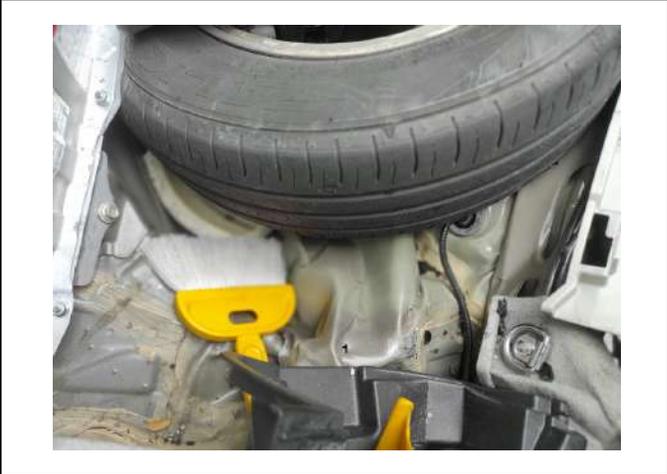







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

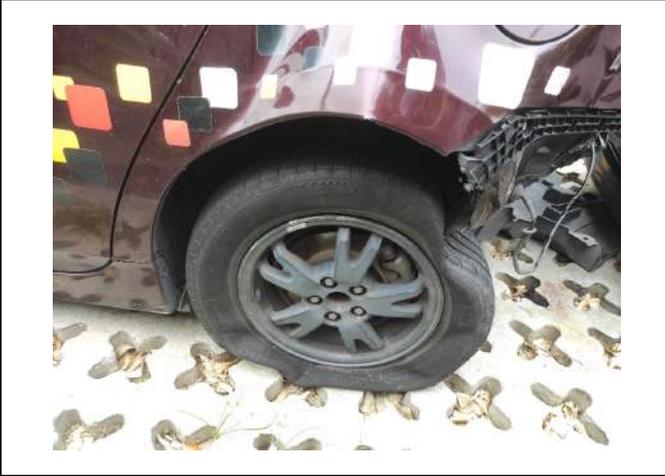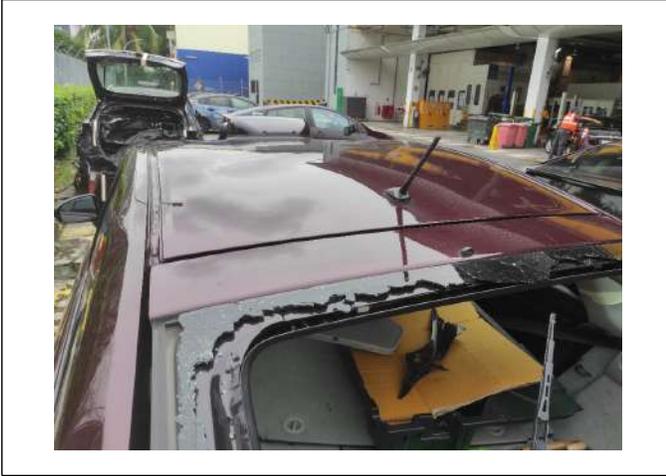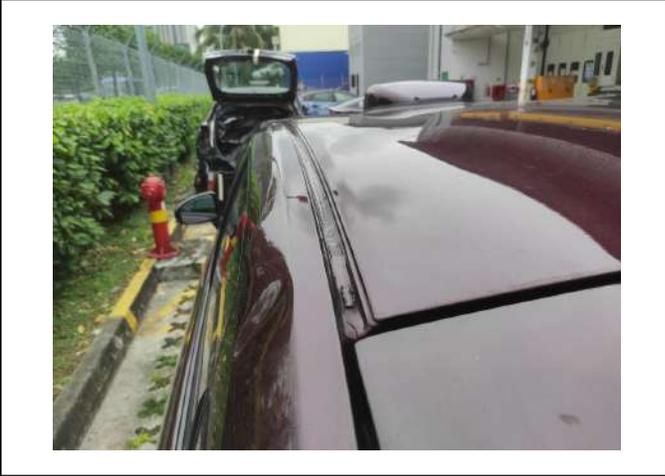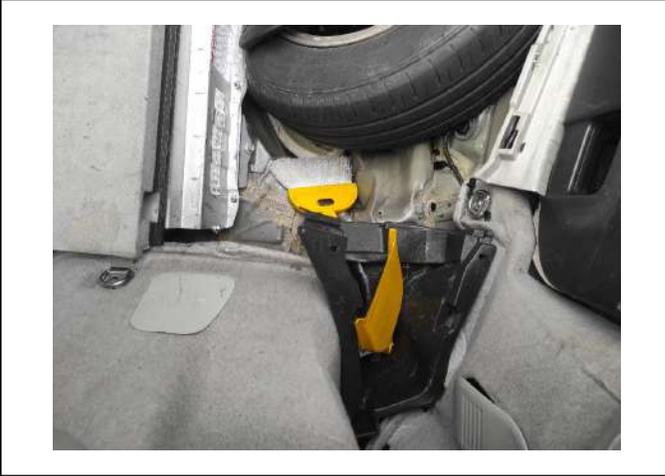





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

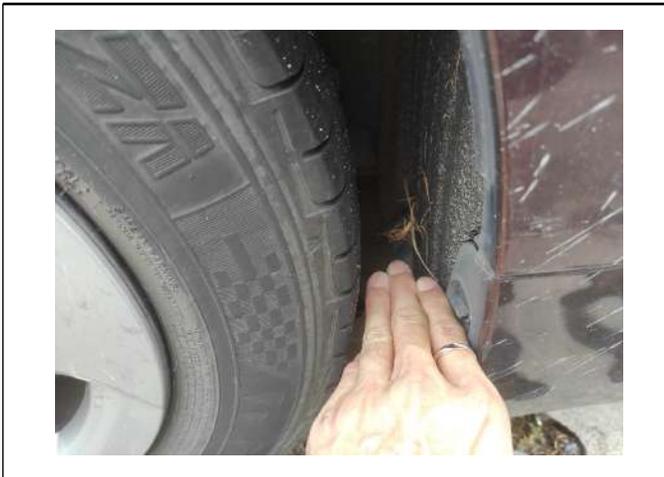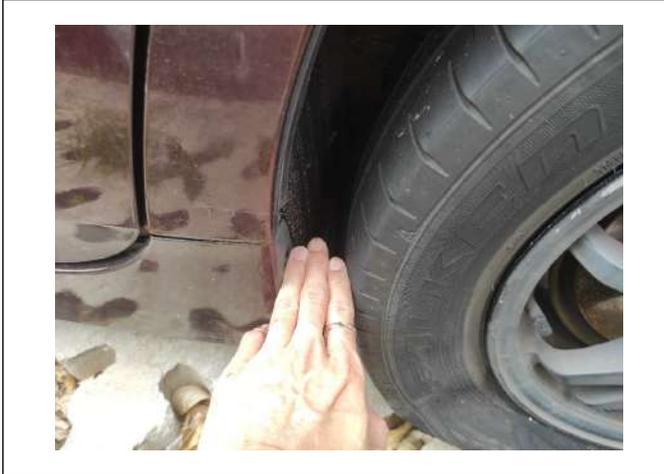






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

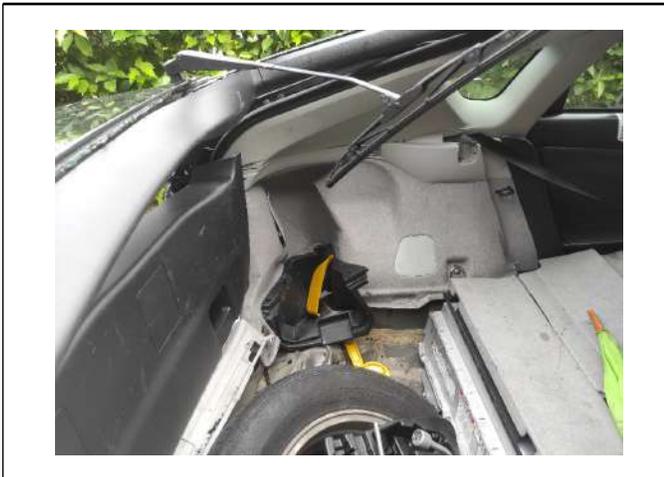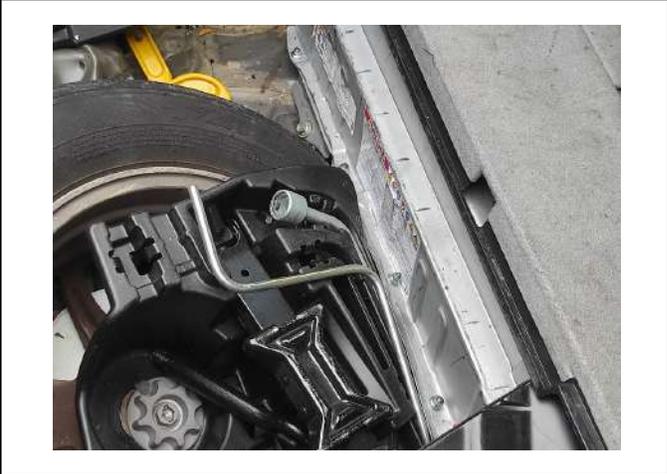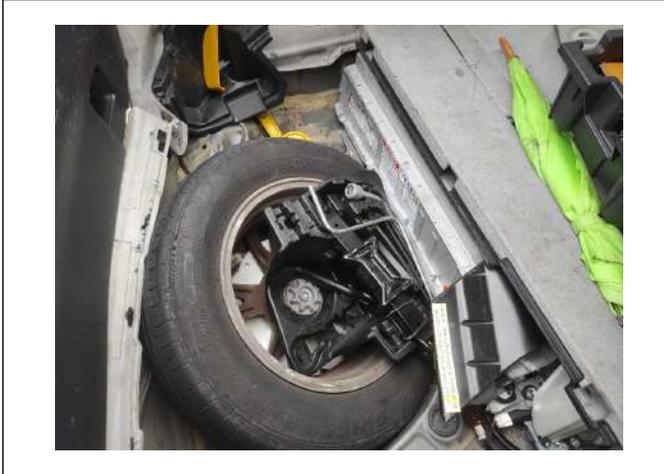



# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 530G

RE-INSPECTION

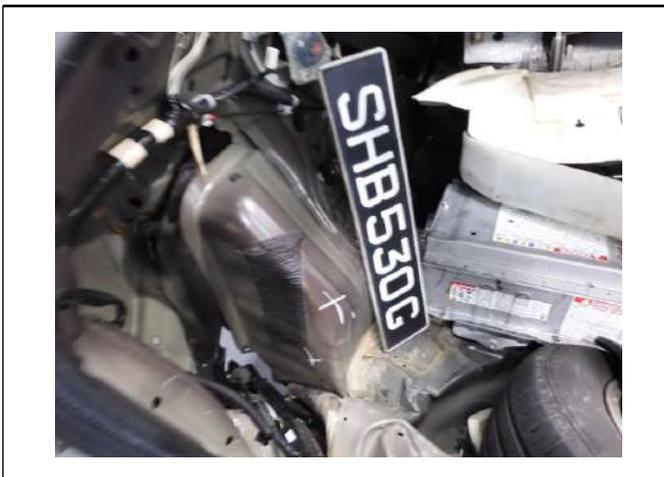




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

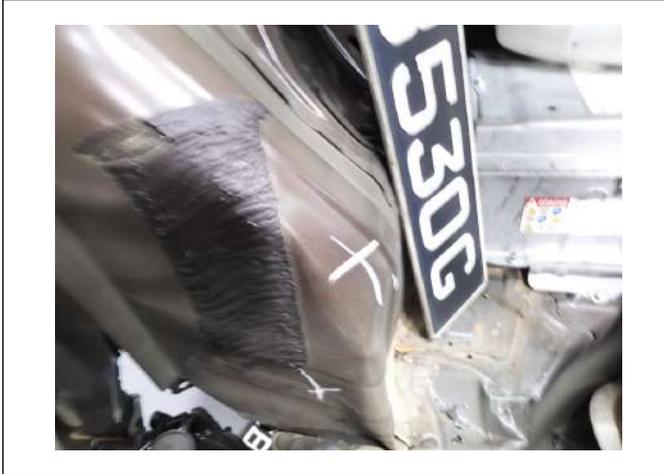



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

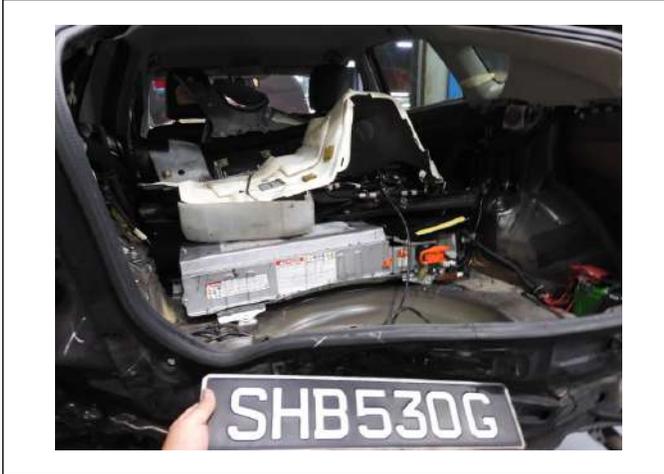



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SHB 530G

## RE-INSPECTION

