

AUTOMOBILE INSPECTION SERVICES PTE LTD

Postal Address : BLK 146 , POTONG PASIR AVE 1 , #02-145 SINGAPORE 350146

Reg. No. 200005790R TEL NO : 62860155 (3 LINES) FAX: 62841539

SURVEY/ADJUSTING DAMAGES ON MOTOR VEHICLE , LICENSED APPRAISERS.

AUTOMOBILE INSPECTION REPORT

TO: MR TAY SENG LEON	PAGE : 1
C/o S THREE AUTOMOTIVE RECOVERY PTE LTD	DATE : 02/03/2020
BLK 8 SIN MING IND. ESTATE #01-64/66	OUR REF : TPA/0026/19
SINGAPORE 575643	

REFERENCE & PARTICULARS:

THIRD PARTY CLAIM

VEHICLE NO	: SJS1779L	INSPECTION REQUEST BY	: THE OWNER
INSURED OWNER	: AS ABOVE		
POLICY NO	: N.A	ASSIGNMENT DATE	: 28/11/2019
CLAIM NO	: N.A	SUM INSURED	: NOT APPLICABLE
ACCIDENT DATE	: 25/11/2019	EXCESS AMOUNT	: NOT APPLICABLE

PARTICULARS OF DAMAGED VEHICLE:

MAKE/MODEL	: KIA SORENTO 2.2 (A)	PRE-ACCIDENT CONDITION	: GOOD
YEAR	: 26/04/2018	STEERING	: IN ORDER
CAPACITY	: 2199	BRAKES	: IN ORDER
ENGINE NO	: NOT VISIBLE	MILEAGE	: 38279
CHASSIS NO.	: KNAPH81BMJ5447381	COLOUR	: WHITE

TYRE CONDITION:

SIZE (FRONT) : 235/60R18

SIZE (REAR) : 235/60R18

NEAR SIDE

OFF SIDE

FRONT REMAINING THREADS: 6 MM GOODYEAR

6 MM GOODYEAR

REAR REMAINING THREADS : 6 MM GOODYEAR

6 MM GOODYEAR

GENERAL DESCRIPTION OF DAMAGE:

DAMAGED TO THE REAR PORTION, REAR BUMPER, BOOTLID DENTED, REAR PANEL, EXHAUST MISALIGN, ETC.
FOR FURTHER DETAILS, PLEASE REFER TO OVERLEAF.

INSPECTION:

SURVEY HELD AT	: S-THREE AUTOMOTIVE RECOVERY PTE LTD
	BLK 8 SIN MING INDUSTRIAL ESTATE #01-64/66, SINGAPORE 575643
PHOTOGRAPH	: 93
	INSPECTED DATE : 28/11/2019


REMARKS : (SUBJECT TO POLICY CONDITION)

WE HAVE REINSPECTED THE ABOVE VEHICLE AND FOUND THAT IT IS IN ORDER
THIS SURVEY WAS CONDUCTED STRICTLY "WITHOUT PREJUDICE"

ESTIMATED NORMAL PERIOD OF REPAIRS: (10)WORKING DAYS

IN ACCORDANCE WITH YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

This estimate covers visible damages only. Should there be any discrepancy or unseen items in this survey, kindly
notify the company within (7) days from the date hereof. Otherwise this estimate/acceptance shall be treated as valid .

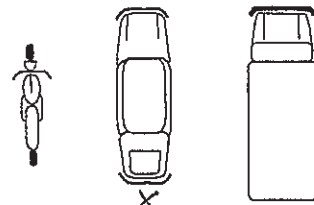

AUTOMOBILE INSPECTION SERVICES PTE LTD

VEHICLE NO : SJS1779L POLICY NO : N.A
CLAIM NO : N.A OUR REF : TPA/0026/19

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS:

S/N	QTY	DESCRIPTIONS	COMMENTS/CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
<u>Material Items</u>					
1	1	TAILGATE	DENTED	1,778.00	1,778.00 <i>x</i>
2	1	TAILGATE INNER TRIM	TORN	398.00	398.00 <i>x</i>
3	1	TAILGATE LOCK	BENT	652.00	652.00 <i>x</i>
4	1	TAILGATE LOCK CATCH	SERVICEABLE	328.00	0.00
5	1	TAILGATE ABSORBER LH	SERVICEABLE	914.00	0.00
6	1	TAILGATE ABSORBER RH	SERVICEABLE	914.00	0.00
7	2	TAILGATE HINGE LH/RH	SERVICEABLE	60.00	0.00
8	1	TAILGATE GLASS MOULDING	NECESSARY	180.00	180.00 <i>x</i>
9	1	TAILGATE EMBLEM (LOGO)	NECESSARY	69.00	69.00 <i>/</i>
10	1	TAILGATE EMBLEM (SERENTO)	NECESSARY	48.00	48.00 <i>/</i>
11	1	TAILGATE EMBLEM (C&C)	NECESSARY	50.00	50.00 <i>/</i>
12	1	TAILGATE EMBLEM (ECO DYNANICS)	NECESSARY	47.00	47.00 <i>/</i>
13	1	TAILGATE RUBBER STOPPER LH	SERVICEABLE	20.00	0.00
14	1	TAILGATE RUBBER STOPPER RH	CUT	20.00	20.00 <i>x</i>
15	1	TAIL LAMP LH	EDGE TORN	598.00	598.00 <i>x</i>
16	1	TAIL LAMP RH	EDGE TORN	598.00	598.00 <i>x</i>
17	1	REAR BUMPER	DENTED/CUT	795.00	605 - 795.00
18	1	REAR BUMPER REFLECTOR LH	BASE TORN	125.00	125.00 <i>/</i>
19	1	REAR BUMPER REFLECTOR RH	BASE TORN	125.00	125.00 <i>/</i>
20	1	REAR BUMPER REFLECTOR COVER LH	EDGE BROKEN	48.00	48.00 <i>/</i>
21	1	REAR BUMPER REFLECTOR COVER RH	EDGE BROKEN	48.00	48.00 <i>/</i>
22	1	REAR BUMPER REINFORCEMENT	BENT	330.00	330.00 <i>x</i>
23	1	REAR BUMPER RETAINER LH	TORN	35.00	35.00 <i>/</i>
24	1	REAR BUMPER RETAINER RH	TORN	35.00	35.00 <i>/</i>
25	1	REAR BUMPER BRACKET LH	SERVICEABLE	55.00	0.00
26	1	REAR BUMPER BRACKET RH	BENT	55.00	55.00 <i>x</i>
27	1	REAR BUMPER SIDE HOLDER LH	TORN	50.00	50.00 <i>x</i>
28	1	REAR BUMPER SIDE HOLDER RH	TORN	50.00	50.00 <i>x</i>
29	1	REAR END PANEL	DENTED/BENT	555.00	555.00 <i>x</i>
30	1	REAR END PANEL GARNISH	DEFORMED	188.00	188.00 <i>x</i>
31	1	REAR EXHAUST PIPE	BENT	1,190.00	1,190.00 <i>x</i>
32	1	REAR EXHAUST PIPE MOUNTING	CRACKED	50.00	50.00 <i>x</i>
33	1	CENTRE EXHAUST PIPE	BENT	980.00	980.00 <i>x</i>
34	1	CENTRE EXHAUST PIPE MOUNTING	SERVICEABLE	35.00	0.00
35	1	REAR NUMBER PLATE LAMP	SERVICEABLE	33.00	0.00
36	1	REAR BUMPER CENTER	DENTED	880.00	565 - 880.00
38	1	REAR BUMPER LOWER SPOILER	DENTED	218.00	105 - 218.00
38	1SET	REAR BUMPER REVERSE SENSOR - 2PCS	SHORTED/DENTED	1,160.00	580.00 <i>/</i>
39	1	TAILGATE SENSOR KEYLESS CONTROL	BROKEN	147.00	53 - 147.00
40	1	TAILGATE RUBBER BEADING	TORN	188.00	188.00 <i>x</i>
41	1	TAILGATE SUCTION LOCK	SERVICEABLE	880.00	0.00

AUTOMOBILE INSPECTION SERVICES PTE LTD

VEHICLE NO : SJS1779L POLICY NO : N.A
CLAIM NO : N.A OUR REF : TPA/0026/19

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS:

S/N	QTY	DESCRIPTIONS	COMMENTS/CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
42	1	TAILGATE SAFETY SENSOR LH	SERVICEABLE	480.00	0.00
43	1	TAILGATE SAFETY SENSOR RH	SERVICEABLE	480.00	0.00
44	1	TAILGATE LAMP LH	BASE TORN	SVC 550.00	550.00 X
45	1	TAILGATE LAMP RH	BASE TORN	" 550.00	550.00 X
46	1	TAILGATE INNER TRIM BOARD	HOLDER TORN	" 425.00	425.00 X
47	1	TAILGATE SUCTION DAMPER	SERVICEABLE	1,200.00	0.00
				18,614.00	12,635.00
SubTotal: Org -10.0% Rev -10.0% Discount				-1,861.40	-1,263.50
				16,752.60	11,371.50
				0.00	0.00
Total Material				\$16,752.60	\$11,371.50
<u>Special Nett Items</u>					
1	1SET	REAR BUMPER CLIPS	NECESSARY	50.00 30	40.00
2	1SET	REAR END PANEL GARNISH CLIPS	NECESSARY	50.00 SVC	30.00 X
3	1	REAR END PANEL SEALANT	NECESSARY	80.00 "	50.00 X
4	1	TAILGATE GLASS INNER SEAL	NECESSARY	120.00 "	50.00 X
5	1	TAILGATE GLASS SEALANT	NECESSARY	120.00 "	60.00 X
6	1	REAR NUMBER PLATE	SERVICEABLE	40.00 "	0.00 X
				460.00	230.00
				0.00	0.00
				460.00	230.00
				0.00	0.00
Total S/Nett				\$460.00	\$230.00
<u>Labour & Misc</u>					
1		STRAIGHTEN & PANEL BEAT ACCIDENT AREA		1,200.00 500	800.00
2		SPRAY PAINTING ON ACCIDENT AREA		1,200.00 600	800.00
3		CHECK & REPAIR WIRING SYSTEM		120.00 30	50.00
4		RESPRAY TUFF KOTE ON ACCIDENT AREA		180.00 30	50.00
5		R&R SPARE TYRES BOARD, CARPET & TRIM TO ASSIST REPAIR		120.00 30	80.00

AUTOMOBILE INSPECTION SERVICES PTE LTD

VEHICLE NO : SJS1779L POLICY NO : N.A
CLAIM NO : N.A OUR REF : TPA/0026/19

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS:

S/N	QTY	DESCRIPTIONS	COMMENTS/CONDITION	ORIGINAL QUOTATION	REVISED QUOTATION
6		R&R SEATS & CARPET TO ASSIST REPAIR		120.00	0.00
7		R&R EXHAUST SYSTEM		200.00	100.00 X
8		R&R TAILGATE COMPONENTS		100.00	80.00 X
9		R&R TAILGATE GLASS		160.00	160.00 X
				3,400.00	2,120.00
				0.00	0.00
				3,400.00	2,120.00
				0.00	0.00
Total Labour				\$3,400.00	\$2,120.00
Total Parts				\$17,212.60	\$11,601.50
Total Parts And Labour				\$20,612.60	\$13,721.50
CONTRACT JOB AS AGREED AT LUMP SUM					\$11,000.00
Nett Total					\$11,000.00

AUTOMOBILE INSPECTION SERVICES PTE LTD

hif
Mr E. C. Looi | Mr I. H. Looi BBM
MIMI AMSOE AMIRTE | MIMI AIIRSM
AMSAE MSAAA Dip. MTM Licensed Appraiser

5 repair days