



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203633

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 13/06/2022
Reference CC6/CTI21006104/Kea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SDZ 1132L
Insured Veh. GBD 8712G
Claim No. SNM21D202902/C02
Policy No. DMCVSNW00093862000
Accident Date 18/05/2021
Inspection Date 21/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21006104/Kea3q2 Date: 13/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBD 8712G	Veh. Inspected	SDZ 1132L
	Policy No.	DMCVSNW00093862000	Coverage (\$)	0.00
	Claim No.	SNM21D202902/C02	Excess (\$)	0.00
	Assign From		Assign Date	21/05/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA HARRIER (A)	c.c	1986
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	ZSU600070196	Colour	METALLIC PEARL WHITE
	Odometer	148176 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	235/55 R18	CONTINENTAL	6 mm
	L/H Front Tyre	235/55 R18	CONTINENTAL	6 mm
	R/H Rear Tyre	235/55 R18	CONTINENTAL	4 mm
	L/H Rear Tyre	235/55 R18	CONTINENTAL	4 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	18/05/2021	Inspection Date	21/05/2021
	Survey held at	GUAN MOTOR WORKS 176 SIN MING DRIVE #02-03 SIN MING AUTOCARE SINGAPORE 575721		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SDZ 1132L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	BENT	1,567.80	1,450.60
1	REAR BUMPER LOWER SPOILER	DENTED / CUT	547.60	455.10
2	REAR BUMPER REFLECTOR	SERVICEABLE	114.40	-
2	REAR BUMPER SIDE RETAINER	O/S DISTORTED	143.14	71.57
1	SET REAR BUMPER CLIPS	NECESSARY	40.00	40.00
1	REAR BUMPER INNER FOAM	CRACKED	185.60	185.60
1	RH TAILLAMP	CRACKED	492.70	492.70
1	REAR TAILGATE	BENT	1,721.50	1,712.00
1	REAR TAILGATE WINDSCREEN GLASS	SHATTERED	1,351.20	1,351.20
1	SET REAR TAILGATE WINDSCREEN MOULDING	NECESSARY	187.90	187.90
1	REAR TAILGATE RH SIDE LAMP	CRACKED	492.80	492.80
1	REAR TAILGATE CENTRE TOP CENTRE 'TOYOTA' LOGO	NECESSARY	58.80	58.80
1	REAR TAILGATE LH 'HARRIER' EMBLEM	NECESSARY	58.40	58.40
1	REAR TAILGATE TOP LOCK	TO REPAIR SEE LABOUR	961.40	-
1	REAR TAILGATE LOWER LOCK CATCH	TO REPAIR SEE LABOUR	49.30	-
1	REAR TAILGATE INNER TRIM BOARD	MTG CRACKED	478.50	478.50
1	SET REAR TAILGATE INNER TRIM BOARD CLIPS	NECESSARY	60.00	60.00
2	REAR TAILGATE DAMPER	O/S PUNCTURE	1,232.50	616.25
1	REAR SPEAKER BOARD /PARCEL SELF	CUT	692.90	692.90
1	REAR END PANEL	BENT	791.20	791.20
1	REAR END PANEL TOP GARNISH	DENTED	367.05	367.05
1	REAR SPARE TYRE PANEL TOP BOARD	DENTED	793.20	793.20
	LESS 25% DISCOUNT		-3,096.97	-2,588.94
			9,290.92	7,766.83
1	REAR TAILGATE WEATHERSTRIP (50%) (SN)	CUT	357.00	178.50
	LESS 25% DISCOUNT		-89.25	-
			267.75	178.50



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>NETT ITEMS</u>			
1	REAR TAILGATE TOP SPOILER (N) (ADDITIONAL)	DENTED / CRACKED	5,025.30	4,810.20
1	REAR SPEAKER BOARD /PARCEL SELF (N) (ADDITIONAL)	RESPRAY	1,413.20	-
	LESS 25% DISCOUNT		-	-1,202.55
			6,438.50	3,607.65
	<u>SPECIAL NETT ITEMS</u>			
1	SET REVERSE SENSORS (SN)	SHORTED	250.00	200.00
1	SET REVERSE CAMERA (SN)	SERVICEABLE	550.00	-
1	SET REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	SET REAR END PANEL SEALANT (SN)	NECESSARY	50.00	30.00
			900.00	270.00
	<u>LABOUR</u>			
	LABOUR CHARGES FOR REMOVE /REFIT ,CUTTING/WELDING AND REPLACEMENT OF DAMAGES.INCLUSIVE OF THE REPAIR OF REAR TAILGATE TOP LOCK AND REAR TAILGATE LOWER LOCK CATCH.		1,000.00	700.00
	TO PUTTY AND SPRAY PAINTING CHARGES.		1,000.00	800.00
	TO REMOVE,REFIT REAR WINDSCREEN GLASS .		140.00	120.00
	TO CHECK WIRINGS AND LIGHTINGS.		50.00	20.00
	TO REMOVE ,REFIT REVERSE SENSOR & REVERSE CAMERA.		120.00	60.00
	TO REMOVE,REFIT REAR TAILGATE FITTINGS.		80.00	60.00
	TO REMOVE,REFIT REAR UPHOLSTERY AND ATTACHMENTS.		120.00	80.00
	TO SUPPLY AND APPLY ANTI RUST TREATMENT.		90.00	60.00
			2,600.00	1,900.00
GRAND TOTAL			19,497.17	13,722.98

Report Ref No. CC6/CTI21006104/Kea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			10,800.00
---	--	--	-----------

Report Ref No. CC6/CTI21006104/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDZ 1132L

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDZ 1132L

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

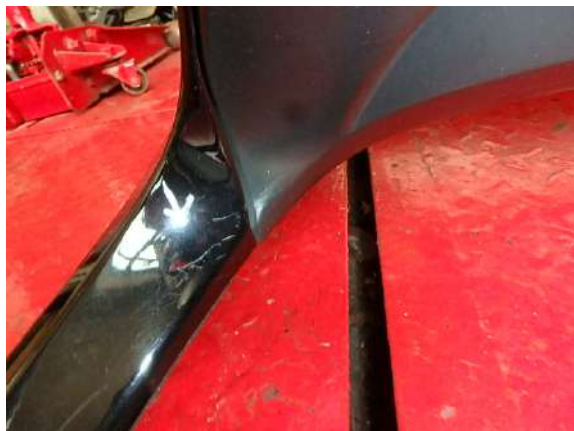



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDZ 1132L

RE-INSPECTION



TOYOTA MOTOR CORPORATION JAPAN
MODEL DBA-ZSU60W-ANXCF
ENGINE 3A-FX 1986 mL
FRAME No. ZSU60-0070196
COLOR TRIM PLANT OPTION
070 FA43 A31
TIME MILE KIT4 -01A 595