

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/121007313/14f3**ASSIGNMENT**

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLP 4487P
at Workshop m/s Pegasus 74 Kingston
of 628800 2/m.Insured: JEH6200

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: **The veh had commenced its repair at the time of inspection.**

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 8 days Res.: Yes or NoLum Sum: W % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: 9752881Veh No: SLP 4487B Yr Regn: 05/06/17Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Trailer or A /Make: Mercedes 3 c.c. 1496Colour: Grey A/C: Insured / Std / NI / NASp. Reading: 255286 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JM6BN22A8H0L52961Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/60R16
R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Triangle

Front

Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 06-03-20 D.O.I. 7/7/21

Survey held at _____

Des. of Damages: Frnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction union.

9/7/21 after 456000 8 by agree with union. photo accompanying 108 p.c.s.

Date/Time, File Pass to?

☐ : Preli. Report1) 16/7 turnish☐ : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 8

Resurvey No. of Trip: _____

Report Format: TRLump Sum / I.B.I. (\$) 6000Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

TOTAL



INVOICE

TO : GRAB RENTALS PTE LTD
C/O: PEGASUS ENGINEERING & TRADING PTE LTD
74 KIAN TECK ROAD,
SINGAPORE 628800

Invoice No.: 0220/PE452
PO Number.: PO20/03-1200
Date: 17-Mar-2020

PARTICULARS

Vehicle Registration No.: SLP 4487 B
Date of Loss: 06-Mar-2020
Date of Assessment: 06-Mar-2020

SERVICES

FEES

1. Assessment with report Photographs -
Including films, developing, storage and Transport.

\$550.00

TOTAL \$550.00

SINGAPORE DOLLARS FIVE HUNDRED FIFTY ONLY

We would appreciate your cheque crossed and made payable to:
"AEON AUTO CONSULTANTS LLP" with our invoice no. written on the back of the cheque.

AEON AUTO CONSULTANTS LLP



AEON AUTO CONSULTANTS LLP

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874
Telephone +65 97687958 Facsimile +65 68264112 Email amas@aeonac.com
Reg. No. LL0701273L (registered with limited liability)

AUTOMOBILE ASSESSMENT REPORT

TO: GRAB RENTALS PTE LTD
C/O: PEGASUS ENGINEERING & TRADING PTE LTD
74 KIAN TECK ROAD,
SINGAPORE 628800

Our Reference: 0220/PE452
Date: 17-Mar-2020

ASSESSMENT OF VEHICLE NO. SLP 4487 B
DATE OF LOSS: 06-Mar-2020

We have carried out a physical assessment at PEGASUS ENGINEERING & TRADING PTE LTD,
74 Kian Teck Road, Singapore 628800, according to your instruction
on 06-Mar-2020 and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No.:	SLP 4487 B
Make & Model:	MAZDA3 SEDAN 1.5 AT EU6
Year of Registration:	2017
Engine Capacity:	1496
Chassis No.:	JM6BN22A8H0152961
Engine No.:	P520444623
Colour:	GREY
Mileage (km):	173469

2. VEHICLE CONDITION

Body Paint:	GOOD
Steering:	SERVICEABLE
Foot Brake:	SERVICEABLE
Parking Brake:	SERVICEABLE
Modification:	NIL

3. TYRE PARTICULARS & CONDITION

Front		
RH Make/Size/Thread:	WESTLAKE	205/60 R16 - 70%
LH Make/Size/Thread:	WESTLAKE	205/60 R16 - 70%
Rear		
RH Make/Size/Thread:	TRIANGLE	205/60 R16 - 75%
LH Make/Size/Thread:	TRIANGLE	205/60 R16 - 75%


2-6447.10
202
5-157.68
7-5-37.08

4. DESCRIPTION OF DAMAGE

At the time of the inspection, the vehicle sustained damages to the FRONT and REAR portion.

5. REMARKS

Market Value:	Na
Salvage Value:	Na
Repair Limit:	Na
Estimated Amount:	\$16,525.28
Adjusted Amount:	\$11,722.08
Lump Sum:	\$9,300.00
Estimated Repair Days:	12 days

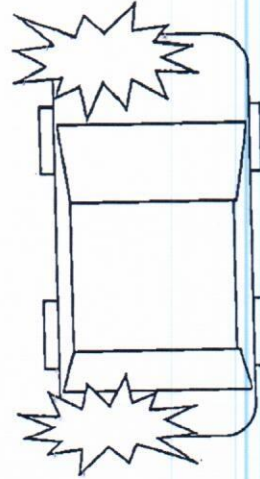

Pursuant to your instruction, we have NOT AUTHORISED repair.
The assessment was conducted on a "Without Prejudice" basis.
If we are not notified of anything to the contrary within 14 days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by Aeon Auto Consultants LLP for any reliance on this report by any third party.

ASSESSMENT REPORT FOR VEHICLE NO. SLP 4487 B

PARTS (LIST ITEMS)

Qty	Description	Condition	Workshop's Estimate	Our Assessment
1	FRONT TOP GRILLE COVER	Cracked <i>one</i>	340.00	340.00 ✓
6	FRONT TOP GRILLE COVER RIVET	Necessary <i>nee</i>	5.00	5.00 ✓
1	FRONT GRILLE LOWER BASE	Cracked <i>one</i>	185.00	185.00 ✓
2	FRONT GRILLE LOWER BASE CLIP	Necessary <i>nee</i>	5.00	5.00 ✓
1	FRONT GRILLE	Cracked <i>one</i>	198.00	198.00 ✓
6	FRONT GRILLE CLIP	Necessary <i>nee</i>	10.00	10.00 ✓
2	FRONT GRILLE WHITE CLIP HOLDER	Necessary <i>nee</i>	5.00	5.00 ✓
2	FRONT GRILLE BRACKET	Bent <i>bent</i>	45.00	45.00 ✓
4	FRONT GRILLE PIN	Necessary <i>nee</i>	5.00	5.00 ✓
2	FRONT GRILLE RIVET	Necessary <i>nee</i>	15.00	15.00 ✓
1	FRONT GRILLE 'LOGO' EMBLEM	Necessary <i>nee</i>	60.00	60.00 ✓
2	FRONT GRILLE SIDE COVER	Cracked <i>one</i>	45.00	45.00 ✓
2	FRONT GRILLE CHROME MOULDING	Cracked <i>one</i>	198.00	198.00 ✓
2	FRONT GRILLE CHROME MOULDING BASE	Cracked <i>one</i>	65.00	65.00 ✓
1	FRONT LH HEADLAMP	Cracked * <i>can't see dyed</i>	1,075.00	1,075.00 X
3	FRONT LH HEADLAMP CLIP	Necessary <i>nee</i>	4.00	4.00 X
1	FRONT LH HEADLAMP PANEL	Bent <i>nee</i>	168.00	168.00 X
1	FRONT BUMPER	Cracked <i>Deform</i>	866.80	866.80 ✓
2	FRONT BUMPER SIDE RETAINER L/R	Bent <i>bent</i>	70.00	70.00 ✓
2	FRONT BUMPER BRACKET	Bent <i>bent</i>	45.00	45.00 ✓
10	FRONT BUMPER CLIP	Necessary <i>nee</i>	4.00	4.00 ✓
2	FRONT BUMPER LOWER GRILLE SIDE COVER	Cracked <i>one</i>	48.00	48.00 ✓
1	FRONT BUMPER LH FOGLAMP	Faulty <i>no photo show dyed</i>	218.00	218.00 X
1	FRONT BUMPER LH FOGLAMP COVER	Cracked <i>no photo show dyed</i>	108.00	108.00 X
1	FRONT BUMPER LH FOGLAMP GARNISH EXTENTION	Cracked <i>no photo show dyed</i>	35.00	35.00 X
1	FRONT BUMPER LH FOGLAMP BRACKET	Bent <i>no photo show dyed</i>	40.00	40.00 X
1	FRONT BUMPER TOW HOOK COVER	Necessary <i>nee</i>	68.00	68.00 X
1	FRONT BUMPER ENGINE UNDER CENTER COVER	Cracked <i>no photo show dyed</i>	295.00	295.00 X
10	FRONT BUMPER ENGINE UNDER CENTER COVER CLIP	Necessary <i>nee</i>	4.00	4.00 X
1	FRONT BUMPER LOWER STIFF	Cracked <i>no photo show dyed</i>	185.00	185.00 X
1	FRONT BUMPER REINFORCEMENT	Repair <i>nee</i>	545.00	- X
1	FRONT SUPPORT TOP COVER	Cracked <i>no photo show dyed</i>	158.00	158.00 X
6	FRONT SUPPORT TOP COVER CLIPS	Necessary <i>nee</i>	5.00	5.00 X
1	FRONT SUPPORT PANEL	Repair <i>nee</i>	489.00	- X
1	FRONT LH FENDER	Repair <i>nee</i>	428.00	- X

ASSESSMENT REPORT FOR VEHICLE NO. SLP 4487 B

1	REAR BOOTLID	Bent	Bent	1,285.00	1,285.00	/
1	REAR BOOTLID 'LOGO' EMBLEM	Necessary	Re	75.00	75.00	/
1	REAR BOOTLID 'MAZDA 3' EMBLEM	Necessary	Re	65.00	65.00	/
1	REAR BOOTLID 'SKYACTIV' EMBLEM	Necessary	Re	85.00	85.00	/
2	REAR BOOTLID HINGES L/R	Bent	+	155.00	155.00	X
1	REAR BOOTLID INNER TRIM BOARD	Cracked	+	395.00	395.00	X
1	REAR BOOTLID INNER TRIM BOARD CLIP -SET	Necessary	11	4.00	4.00	X
1	REAR BOOTLID REFLECTOR LAMP LH	Cracked	one	159.00	159.00	/
1	REAR BOOTLID REFLECTOR LAMP RH	Reuse	11	159.00	-	X
2	REAR BOOTLID REFLECTOR CLIPS L/R - SET	Necessary	Re	12.00	12.00	/
2	REAR BOOTLID REFLECTOR GASKET L/R	Necessary	Re	15.00	15.00	/
1	REAR BOOTLID OUTER LOCK SWITCH	Reuse	11	148.00	-	X
2	REAR BOOTLID NUMBER PLATE LAMP L/R	Reuse	11	95.00	-	X
1	REAR BOOTLID LOCK STRIKER	Bent	-	55.00	55.00	X
1	REAR BOOTLID MECHANISM LOCK	Bent	+	298.00	298.00	X
2	REAR BOOTLID RUBBER GUIDE STOPPER L/R	Bent	+	25.00	25.00	X
1	REAR BOOTLID WEATHER STRIP	Cut	+	198.00	198.00	X
1	REAR TAILLAMP LH	Cracked	one	535.00	535.00	X
1	REAR TAILLAMP RH	Reuse	11	535.00	-	X
2	REAR TAILLAMP INNER RUBBER GASKET L/R	Necessary	Re	41.80	41.80	/
6	REAR TAILLAMP CLIPS L/R	Necessary	Re	10.00	10.00	/
1	REAR LH FENDER	Repair	R	1,575.00	-	X
2	REAR FENDER INNER TRIM L/R	Repair	11	990.00	-	X
20	REAR FENDER INNER TRIM CLIPS L/R	Necessary	11	8.00	8.00	X
2	REAR FENDER INNER SHIELD L/R	Cracked	+	310.00	310.00	X
2	REAR FENDER INNER SHIELD CLIPS L/R - SET	Necessary	11	8.00	8.00	X
1	REAR BUMPER	Cracked	D.S	1,175.00	1,175.00	/
10	REAR BUMPER CLIPS	Necessary	Re	4.00	4.00	/
1	REAR BUMPER CENTER BRACKET	Bent	Bent	45.00	45.00	/
2	REAR BUMPER REFLECTOR L/R	Necessary	11/one	115.00	115.00	1pc
1	REAR BUMPER REINFORCEMENT	Bent	Bent	545.00	545.00	/
2	REAR BUMPER SIDE RETAINER L/R	Bent	Bent	85.00	85.00	/
2	REAR BUMPER TOW HOOK COVER L/R	Necessary	Re	38.00	38.00	/
1	REAR END PANEL TOP GARNISH	Cut	-	125.00	125.00	X
10	REAR END PANEL TOP GARNISH CLIPS	Necessary	11	4.00	4.00	X
1	REAR END PANEL	Repair	R	715.00	-	X
				16,131.60	10,452.60	
Less 20% discount				3,226.32	2,090.52	
Parts Total:				12,905.28	8,362.08	

SPECIAL NETT ITEMS

1	FRONT BUMPER NUMBER PLATE	Bent	20
1	FRONT BUMPER NUMBER PLATE HOLDER	Bent	20
1	REAR BOOTLID NUMBER PLATE	1 pc	X
1	REAR BOOTLID NUMBER PLATE HOLDER	1 pc	X
1	REAR BUMPER REVERSE SENSOR	Shred	200

Bent	25.00	25.00
Cracked	50.00	50.00
Bent	25.00	25.00 X
Cracked	50.00	50.00 X
Cracked	350.00	350.00

Special Nett Total : 500.00 500.00

LABOUR

S/N	Description	Workshop's Estimate	Our Assessment
1	To remove, reinstall electrical wiring harness, check lighting, and rewire for parking sensor.	120.00	100.00 80
2	To remove, reinstall top trim upholstery, cushion seat, trim garnish, trim liner carpet.	100.00	80.00 ✓
3	To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,200.00	1,100.00 ✓
4	To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	1,600.00 800	1,500.00 900
5	To apply anti-rust chemical on repaired and replaced panel.	100.00	80.00 ✓
Labour Total :		3,120.00	2,860.00
TOTAL (PARTS & LABOUR) \$		16,525.28	11,722.08

The workshop has agreed to undertake the repair on a Lump Sum basis.
The final adjusted Lump Sum contract amount is

\$9,300.00

(SINGAPORE DOLLARS NINE THOUSAND THREE HUNDRED ONLY)



as Ong
omobile Assessor

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	200G

Vehicle Details

Vehicle No.:	SLP4487B
Vehicle to be Exported:	No
Intended Deregistration Date:	07 Jul 2021
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 SEDAN 1.5 AT EU6
Primary Colour:	Grey
Manufacturing Year:	2017
Engine No.:	P520444623
Chassis No.:	JM6BN22A8H0152961
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$14,761.00
Original Registration Date:	05 Jun 2017
First Registration Date:	05 Jun 2017
Transfer Count:	0
Actual ARF Paid:	\$9,761.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	04 Jun 2027
PARF Rebate Amount:	\$7,320.00

Intended COE Rebate Details

COE Expiry Date:	04 Jun 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$52,000.00
COE Rebate Amount:	\$30,726.00
Total Rebate Amount:	\$38,046.00

The information contained herein is correct as at 07 Jul 2021

OK