



TeamWork Garage Pte Ltd
53 Ubi Avenue 1 #01-24 Spore 408934
Paya Ubi Industrial Park
Tel : 6844 2475 Fax : 6844 2474
E-mail : claims@teamworkgarage.com
GST registered number : 201015366H

PROFOMA INVOICE - PI-2297

TAN JUN WEI
C/O 53 Ubi Avenue 1 #01-24
Paya Ubi Industrial Park
Singapore 408934

Date : 10-May-21
Vehicle number : SCX888T
Make Model : MITSUBISHI EVO 9
Accident date : 15-Jan-21
Reference number : 2101-46

Description		Amount SGD\$
Inclusive of supplying parts, labour, panel beating and spray painting		
Lump sum repair	:	15000.00
7% GST	:	1050.00
Grand total	:	16050.00
Singdollars: SIXTEEN THOUSAND AND FIFTY DOLLARS		



Teamwork Garage Pte Ltd

ST Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 60 Arab Street Singapore 199757

Tel: 66523352 / 98586761; Fax: 6297 0270

E mail - ttrajan@singnet.com.sg

Mailing Address: 161 Alexandra Post Office Singapore 911506

Invoice No : 06151

ORIGINAL

INVOICE

Date : 10 Mar 2021

Our Ref : TP / TWG SCX888T/ 01.15/21

Your Ref :

CUSTOMER PARTICULARS

Name	:	Mr Tan Jun Wei
Address	:	No 16 Lucky Rise Singapore 467523

ASSIGNMENT

TP Motor Claims by SCX 888 T

DESCRIPTION

A set of Survey Report, correspondence & consultation. Other disbursements incurred. Transport charges.

AMOUNT CHARGEABLE

\$833.00

TOTAL

\$833.00

Terms of payment: 7 days from date of invoice

All Payments please make payment to "ST Appraisal Services"


Authorised Signature

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address : 60 Arab Street Singapore 199757
Tel: 66523352 / 98586761 / 96786893 Fax: 63924709

Mailing Address : 161 Alexandra Post Office Singapore 911506

Date : 10th Mar 2021

Our Ref : TP / TWG SCX888T/ 01.15/21
Your Ref :

Mr Tan Jun Wei
No 16
Lucky Rise
Singapore 467523

DAMAGED VEHICLE (SCX 888 T) INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:

(A) Reference

Name of Claimant	: Mr Tan Jun Wei	Date of Request	: 2 nd Feb 2021
Policy No.	: Please Advise	Referred By	: Insured
Claim No.	: Please Advise	Date of Inspection	: 2 nd Feb 2021
Accident Date	: 15 th Jan 2021	Date of Re-inspection	:
Place of Inspection	: M/s Team Work Garage Pte Ltd	Sum Insured	: NA
	53 Ubi Avenue 1	Excess Amount	: NA
	#01-23 Paya Ubi Industrial Park	3 rd Party Vehicle	: Please Advise
	Singapore 408934	3 rd Party Insurer	: Please Advise

(B) Particulars of Vehicle

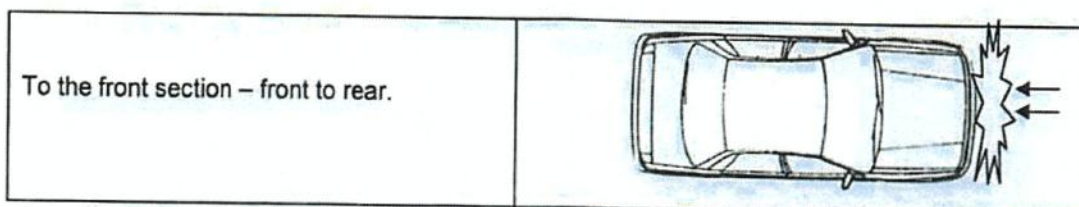
Registration No	SCX 888 T	Mileage	087718 Km
Make & Model	MITSUBISHI EVO 9	Engine No	-
Date of Registration	-	Chassis No.	CT9A0405965
Colour	Purple	Engine Capacity	1,997 c.c.

(C) Pre-Accident Condition (Static Test Only)

Steering	: In order	Paint Work	: Good
Foot-brake	: In order	Modification	: NIL
Hand-brake	: In order	General Condition	: Good

(D) Tyre Condition

	Tread Depth	Make	Size
Front RH	60 %	GOODYEAR	245/40 R18
Front LH	60 %	GOODYEAR	245/40 R18
Rear RH	60 %	GOODYEAR	245/40 R18
Rear LH	60 %	GOODYEAR	245/40 R18

(E) Point of Impact**(F) General Description of Damages**

The impact of the collision has damaged the bonnet, front bumper, front bumper lower spoiler, headlamps and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

(G) Recommendation

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of lump sum repair is **\$15,000.00** and an estimated **6** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

(H) Remarks

We have not authorised the repairs. However for information, under normal circumstances, the repairs should not exceed **6** working days subject to parts availability.

This inspection/damage assessment was conducted on a "without prejudice" basis.

We are pleased to advice that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services



T T RAJAN
MVI, ITC (Mechanical), NTC (Motor Vehicle)
ASIET, MSAAA, Assessor/Appraiser
AD041-2007532D

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SCX 888 T

Adjustment of Spare Parts Costs for Repairs

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost	
1	2	Front bumper retainer X SVC	necessary	126.30	10	113.67	
2	1	Front bumper reinforcement X SVC	dented	317.20	10	285.48	
3	1	Front bumper support X SVC	damaged	241.80	10	217.62	
4	2	Headlamp assembly ✓	cracked	4720.80	190010	4248.72	
5	1	Bonnet lock ✓	distorted	181.90	135 10	163.71	
6	1	Front number plate garnish X SVC	damaged	82.90	10	74.61	
7	1	Air con condenser ✓	damaged	1120.00	✓ 10	1008.00	
8	1	Radiator ✓	damaged	1421.00	700 10	1278.90	
9	1	Air con fan assembly X SVC	damaged	922.00	10	829.80	
10	1	Cooling fan assembly X SVC	damaged	897.60	10	807.84	
					3855	3469.5	
<u>Special Nett items</u>							
1	1	Bonnet - SEIBON ✓	damaged	2200.00		2000.00	1350
2	1	Front bumper - VARIS ✓	damaged	2800.00		2650.00	1100
3	1	Front bumper grille mesh ✓	damaged	250.00		220.00	150
4	1	Front bumper lower spoiler X SVC	damaged	1200.00		1100.00	
5	1	Intercooler ✓	damaged	1500.00		1400.00	1100
6	1	Front number plate X SVC	damaged	80.00		70.00	
7	1 set	Front bumper clip ✓	necessary	50.00		30.00	✓
				18111.50		16498.35	3730

Adjustment of Labour Costs for Repairs

To remove and replaced damaged parts including straightening and repositioning replacement parts.	1400.00	1080.00	400
Supply paint material and necessary items. To respray front bumper, front support panel and other affected panels.	1400.00	900.00	400
To check electrical components for proper functions.	60.00	50.00	30
To carry out anti rust treatment on affected panels.	150.00	80.00	×
To remove and replace air con condenser. To check for proper functions.	200.00	140.00	120
Total labour	3210.00	2250.00	950

Adjustment Parts and Labour Costs of Repairs

	Estimated by workshop	Adjusted cost (S\$)
TOTAL PARTS COSTS	18111.50	16498.35
TOTAL LABOUR COSTS	3210.00	2250.00
TOTAL REPAIR COSTS	21321.50	18748.35
ADJUSTED REPAIR COST		15000.00

8149.5

-20%: 6500

4 Days