



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2202041
3 ANSON ROAD #16-00	INV Date	08/04/2021
SPRINGLEAF TOWER	Reference	CC6/CTI21007638/Kea3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMX 9804H
Insured Veh.	SJF 5888Y
Claim No.	SNM21D203836/C02
Policy No.	DMPCSNA00082752105
Accident Date	10/07/2021
Inspection Date	13/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21007638/Kea3q2 Date: 08/04/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJF 5888Y	Veh. Inspected	SMX 9804H
Policy No.	DMPCSNA00082752105	Coverage (\$)	0.00
Claim No.	SNM21D203836/C02	Excess (\$)	0.00
Assign From		Assign Date	13/07/2021
2. Vehicle Particulars & Condition			
Make & Model	HONDA SHUTTLE (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2021
Chassis No.	GK82103964	Colour	METALLIC GREY
Odometer	46225 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	185/65 R15	YOKOHAMA	3 mm
L/H Front Tyre	185/65 R15	YOKOHAMA	3 mm
R/H Rear Tyre	185/65 R15	YOKOHAMA	3 mm
L/H Rear Tyre	185/65 R15	YOKOHAMA	3 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	10/07/2021	Inspection Date	13/07/2021
Survey held at	THIAM HENG HUAT PTE LTD 176 SIN MING DRIVE #05-14 SINGAPORE 575721		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMX 9804H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BUMPER	BENT	1,165.00	936.50
2	REAR BUMPER SIDE RETAINER @\$56.00	DISTORTED (1 PCS ONLY)	112.00	56.00
1	REAR BUMPER REFLECTOR N/S	MTG CRACKED	151.00	90.00
1	TAILLAMP O/S	MTG CRACKED	728.00	520.00
1	TAILLAMP LOWER BRACKET N/S	CRACKED	151.00	151.00
1	TAILLAMP LOWER PANEL N/S	TO REPAIR SEE LABOUR	528.00	-
1	END PANEL TOP GARNISH	SERVICEABLE	178.00	-
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	935.00	-
1	SPARE TYRE TOP BOARD	SERVICEABLE	311.00	-
1	REAR BUMPER TOW COVER	SERVICEABLE	67.00	-
1	REAR FENDER INNER TRIM BOARD N/S	SERVICEABLE	437.00	-
1	REAR BOOT WEATHERSTRIP	SERVICEABLE	239.00	-
1	REAR AIR DUCT N/S	SERVICEABLE	55.00	-
1	TAILGATE	BENT	1,789.00	1,193.00
1	TAILGATE LOCK	TO REPAIR SEE LABOUR	215.00	-
1	TAILGATE LOCK STRIKER	TO REPAIR SEE LABOUR	84.00	-
1	TAILGATE WEATHERSTRIP	SERVICEABLE	189.00	-
1	TAILGATE CENTER GARNISH	SERVICEABLE	315.00	-
1	TAILGATE 'HONDA' LOGO	NOT NECESSARY	75.00	-
1	TAILGATE REFLECTOR LAMP N/S	SERVICEABLE	530.00	-
2	REAR LICENSE PLATE LAMP @\$55.00	SERVICEABLE	110.00	-
1	REAR WINDSCREEN MOULDING	NECESSARY	170.00	170.00
1	TAILGATE 'SHUTTLE' EMBLEM	NECESSARY	56.00	56.00
2	TAILGATE HINGE @\$119.00	TO REPAIR SEE LABOUR	238.00	-
1	REAR FENDER COWLING N/S	SERVICEABLE	198.00	-
1	REAR FENDER N/S	TO REPAIR SEE LABOUR	1,102.00	-

Report Ref No. CC6/CTI21007638/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FENDER GLASS MOULDING N/S	NOT NECESSARY	185.00	-
1	REAR BUMPER CHROME MOULDING	NECESSARY	198.00	178.00
1	KEYLESS SENSOR	CRACKED	257.00	122.70
1	KEYLESS SENSOR BRACKET	TO REPAIR SEE LABOUR	85.00	-
1	REAR BUMPER SIDE SPONGE N/S	SERVICEABLE	185.00	-
	LESS 20% DISCOUNT		-2,207.60	-694.64
			8,830.40	2,778.56
	<u>SPECIAL NETT ITEMS</u>			
10	REAR BUMPER CLIPS @\$4.50 (SN)	NECESSARY	45.00	45.00
6	TAILLAMP CLIPS @\$4.50(SN)	NOT NECESSARY	27.00	-
8	REAR FENDER COWLING N/S CLIPS @\$4.50 (SN)	NOT NECESSARY	36.00	-
1	END PANEL SEALANT (SN)	NOT NECESSARY	100.00	-
6	END PANEL TOP GARNISH CLIPS @\$4.50 (SN)	NOT NECESSARY	27.00	-
1	TAILLAMP PANEL N/S SEALANT (SN)	NOT NECESSARY	80.00	-
8	REAR FENDER INNER TRIM BOARD N/S CLIPS @\$4.50 (SN)	NOT NECESSARY	36.00	-
4	TAILGATE CENTER GARNISH CLIPS @\$4.50 (SN)	NOT NECESSARY	18.00	-
1	REAR FENDER GLASS SEALANT N/S (SN)	NOT NECESSARY	80.00	-
8	TAILGATE INNER TRIM BOARD CLIPS @\$4.50 (SN)	NOT NECESSARY	36.00	-
1	REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR LICENCE PLATE & FRAME (SN)	SERVICEABLE	55.00	-
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			870.00	245.00
	<u>LABOUR</u>			
	TO DISMANTLE /RENEW THE ACCIDENT DAMAGED PORTION .TO PANEL BEAT ,RESHAPE ,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF TAILLAMP LOWER PANEL N/S,SPARE TYRE PANEL,TAILGATE LOCK ,TAILGATE LOCK STRIKER ,TAILGATE HINGE ,REAR FENDER N/S AND KEYLESS SENSOR BRACKET .		1,400.00	500.00
	TO DISCONNECT REAR WIRE HARNESSSES OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS ,RECONNECT AND CHECK FUNCTIONS INCLUDING TAILLAMP LIGHTINGS.		50.00	20.00

Report Ref No. CC6/CTI21007638/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE ,REFIT TAILGATE COMPONENTS TO REPLACE TAILGATE ,CHECK AND RE-ADJUST CLOSE GAP,ALIGNMENT AND WATER SEEPAGE.		100.00	60.00
	TO REMOVE AND REFIT REAR WINDSCREEN TO FACILITATE REPAIR WORK.		150.00	120.00
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.		100.00	30.00
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA /PANEL.		1,200.00	600.00
			3,000.00	1,330.00
	GRAND TOTAL		12,700.40	4,353.56
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			3,450.00

Report Ref No. CC6/CTI21007638/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMX 9804H

INSPECTION

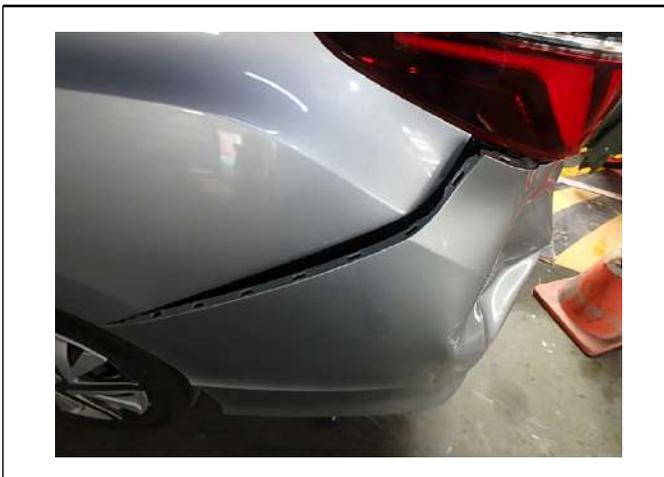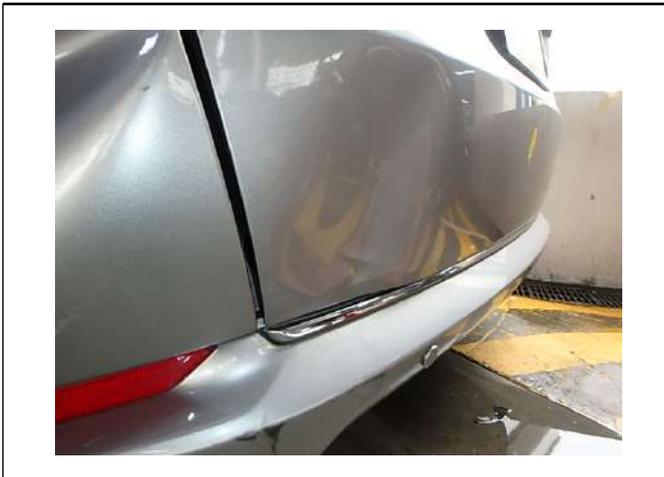



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMX 9804H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMX 9804H

RE-INSPECTION

