



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2107122

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/10/2021
Reference CC6/CTI21007645/Eea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBK 3115B
Insured Veh. GV 3649K
Claim No. SNM21D203804/C02
Policy No. DMCVSNW00044382100
Accident Date 05/07/2021
Inspection Date 14/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21007645/Eea3q2 Date: 15/10/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GV 3649K	Veh. Inspected	GBK 3115B
	Policy No.	DMCVSNW00044382100	Coverage (\$)	0.00
	Claim No.	SNM21D203804/C02	Excess (\$)	0.00
	Assign From		Assign Date	14/07/2021
2. Vehicle Particulars & Condition				
	Make & Model	NISSAN NV350	c.c	2488
	Engine No.	HIDDEN	Year of Reg.	2020
	Chassis No.	JN1MC2E26Z0031911	Colour	WHITE
	Odometer	32081 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195 R15C	DUNLOP	5 mm
	L/H Front Tyre	195 R15C	DUNLOP	5 mm
	R/H Rear Tyre	195 R15C	DUNLOP	5 mm
	L/H Rear Tyre	195 R15C	DUNLOP	5 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	05/07/2021	Inspection Date	14/07/2021
	Survey held at	EFFICIENT MOTOR & ENGINEERING WORKS PTE LTD 56 LOYANG WAY #06-07 LOYANG ENTERPRISE BUILDING SINGAPORE 508775		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBK 3115B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	BROKEN	667.20	667.20
6	REAR BUMPER BRACKET LH/RH @\$12.10	BROKEN (3 PCS ONLY)	72.60	36.30
1	REAR BUMPER STEP PANEL	NOT NECESSARY	252.30	-
1	REAR END PANEL OUTER	DENTED	360.90	360.90
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	464.20	-
1	TAILGATE	DENTED	2,280.00	2,280.00
1	TAILGATE LOCK LOWER	JAMMED	528.60	428.00
1	TAILGATE LOCK UPPER	NOT NECESSARY	178.80	-
1	TAILGATE LOCK COVER	NOT NECESSARY	84.00	-
1	TAILGATE LOCK ACTUATOR	NOT NECESSARY	408.40	-
1	TAILGATE STRIKET	NOT NECESSARY	51.50	-
1	TAILGATE WEATHERSTRIP	CRUMPLED	228.00	176.50
1	TAILGATE CHROME GARNISH	NOT NECESSARY	535.70	-
2	TAILGATE ABSORBER @\$215.90	NOT NECESSARY	431.80	-
1	TAILGATE INNER TRIM BOARD	TORN	220.00	220.00
1	TAILGATE LOGO	NECESSARY	115.20	48.00
1	TAILGATE EMBLEM 'NV350 URBAN'	NECESSARY	156.00	65.00
1	TAILGATE INNER CENTER COVER	NOT NECESSARY	108.00	-
2	TAILGATE FEMALE DOVETAIL @\$58.70	NOT NECESSARY	117.40	-
2	TAILGATE MALE DOVETAIL @\$58.70	NOT NECESSARY	117.40	-
2	TAIL LAMP LH/RH @\$224.80	N/S BROKEN	449.60	224.80
1	REAR BUMPER PLATE LAMP	NOT NECESSARY	96.00	-
1	REAR FENDER LH	DENTED	1,793.40	1,793.40
1	TAIL LAMP PANEL LH	DENTED	465.30	315.00
1	BACKDOOR OPENING REINFORCEMENT LH	NOT NECESSARY	680.00	-
1	EXHAUST SILENCER	NOT NECESSARY	1,350.00	-
	LESS 10% DISCOUNT		-	-661.51
	COST PLUS 10%		1,221.23	-
			13,433.53	5,953.59

Report Ref No. CC6/CTI21007645/Eea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	70KM/H STICKER (SN)	NECESSARY	20.00	15.00
1	REVERSE SENSOR (SN)	SHORTED	200.00	200.00
1	REAR NO PLATE (SN)	NOT NECESSARY	45.00	-
1	PAN PACIFIC METAL PLATE (SN)	NECESSARY	80.00	50.00
1	BACK DOOR GLASS SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	150.00	-
1	REAR WOODEN FLOOR BOARD (SN)	BROKEN	250.00	200.00
1	REAR PANEL CHECKER PLATE (SN)	BENT	80.00	50.00
1	REAR FENDER LH ADVERTISEMENT (SN)	NECESSARY	800.00	300.00
1	8 PAX STICKER (SN)	NECESSARY	30.00	25.00
			1,785.00	910.00
	<u>LABOUR</u>			
	TO CUT/WELD PANELS ,PANEL BEAT & ALIGN TAILGATE ,REMOVE & REPLACE DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER .		1,800.00	1,300.00
	TO APPLY ANTI RUST COAT AND TUFF KOTE REPAIRED AREAS .		100.00	30.00
	TO CHECK AND RECTIFY LIGHTING & WIRING .		50.00	30.00
	TO REMOVE & REPLACE REVERSE SENSOR .		100.00	30.00
	TO SPRAY PAINTING FOR REAR PORTIONS & AFFECTED AREAS .		1,200.00	900.00
	TO REMOVE & TRANSFER TAILGATE COMPONENTS.		150.00	50.00
	TO REMOVE AND REPLACE REAR WINDSCREEN GLASS .		150.00	120.00
	TO REMOVE AND REFIT AND ALIGN EXHAUST SILENCER .	NOT NECESSARY	100.00	-
	TO CONDUCT WATER LEAKAGE TESTS TO ENSURE PROPER AIR AND SEALING.		50.00	30.00
			3,700.00	2,490.00
	GRAND TOTAL		18,918.53	9,353.59



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,500.00
---	--	--	-----------------

Report Ref No. CC6/CTI21007645/Eea3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBK 3115B

INSPECTION

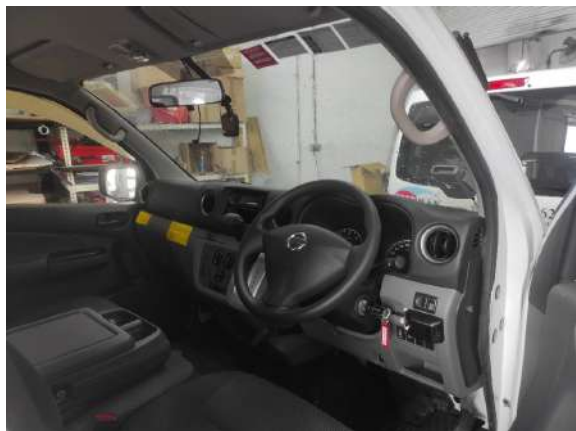



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

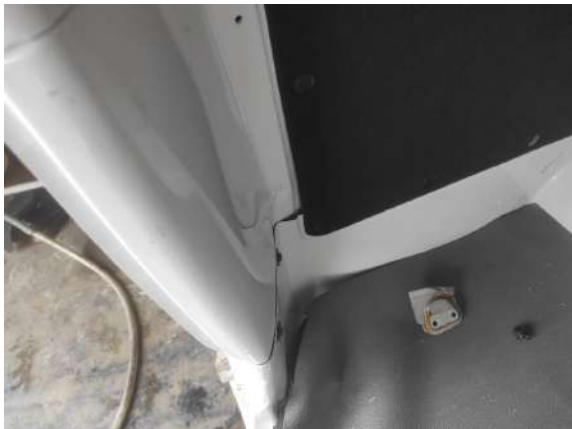



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBK 3115B

RE-INSPECTION

