

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD INV No. AC2106207

300 BEACH ROAD INV Date 07/09/2021

#17-04/07 THE CONCOURSE Reference CC4/LPC21007667/Nps3q2

SINGAPORE 199555 Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SHC 6990S

Insured Veh. YP 6154U

Claim No. 21/21/VC05/024771

Policy No.

Accident Date 15/07/2021

Inspection Date 15/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

**LKK Auto Consultants Pte Ltd** 

**LKM** 



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

	Affiliated to Federation Internationale Des Experts En Automobile				
	LONPAC INSURAI	NCE BHD	Ref:	CC4/LPC21007667/Nps3q2	
	300 BEACH ROAD #17-04/07 THE CC	) NCOURSESINGAPORE 199555	Date:	07/09/2021	
			Code:	LPC2	
1.		Policy Particulars	- THIRD PARTY CLAII	VI	
	Insured Veh.	YP 6154U	Veh. Inspected	SHC 6990S	
	Policy No.		Coverage (\$)	0.00	
	Claim No.	21/21/21/VC05/024771	Excess (\$)	0.00	
	Assign From	GERALD	Assign Date	15/07/2021	
2.		Vehicle Partic	ulars & Condition		
	Make & Model	KIA OPTIMA	c.c	1685	
	Engine No.	HIDDEN	Year of Reg.	2015	
	Chassis No.	KNAGM414MF5657643	Colour	SILVER	
	Odometer	618784 KM	Steering	IN ORDER	
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
	General	FAIR			
3.		Condition	ons of Tyres		
		Size	Make	Balance	
	R/H Front Tyre	205/65 R16	MAXXIS	5 mm	
	L/H Front Tyre	205/65 R16	MAXXIS	5 mm	
	R/H Rear Tyre	205/65 R16	MAXXIS	5 mm	
	L/H Rear Tyre	205/65 R16	MAXXIS	5 mm	
4.		Description	on of Damages		
	THE VEHICLE SU	STAINED DAMAGES AT THE REA	AR PORTION AND N/S B	ODY.	
	DAMAGES SEE DETAILS.				
5.		General	Information		
	Accident Date	15/07/2021	Inspection Date	15/07/2021	
	Survey held at	PREMIER AUTOMOTIVE SERVI	CES PTE LTD		
		23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443			
5a.		Re	emarks		
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b.		Estimate I	Days of Repair		
	ESTIMATED NOR	MAL PERIOD FOR REPAIR:	4 Work	king Days	



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 6990S

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR N/S FENDER	DENTED	1,205.00	1,205.00
1	REAR N/S FENDER INNER SHIELD	DEFORMED	120.00	120.00
1	REAR WINDSCREEN MOULDING	NECESSARY	87.00	87.00
1	REAR BUMPER	CRACKED	696.00	696.00
1	REAR BUMPER SIDE BRACKET N/S	SERVICEABLE	29.00	-
1	N/S ROCKER PANEL GARNISH	TO REPAIR SEE LABOUR	286.00	-
1	WHEEL COVER	SCRATCHED	116.00	116.00
	LESS 10% DISCOUNT		-253.90	-222.40
			2,285.10	2,001.60
	SPECIAL NETT ITEMS			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	48.00	48.00
1	SET REAR FENDER N/S INNER SHIELD CLIPS (SN)	NECESSARY	38.00	38.00
1	REAR N/S FENDER STICKER (SN)	NECESSARY	60.00	60.00
1	SEALANT (SN)	NECESSARY	50.00	40.00
1	SET N/S ROCKER PANEL GARNISH CLIPS (SN)	NOT NECESSARY	38.00	-
1	SET N/S DOOR STICKER (SN)	NOT NECESSARY	100.00	-
1	SUNDRY (SN)	NOT NECESSARY	50.00	-
			384.00	186.00
	<u>LABOUR</u>			
	TO DISMANTLE AND REFIT REAR WINDSCREEN .		120.00	120.00
	TO DISMANTLE /REFIT REVERSE SENSOR TO NEW BUMPER AND RESET TO THE SAME.		120.00	30.00
	TO CHECK WHEEL ALIGNMENT.	NOT NECESSARY	160.00	-
	TO DISMANTLE /REFIT THE INNER GARNISHES ,INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ,ETC TO FACILITATE REPAIRS.	NOT NECESSARY	180.00	-
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS .TO HEAT/WELD ,CUT-OFF THE REAR N/S FENDER .INCLUDING KNOCK - OUT,STRAIGHTEN ,REPAIR ,RESHAPE AND ADJUST OF THE REAR N/S DOOR ETC.INCLUSIVE OF THE REPAIR OF N/S ROCKER PANEL GARNISH.		950.00	450.00

Report Ref No. CC4/LPC21007667/Nps3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO PUTTY AND SPRAY PAINTING ON REAR BUMPER ,REAR N/S FENDER,REAR N/S DOOR ,N/S ROCKER PANEL GARNISH .		800.00	450.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		180.00	50.00
			2,510.00	1,100.00
	GRAND TOTAL		5,179.10	3,287.60

RECOMMENDED COST OF LUMP SUM REPAIRS		2,600.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CC4/LPC21007667/Nps3q2

**MUHAMMAD NAZRIL BIN ABDULLAH** 

**Automotive Assessor** 

Amonto

**HO LEONG CHUAN** 

**Automotive Assessor** 



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R


### PHOTOGRAPHS FOR VEHICLE NO. SHC 6990S

#### **INSPECTION**







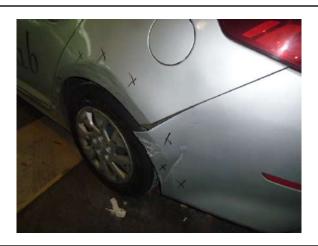







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R













51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SHC 6990S

#### **RE-INSPECTION**









