



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2207019

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 11/11/2022
Reference CC6/CTI21007949/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBB 460X
Insured Veh. GR 8802Y
Claim No. SNM21D204115/C02
Policy No. DMCVSNW00063502102
Accident Date 23/07/2021
Inspection Date 26/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21007949/Apa3q2	
			Date: 11/11/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GR 8802Y	Veh. Inspected	GBB 460X	
Policy No.	DMCVSNW00063502102	Coverage (\$)	0.00	
Claim No.	SNM21D204115/C02	Excess (\$)	0.00	
Assign From		Assign Date	26/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	JTFHT02P300024045	Colour	SILVER	
Odometer	218994 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/70 R15C	YOKOHAMA	6 mm	
L/H Front Tyre	195/70 R15C	YOKOHAMA	6 mm	
R/H Rear Tyre	195/70 R15C	YOKOHAMA	6 mm	
L/H Rear Tyre	195/70 R15C	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/07/2021	Inspection Date	26/07/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBB 460X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BONNET	DENTED	765.30	765.30
2	FRONT BONNET HINGES @\$137.80	NOT NECESSARY	137.80	-
1	FRONT BONNET LOGO	NECESSARY	95.20	95.20
1	FRONT BONNET INNER LOCK	NOT NECESSARY	298.60	-
1	FRONT CORNER PANEL	NOT NECESSARY	185.60	-
1	FRONT BUMPER	DEFORMED	598.20	598.20
1	FRONT BUMPER GRILLE	CRACKED	682.30	581.00
1	SET FRONT BUMPER GRILLE CLIPS	NECESSARY	30.00	20.00
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	198.30	-
2	FRONT BUMPER SIDE RETAINERS @\$145.30	NECESSARY	290.60	290.60
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	458.20	-
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	30.00
1	FRONT BUMPER TOP BEAM	DENTED	379.80	379.80
2	FRONT BUMPER REINFORCEMENT SIDE BRACKET @ \$138.00	NOT NECESSARY	276.00	-
2	FRONT BUMPER LOWER SIDE COVER @\$95.80	NOT NECESSARY	191.60	-
2	FRONT BUMPER FOGLAMP @\$156.30	NOT NECESSARY	312.60	-
2	HEADLAMPS @\$745.80	N/S CRACKED	1,491.60	745.80
2	SET HEADLAMPS CLIPS	NECESSARY	60.00	10.00
1	AIR CON CONDENSER	DENTED	1,521.90	1,521.90
1	CONDENSER AIR CON PIPE	NOT NECESSARY	310.60	-
1	C SUCTION PIPE	NOT NECESSARY	526.80	-
1	CONDENSER DISCHARGE PIPE	NOT NECESSARY	437.60	-
1	FRONT WASHER TANK	DEFORMED	158.20	158.20
1	FRONT WIPER GARNISH	NOT NECESSARY	185.20	-
1	FRONT WIPER GARNISH RUBBER SEAL	NOT NECESSARY	86.30	-
1	RADIATOR	LEAKING	1,856.90	1,856.90
1	RADIATOR SPARE TANK	CRACKED	205.80	205.80
1	RADIATOR BRACE PANEL	NOT NECESSARY	298.20	-
1	TURBO INTERCOOLER	DENTED	1,589.60	1,589.60
1	TURBO INTERCOOLER TOP COVER	NOT NECESSARY	165.80	-

Report Ref No. CC6/CTI21007949/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TURBO INTERCOOLER RUBBER SEAL	NOT NECESSARY	125.80	-
1	TURBO INTERCOOLER GUIDE	NOT NECESSARY	198.60	-
	LESS 25% DISCOUNT		-3,542.25	-2,212.08
			10,626.75	6,636.22
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET RADIATOR COOLANT (SN)	NECESSARY	60.00	40.00
			110.00	40.00
	<u>LABOUR</u>			
	PANEL BEATING TO WELD AND ALIGN DAMAGED PARTS.		1,600.00	500.00
	SPRAY PAINTING.		1,600.00	250.00
	CHECK WIRING ON HEADLAMP.		120.00	30.00
	ANTI RUST.	NOT NECESSARY	120.00	-
	REMOVE AND INSTALL CONDENSER /TOP UP GAS.		100.00	60.00
	REMOVE AND INSTALL TAILGATE PARTS.	NOT NECESSARY	150.00	-
	REPAIR AND REALIGN CHASIS MEMBER.	NOT NECESSARY	200.00	-
			3,890.00	840.00
GRAND TOTAL			14,626.75	7,516.22
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,000.00

Report Ref No. CC6/CTI21007949/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBB 460X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

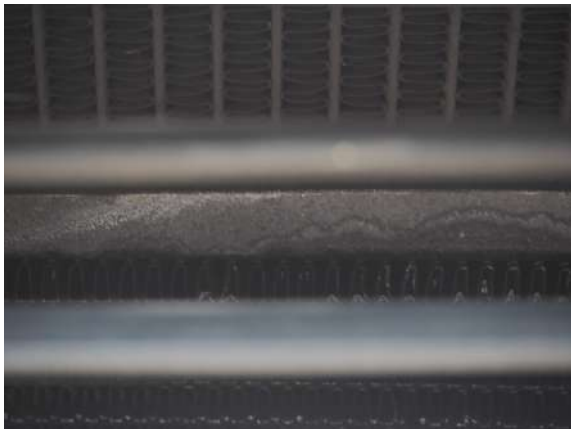



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBB 460X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBB 460X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

