

# **MOTOR APPRAISER PTE LTD**

Motor Appraiser and Insurance Loss Adjustor  
Blk 361 Yung An Road #12-105 Singapore 610361  
Mobile: +65 9232 0012 Email: iconappraiser@gmail.com  
UEN. : 202006885Z

## **INSPECTION REPORT**

To : Ong Yew Hua

Our ref. : 20120716/00052/CCE

Date : 16 Jul 2021

### **REFERENCE**

Assign by : Ong Yew Hua  
Assign on : 28 Jun 2021  
Inspection on : 28 Jun 2021  
Accident on : 26 Jun 2021  
Workshop name : Cheng Chuan Enterprise Pte Ltd  
Inspection at : 2 Kaki Bukit Avenue 2 #02-20/26/30/31  
Kaki Bukit Autohub  
Singapore 417921

### **PARTICULARS OF DAMAGED VEHICLE**

Registration no.	: SGT3346U	Odometer	: 177483 km
Make / Model	: TOYOTA COROLLA ALTIS 1.6 AUTC	Chassis no.	: MR053ZEE106177402
Regn. date	: 2010	Engine no.	: 3ZZB005852
Body colour	: Black	Engine cap.	: 1598 cc

### **PRE-ACCIDENT CONDITION OF VEHICLE (STATIC CHECK ONLY)**

Steering	: In order	Paintwork	: Fair
Footbrake	: In order	Undercarriage	: Serviceable
Handbrake	: In order	Gen. condition	: Fair


### **TYRE CONDITION ON VEHICLE**

	Make	Size	Tread depth	Type of road wheel
Front N/S	: Bridgestone	205/65R15	70%	Alloy
Front O/S	: Bridgestone	205/65R15	70%	Alloy
Rear N/S	: Bridgestone	205/65R15	70%	Alloy
Rear O/S	: Bridgestone	205/65R15	70%	Alloy

NOTE: Tread depth percentages represents the visually estimated remaining life of tyre treads.

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

## POINT OF IMPACT

The damages was found on the rear portion.	
--	--

## RECOMMENDATION

The estimated cost of repair submitted by the repairer Cheng Chuan Enterprise Pte Ltd as per schedule attached has been revised and scrutinised, and in our opinion, we consider it to be fair and reasonable. The repairer have agreed to undertake the repairs at our recommendation.

Our adjusted cost of repair is SGD 5,700.00 to carry out the repairs.  
Kindly refer to parts and labour portion for a detailed account of the cost estimates.

## REMARKS

However, for your information, under normal circumstances, the repair normally would take approximately 8 (Eight) working days to complete.

We have **NOT AUTHORISED** the repair to the damaged vehicle.  
The survey was conducted strictly on a "**WITHOUT PREJUDICE**" basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our final report, which includes material damages photographs.

Yours faithfully,  
ICON Motor Appraiser Pte Ltd



Patrick Ng  
Motor Vehicle Appraiser

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

List items					
S/N	Parts description	QTY	Condition	Repairer's Estimate	Our Recommendation
1	Bootlid	1	Damaged	\$ 813.00	\$ 813.00
2	Bootlid inner trim	1	Re-use	--	--
3	Bootlid hinge	2	Bent	\$ 134.00	\$ 134.00
4	Bootlid lock	1	Jammed	\$ 159.00	\$ 159.00
5	Bootlid lock striker	1	Bent	\$ 65.00	\$ 65.00
6	Bootlid key cylinder	1	Re-use	--	--
7	Bootlid release cable	1	Re-use	--	--
8	Bootlid weatherstrip	1	Deformed	\$ 185.00	\$ 185.00
9	Licence plate lamp	2	Damaged	\$ 144.00	\$ 144.00
10	Bootlid chrome garnish	1	Cracked	\$ 117.00	\$ 117.00
11	Bootlid hinge garnish	2	Not necessary	--	--
12	Bootlid "TOYOTA" logo	1	Necessary	\$ 61.00	\$ 61.00
13	Bootlid "COROLLA ALTIS" emblem	1	Necessary	\$ 47.00	\$ 47.00
14	Bootlid "1.6" emblem	1	Necessary	\$ 32.00	\$ 32.00
15	Bootlid "ELEGANCE" emblem	1	Necessary	\$ 45.00	\$ 45.00
16	Bootlid lamp	2	Re-use	--	--
17	Bootlid lamp sponge seal	2	Not necessary	--	--
18	Rear bumper	1	Damaged	\$ 688.00	\$ 688.00
19	Rear bumper side retainer	2	Cracked	\$ 114.00	\$ 114.00
20	Rear bumper sponge	1	Damaged	\$ 125.00	\$ 125.00
21	Rear bumper sponge pipe	1	Damaged	\$ 53.00	\$ 53.00
22	Rear bumper lower cowl	1	Re-use	--	--
23	Taillamp	2	Damaged	\$ 878.00	\$ 878.00
24	Taillamp sponge seal	2	Necessary	\$ 16.00	\$ 16.00
25	Taillamp panel	2	Repair	--	--
26	Taillamp lower bracket	2	Not necessary	--	--
27	End panel	1	Buckled	\$ 532.00	\$ 532.00
28	End panel top garnish	1	Damaged	\$ 164.00	\$ 164.00
29	Spare tyre floor panel	1	Deformed	\$ 795.00	\$ 795.00
30	Spare tyre top board	1	Damaged	\$ 127.00	\$ 127.00
31	Rear bumper top bracket	2	Bent	\$ 94.00	\$ 94.00
32	Rear bumper splash guard	2	Re-use	--	--
33	Rear bumper reflector	2	Re-use	--	--
Subtotal				\$ 5,388.00	\$ 5,388.00
Discount (less 25.00%)				\$ -	\$ 1,347.00
Total				\$ 5,388.00	\$ 4,041.00



Special nett items					
No.	Parts description	QTY	Condition	Repairer's Estimate	Our Recommendation
1	Reverse sensor	1	Damaged	\$ 280.00	\$ 250.00
2	Bootlid inner trim clips	10	Necessary	\$ 45.00	\$ 40.00
3	Rear bumper clips	10	Necessary	\$ 45.00	\$ 40.00
4	Taillamp clips	6	Necessary	\$ 27.00	\$ 20.00
5	Bootlid lamp clips	6	Necessary	\$ 27.00	\$ 20.00
6	End panel sealant	1	Necessary	\$ 120.00	\$ 100.00
7	End panel top garnish clips	6	Necessary	\$ 27.00	\$ 20.00
8	Spare tyre floor panel sealant	1	Necessary	\$ 120.00	\$ 100.00
9	Rear licence plate & frame	1	Damaged	\$ 65.00	\$ 55.00
10	Reverse camera	1	Malfunction	\$ 450.00	\$ 350.00
11	Sundries	1	Necessary	\$ 60.00	\$ 50.00
<b>Total</b>				<b>\$ 1,266.00</b>	<b>\$ 1,045.00</b>


Labour				
No.	Description	QTY	Repairer's Estimate	Our Recommendation
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	1	\$ 1,200.00	\$ 1,000.00
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	1	\$ 80.00	\$ 60.00
3	To remove, refit bootlid components and replace bootlid, check and re-adjust close gap, alignment and water seepage.	1	\$ 150.00	\$ 120.00
4	Supply spray paint material and necessary items to respray affected area / panel.	1	\$ 1,000.00	\$ 800.00
5	To rust proof all affected portions after repair.	1	\$ 120.00	\$ 100.00
<b>Total labour</b>			<b>\$ 2,550.00</b>	<b>\$ 2,080.00</b>

<b>Estimate Grand Total</b>	<b>\$ 9,204.00</b>	<b>\$ 7,166.00</b>
-----------------------------	--------------------	--------------------



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

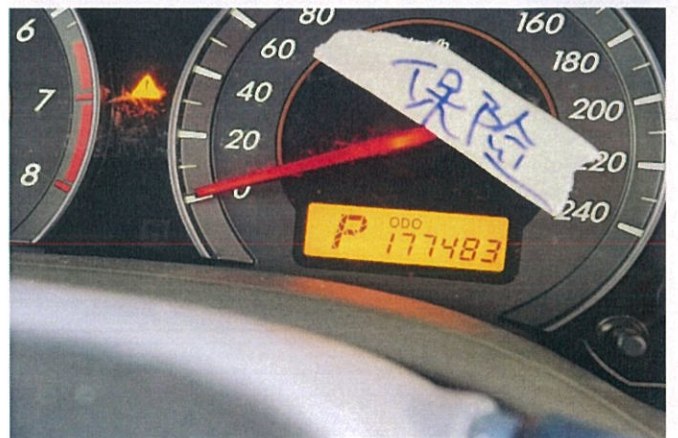


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P


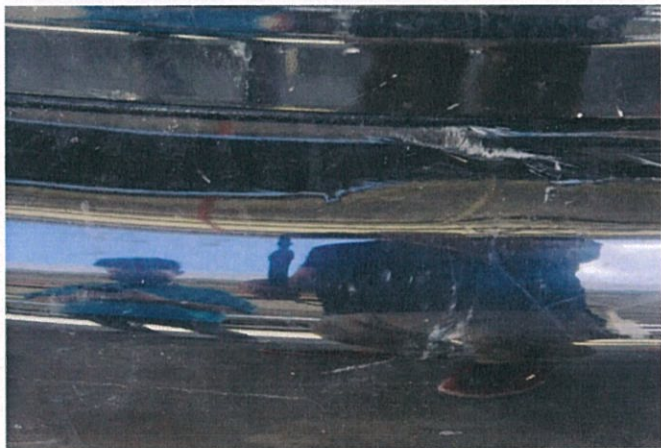


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

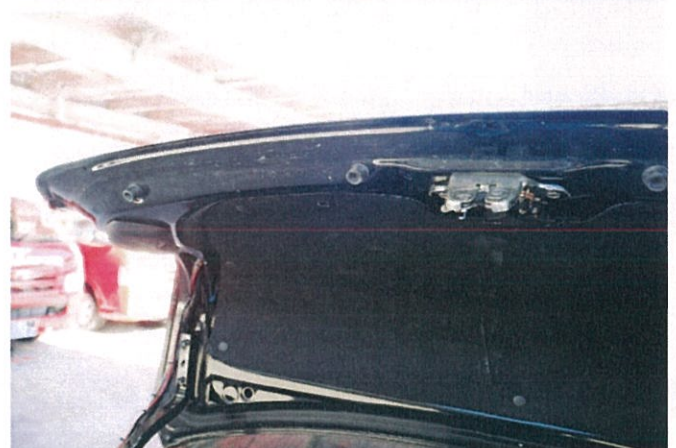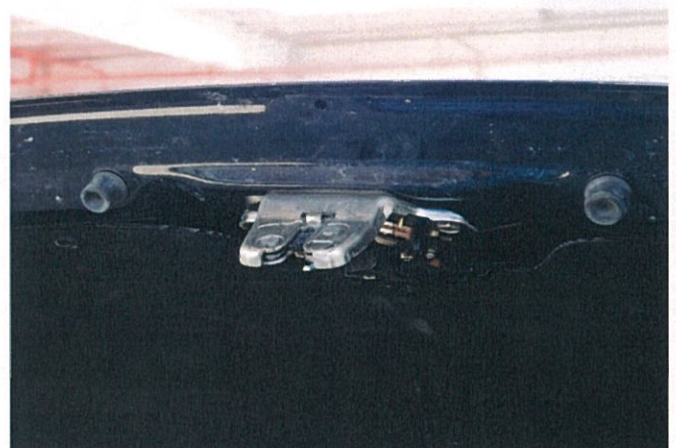


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

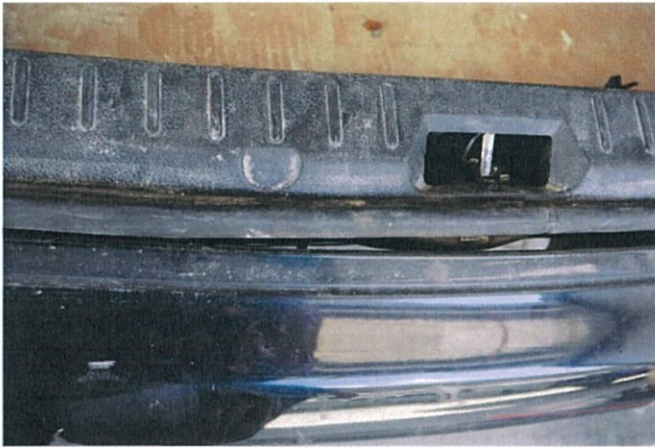


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

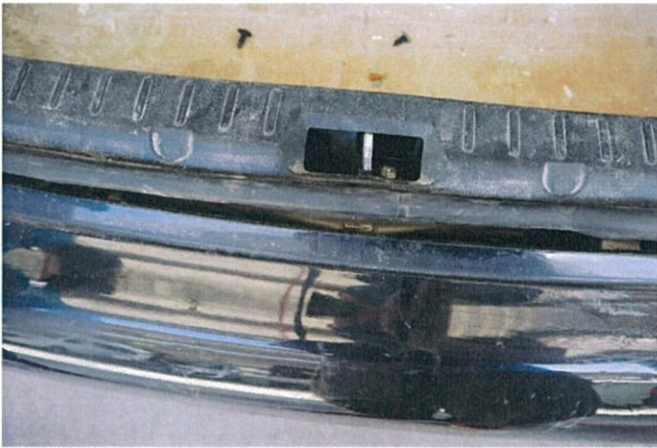


Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

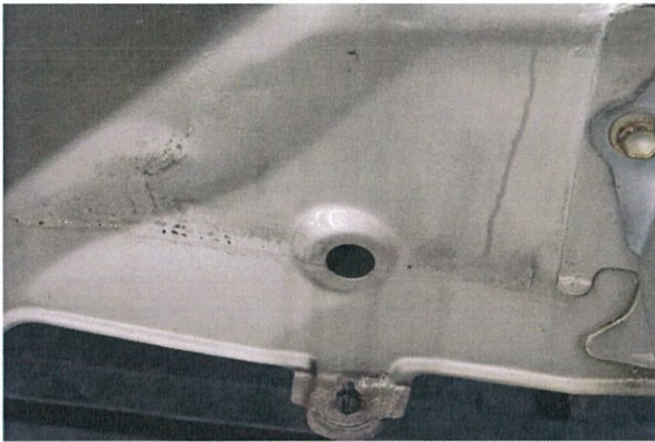


**Note:** This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

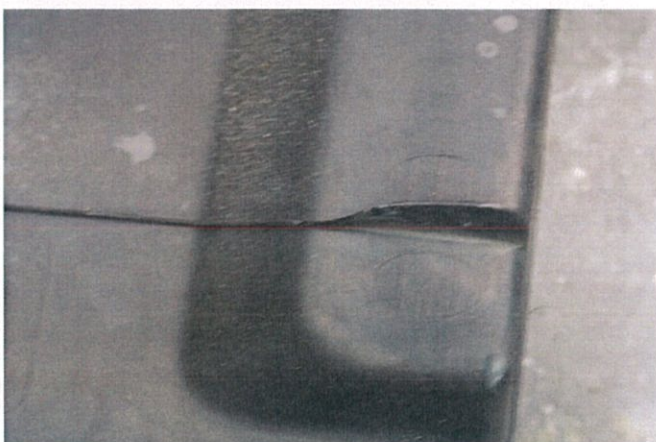

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P




**Note:** This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



# ICON MOTOR APPRAISER PTE LTD

Our Ref: 20120716/00052/CCE  
Your Ref: SLN2912P

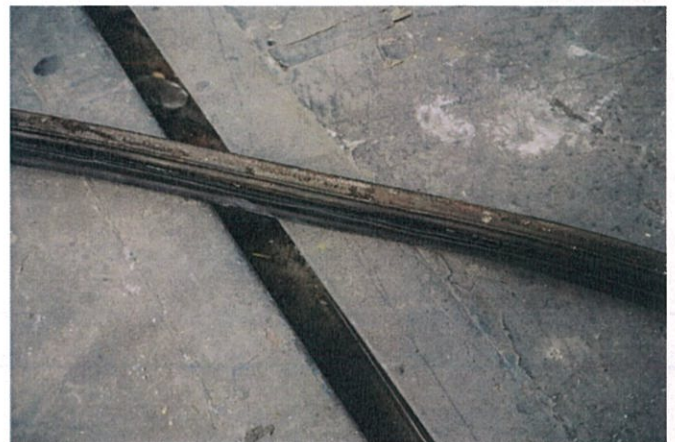

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.