



PRIORITY SERVICES (SG) PTE LTD

Insurance Loss Adjusters and Motor Appraisers

Blk 779 Yishun Avenue 2

#01-1545 Singapore 760779

Tel: 6293 4822 Fax: 6296 3283

E-mail: admin@priorityservices.sg

Vehicle Inspection Report

Report No. IN-0003/11/20	Date of Report	: 11/11/2020
To : Sam Shi Hoe	Date of Request	: 06/11/2020
Block 69 Telok Blangah Heights	Report requested by	: Mr. Sam Shi Hoe
#04-275	Date of Inspection	: 06/11/2020
Singapore 100069	Date of Accident	: 05/11/2020
Policy No :	Sum Insured	-
Claim No : Third Party Claim	Excess (S\$)	: N/A
	Insured Vehicle	

PARTICULARS OF DAMAGED VEHICLE

Registration Plate No	: SLW 9181 M	Odometer Reading	: 66108 km
Make / Model	: Honda Vezel (A)	Radio / CD	: Yes
Year	: 2018	Air-conditioner	: Yes
Colour	: Pearl White	Wing Mirror	: Yes
Engine Capacity	: 1496 cc	View Cam	: Yes
Engine No	: -	Seat Belts	: Yes
Chassis / Frame No	: RU11231990	Accessories	: -
Carrying Capacity	: 4		

TYRE CONDITION

Front Left	: 7mm	Front Right	: 7mm
Make	: Dunlop	Make	: Dunlop
Rear Left	: 6mm	Rear Right	: 6mm
Make	: Dunlop	Make	: Dunlop
Spare	:	Road Wheels Type	: Alloy

(The above represents the approximate remaining life of tyre treads)

Tools	: -	Spare tyre	: -
-------	-----	------------	-----

PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (static tests only)

General bodywork	: Good
Paintwork	: Good
Handbrake	: Serviceable
Footbrake	: Serviceable
Steering	: Serviceable
Apparent engine modification	: Nil

This report is confidential and is given for the use of clients and their agents and any disclosure or publication of it or parts thereof shall be the responsibility of such person and no liability shall be attached to us therefore.



PRIORITY SERVICES (SG) PTE LTD

Insurance Loss Adjusters and Motor Appraisers

Blk 779 Yishun Avenue 2

#01-1545 Singapore 760779

Tel: 6293 4822 Fax: 6296 3283

E-mail: admin@priorityservices.sg

ASSESSMENT

		Repairer's Estimate (S\$)	Our Recommendation (S\$)
Spare Parts	:	5,848.80	3,788.04
Labour Charges	:	1,950.00	1,280.00
Paint Work	:	1,000.00	700.00
Towing Charges	:	0.00	0.00
Others	:		
Totals	:	8,798.80	5,768.04

Reduction (S\$) : 4,198.80

Recommended Reserve (S\$) : 4,600.00 (Lump Sum)

Estimated Normal Period of Repairs : 5 working days

CONTRIBUTIONS BY INSURED

Excess (S\$) : N/A

Others :

GENERAL REMARKS

WITHOUT PREJUDICE

Continuation Sheet

The Assignment

The survey was conducted at M/s. Edwin Garage Aircon & Repair, Block 5032 Ang Mo Kio Industrial Park 2, 01-295, Singapore 569535
Follow-up inspection has been conducted.

Point of Impact

At the rear portion.

Damages

The rear bumper, rear bumper side LH, rear end panel, rear buzzer sensor, rear reverse camera, tail gate, tail gate inner trim board, tail gate lock, tail gate weatherstrip, tail gate outer garnish, tail gate reflector LH/RH, etc.

Other parts were also found damaged. (see schedule for details)

Adjustment / Recommendation

We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle and we list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is \$5,768.04

Conclusion

The repairer has agreed to undertake repairs at a lump sum of \$4,600.00

We now revert to you for your decision on repairs.

Assuring you of our best services always.

Very truly yours

PRIORITY SERVICES (SG) PTE LTD



JEFFREY ONG
Motor Appraiser

Encl. Photographs of the damaged vehicle taken by us during inspection.

Vehicle No : SLW 9181 M Honda Vezel (A)

IN-0003/11/20

Workshop : Edwin Garage Aircon & Repair

Description	Condition	Repairer's Estimate (S\$)	Dist %	Our Recommendation (S\$)	Dist %
To Supply :					
1pc. rear bumper	dented	763.00	20	763.00	20
2pcs. rear bumper retainer LH/RH	necessary	46.00	20	46.00	20
2pcs. rear bumper reflector LH/RH	refit	282.20	20	0.00	20
2pcs. rear bumper side LH/RH	LH dented/loop cracked	390.00	20	195.00	20
1pc. rear bumper lower cover	refit	243.80	20	0.00	20
1pc. rear end panel	dented/repair	415.60	20	0.00	20
1pc. rear end panel inner garnish	refit	98.00	20	0.00	20
1pc. rear end panel antenna sensor	refit	60.10	20	0.00	20
1pc. rear end panel buzzer sensor	cracked	85.20	20	85.20	20
2pcs. rear tail lamp LH/RH	refit	895.00	20	0.00	20
1pc. rear tail gate	dented	954.00	20	954.00	20
1pc. rear tail gate I/LOGO emblem	necessary	25.70	20	25.70	20
1pc. rear tail gate VEZEL emblem	necessary	56.20	20	56.20	20
1pc. rear tail gate inner trim board	holder cracked	153.40	20	153.40	20
1pc. rear tail gate inner handle trim	refit	27.50	20	0.00	20
1pc. rear tail gate lock	dented	180.00	20	180.00	20
1pc. rear tail gate lock striker	refit	27.50	20	0.00	20
1pc. rear tail gate weatherstrip	deformed	96.80	20	96.80	20
1pc. rear tail gate outer garnish	holder cracked	220.00	20	220.00	20
2pcs. rear tail gate reflector LH/RH	pin cracked	693.00	20	693.00	20
1pc. rear tail gate windscreen moulding	necessary	100.00	20	100.00	20
2pcs. rear tail gate windscreen inner seal	necessary	98.00	20	98.00	20
Sub-Total :		5,911.00		3,666.30	
Total Discount :		1,182.20		733.26	
		4,728.80		2,933.04	
Special Nett :					
1pc. rear number plate	dented	50.00		35.00	
1set rear bumper clip	necessary	60.00		40.00	
1set rear reverse sensor	dented	300.00		250.00	
1set rear end panel inner garnish clip	necessary	50.00		30.00	
1set rear tail gate inner trim clip	necessary	60.00		40.00	
2pcs. rear panel sealant	not necessary	100.00		0.00	
2pcs. rear tail gate windscreen sealant	necessary	100.00		60.00	
1pc. rear bumper lower chrome trim moulding	dented	150.00		150.00	
1pc. rear reverse camera	dented/malfunction	250.00		250.00	



Vehicle No : SLW 9181 M Honda Vezel (A)


IN-0003/11/20




Workshop : Edwin Garage Aircon & Repair

Sub-Total :		1,120.00		855.00	
Total Discount :		0.00		0.00	
		1,120.00		855.00	
Total For Parts :		5,848.80		3,788.04	
Labour Charges :					
Check rear wiring and lighting system.		100.00		50.00	
Remove and refit rear lining, trim and garnish.		200.00		120.00	
Remove and refit rear windscreen.		200.00		150.00	
Remove and renew tail gate components.		100.00		80.00	
Remove and renew rear reverse sensor.		100.00		50.00	
Remove and renew rear reverse camera.		100.00		80.00	
Panel beating on affected areas.		1,000.00		700.00	
Apply anti rust on affected areas.		150.00		50.00	
Spray Painting Charges :					
Spray painting on affected areas.		1,000.00		700.00	
Grand Total :		8,798.80		5,768.04	



Surveyor : JEFFREY ONG


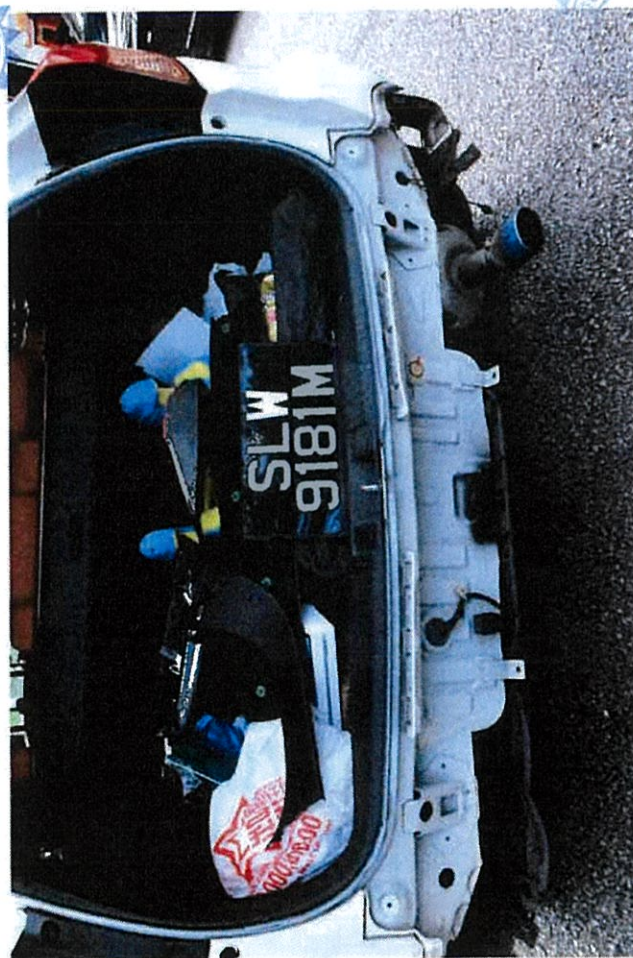
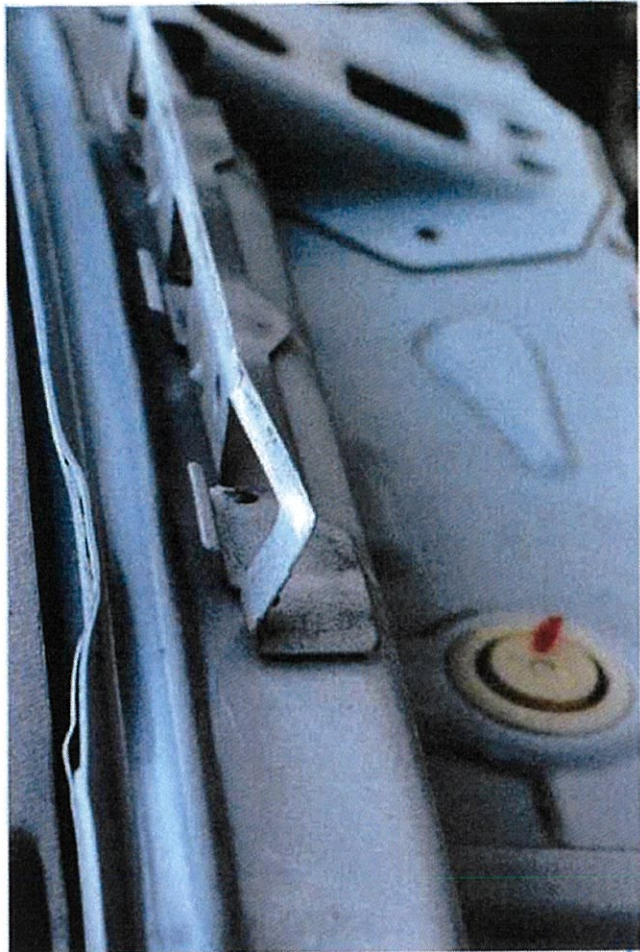




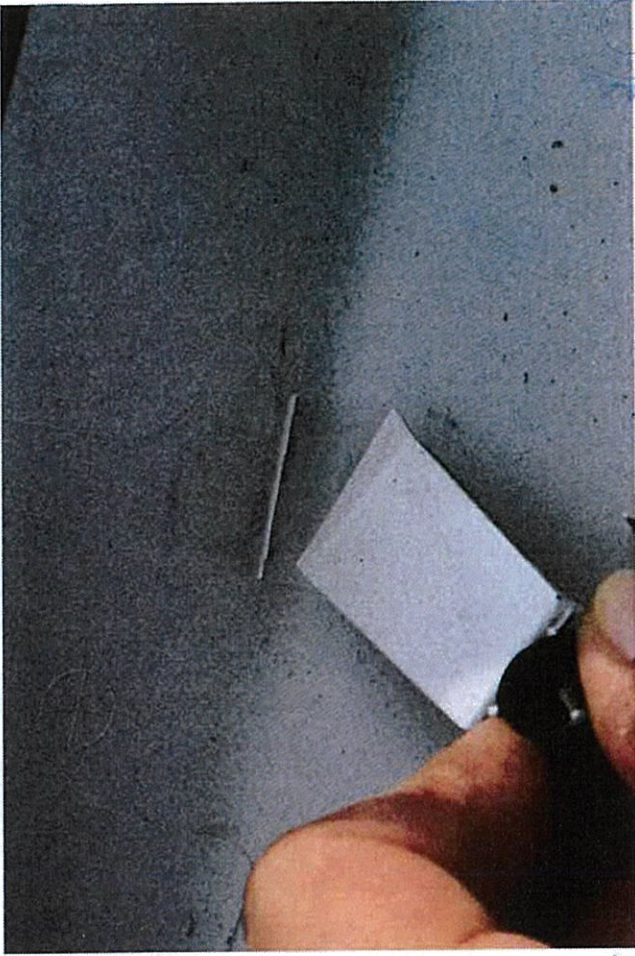


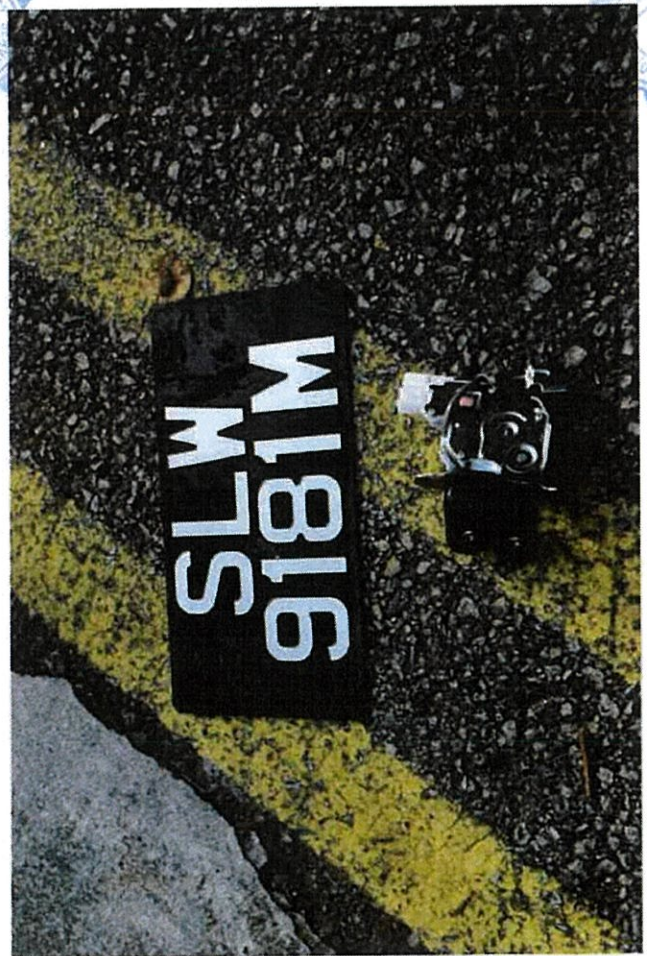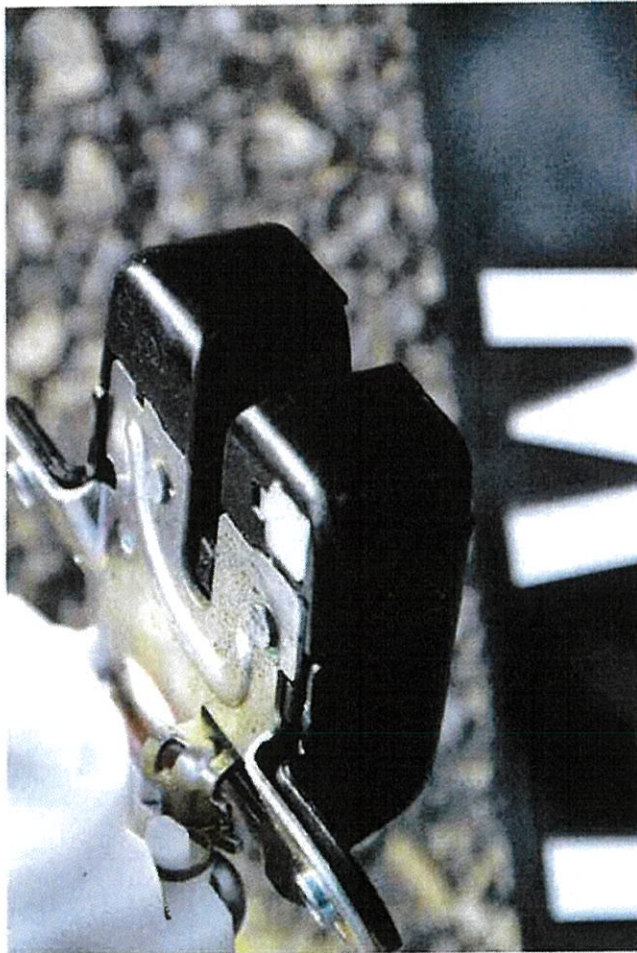
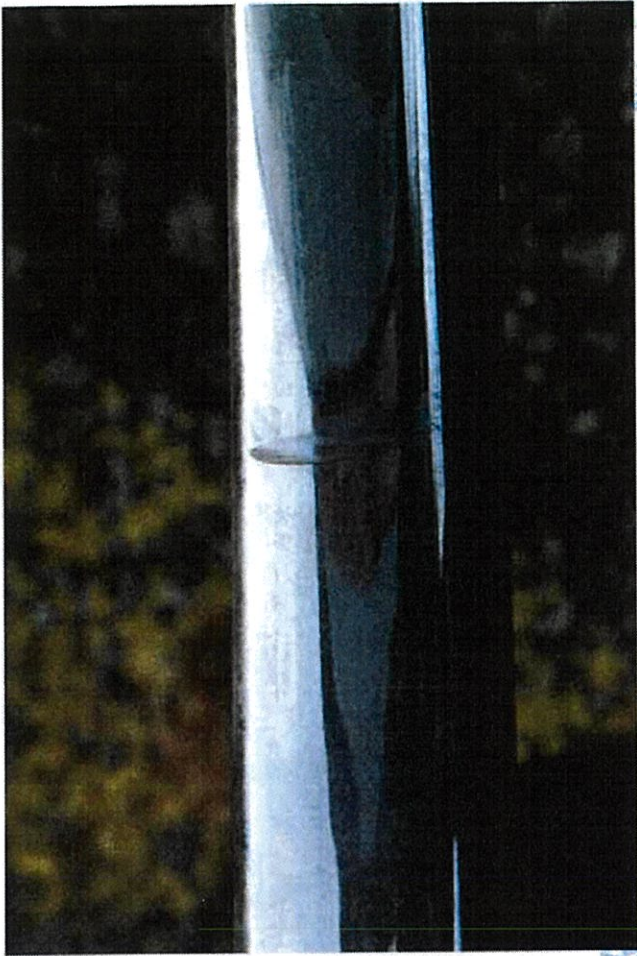







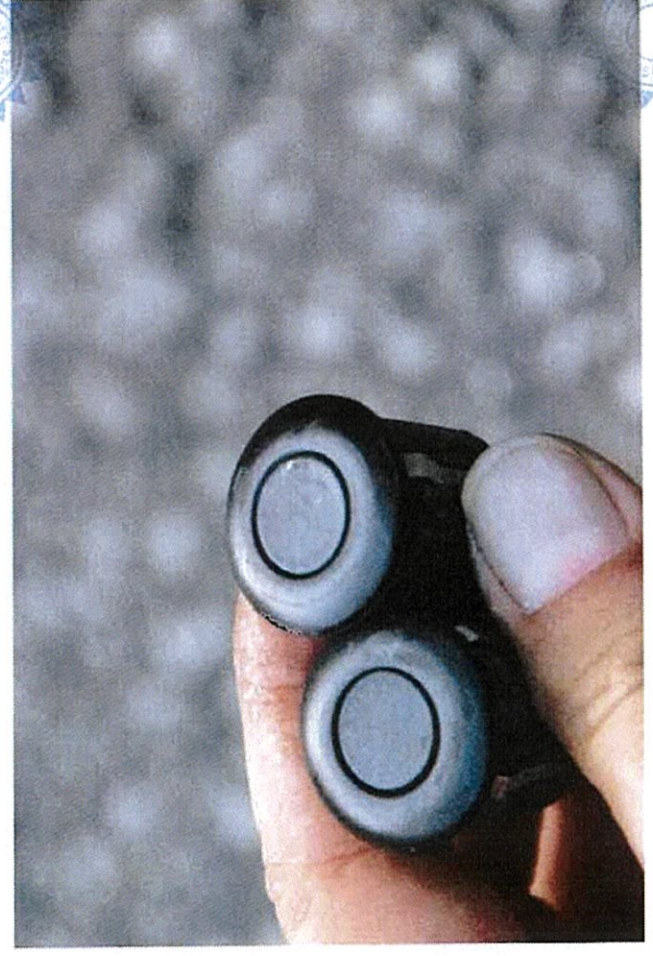
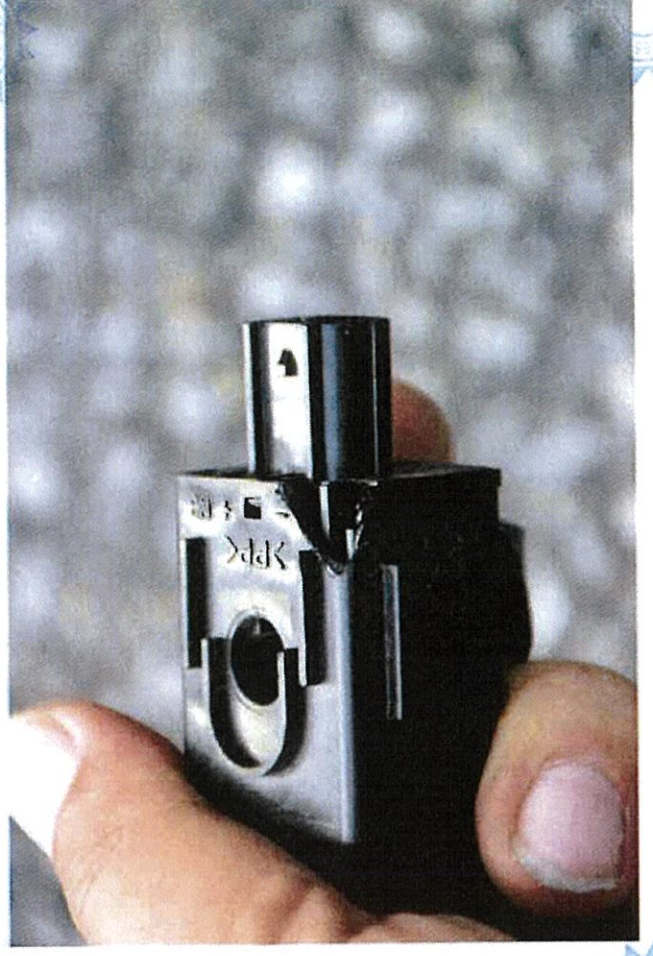


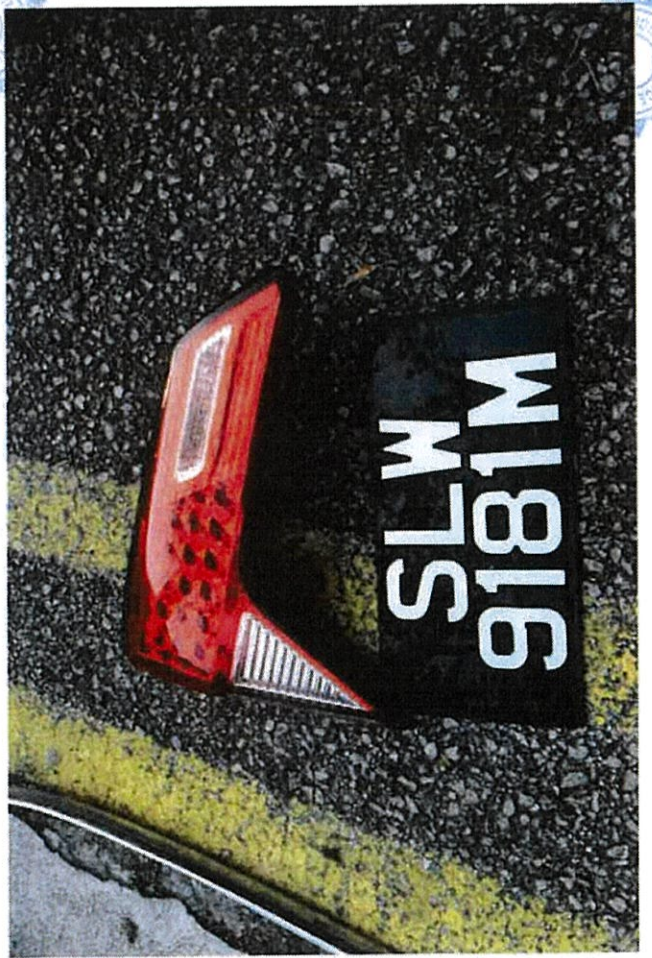
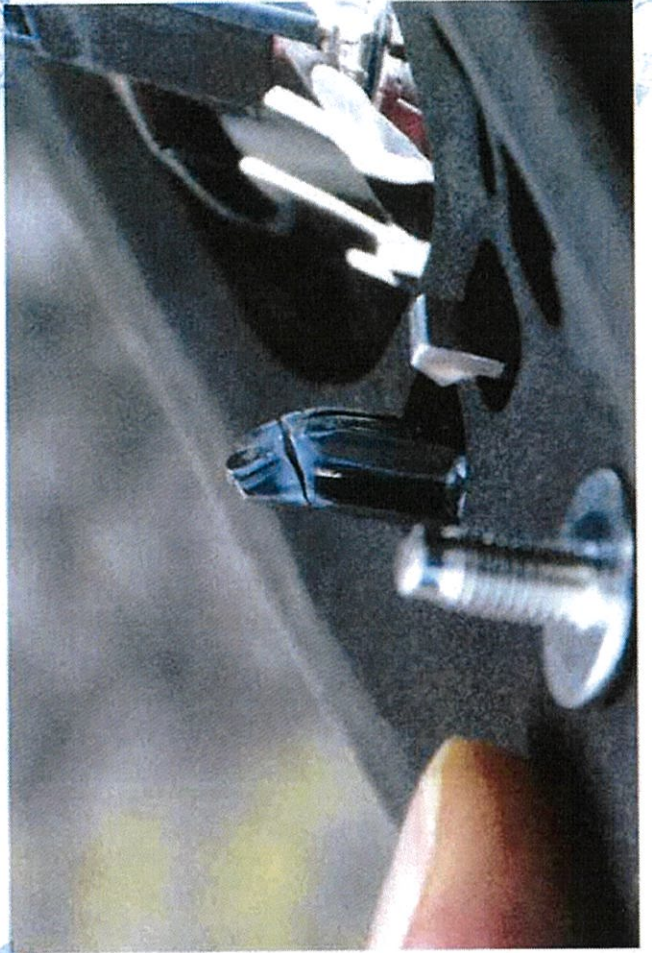
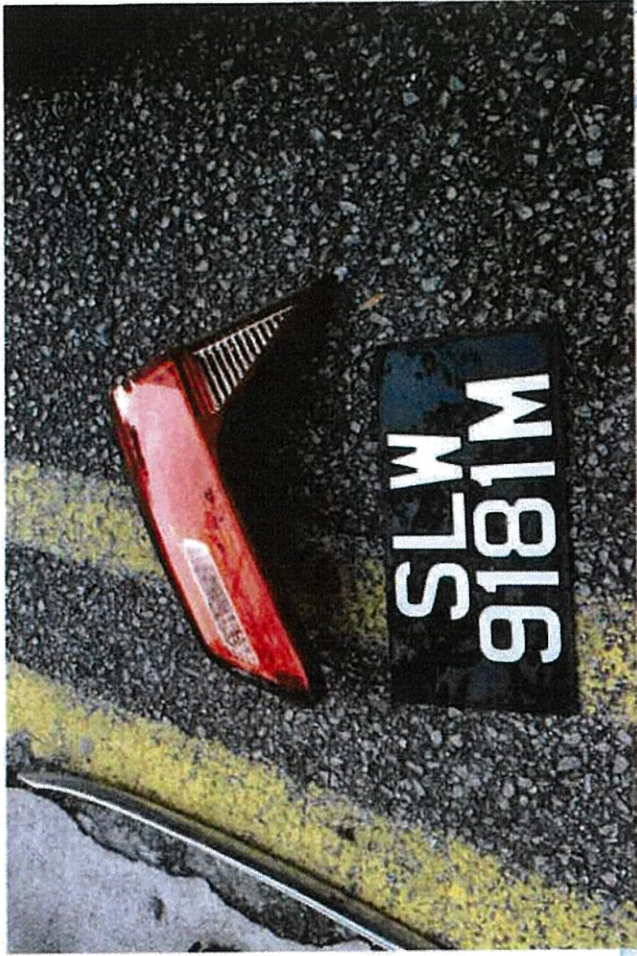


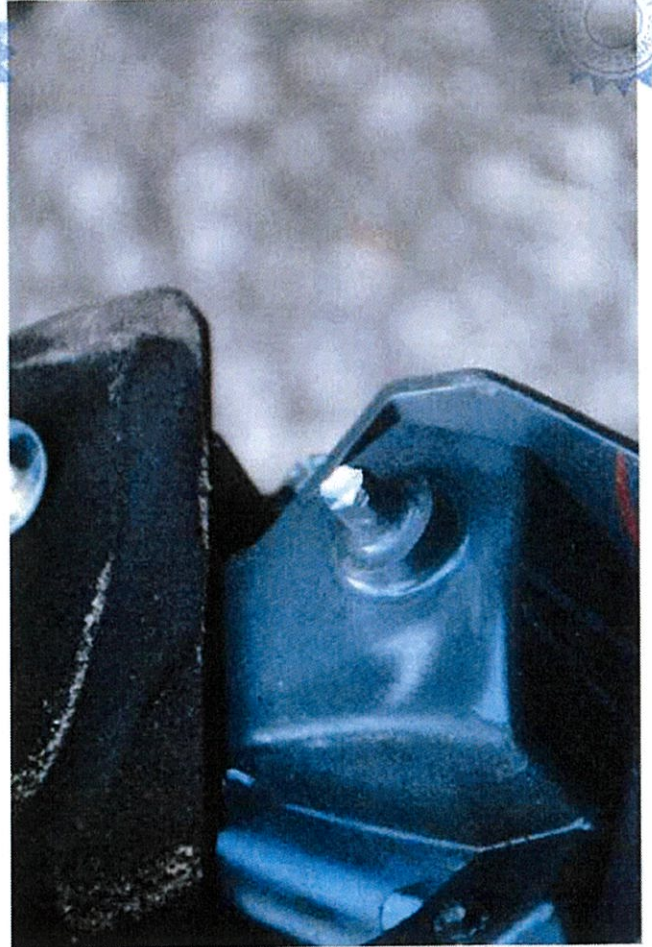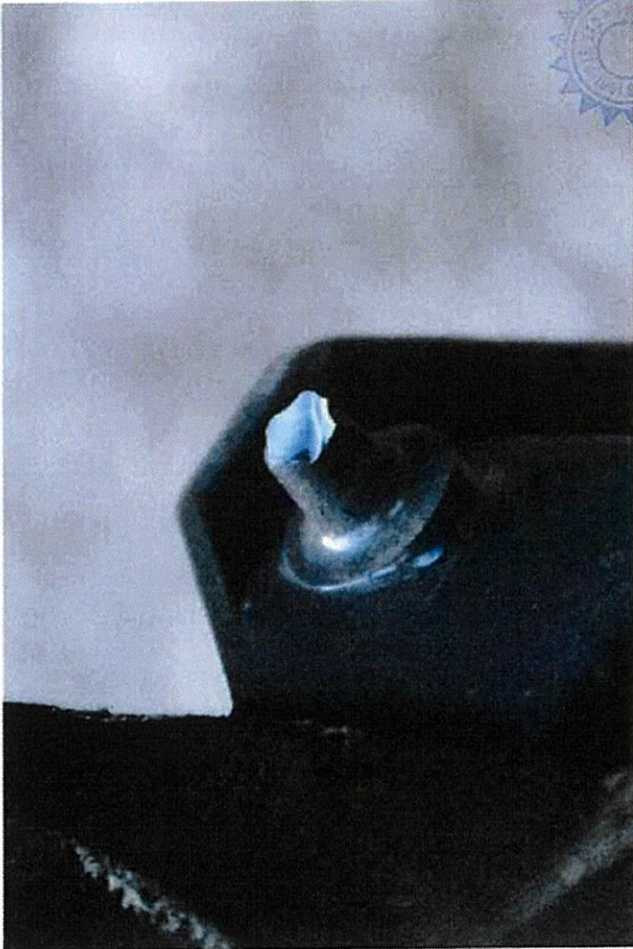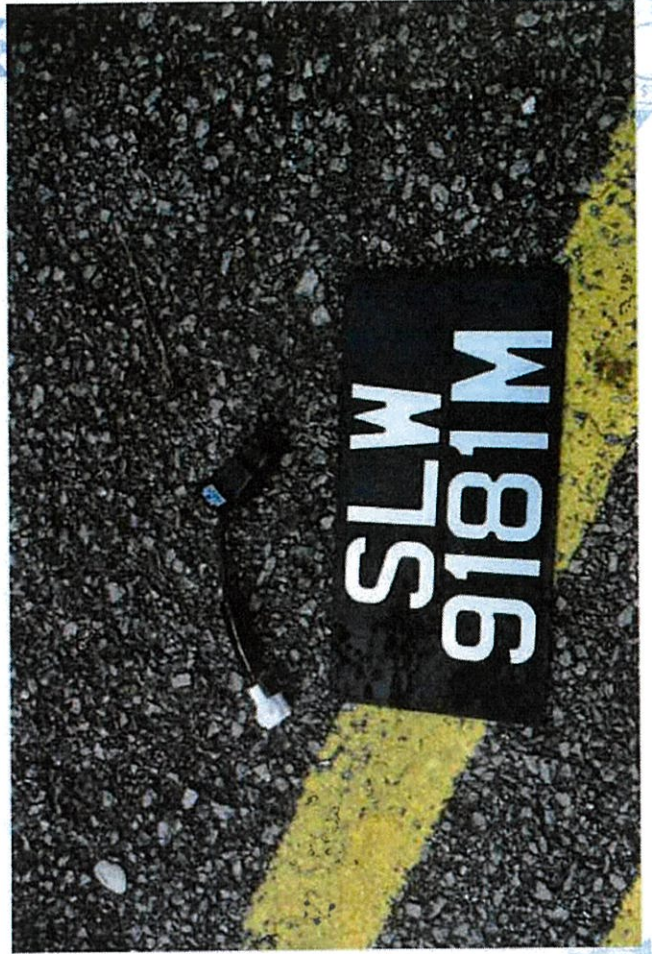




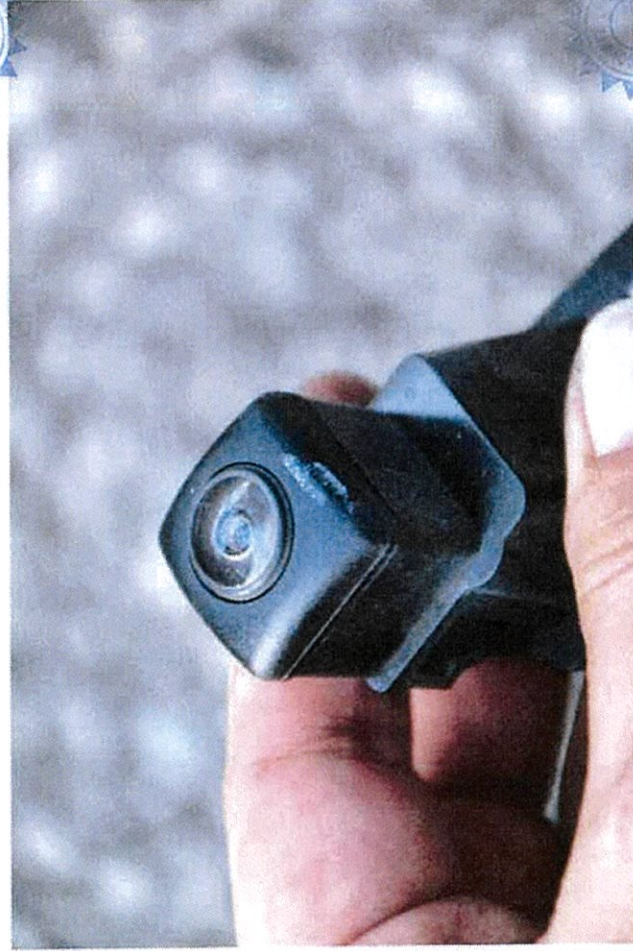
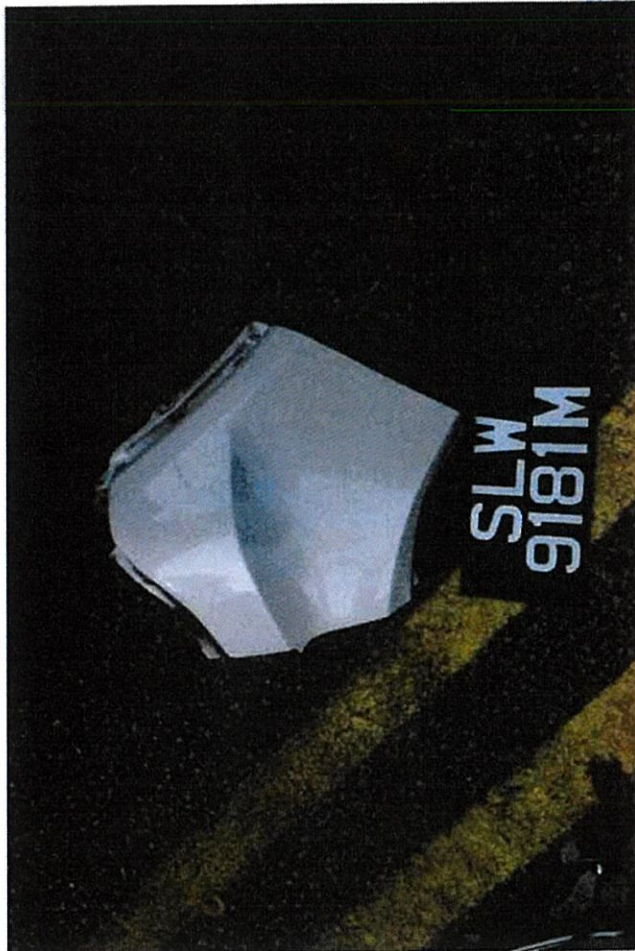


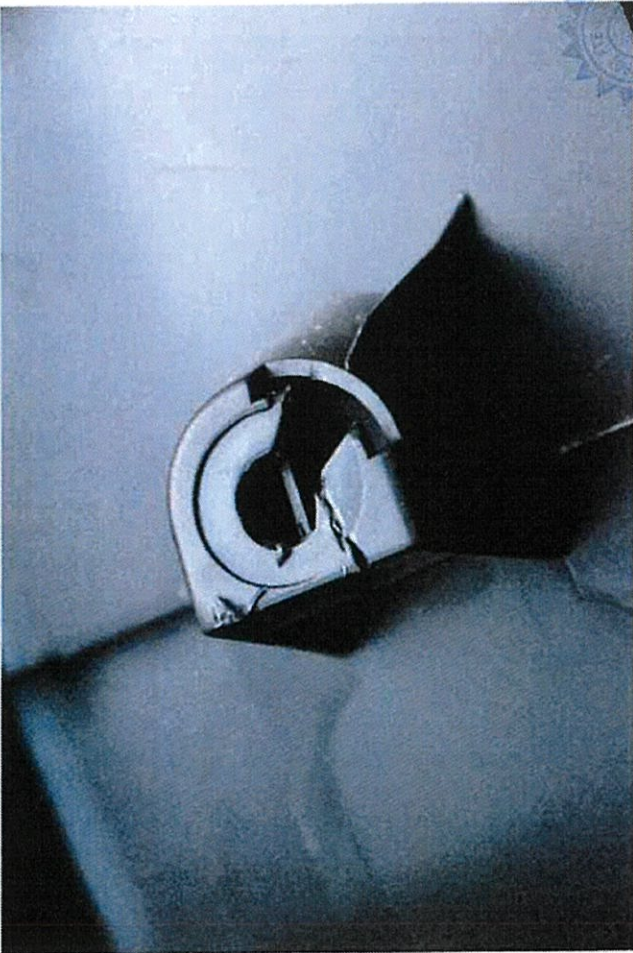
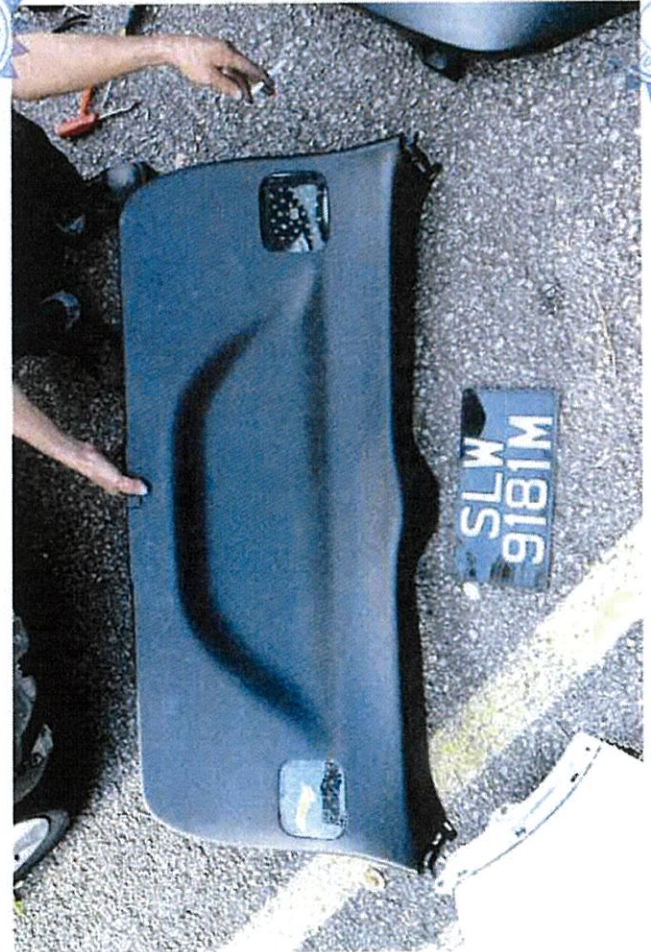


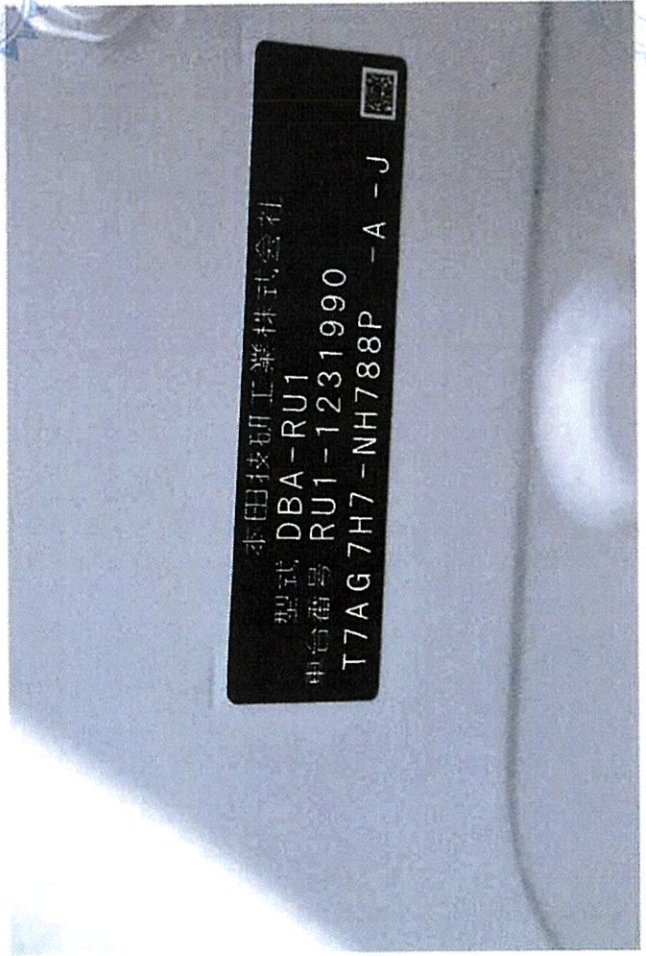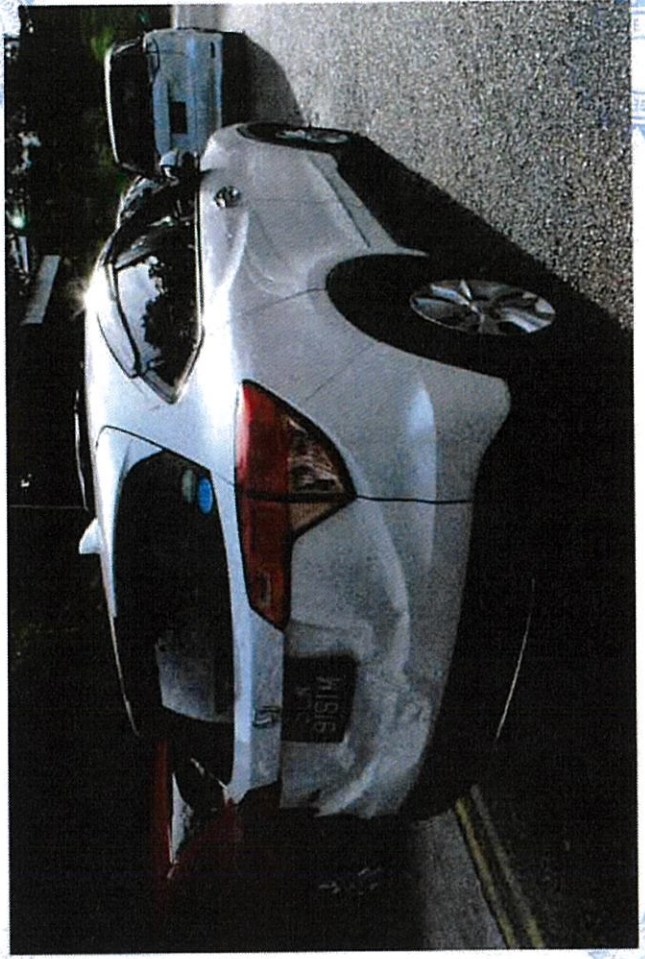
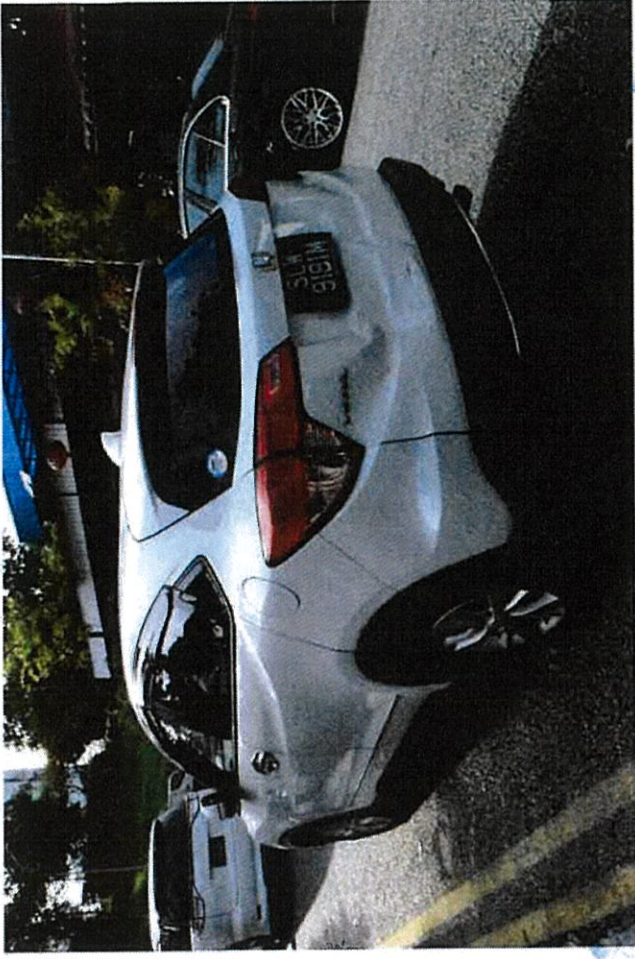



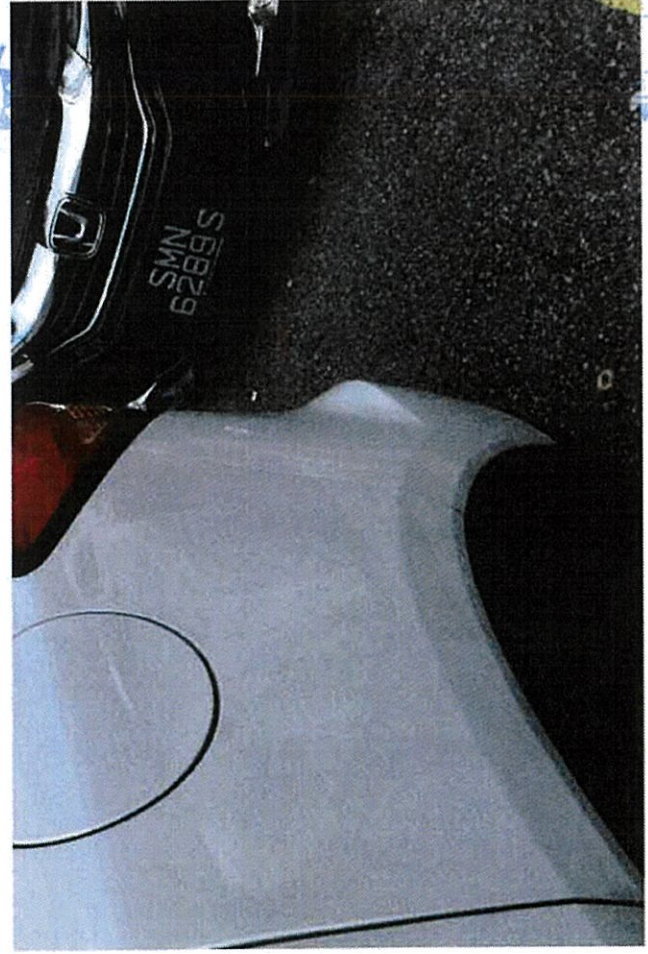
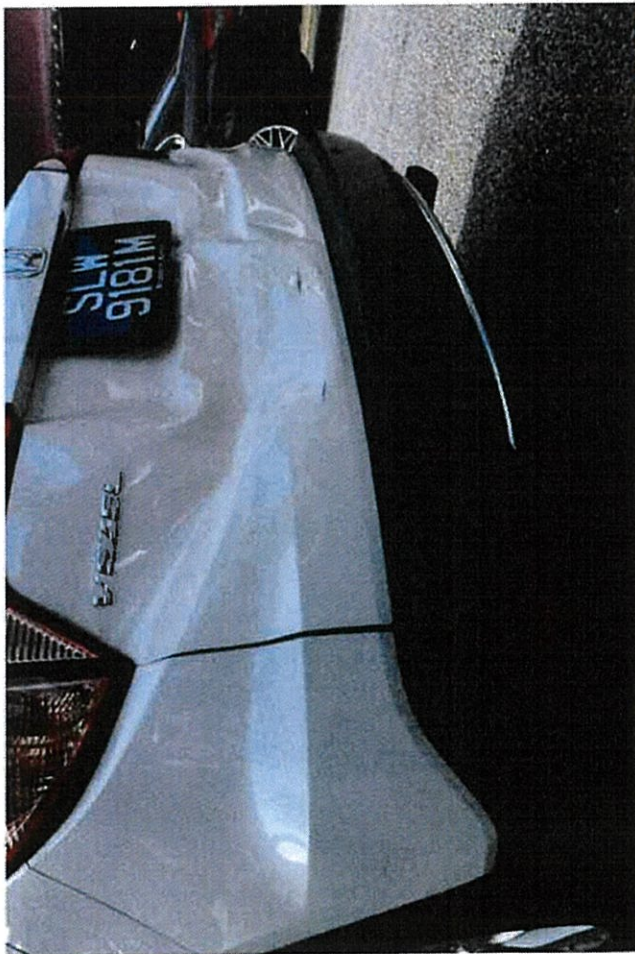
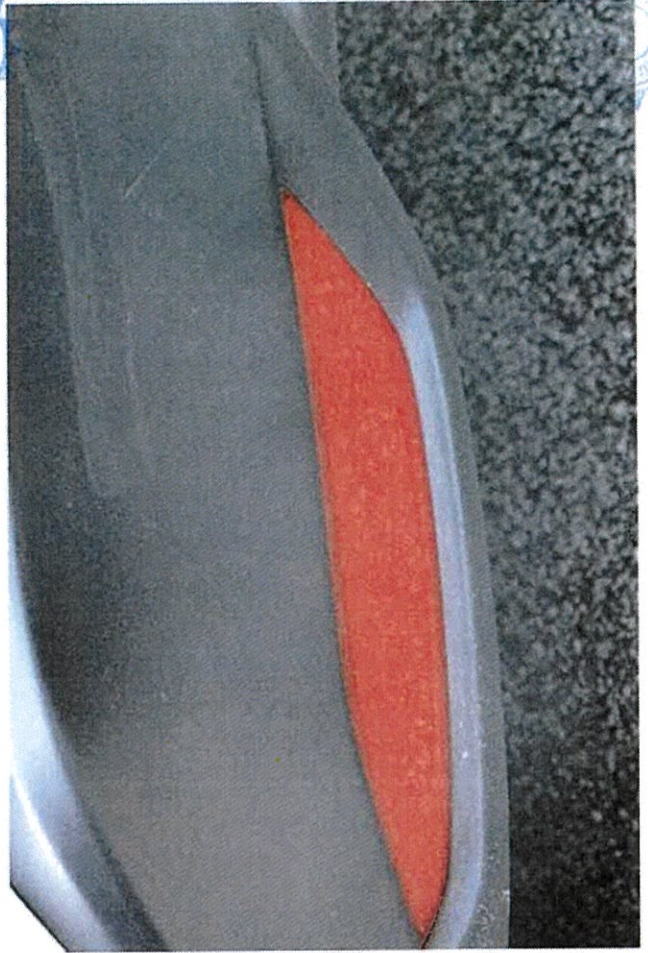




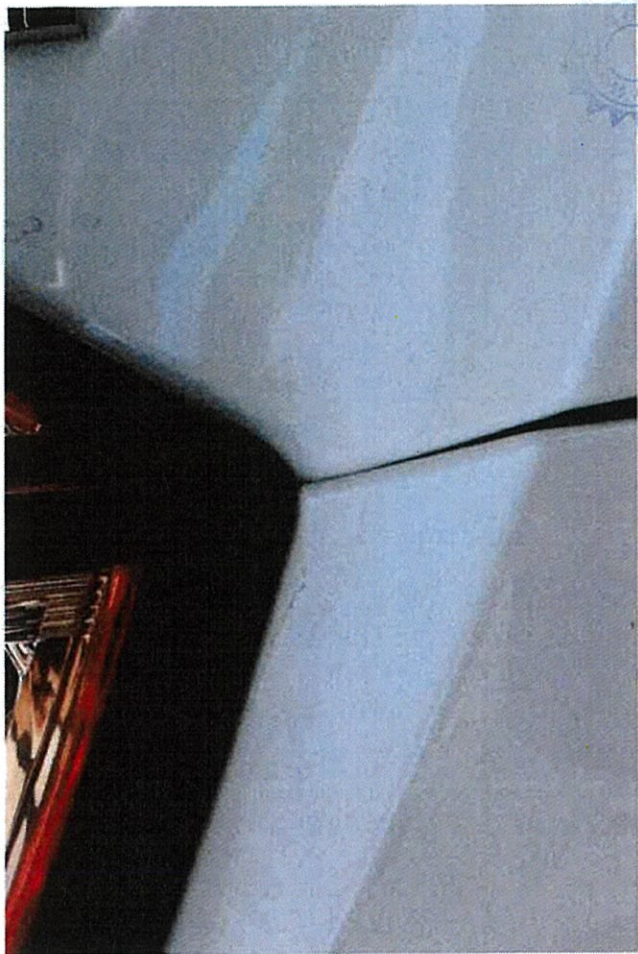


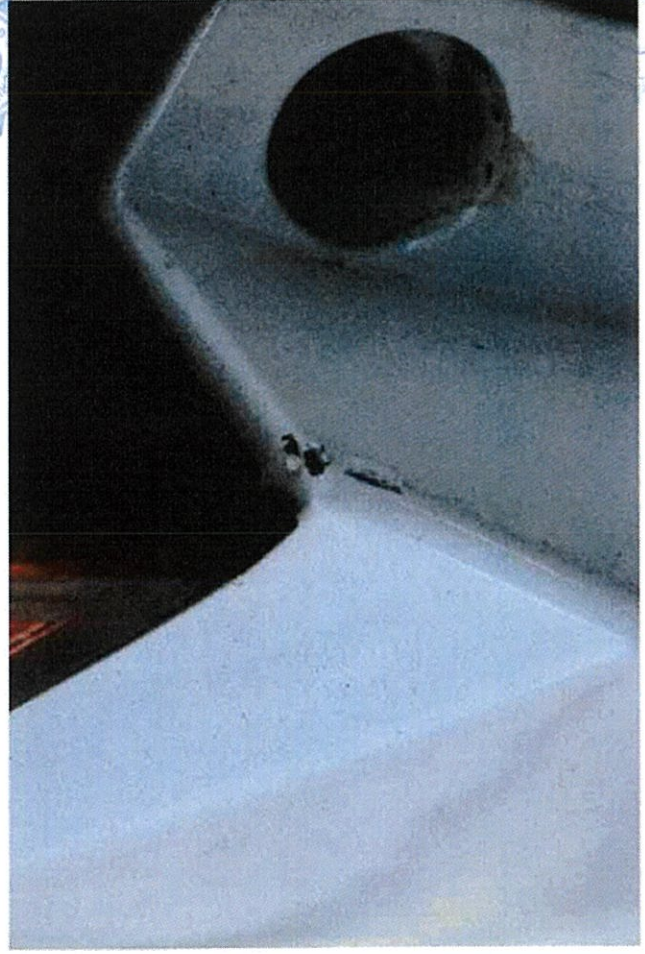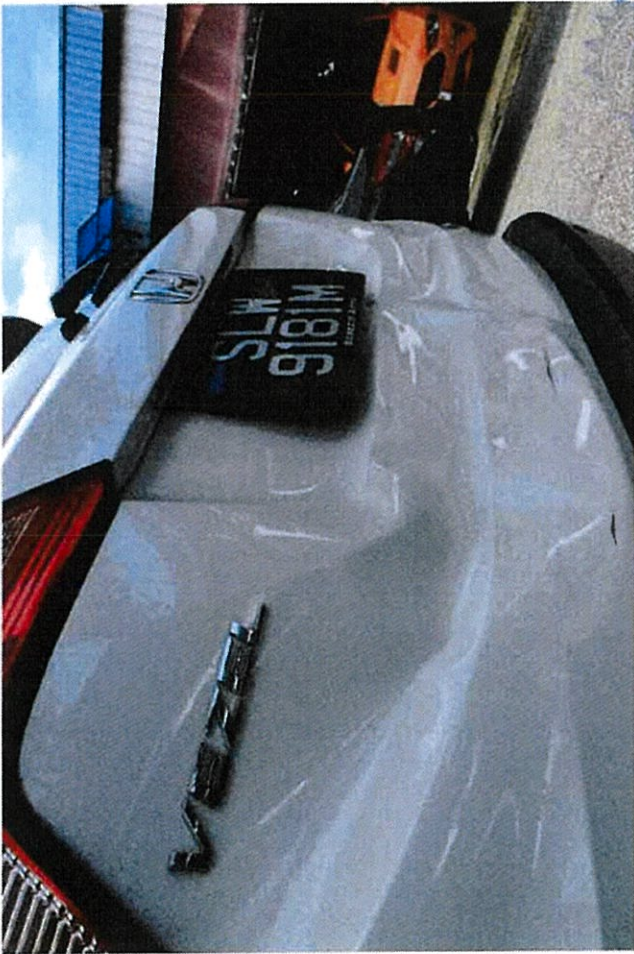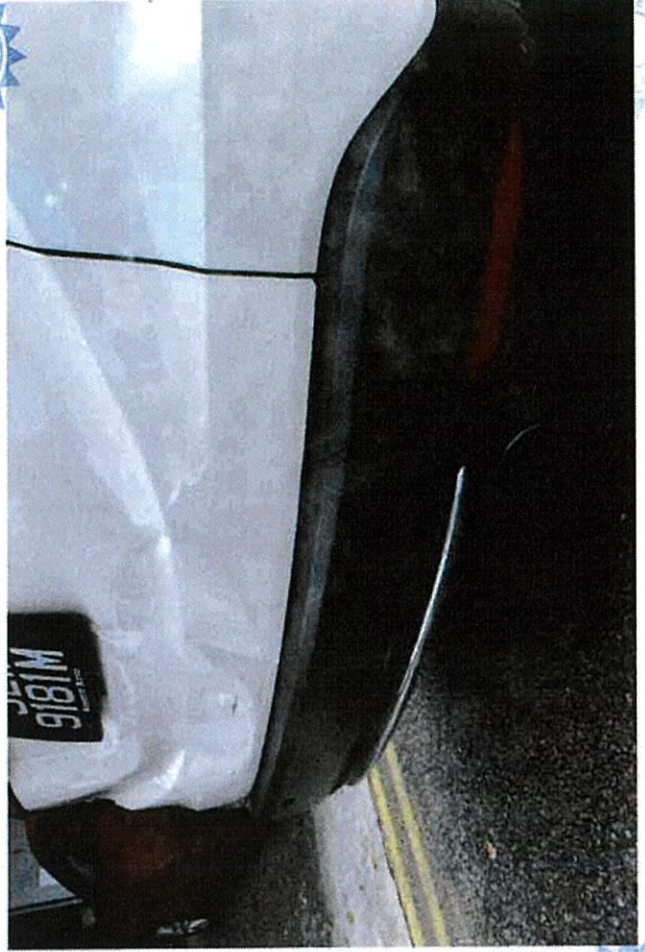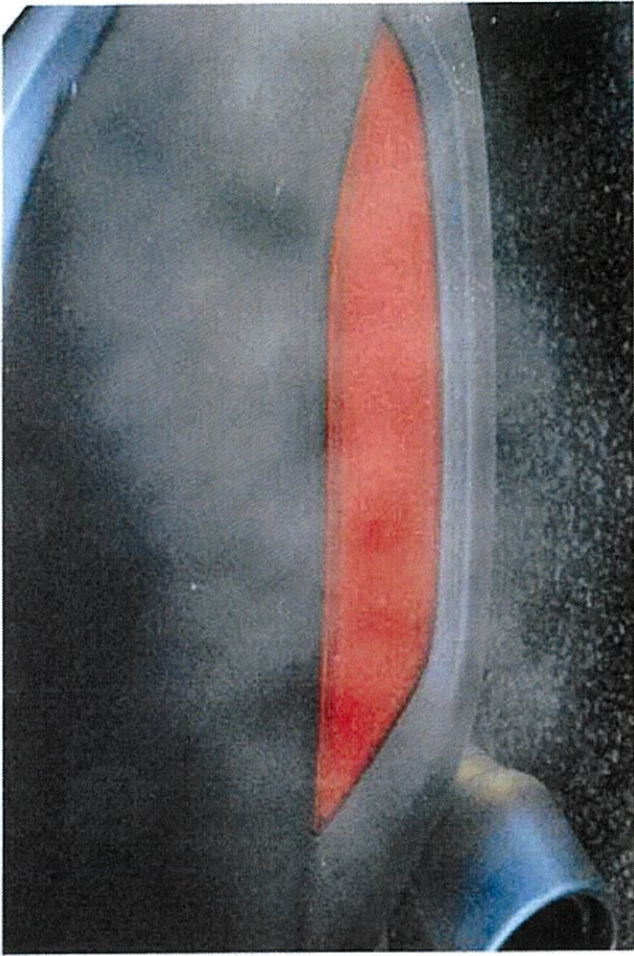

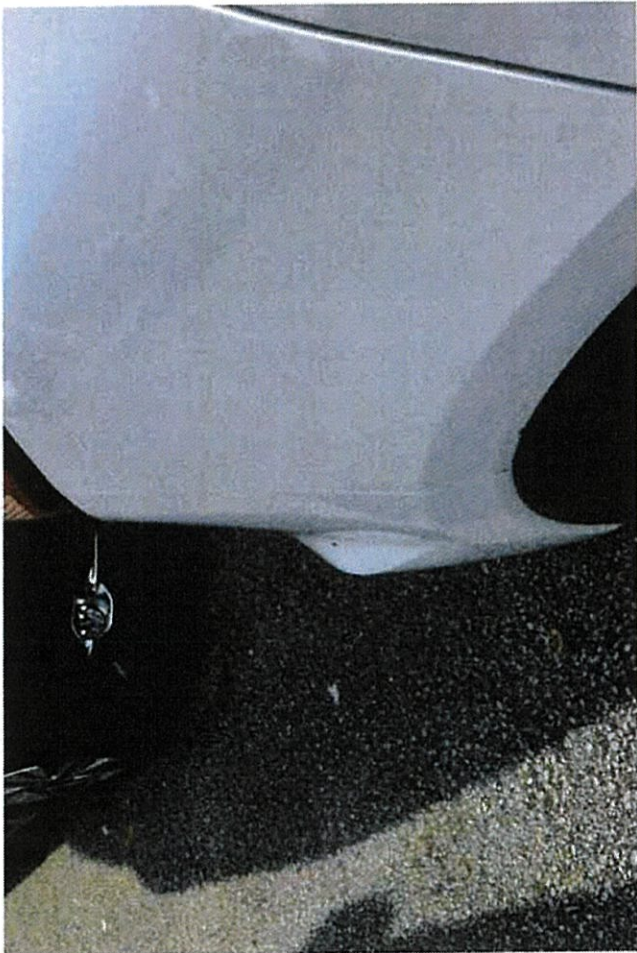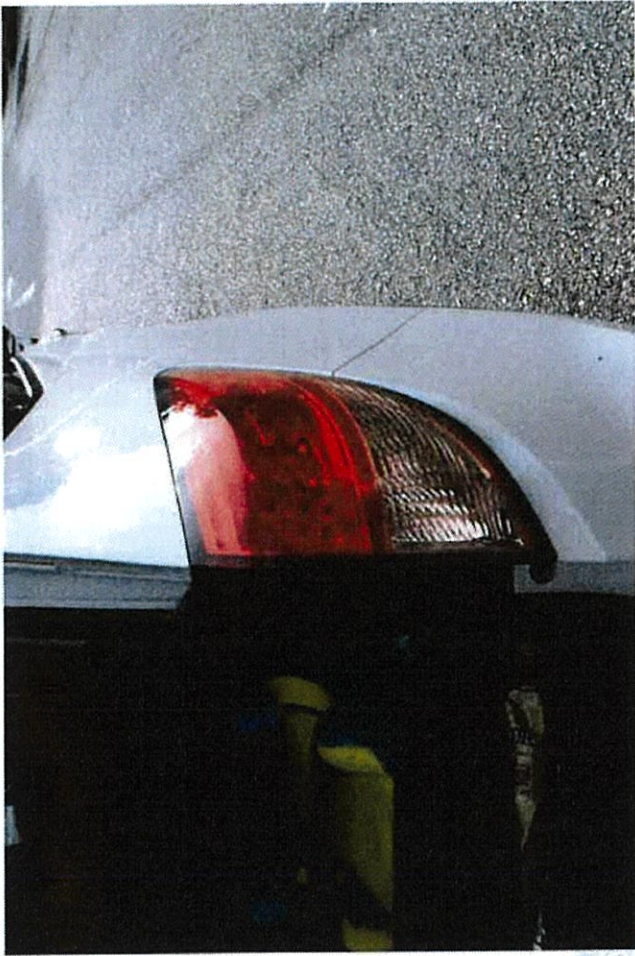

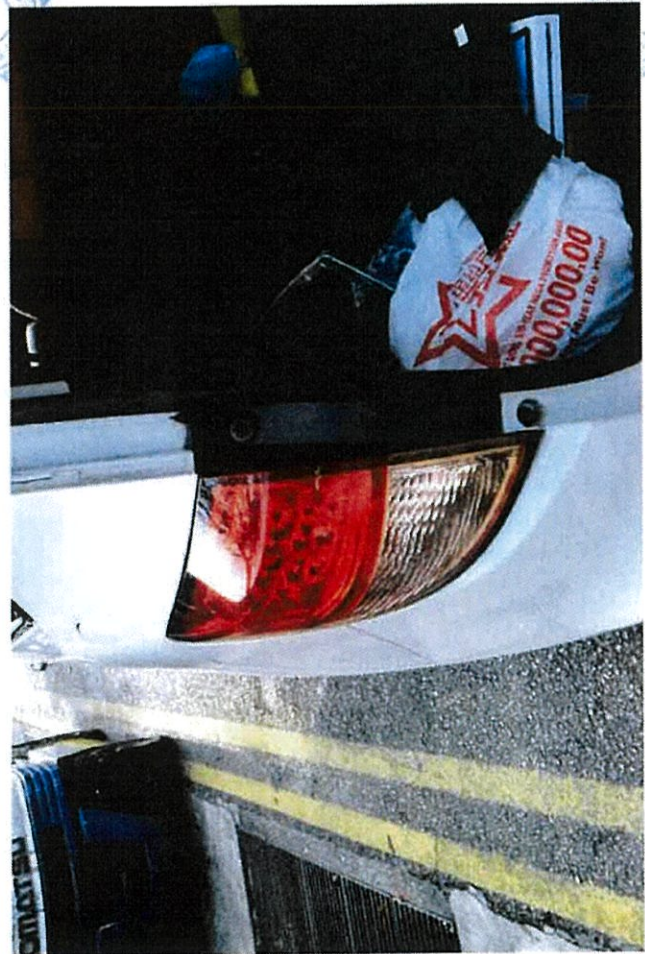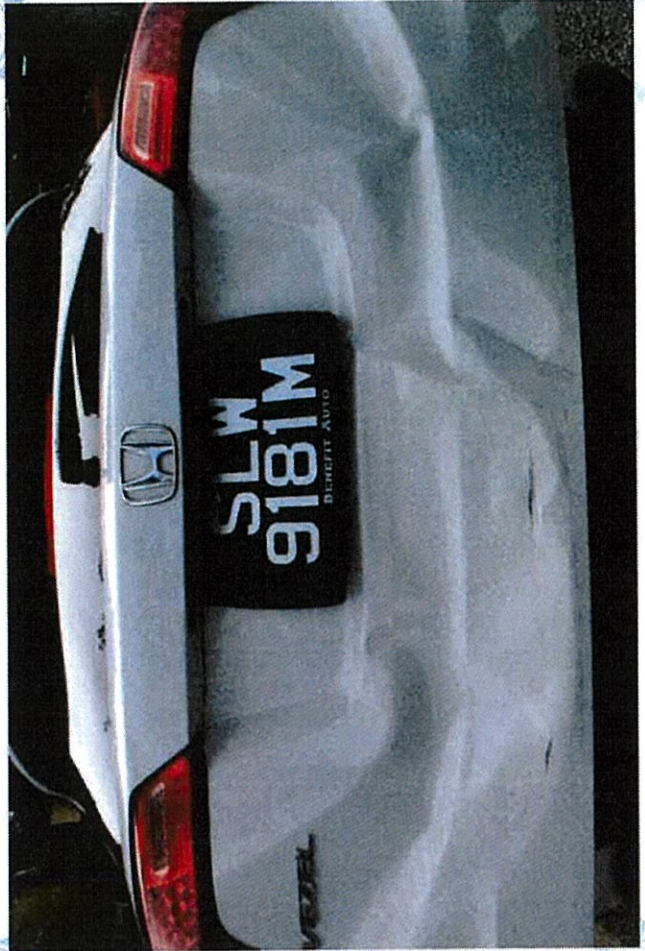

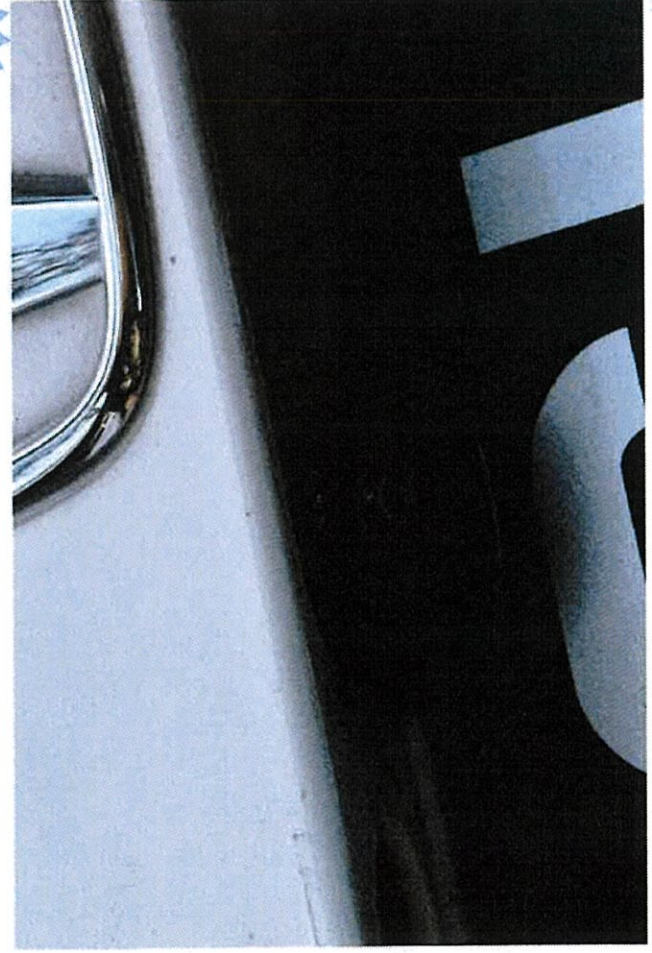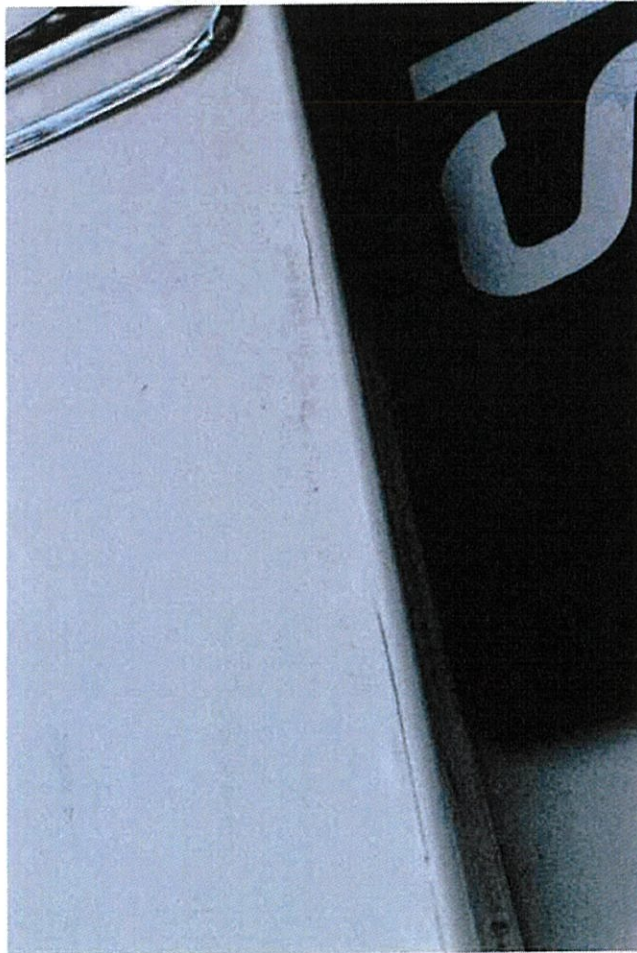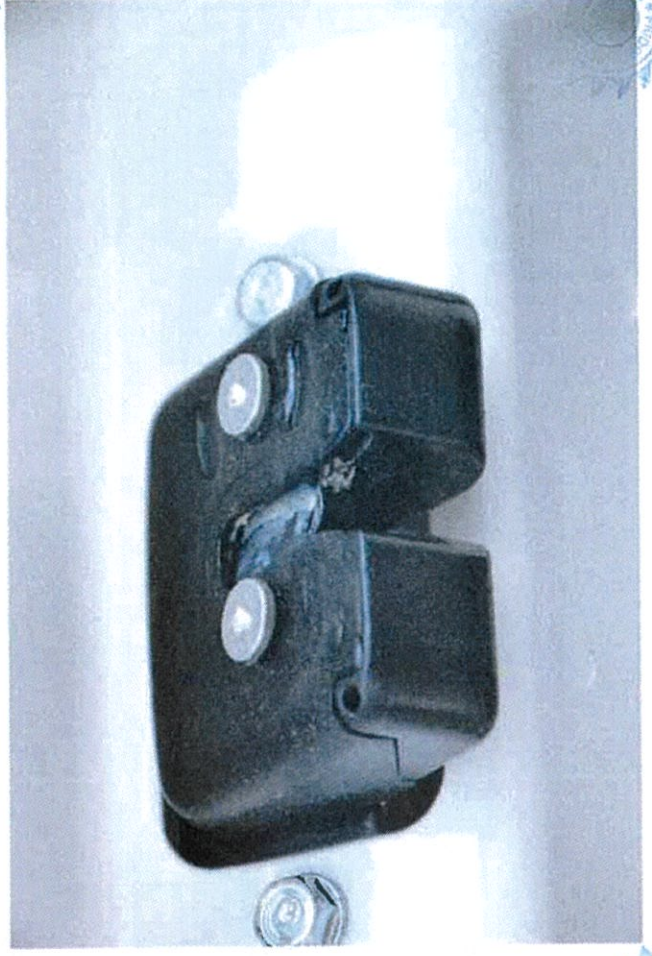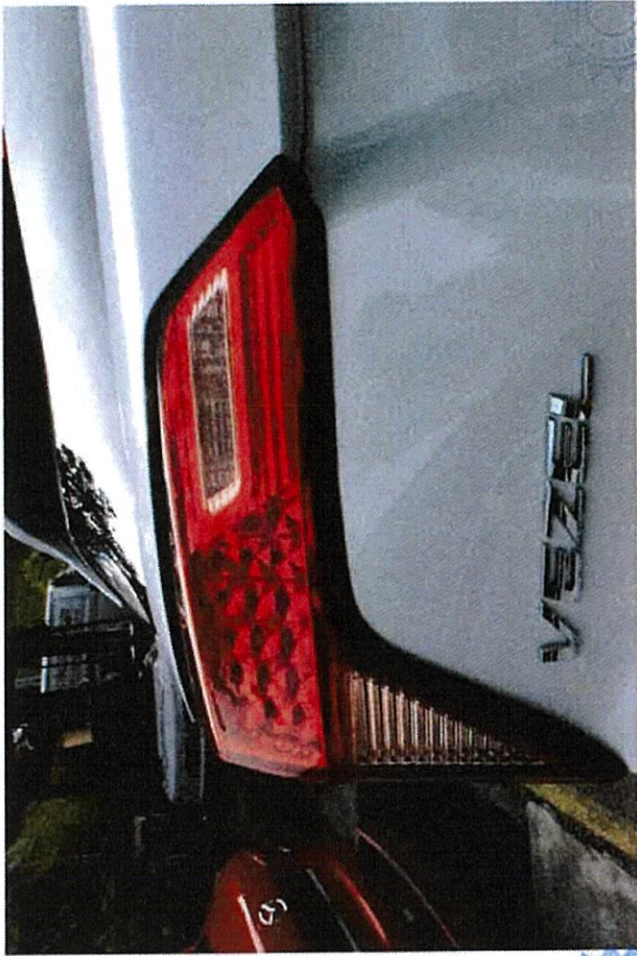

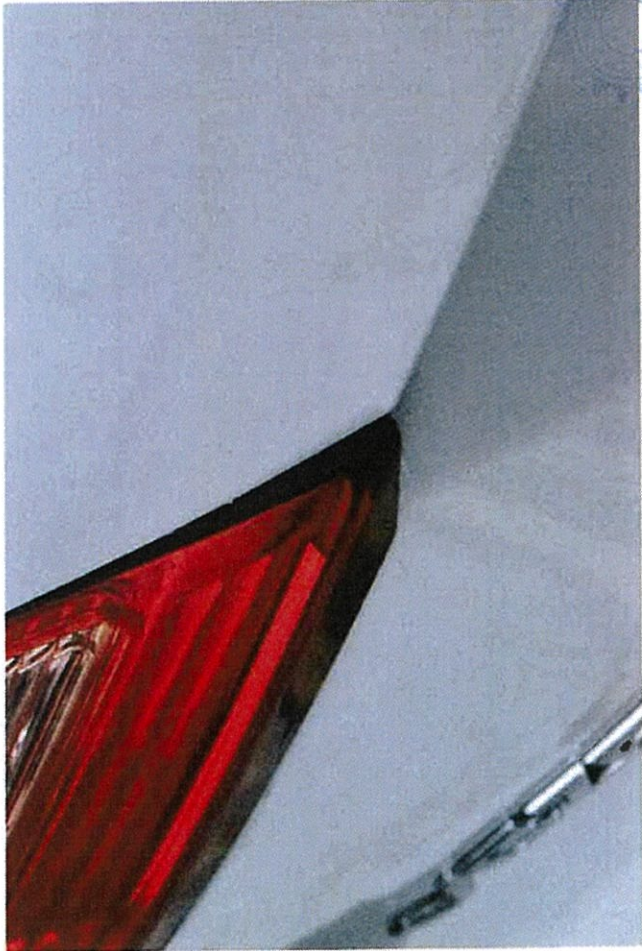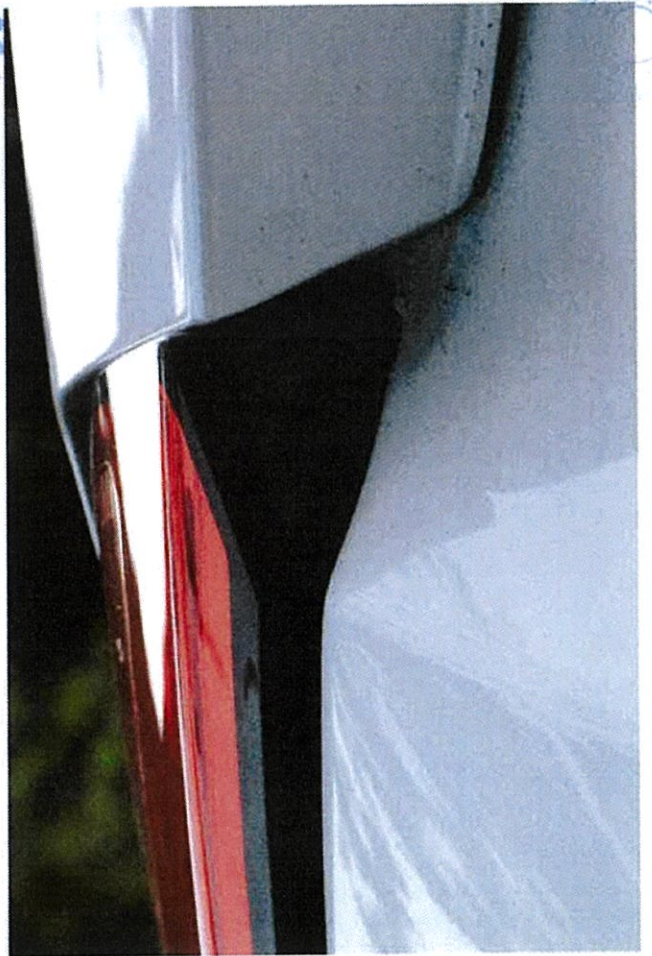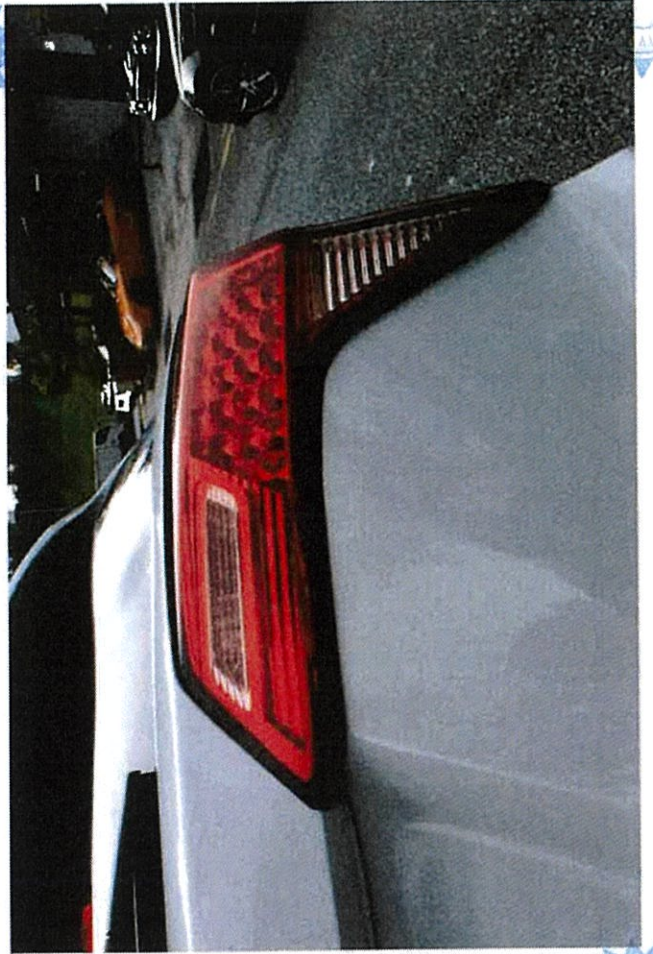

C

C