



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2202231

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 18/04/2022
Reference CC6/CTI21008484/Aga3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBD 410E
Insured Veh. SMW 6984X
Claim No. SNM21D204178
Policy No. DMPCSNW00011482100
Accident Date 27/07/2021
Inspection Date 11/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21008484/Aga3q2	
			Date: 18/04/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMW 6984X	Veh. Inspected	GBD 410E	
Policy No.	DMPCSNW00011482100	Coverage (\$)	0.00	
Claim No.	SNM21D204178	Excess (\$)	0.00	
Assign From		Assign Date	11/08/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	JTFHT02P100138125	Colour	SILVER	
Odometer	197395 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15C	YOKOHAMA	6 mm	
L/H Front Tyre	195 R15C	YOKOHAMA	6 mm	
R/H Rear Tyre	195 R15C	YOKOHAMA	6 mm	
L/H Rear Tyre	195 R15C	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/07/2021	Inspection Date	11/08/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBD 410E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BONNET	DENTED	698.70	698.70
2	FRONT BONNET HINGES @\$65.20	NOT NECESSARY	130.40	-
1	FRONT BONNET LOGO	NECESSARY	95.20	95.20
1	FRONT BONNET INNER LOCK	NOT NECESSARY	298.60	-
1	FRONT CORNER PANEL	BUCKLED	198.20	198.20
1	FRONT BUMPER	DEFORMED	598.20	598.20
1	FRONT BUMPER GRILLE BASE	CRACKED	526.90	526.90
1	FRONT BUMPER GRILLE TOP GARNISH	CRACKED	345.80	345.80
1	FRONT BUMPER GRILLE LOWER GARNISH	CRACKED	259.60	259.60
1	SET FRONT BUMPER GRILLE CLIPS	NECESSARY	30.00	20.00
1	FRONT BUMPER FOGLAMP GRILLE LH	DEFORMED	98.60	98.60
1	FRONT BUMPER SIDE RETAINERS	NECESSARY	145.80	85.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	458.20	-
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	30.00
1	FRONT BUMPER TOP BEAM	NOT NECESSARY	379.80	-
2	FRONT BUMPER REINFORCEMENT SIDE BRACKET @ \$138.00	NOT NECESSARY	276.00	-
1	HEADLAMPS	CRACKED	798.50	798.50
1	SET HEADLAMPS CLIPS	NECESSARY	60.00	20.00
1	FRONT WIPER TANK	NOT NECESSARY	158.20	-
1	FRONT WIPER GARNISH	NOT NECESSARY	185.20	-
1	FRONT DOOR	TO REPAIR SEE LABOUR	1,785.20	-
1	FRONT STEP PANEL GARNISH	NOT NECESSARY	145.80	-
	LESS 25% DISCOUNT		-1,930.73	-943.68
			5,792.17	2,831.02
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT DOOR COMPANY STICKER (SN)	NECESSARY	35.00	30.00
1	FRONT NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET RADIATOR COOLANT (SN)	NOT NECESSARY	60.00	-
			145.00	30.00

Report Ref No. CC6/CTI21008484/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>LABOUR</u>			
	PANEL BEATING,TO WELD AND ALIGN DAMAGED PARTS.INCLUDING OF THE REPAIR OF FRONT DOOR .		1,200.00	400.00
	SPRAY PAINTING.		1,200.00	550.00
	CHECK WIRING ON HEADLAMP.		120.00	30.00
	ANTI RUST.		120.00	40.00
			2,640.00	1,020.00
	GRAND TOTAL		8,577.17	3,881.02

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			3,100.00
---	--	--	-----------------

Report Ref No. CC6/CTI21008484/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 410E

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

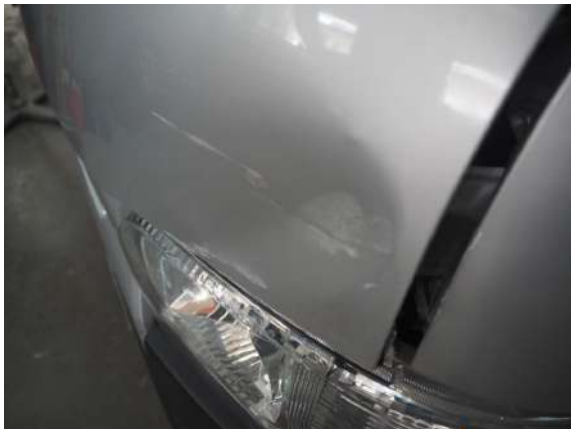



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 410E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

