

SINCERE

APPRAISAL SERVICES PTE LTD

VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 889/TP/2018

Date: 21/12/2018

REFERENCE

Date of loss: 8/12/2018
Claimant: Imran Bin Milatu

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJL7274Z	Make &	Mitsubishi
Reg date:	11/12/2008	Model	Lancer 1.5 Mivec
Colour:	Blue	Engine No:	4A910114757
Type:	Motor Car	Chassis No:	JMYSRCY2A9U002023
Type of Claims:	Third Party	Odometer No:	61124km
		Engine Cap:	1499cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY (STATIC ONLY)

General Condition: Good	Steering: Good	Engine Modification: Nil
Paint work: Good	Handbrake: Good	Pre-accident
	Footbrake: Good	Damage: Nil

CONDITION OF TYRES

Front Left Size:	Dunlop 205/60R16 70%	Front Right Size:	Dunlop 205/60R16 70%
Rear Left Size:	Dunlop 205/60R16 70%	Rear Right Size:	Dunlop 205/60R16 70%

The above percentages represent the remaining life of the tyre threads


COST OF REPAIRS

	Repairer S\$	Adjuster S\$
Parts	\$ 4,253.40	\$ 4,253.40
Labour	\$ 2,840.00	\$ 2,340.00
Calculated Cost (S\$) :	\$ 7,093.40	\$ 6,593.40

Recommended Lump Sum Repair Cost (S\$) : \$ 5,300.00

Date of Assignment:	12/12/2018	Inspected At:	28 Autowerkz Pte Ltd
Date Inspected:	12/12/2018		1002 Bukit Merah Lane 3
Est. repair Period:	06 days		#01-83
			Singapore 159719

POINT OF IMPACT

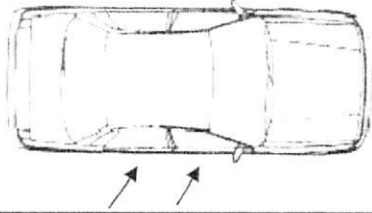Damaged at the right hand front and right hand rear portion	
---	--

BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's vehicle along Woodlands Avenue 6.

GENERAL DESCRIPTION OF DAMAGES


Our visual inspection of the vehicle revealed that the damages noted are at the right hand front and right hand rear portion.

SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$7,093.40. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$5,300.00.

We have not authorised the repair. Under normal circumstances, estimated 06 working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

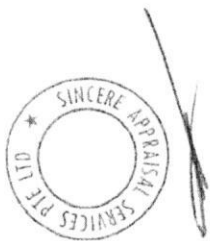

Dave Chang
Automotive Appraiser
AUTO. ENG, CAE, CGI
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.

ANNEX A

REPAIR DETAILS

Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount	
1	1	Front right door assy	grazed/dented	\$ 973.00	\$ 973.00	
2	1	Rear right door assy	grazed/dented	\$ 903.00	\$ 903.00	
3	2	Rear right door hinges	bent/necessary	\$ 176.00	\$ 176.00	XR
4	1	Rear right door checker linkage	bent/necessary	\$ 179.00	\$ 179.00	XR
5	1	Rear right door outer handle	bent/necessary	\$ 175.00	\$ 175.00	
6	1	Rear right door lock mechanism	bent	\$ 125.00	\$ 125.00	
7	1	Rear right door regulator with motor assy	malfunction	\$ 347.00	\$ 347.00	
8	1	Rear right door weatherstrip	warped/cut	\$ 124.00	\$ 124.00	
9	1	Rear right door glass	grazed/cut	\$ 345.00	\$ 345.00	
10	1	Rear right door glass chrome moulding	grazed/cut	\$ 279.00	\$ 279.00	
				\$ 3,626.00	\$ 3,626.00	3271
Less 10%				\$ 362.60	\$ 362.60	2943.90
				\$ 3,263.40	\$ 3,263.40	
<u>Special Nett Items</u>						
1	1	Rear right lower spoiler	warped/bent	\$ 880.00	\$ 880.00	700 550
2	10	Rear right lower spoiler clips	necessary	\$ 30.00	\$ 30.00	
3	1	Rear right lower spoiler sealant	necessary	\$ 80.00	\$ 80.00	50
				\$ 990.00	\$ 990.00	840
Total parts				\$ 4,253.40	\$ 4,253.40	630

ANNEX B

REPAIR DETAILS

Recommended Labour

No	Description	Repairer's Amount	Adjuster's Amount	
1	Labour for panel beating, cut, weld, straighten front right, rear right affected area and replace front right and rear right damaged parts.	\$ 1,200.00	\$ 1,000.00	800 600
2	To putty and spray painting front right and rear right portion.	\$ 1,200.00	\$ 1,000.00	600 800
3	To apply anti rust proofing to front right and rear right affected area.	\$ 120.00	\$ 100.00	40
4	To remove and install rear right door lock mechanism.	\$ 80.00	\$ 60.00	
5	To check door centre locking for function.	\$ 80.00	\$ 60.00	30
6	To transfer rear right door glass to new door.	\$ 80.00	\$ 60.00	
7	To transfer front right door glass to new door.	\$ 80.00	\$ 60.00	
Total labour :		\$ 2,840.00	\$ 2,340.00	1850 1450

ANNEX C

REPAIR DETAILS

Adjusted Repair Cost

	Repairer's Amount	Adjuster's Amount
Total parts :	\$ 4,253.40	\$ 4,253.40
Total labour :	\$ 2,840.00	\$ 2,340.00
Total repair cost :	\$ 7,093.40	\$ 6,593.40
		5603.90
		6 DAYS L/\$4500

Adjusted Repair Cost (Lump Sum Repair)

\$ 5,300.00

[Signature]
25/8/2021

2943.90

630

1450

5023.90

1/5 \$4000

06 days
4 days