



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200334

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 17/01/2022
Reference CC3/CTI21008921/Kea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHF 761K
Insured Veh. SLL 203B
Claim No. SNM21D204734/C02
Policy No. DMHCSNA00004192100
Accident Date 23/08/2021
Inspection Date 24/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21008921/Kea3q2 Date: 17/01/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLL 203B	Veh. Inspected	SHF 761K	
Policy No.	DMHCSNA00004192100	Coverage (\$)	0.00	
Claim No.	SNM21D204734/C02	Excess (\$)	0.00	
Assign From		Assign Date	24/08/2021	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	VF1ABL15AUC283336	Colour	METALLIC WHITE /RED	
Odometer	564481 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	SAILUN	8 mm	
L/H Front Tyre	215/60 R16	SAILUN	8 mm	
R/H Rear Tyre	215/60 R16	SAILUN	8 mm	
L/H Rear Tyre	215/60 R16	SAILUN	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/08/2021	Inspection Date	24/08/2021	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 761K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR	BUCKLED	561.70	561.70
1	BUMPER LOWER REAR	DENTED / DISTORTED	411.90	411.90
1	BUMPER BRACKET CTR REAR	SERVICEABLE	98.10	-
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	82.10	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	59.80	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	80.80	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	54.20	-
1	BUMPER BEAM REAR	TO REPAIR SEE LABOUR	547.80	-
1	BUMPER BEAM BRACKET LH REAR	TO REPAIR SEE LABOUR	114.50	-
1	BUMPER BEAM BRACKET RH REAR	TO REPAIR SEE LABOUR	114.50	-
1	OUTER PANEL REAR (END PANEL)	TO REPAIR SEE LABOUR	745.80	-
1	OUTER PANEL REAR (END PANEL) TRIM	SERVICEABLE	404.56	-
1	BUMPER COVER FRT	BENT /TORN	747.20	747.20
1	BUMPER SPOILER FRT	DISTORTED	344.70	344.70
1	BUMPER ABSORBER FRT	CRACKED	394.68	394.68
1	BUMPER RETAINER FRT LH	SERVICEABLE	101.40	-
1	BUMPER SUPPORT FRT	SERVICEABLE	10.70	-
1	BUMPER RETAINER FRT RH	DISTORTED	101.40	101.40
1	BUMPER SUPPORT FRT	SERVICEABLE	10.70	-
1	BUMPER UNDERTRAY FRT	CRACKED	292.50	292.50
1	BUMPER GRILLE LOWER FRT	DISTORTED	147.00	147.00
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER FOG LAMP GRILLE RH	DISTORTED	207.21	207.21
1	BUMPER BEAM FRT	BENT	663.70	663.70
1	TOW COVER FRT	MISSING	60.90	60.90
1	RADIATOR GRILLE	CRACKED	969.90	969.90
1	RADIATOR GRILLE BADGE 'RENAULT'	NECESSARY	225.36	225.36
1	RADIATOR GRILLE FRAME	CRACKED	686.00	686.00

Report Ref No. CC3/CTI21008921/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRAME FULL SUPPORT PANEL	BROKEN	592.70	592.70
1	FRAME FULL SUPPORT BRACKET	BENT	41.60	41.60
1	FRONT BRACE PANEL	BENT	177.22	177.22
1	HORN	SERVICEABLE	449.90	-
1	HORN BRACKET	TO REPAIR SEE LABOUR	21.90	-
1	HEADLAMP LH	CRACKED	743.60	743.60
1	HEADLAMP RH	CRACKED	743.60	743.60
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	128.30	-
1	HEADLAMP PANEL FRT RH	BENT	128.30	128.30
1	BONNET	BUCKLED	1,312.70	1,312.70
1	BONNET INSULATOR	SERVICEABLE	294.30	-
1	BONNET STRUT LH	SERVICEABLE	53.30	-
1	BONNET STRUT RH	SERVICEABLE	53.30	-
1	BONNET HINGE LH	DISTORTED	237.40	237.40
1	BONNET HINGE RH	DISTORTED	237.40	237.40
1	BONNET LOCK	BENT	152.80	152.80
1	FENDER PANEL FRT RH	BENT	437.10	437.10
1	FENDER PANEL FRT LH	TO REPAIR SEE LABOUR	437.10	-
1	WHEELARCH FRT LH	SERVICEABLE	191.40	-
1	FENDER BRACKET LOWER LH	SERVICEABLE	11.80	-
1	FENDER INSULATOR LH	SERVICEABLE	66.30	-
1	FENDER BRACKET FRT LH	TO REPAIR SEE LABOUR	106.40	-
1	WHEELARCH FRT RH	MISSING	191.40	191.40
1	FENDER BRACKET LOWER RH	SERVICEABLE	11.80	-
1	FENDER INSULATOR RH	SERVICEABLE	66.30	-
1	FENDER BRACKT FRT RH	TO REPAIR SEE LABOUR	106.40	-
1	WIPER RESERVOIR	SERVICEABLE	179.60	-
1	WIPER RESERVOIR NECK	SERVICEABLE	29.30	-
1	WIPER RESERVOIR MOTOR	SERVICEABLE	82.60	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-

Report Ref No. CC3/CTI21008921/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIR CLEANER HOSE	SERVICEABLE	175.85	-
1	BASE BATTERY TRAY	SERVICEABLE	363.40	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	A/C HEATER VALVE	SERVICEABLE	484.50	-
1	SUBFRAME OUTER FRT	SERVICEABLE	1,094.20	-
1	SUBFRAME BRACKET OUTER LH	SERVICEABLE	49.00	-
1	SUBFRAME BRACKET OUTER RH	SERVICEABLE	49.00	-
1	ENGINE UNDERTRAY	SERVICEABLE	583.10	-
1	A/C CONDENSER	BENT	1,537.80	1,537.80
1	A/C CONDENSER GARNISH LH UPPER	SERVICEABLE	57.30	-
1	A/C CONDENSER GARNISH RH UPPER	SERVICEABLE	56.70	-
1	A/C CONDENSER GARNISH LH	SERVICEABLE	67.90	-
1	A/C CONDENSER GARNISH RH	SERVICEABLE	67.70	-
1	RADIATOR	BENT	871.20	871.20
2	RADIATOR STUD UPPER	SERVICEABLE	11.10	-
2	RADIATOR BUSH UPPER	SERVICEABLE	11.10	-
2	RADIATOR MTG LOWER	SERVICEABLE	30.10	-
1	RADIATOR FAN COWLING	SERVICEABLE	417.00	-
1	RADIATOR FAN MOTOR LH	SERVICEABLE	826.70	-
1	RADIATOR FAN MOTOR RH	SERVICEABLE	821.20	-
1	SUBFRAME INNER FRT	SERVICEABLE	2,284.80	-
1	SUBFRAME SUPPORT TRIM	SERVICEABLE	69.50	-
1	SUBFRAME BRACKET INNER FRT LH	TO REPAIR SEE LABOUR	101.00	-
1	SUBFRAME BRACKET INNER FRT RH	TO REPAIR SEE LABOUR	101.00	-
	LESS 10% DISCOUNT		-2,659.88	-1,321.90
			23,938.87	11,897.07
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN)	NOT NECESSARY	33.00	-
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-

Report Ref No. CC3/CTI21008921/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BONNET LOCK NUT (SN)	SERVICEABLE	60.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	BUMPER CLIP FRT (SN)	NECESSARY	85.00	66.00
1	BUMPER RETAINER CLIP FRT (SN)	NOT NECESSARY	70.00	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT CHANGED	70.00	-
1	BUMPER FOG LAMP GRILLE CLIP (SN)	NOT NECESSARY	65.00	-
1	LICENSE PLATE WITH HOLDER FRT (SN)	BENT	120.00	45.00
1	BUMPER SUPPORT CLIP FRT RH (SN)	NOT NECESSARY	10.50	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NO SUCH PARTS	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
6	BONNET INSULATOR CLIP L70Y (SN)	NOT NECESSARY	7.30	-
2	BONNET CABLE CLIP L70Y (SN)	NOT NECESSARY	6.31	-
2	BONNET CABLE COVER SCREW L70Y (SN)	NOT NECESSARY	10.85	-
			1,634.96	243.00
	LABOUR			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		3,000.00	1,320.00
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BUMPER BEAM REAR,BUMPER BEAM BRACKET LH REAR,BUMPER BEAM BRACKET RH REAR,OUTER PANEL REAR (END PANEL),HORN BRACKET,HEADLAMP PANEL FRT LH,FENDER PANEL FRT LH,FENDER BRACKET FRT LH ,FENDER BRACKET FRT RH,SUBFRAME BRACKET INNER FRT LH AND SUBFRAME BRACKET INNER FRT RH .		6,000.00	800.00
	TO RUST-PROOFING OF THE AFFECTED AREAS .		170.00	90.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	60.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF BOOTLID FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE .	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX ,RENEW THE SAME ,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			10,580.00	2,290.00
GRAND TOTAL			36,153.83	14,430.07
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				11,550.00

Report Ref No. CC3/CTI21008921/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHF 761K

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

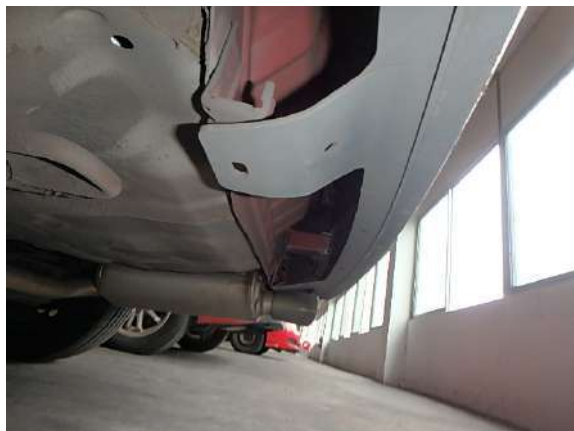



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

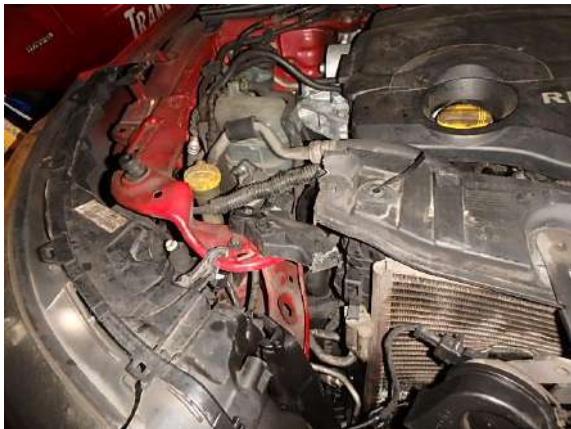



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

