



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2200319

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 14/01/2022
Reference CC4/LPC21009009/Bea3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBC 6181G
Insured Veh. YN 5196R
Claim No. 21/21/21/VC05/024891
Policy No. Z21VC05008201
Accident Date 25/08/2021
Inspection Date 30/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21009009/Bea3q2 Date: 14/01/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 5196R	Veh. Inspected	GBC 6181G	
Policy No.	Z21VC05008201	Coverage (\$)	0.00	
Claim No.	21/21/21/VC05/024891	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	26/08/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	JTFHT02P300114313	Colour	ORANGE	
Odometer	209905 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/15	BRIDGESTONE	5 mm	
L/H Front Tyre	195/15	BRIDGESTONE	5 mm	
R/H Rear Tyre	195/15	BRIDGESTONE	5 mm	
L/H Rear Tyre	195/15	BRIDGESTONE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/08/2021	Inspection Date	30/08/2021	
Survey held at	TEAM AUTOPRO PTE LTD 160 SIN MING DR #01-14 SIN MING AUTO CITY SINGAPORE 575722			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBC 6181G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	BROKEN	548.30	375.40
2	FRONT BUMPER SIDE RETAINER @\$298.90	NECESSARY	597.80	120.00
1	HEADLAMP LH	BROKEN	754.20	340.00
1	HEADLAMP PANEL	NOT DAMAGED	148.60	-
1	FRONT DOOR LH	DENTED	975.80	520.00
1	FRONT DOOR WEATHERSTRIP	NOT DAMAGED	148.00	-
1	FRONT DOOR INNER LOCK	NOT DAMAGED	315.20	-
2	FRONT DOOR HINGE @\$105.80	NOT DAMAGED	211.60	-
1	FRONT DOOR PILLAR LH	NOT DAMAGED	923.30	-
1	FRONT STEP PANEL LH	NOT DAMAGED	240.60	-
1	FRONT STEP PANEL GARNISH LH	NOT DAMAGED	187.40	-
1	SIDE MIRROR ASSY LH	BROKEN	870.00	599.10
1	FRONT KNUCKLE ARM LH	NOT DAMAGED	451.20	-
1	FRONT KNUCKLE ARM BEARING LH	JAMMED	298.00	298.00
1	FRONT LOWER ARM LH	NOT DAMAGED	378.20	-
1	FRONT UPPER ARM LH	NOT DAMAGED	396.70	-
1	FRONT SHOCK ABSORBER LH	NOT DAMAGED	213.20	-
1	FRONT CONTROL ARM LH	NOT DAMAGED	242.00	-
	LESS 25% DISCOUNT		-1,975.03	-563.13
			5,925.07	1,689.37
<u>SPECIAL NETT ITEMS</u>				
1	SUNDRIES (SN)	NOT NECESSARY	80.00	-
1	FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	FRONT BUMPER LOWER LIP (FIBRE) (SN)	CUT	650.00	500.00
1	FRONT CORNER PANEL LH (FIBRE) (SN)	BROKEN	400.00	258.20
1	HEADLAMP OUTER CHROME GARNISH (SN)	NECESSARY	350.00	205.40
1	FRONT DOOR SEALANT (SN)	NOT DAMAGED	100.00	-
1	FRONT DOOR COMPANY STICKER (SN)	NOT NECESSARY	60.00	-
1	FRONT DOOR OUTER GARNISH (CARBON FIBRE) (SN)	CUT	400.00	98.00
1	FRONT STEP PANEL SEALANT (SN)	NOT NECESSARY	100.00	-

Report Ref No. CC4/LPC21009009/Bea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT STEP PANEL GARNISH CLIPS (SN)	NOT NECESSARY	50.00	-
1	SIDE MIRROR OUTER CHROME GARNISH (SN)	NECESSARY	380.00	102.65
1	FRONT RIM (SN)	NOT DAMAGED	650.00	-
1	FRONT TYRE (SN)	NOT DAMAGED	480.00	-
1	FRONT RIM CAP (SN)	BROKEN	280.00	126.80
			4,030.00	1,321.05
	LABOUR			
	R&R FRONT DOOR COMPONENT.		150.00	80.00
	R&R FRONT UNDER CARRIAGE .		300.00	120.00
	R&R FRONT TYRE & BALANCING .	NOT NECESSARY	100.00	-
	WHEEL ALIGNMENT.		180.00	60.00
	CHECK WIRING .		100.00	30.00
	UPHOLSTERY.	NOT NECESSARY	300.00	-
	PANEL BEATING.		1,400.00	800.00
	RUST PROOFING.	NOT NECESSARY	200.00	-
	SPRAY PAINTING.		1,400.00	600.00
			4,130.00	1,690.00
GRAND TOTAL			14,085.07	4,700.42
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,750.00

Report Ref No. CC4/LPC21009009/Bea3q2

LIM TEOW GUAN

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 6181G

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

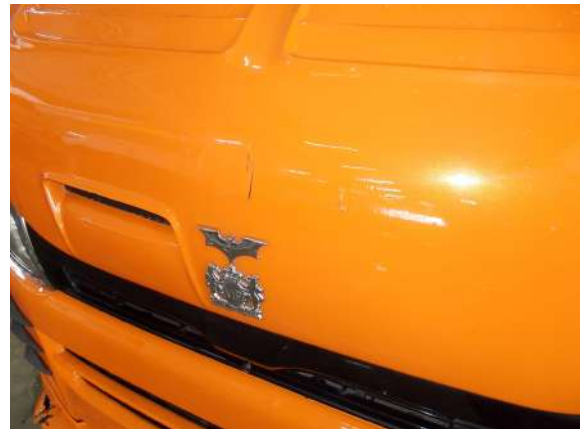



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

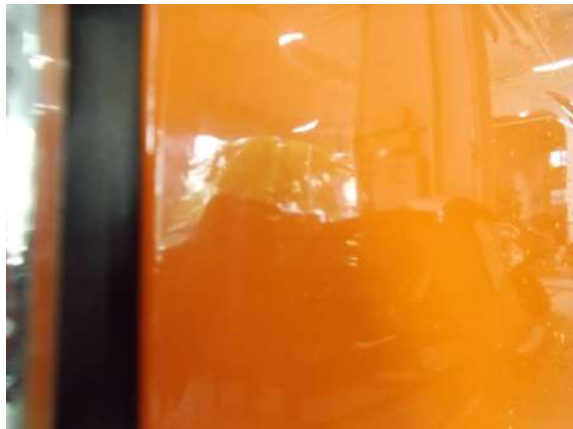



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 6181G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 6181G

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

