



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2108399

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 07/12/2021
Reference CC3/CTI21009142/Vpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHA 9498M
Insured Veh. SLD 4343X
Claim No. SNM21D204800/C02
Policy No. DMHCSNW00008372001
Accident Date 26/08/2021
Inspection Date 27/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC3/CTI21009142/Vpa3q2	
			Date: 07/12/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLD 4343X	Veh. Inspected	SHA 9498M	
Policy No.	DMHCSNW00008372001	Coverage (\$)	0.00	
Claim No.	SNM21D204800/C02	Excess (\$)	0.00	
Assign From		Assign Date	27/08/2021	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHC851CVLU178518	Colour	YELLOW	
Odometer	153440 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/08/2021	Inspection Date	27/08/2021	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 9498M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	DEFORMED	2,253.80	2,253.80
1	BONNET RUBBER LH	SERVICEABLE	118.70	-
1	BONNET RUBBER RH	SERVICEABLE	118.70	-
2	BONNET HINGE LH RH @\$118.70	BENT	237.40	237.40
1	BONNET MOULDING	SERVICEABLE	41.40	-
1	BONNET LOCK	JAMMED	127.30	127.30
1	BONNET ABSORBER	SERVICEABLE	35.70	-
1	BONNET INSULATOR	SERVICEABLE	230.10	-
1	BONNET SEAL	SERVICEABLE	38.30	-
1	BONNET INSULATOR CLIPS	SERVICEABLE	15.00	-
1	RADIATOR GRILLE	CUT	1,409.10	1,409.10
1	RADIATOR GRILLE UPR	CUT	48.30	-
1	FRONT NUMBER PLATE GARNISH	CUT	188.00	188.00
1	RADIATOR H EMBLEM	SERVICEABLE	31.30	-
1	UNIT ASSY -SMART CRU (RADAR SENSOR)	SERVICEABLE	2,910.90	-
1	COVER ASSY -S.C.C UNIT	SERVICEABLE	767.30	-
2	ANTENNA ASSY SMARTKEY LH RH @\$80.20	SERVICEABLE	160.40	-
1	WIRING HARNESS BES EXT	SERVICEABLE	988.90	-
1	FRONT BUMPER COVER	CUT	430.90	430.90
1	FRONT BUMPER TOP COVER	SERVICEABLE	476.30	-
1	FRONT BUMPER SPONGE	CUT	186.90	186.90
1	FRONT BUMPER SPONGE /ABSORBER	SERVICEABLE	96.90	-
1	FRONT BUMPER REINFORCEMENT	CUT	1,075.10	1,075.10
2	FRONT BUMPER REINFORCEMENT ABSORBER LH RH	SERVICEABLE	186.50	-
1	FRONT BUMPER MOULDING CENTRE UPPER	CUT	368.50	368.50
1	FRONT BUMPER GRILLE LH	CUT	186.90	186.90
1	FRONT BUMPER TOWING COVER	CUT	29.00	29.00
1	FRONT BUMPER CENTRE MOULDING	SERVICEABLE	188.00	-
1	FRONT BUMPER MOULDING	SERVICEABLE	187.20	-
1	FRONT BUMPER LOWER STIFFNER	SERVICEABLE	285.10	-
1	FRONT BUMPER LIP	SERVICEABLE	35.10	-

Report Ref No. CC3/CTI21009142/Vpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT BUMPER BRACKET TOP LH RH	NECESSARY	70.00	70.00
2	FRONT BUMPER BRACKET LH RH	NECESSARY	56.00	56.00
10	FRONT BUMPER CLIPS	NECESSARY	22.00	22.00
1	FRONT BUMPER CENTRE GRILLE	CUT	318.80	318.80
1	FRONT BUMPER LOWER GRILLE MOULDING	SERVICEABLE	127.60	-
2	FRONT BUMPER AIR DUCT LH RH	CUT	153.80	153.80
1	HEADLAMP SUPPORT PANEL ASSY	CUT	949.30	949.30
2	HEADLAMP LH RH @\$1993.65	N/S CRACKED	3,987.30	1,993.65
1	DAY LIGHT ,LH	SERVICEABLE	642.50	-
1	DAY LIGHT WIRE ,LH	SERVICEABLE	585.50	-
1	BUZZER ASSY -PIEZO (LH)	SERVICEABLE	388.00	-
1	RADIATOR INVERTER	CUT	884.80	884.80
1	RADIATOR	CUT	710.50	710.50
1	COOLANT	NECESSARY	45.00	45.00
1	RADIATOR FAN	SERVICEABLE	375.10	-
1	RADIATOR HOSE UPPER	SERVICEABLE	166.20	-
1	RADIATOR HOSE LOWER	SERVICEABLE	156.20	-
1	RADIATOR HOSE WATER	SERVICEABLE	123.50	-
1	RADIATOR PIPE WATER	SERVICEABLE	176.30	-
1	RADIATOR TANK RESERVOIR	SERVICEABLE	196.50	-
1	RADIATOR HOSE & TUBE ASSY	SERVICEABLE	245.70	-
2	RADIATOR AIR GUARD (LH/RH) @\$38.20	SERVICEABLE	76.40	-
2	RADIATOR AIR GUARD ,UPR (LH/RH) @\$63.75	SERVICEABLE	127.50	-
1	HORN UNIT	SERVICEABLE	72.80	-
1	HORN WIRE	SERVICEABLE	386.70	-
1	FRONT FENDER LH	DEFORMED	588.80	588.80
1	FRONT FENDER SHIELD LH	SERVICEABLE	164.70	-
1	FRONT FENDER RETAINER	SERVICEABLE	82.80	-
1	EMBLEM BLUE-DRIVE	NECESSARY	26.60	26.60
1	AIRCON EXPANSION VALVE	SERVICEABLE	313.60	-
1	AIRCON CONDENSER	CUT	663.60	663.60
1	AIRCON SUCTION & LIQUID HOSE	SERVICEABLE	679.60	-
1	AIRCON DISCHARGE HOSE	SERVICEABLE	148.50	-

Report Ref No. CC3/CTI21009142/Vpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AIRCON BLOWER MOTOR	SERVICEABLE	567.50	-
1	BATTERY TRAY	SERVICEABLE	234.80	-
1	FRONT WINDSCREEN PILLAR OUTER RH	TO REPAIR SEE LABOUR	3,764.90	-
1	REAR BUMPER COVER	CUT	459.40	459.40
1	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	REAR BUMPER CENTRE MOULDING ASSY	CUT	451.25	451.25
1	REAR BUMPER REINFORCEMENT	CUT	394.80	394.80
2	REAR BUMPER REINFORCEMENT BRACKET LH RH @ \$138.10	SERVICEABLE	276.20	-
1	REAR BUMPER LOWER CTR MOULDING	TO REPAIR SEE LABOUR	155.00	-
1	REAR BUMPER TOWING COVER	SERVICEABLE	98.80	-
1	REAR BUMPER FOG LAMP	SERVICEABLE	201.50	-
1	REAR BUMPER UNDER COVER	CUT	225.00	225.00
1	LICENCE LAMP	DISTORTED	85.30	85.30
1	BOOTLID	CUT	2,480.40	2,480.40
2	BOOTLID HINGE LH RH @\$31.30	SERVICEABLE	62.60	-
1	BOOTLID KEY LOCK	JAMMED	141.00	141.00
1	BOOTLID HYUNDAI PLATE	NECESSARY	24.30	24.30
1	EMBLEM HYBRID	NECESSARY	24.30	24.30
1	EMBLEM -IONIQ	NECESSARY	31.30	31.30
1	REAR PANEL	TO REPAIR SEE LABOUR	532.00	-
1	REAR PANEL GARNISH	SERVICEABLE	346.80	-
1	ANTENNA ASSY SMARTKEY	SERVICEABLE	40.50	-
1	EXHAUST SILENCER	SERVICEABLE	943.50	-
1	EXHAUST PIPE HANGER	SERVICEABLE	29.20	-
1	RADIATOR FAN BLOWER MOTOR ASSY (ADDITIONAL)	CUT	1,226.60	1,226.60
	LESS 20% DISCOUNT		-7,996.83	-3,708.28
			31,987.32	14,833.12
	<u>SPECIAL NETT ITEMS</u>			
1	FRT NUMBER PLATE WITH TRIM COVER (SN)	SCRATCHED	55.00	55.00
1	BOOTLID COMFORT TEL NO STICKER (SN)	NECESSARY	35.00	35.00

Report Ref No. CC3/CTI21009142/Vpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOTLID COMFORT LOGO STICKER (SN)	NECESSARY	30.00	30.00
1	BOOTLID COMFORT APP STICKER (SN)	NECESSARY	30.00	30.00
1	REAR NUMBER PLATE WITH TRIM COVER (SN)	SCRATCHED	55.00	55.00
1	REAR BUMPER RUBBER MAT (SN)	NECESSARY	50.00	50.00
1	REAR BUMPER REVERSE SENSOR (SN)	CUT	180.00	180.00
			435.00	435.00
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT WINDSCREEN PILLAR OUTER RH ,REAR BUMPER LOWER CTR MOULDING AND REAR PANEL.		2,500.00	1,750.00
	SPRAY PAINTING CHARGE.		2,000.00	1,250.00
	REMOVE/REFIX AIRCON & REFILL GAS.		150.00	60.00
	REMOVE/REFIX RADIATOR .		90.00	30.00
	REMOVE/REFIX EXHAUST PIPE.	NOT NECESSARY	150.00	-
	TOWING CHARGE.		60.00	60.00
	TUFF KOTE.		120.00	60.00
	CHECK WIRING .		120.00	40.00
			5,190.00	3,250.00
GRAND TOTAL			37,612.32	18,518.12
RECOMMENDED COST OF REPAIRS				18,518.12

Report Ref No. CC3/CTI21009142/Vpa3q2

THEVAN THOMAS KARTHIKESAVAN

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9498M

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

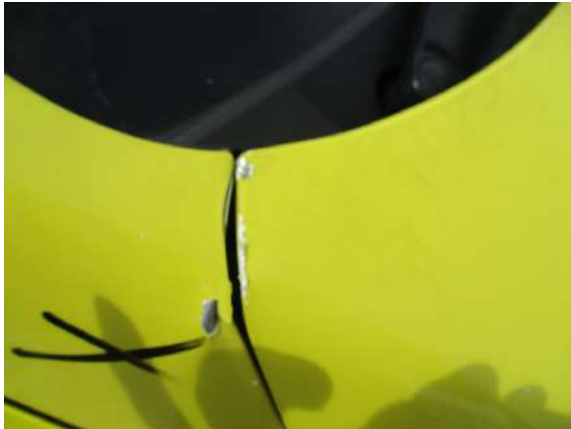



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

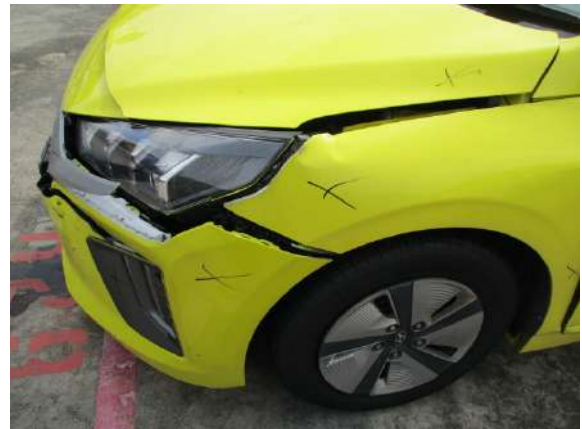



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9498M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9498M

RE-INSPECTION

