



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2201079
3 ANSON ROAD #16-00	INV Date	28/02/2022
SPRINGLEAF TOWER	Reference	CC3/CTI21009271/Ges3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SHC 4644E
Insured Veh.	GW 1660J
Claim No.	SNM21D204932C02
Policy No.	DMPCSNW00033492100
Accident Date	28/08/2021
Inspection Date	01/09/2021

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (7%)</b>	<b>28.00</b>
<b>Grand Total</b>	<b>428.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD  
3 ANSON ROAD #16-00  
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC3/CTI21009271/Ges3q2

Date: 28/02/2022

Code: CTI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	GW 1660J	<b>Veh. Inspected</b>	SHC 4644E
<b>Policy No.</b>	DMPCSNW00033492100	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	SNM21D204932C02	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	01/09/2021

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	TOYOTA PRIUS	<b>c.c</b>	1798
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2014
<b>Chassis No.</b>	JTDKN36U105752279	<b>Colour</b>	MAROON
<b>Odometer</b>	503500 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	STANDARD ALLOY RIM
<b>General</b>	GOOD		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	195/65 R15	SAILUN	6 mm
<b>L/H Front Tyre</b>	195/65 R15	SAILUN	6 mm
<b>R/H Rear Tyre</b>	195/65 R15	SAILUN	6 mm
<b>L/H Rear Tyre</b>	195/65 R15	SAILUN	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION.

DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	28/08/2021	<b>Inspection Date</b>	01/09/2021
<b>Survey held at</b>	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **5 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4644E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	FENDER FRT/LH (DISC 25%)	BUCKLED	723.40	542.55
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	FENDER LINER FRT/LH (DISC 25%)	DEFORMED	171.70	128.78
1	FENDER LINER PAD ,FR WHEEL ,LH (DISC 25%)	NECESSARY	49.30	36.98
1	WHEEL DISC ,FRONT (DISC 25%)	CUT	1,484.20	1,113.15
1	BUMPER FRT (DISC 25%)	CUT	482.00	361.50
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	BUMPER SUPPORT F/LH (DISC 25%)	DEFORMED	76.40	57.30
1	DOOR FRT /LH (DISC 25%)	BENT	894.40	670.80
1	CAP SUB-ASSY ,WHEEL (DISC 25%)	DISTORTED	174.10	130.58
1	HEADLAMP LH (DISC 10%)	SCRATCHED	945.20	850.68
1	STICKER DECAL SMRT (DOOR) (SN)	NECESSARY	60.00	60.00
1	HINGE LOWER LHF ,DOOR	NOT NECESSARY	90.10	-
1	HINGE UPPER LHF ,DOOR	NOT NECESSARY	80.50	-
1	CHECK ASSY ,FR DOOR	NOT NECESSARY	150.30	-
1	DOOR LOCK FRT/LH	NOT NECESSARY	575.80	-
1	MIRROR ASSY ,LH	NOT NECESSARY	1,224.90	-
1	MIRROR LAMP LH	NOT NECESSARY	65.30	-
1	COVER ,OUTER MIRROR LH	NOT NECESSARY	107.40	-
1	FENDER PROTECTOR FRT/LH UPPER	NOT NECESSARY	46.10	-
1	PROTECTOR ,FRONT FENDER SIDE PANEL LH	NOT NECESSARY	114.50	-
1	FENDER APRON SUB FRT/LH	NOT NECESSARY	637.80	-
1	WHEEL HUB FRT	NOT NECESSARY	549.70	-
1	BUMPER ENERGY ABSORBER FRT	NOT NECESSARY	78.80	-
1	BUMPER REINFORCEMENT FRT	NOT NECESSARY	498.40	-
1	ARM SUB-ASSY ,FR BUMPER LH	NOT NECESSARY	250.40	-
1	ARM SUB-ASSY ,FR BUMPER RH	NOT NECESSARY	250.40	-
1	BUMPER GRILLE SUB-ASSY ,LOWER	NOT NECESSARY	311.10	-
1	FOG LAMP LH	NOT NECESSARY	280.10	-
1	LENS & BODY ,FR TURN LH	NOT NECESSARY	511.80	-
1	GRILLE RADIATOR GRILLE NO.2	NOT NECESSARY	94.60	-

Report Ref No. CC3/CTI21009271/Ges3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BUMPER LIP FRT	NOT NECESSARY	139.60	-
1	BUMPER FRT ABSORBER LOWER	NOT NECESSARY	127.70	-
1	UNDER COVER CENTER	NOT NECESSARY	448.30	-
1	UNDER COVER SIDE /LH	NOT NECESSARY	46.10	-
1	HOOD PANEL	NOT NECESSARY	748.10	-
1	HOOD HINGE LH	NOT NECESSARY	55.90	-
1	HOOD HINGE RH	NOT NECESSARY	55.90	-
1	HEAD LAMP LH	NOT NECESSARY	945.20	-
1	SEAL ,FRONT FENDER TO COWL SIDE LH	TO REPAIR SEE LABOUR	15.20	-
1	MOULDING BODY ,LH	TO REPAIR SEE LABOUR	673.60	-
			14,302.30	4,003.33
	<b>LABOUR</b>			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF SEAL ,FRONT FENDER TO COWL SIDE LH AND MOULDING BODY ,LH .		676.00	400.00
	SPRAY PAINT.		2,412.00	680.00
	TO DO WHEEL ALIGNMENT /TYRE BALANCING .		120.00	60.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIX WING MIRROR .	NOT NECESSARY	120.00	-
	TO TRANSFER DOOR MECHANISM .		120.00	60.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	20.00
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	20.00
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	TOWING CHARGE.		56.00	40.00
			3,964.00	1,280.00
	<b>GRAND TOTAL</b>		<b>18,266.30</b>	<b>5,283.33</b>



<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>4,500.00</b>
---	--	--	-----------------

Report Ref No. CC3/CTI21009271/Ges3q2

**XING GUO QIANG**

**M.MATAI, AMSAE-A**

**Automotive Assessor**

**HO LEONG CHUAN**

**Automotive Assessor**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4644E

INSPECTION






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

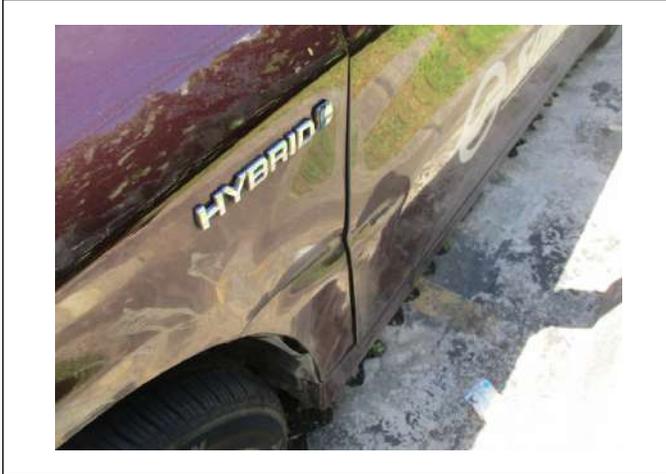



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

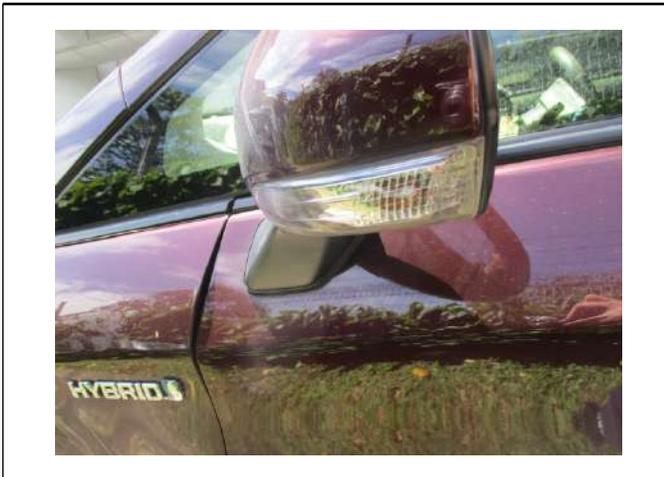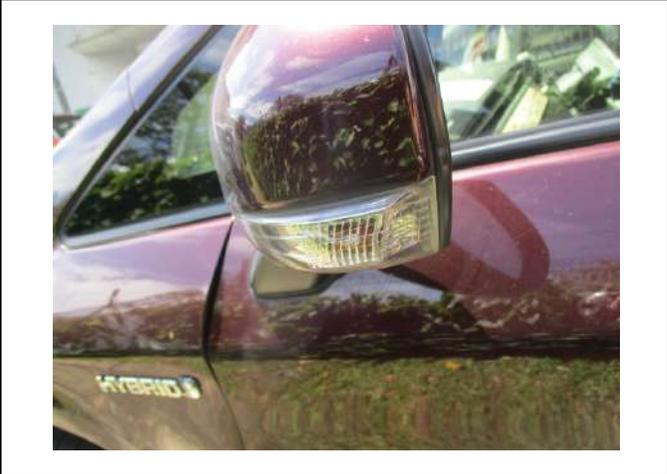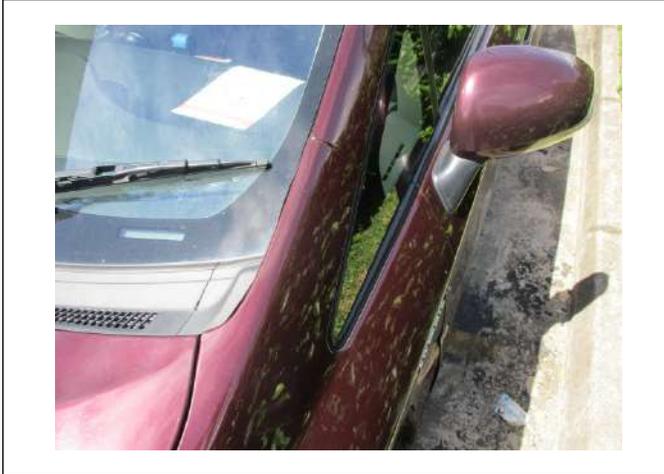





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

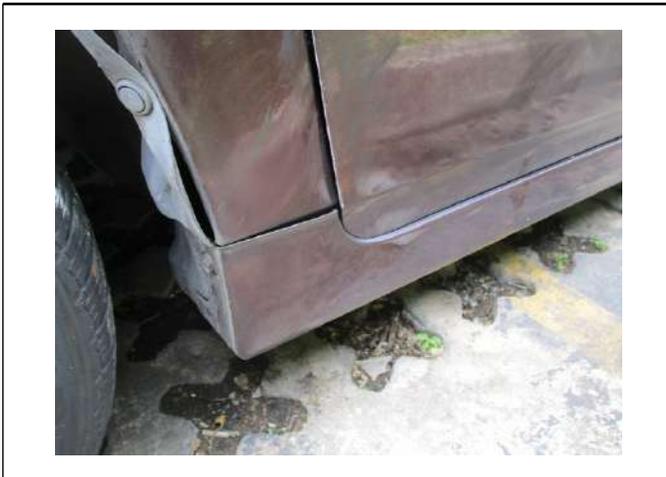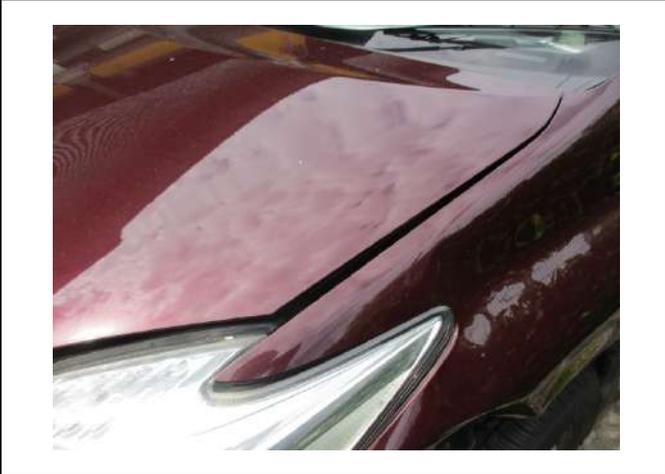



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SHC 4644E**

**RE-INSPECTION**

