

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
424 Balestier Road #02-06 Giffard Mansion Singapore 329810
E-mail Address: aasschee@singnet.com.sg
Tel: 96623655, 67655661, Fax: 67655662
RCB No. 43037800M

VEHICLE INSPECTION REPORT

To: Tong Heng Motor Work Report No : TP/0026/08/2021
Block 6, # 01-26
Kranji Loop
Singapore 739542 Date : 30 August 2021

REFERENCE

Requested by : Low Eng Siah 3rd Party Vehicle No. : XD 2876X
Date of Request : 23 August 2021 Owner's Vehicle No. : XD 5222M
Date of Accident : 19 August 2021 Sum Insured : Not Available
Date Inspected : 23 August 2021 Policy No. : Not Available
Inspected at : Tong Heng Motor Work Claim No. : Not Available

PARTICULARS OF VEHICLE

Reg. No. : XD 5222M Vehicle Model : CYZ52K Air Conditioner : Yes
Vehicle Make : Isuzu Engine No. : 6WG1415005 Radio/Cassette : Yes
Original Regn Date : 29 September 2011 Chassis No. : JALCYZ52KB7000054 Seat Belt : Yes
Lifespan Expire Date : 28 September 2031 Propellant : Diesel Colour : White/Blue
COE Expire Date : 28 September 2021 Engine Capacity : 15,681 cc. Speedometer : N.A.

CONDITION OF TYRES	MAKE	SIZE	RIM	% REMAINING
Right Front :	Annaite	295/80 R22.5	Standard	60%
Left Front	Annaite	295/80 R22.5	Standard	60%
Right rear	Annaite	295/80 R22.5	Standard	60%
Left Rear :	Annaite	295/80 R22.5	Standard	60%

DESCRIPTION OF DAMAGES

NOTE: The above vehicle was SURVEYED WITHOUT PREJUDICE

The owner's vehicle sustained damages on the frontal LH side portions

Estimated period of repairs: 10 (Ten) working days

Repairer completed in : 05 (Five) working days

Number of photographs taken at time of inspection and attached: 24 (Twenty-Four) + 06 (Six) Follow-up Survey
(After Dismantling & Damaged Parts) and 06 (Six) Follow-up survey (After Repair/Painting) only.

SUMMARY OF REPAIR COSTS

Repairer's Estimate	\$	40,566.05
Revised Parts	\$	13,145.31
Revised Labour	\$	2,580.00
Total Revised Amount	\$	<u>15,725.31</u>
Adjusted Amount	Lump sum \$	12,550.00
Less: Owner's Excess	\$	<u>N.A.</u>
Total	\$	<u>12,550.00</u>
Nett Total without GST	\$	<u><u>12,550.00</u></u>

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

CHEE AIK THUAN (HP 96623655)
ENG TECH, CAE MIMI / AM SAE-A
MSAAA-Accident Damage Appraiser

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810
 E-mail Address: aasschee@singnet.com.sg
 Tel: 96623655, 67655661, Fax: 67655662
 RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
REPLACEMENT OF DAMAGED PANELS/PARTS	LESS 15%	LUMP SUM REPAIR	LESS 15%
01. 1 pc front cabin windscreen glass	1,545.30	Cracked when removed to facilitate the repair - Allowable	1,545.30
02. 1 pc front windscreen glass rubber	494.70	Necessary - Allowable	494.70
03. 1 pc front windscreen glass LH pillar	1,424.65	Bent/Cracked - Allowable	1,424.65
04. 2 pcs front cabin LH side centre and bottom (Electrical) mirror	1,249.60	Cracked (Missing) - Allowable NOTE: Bottom mirror is electrical operated.	1,249.60
05. 1 pc front cabin LH side mirror stand assy	647.80	Bent - Allowable	647.80
06. 1 pc front cabin bonnet cover	3,830.70	Scratched - Not Allowed	To repair
07. 1 pc front cabin bonnet 'ISUZU' emblem	169.40	Not necessary - Not allowable	0.00
08. 1 pc front cabin LH corner panels	1,296.40	Dented/Cracked - Allowable	1,296.40
09. 1 pc front bumper	3,530.70	Scratched - Not Allowed	Not Consistent
10. 1 pc front cabin LH door pillar	1,335.00	Dented/Bent - Allowable	1,335.00
11. 2 pcs front cabin LH door hinges @ 175.00	350.00	Bent - Allowable (Top only)	175.00
12. 1 pc front cabin LH door frame garnish	120.30	Serviceable - Not Allowed	To reuse
13. 1 pc front cabin LH door wheel arch panel	396.60	Bent - Not Allowed	To repair
14. 1 pc front cabin LH door wheel arch garnish	375.10	Serviceable - Not Allowed	To reuse
15. 1 pc front cabin LH door wheel arch signal lamp	237.30	Serviceable - Not Allowed	To reuse
16. 1 pc front cabin LH door wheel arch rear garnish	191.20	Serviceable - Not Allowed	To reuse
17. 1 pc front cabin LH door step bracket	664.80	Bent - Not Allowed	Not Consistent
18. 1 pc front cabin LH door step panel garnish	242.90	Bent - Not Allowed	Not Consistent
19. 1 pc front cabin LH door top step	355.14	Bent - Not Allowed	Not Consistent
20. 1 pc front cabin LH door bottom step	315.25	Bent - Not Allowed	Not Consistent
21. 1 pc front cabin dashboard	3,283.06	Serviceable - Not Allowed	To reuse
22. 1 pc front cabin LH side top garnish	680.00	Bent - Allowable	680.00
23. 1 pc front cabin LH side lower garnish	680.00	Bent/Cracked - Allowable	680.00
24. 1 pc front cabin dashboard air-con duct centre garnish	885.16	Serviceable - Not Allowed	To reuse
25. 2 pcs front cabin dashboard air-con centre duct @ 54.86	109.72	Serviceable - Not Allowed	To reuse
	----- 24,410.78		----- 9,528.45

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES


CHEE AIK THUAN (HP. 96623655)
 ENG TECH, CAE MIMI / AM SAE-A
 MSAAA/Accident Damage Appraiser

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810
 E-mail Address: aasschee@singnet.com.sg
 Tel: 96623655, 67655661, Fax: 67655662
 RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
REPLACEMENT OF DAMAGED PANELS/PARTS	LESS 15%	LUMP SUM REPAIR	LESS 15%
Carried forward from page 1/5	24,410.78		9,528.45
26. 1 pc front cabin dashboard LH air-duct	54.86	Bent/Cracked - Allowable	54.86
27. 1 pc front cabin air-con cooling coil	2,628.97	Serviceable - Not Allowed	To reuse
28. 1 pc front cabin air-con blower	1,316.44	Serviceable - Not Allowed	To reuse
29. 1 pc front cabin air-con pipe	136.00	Serviceable - Not Allowed	To reuse
30. 1 pc front cabin air-con vacuum pipe	236.00	Serviceable - Not Allowed	To reuse
31. 1 pc front cabin air-con discharge pipe	236.00	Serviceable - Not Allowed	To reuse
32. 1 set front cabin electrical harness wire	2,250.00	Serviceable - Not Allowed	To reuse
1 pc front cabin LH door 1 pc front cabin LH door window glass 1 pc front cabin LH door window glass run channel 1 pc front cabin LH door trim board 33. 1 pc front cabin LH door inner lock handle 1 pc front cabin LH door window regulator 1 pc front cabin LH door power window motor 1 pc front cabin LH door lock	5,850.00	Dented/Bent/Cracked (Glass) - Allowable	5,850.00
	-----		-----
	37,119.05		15,433.31
			2,315.00

			13,118.31
03. 1 pc front cabin windscreen glass ERP bracket S.Nett	27.00	Necessary - Allowable	27.00
	-----		-----
	37,146.05		13,145.31
	-----		-----

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES


CHEE AIK THUAN (HP. 96623655)
 ENG TECH, CAE MIMI / AM SAE-A
 MSAAA/Accident Damage Appraiser

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810
 E-mail Address: aasschee@singnet.com.sg
 Tel: 96623655, 67655661, Fax: 67655662
 RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
LABOUR CHARGES			
01. Labour charges - R & R front windscreen glass	200.00	Necessary Reason being: 01. To remove and refit front windscreen glass to facilitate the repair.	200.00
02. Labour charges - R & R front dashboard	350.00	Necessary Reason being: 01. To remove and refit front dashboard assy, instrumental panel and etc to facilitate the repair.	350.00
03. Labour charges - R & R air-con.	240.00	Not Necessary Reason being: 01. Not necessary to remove and refit the air-con blower, cooling coil, piping hoses and etc to facilitate the repair.	0.00
04. Labour charges - Panel beating	1,250.00	Necessary Reason being: 01. To remove damaged parts and attachments, jack and cut out damaged panels, rerpair and reshape dented panels, renew damaged panels (refer to our recommendations) align and weld into position, renew damaged parts (refer to our recommendations), align and refit attachments.	1,000.00
	----- 2,040.00		----- 1,550.00

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES


CHEE AIK THUAN (HP. 96623655)
 ENG TECH, CAE MIMI / AM SAE-A
 MSAAA/Accident Damage Appraiser

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810
 E-mail Address: aasschee@singnet.com.sg
 Tel: 96623655, 67655661, Fax: 67655662
 RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
LABOUR CHARGES			
Carried forward from page 3/5	2,040.00		1,550.00
05. Labour charges - Spray painting	1,200.00	Necessary Reason being: 01. To respray paint on front windscreen glass LH pillar, front LH door, door pillar, LH wheel arch panel; and other affected areas.	900.00
06. Labour charges - Anti rust proofing	150.00	Necessary Reason being: 01. To apply and respray anti-rust proofing.	100.00
07. Labour charges - Electrical system.	30.00	Necessary Reason being: 01. To check wiring, lighting system and conduct water leak test.	30.00
	----- 3,420.00 -----		----- 2,580.00 -----

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES


CHEE AIK THUAN (HP. 96623655)
 ENG TECH, CAE MIMI / AM SAE-A
 MSAAA/Accident Damage Appraiser

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
 424 Balestier Road #02-06 Giffard Mansion Singapore 329810
 E-mail Address: aasschee@singnet.com.sg
 Tel: 96623655, 67655661, Fax: 67655662
 RCB No. 43037800M

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

Registration No: **XD 5222M**

Attachment to report no. TP/0026/08/2021

REPAIRER'S ESTIMATE		OUR RECOMMENDATIONS	
Replacement Of Damaged Panels/Parts and Labour Charges	S\$ Price	Conditions	S\$ Price
CARRIED FORWARD FROM PAGE 2/5			
Replacement of damaged panels/parts	37,146.05		13,145.31
CARRIED FORWARD FROM PAGE 4/5			
Labour Charges	3,420.00		2,580.00
	-----		-----
	40,566.05		15,725.31
	-----		-----
			LUMP SUM
			12,550.00
			=====

NOTE:

Please refer to our recommendations of **SS 15,725.31**

In our opinion, the vehicle can be repaired at a Lump Sum of S'pore Dollars: **Twelve Thousand, Five Hundred And Fifty Only.**

(S\$ 15,725.31 x 20% (S\$ 3,145.06) = S\$ 12,550.00

LUMP SUM CONTRACT

In view of the fact that the repairer has been offered a reduced budget to complete the repair. **(TOTAL REVISED LESS ANOTHER 20%)**, the repairer should be entitled to exercise some discretion to complete the repair.

- a. To replace with New Parts (Genuine or Non Genuine Parts)
- b. To replace with Second Hand Parts (Imported or local Used Parts)
- c. To repair

The repairer would repair the vehicle to the entire satisfaction of the owner and in 'road worthy' condition.

The above terms and condition for the **LUMP SUM REPAIR CONTRACT** (Accident-Damaged Vehicle) is in line with the circular through a referendum from the Singapore Automobile Appraisers Association dated 25 May 2004.

Please find enclosed

- a. Letter from the Singapore Automobile Appraisers Association dated 25 May 2004
- b. Letter from The General Insurance Association Of Singapore dated 28 June 2004.
- c. Letter from the General Insurance Association Of Singapore dated 08 September 2005
- d. The New Paper reply from NTUC Income dated 19 September 2003.

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES


CHEE AIK THUAN (HP. 96623655)
 ENG TECH, CAE MIMI / AM SAE-A
 MSAAA/Accident Damage Appraiser

Singapore Automobile Appraisers Association

c/o 424 Balestier Road #02-06 Giffard Mansion

Singapore 329810 Tel: 64423323

Fax : 64429690

- (1) To All Members
- (2) To Whom It May Concern

Date : 25th May 2004

Definition of the Terms and Conditions for a LUMP SUM REPAIR CONTRACT (Accident - Damaged Vehicle)

The new committee had through a referendum with all members, by way of a circular, on the above subject, received overwhelming support and agreement.

In view of the above, it is agreed that the terms and conditions for a Lump Sum Repair Job as had been in practice by the majority of licensed appraisers in the past couple of decades, should be as follows :-

The repairer, by agreeing to a further reduction of a minimum of 20% from the revised cost for repairs as recommended by the appraiser, shall reserve the right to :

1. Replace any damaged parts with used, reconditioned or new parts.
2. Repair any damaged body parts that the repairer is confident and capable of repairing to a roadworthy condition and to the entire satisfaction of the owner.

However, the repairer by accepting the Lump Sum Repair Contract shall also be responsible for the following :-

1. Repair the vehicle to a roadworthy condition (including a final inspection by a reputable vehicle inspection centre, if the owner insists) and to the entire satisfaction of the owner.
2. To absorb or be responsible for any additional labour or parts costs which are either omitted from the original quotation or are discovered during the course of repairs.

This circular serves to supersede " The Concept of Lump Sum Repair " circular dated 29th January 2004 put up by the old committee.

THE COMMITTEE



GENERAL INSURANCE ASSOCIATION OF SINGAPORE

103 Amoy Street, Singapore 069923. Tel: 62218788/9 Fax: 62272051

• Your Reference

• Our Reference

MV/262

To Mr Chee, SAAA

28 June 2004

Mr Kenny Tan
Hon Secretary
The Singapore Motor Workshop Association
Block 10, Ang Mo Kio Industrial Park 2A
#01-22 AMK AutoPoint
Singapore 568047

Via Mail & Fax No.: 6484 6923

Dear Mr. Tan,

LUMP SUM REPAIRS AS DEFINED BY SAAA

We invite reference to your circular dated 1 April 2004 on the above subject sent under cover of your letter of the same date.


We find that the said circular recommended a change in repair practice to members of the SMWA on the basis of a circular dated 29 January 2004 from the Singapore Automobile Appraisers Association (SAAA) to their members, which stated that all damaged parts are to be replaced rather than repaired or used back.

We now enclose for your ready perusal the SAAA's letter of 25 May 2004 that supersedes the aforesaid circular dated 29 January 2004 and reverts to the practice that has been in force all along, which is to carry out repairs wherever possible rather than carry out a replacement.

We trust that you will make appropriate and immediate arrangements to communicate this change to your members so that both our members can continue to work together on the same basis as before.

Thank you.

Yours sincerely,


Wu Sheng Yan
Executive Director

Encl: SAAA circular dated 25 May 2004
Cc: Ms. Portia Ho of MAS



GENERAL INSURANCE ASSOCIATION OF SINGAPORE

103 Amoy Street, Singapore 069923. Tel: 62218788/9 Fax: 62272051

▶ Your Reference

▶ Our Reference

MV/262, MV/343

8 September 2005

Mr Bernard Low
President
Singapore Motor Workshop Association
Blk 10 Ang Mo Kio Industrial Park 2A
AMK AutoPoint
Singapore 568047

Dear Mr. Low,

COST OF REPAIR OF DAMAGED VEHICLE / LUMP SUM REPAIR (STANDARD BASIS)

We refer to your letter of 24th August 2005.

As we have explained in our letter of 19th May, the purpose of the GIA guideline on Cost of repairs including Lump Sum repairs, is to raise standards and improve the transparency to all parties concerned. It is in line with recent regulatory development for transparency in corporate management and consumer rights protection.

Under this new guideline, workshops are required to specify which parts have been repaired and which parts have been replaced. By specifying these additional information, the workshops will help to avoid the unnecessary and unpleasant disputes which have arose sometime in the past simply because of the uncertainty of work done on a damaged vehicle.

This new guideline does not contradict our common understanding that repairs should be done wherever possible rather than carry out a replacement. As mentioned in your letter, "if the repairer is confident and capable of repairing to a roadworthy condition and to the entire satisfaction of the owner", we see no reason for the workshops to disagree to being transparent by providing the information in the repair bill. Conversely, by not agreeing to this new guideline a negative inference will be created on the intention of the workshops and no doubt the courts will look closely at such intention in case they have to decide.

The New Paper 19 September 2003

NTUC INCOME'S REPLY

THE two workshops were not quoting widely varying figures for the same service, according to Income.

Mr Freddy Neo, senior manager of NTUC Income's claims department, told The New Paper: 'As Mr Ong's vehicle is nine years old, we arranged for it to be repaired on a lump sum basis.'

This means the repairers are allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition. Part-by-part repairs require only new, genuine parts.

Mr Neo said Income sent the work out for bidding only on Sept 3 because Mr Ong had originally wanted to file a third party claim. On Sept 5, Income awarded the job to one of its workshops with its 'benchmarked price' of \$1,400.

This price was not accepted by Mr Ong's preferred workshop. "(The \$10,000 quote)... was for a part-by-part estimate and included some items that were not recommended by Idac to be replaced," Mr Neo said.

"The total of parts not recommended to be replaced amounted to \$1,800."

Mr Neo added that Income had then offered \$1,500 to Mr Ong's preferred workshop, but it rejected this too.

He said that he understood Mr Ong was looking into the possibility of making a third-party claim.

In an e-mail reply from overseas, NTUC Income's CEO Tan Kin Lian said that if the delay in repairs was caused by Income, it would provide compensation to Mr Ong. This is \$50 to \$80 a day, depending on the car's model.

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810


E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021

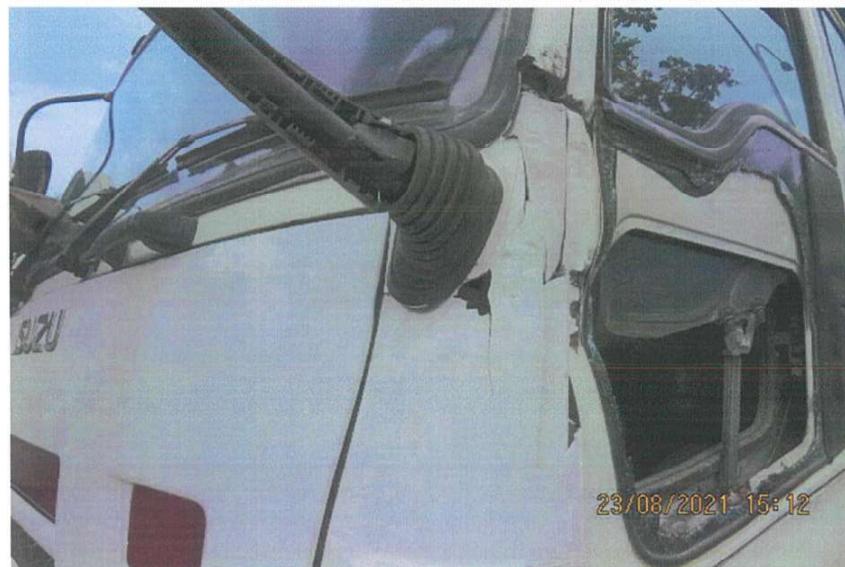

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021




AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
424 Balestier Road #02-06 Giffard Mansion Singapore 329810
E-mail Address: aasschee@singnet.com.sg
Tel: 96623655, 67655661 Fax: 67655662
RCB No.: 43037800M

Photographs: SURVEYED PHOTOGRAPHS

Attachment to report no. TP/0026/08/2021

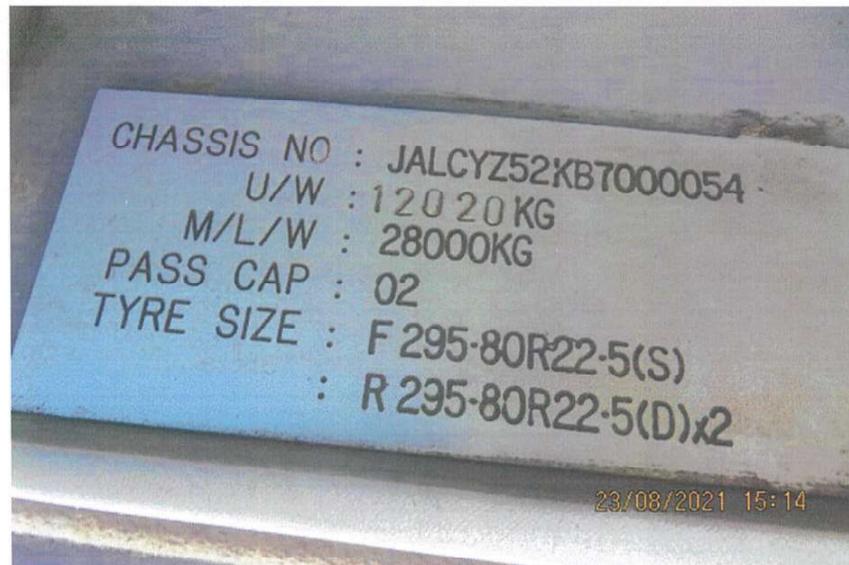

AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: **FOLLOW-UP SURVEYED PHOTOGRAPHS** Attachment to report no. TP/0026/08/2021
(After Dismantling And Damaged Parts)



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: FOLLOW-UP SURVEYED PHOTOGRAPHS Attachment to report no. TP/0026/08/2021
(After Dismantling And Damaged Parts)



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
424 Balestier Road #02-06 Giffard Mansion Singapore 329810
E-mail Address: aasschee@singnet.com.sg
Tel: 96623655, 67655661 Fax: 67655662
RCB No.: 43037800M

Photographs: FOLLOW-UP SURVEYED PHOTOGRAPHS Attachment to report no. TP/0026/08/2021
(After Dismantling And Damaged Parts)



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: FOLLOW-UP SURVEYED PHOTOGRAPHS Attachment to report no. TP/0026/08/2021
(After Repair/Painting)



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
424 Balestier Road #02-06 Giffard Mansion Singapore 329810
E-mail Address: aasschee@singnet.com.sg
Tel: 96623655, 67655661 Fax: 67655662
RCB No.: 43037800M

Photographs: **FOLLOW-UP SURVEYED PHOTOGRAPHS** Attachment to report no. TP/0026/08/2021
(After Repair/Painting)



AUTOMOTIVE APPRAISER AND SURVEYING SERVICES

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

424 Balestier Road #02-06 Giffard Mansion Singapore 329810

E-mail Address: aasschee@singnet.com.sg

Tel: 96623655, 67655661 Fax: 67655662

RCB No.: 43037800M

Photographs: FOLLOW-UP SURVEYED PHOTOGRAPHS Attachment to report no. TP/0026/08/2021
(After Repair/Painting)

