

ASS. BY:

REF: C93/MSG21009356/D+y<sup>3</sup>

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_  
Estimated Cost: \_\_\_\_\_  
OD / TP RES / OD RES / EVA / INV / MV  
To Insp Vehicle No: \_\_\_\_\_  
at Work m/s \_\_\_\_\_  
of \_\_\_\_\_  
Insured \_\_\_\_\_  
Policy # \_\_\_\_\_  
Claimed b. \_\_\_\_\_  
Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
(Check Record)  
Make Clvt: \_\_\_\_\_

(Police Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. of Market Value: \_\_\_\_\_  
IDAC Accident Report \_\_\_\_\_ Consistent? : Yes or No  
GIA / IR Seen: \_\_\_\_\_ Consistent? : Yes or No  
Est. Repairs: 2 days Res.: Yes or No  
Lump Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: 8MU8882D Yr Regn: Jun / 2019  
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
Truck / Trailer or  
Makes: Mazda Axela C.D. 1498  
Colour: Silver A/C: Insured / Std / Nil / NA  
Sp. Reading: 96279 T/Radio: Insured / Std / Nil / NA  
Eng/No: 8530435641  
C/No: B.M.LFP101399  
Gen. Cond: Good / Fair / Poor / Burnt  
Steering: In order / Jammed / Leaked / Burnt or  
Brake: In order / Jammed / Leaked / Burnt or  
Modi: Nil / S/Rim / STD A/Rim or  
Tyre Size: F: 205/55 R16  
R: "

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMAI /  
TOYO / YOKO or Maxxis

Front	Rear
R/Bal. <u>S</u> mm	R/Bal. <u>S</u> mm
L/Bal. <u>S</u> mm	L/Bal. <u>S</u> mm
D.O.A. <u>01/09/2021</u>	D.O.L. <u>07/09/2021</u>

Survey held at SWG AMK  
Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or  
O/S Body  
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	MSG SKP 8618B
	PRS case COR range 1.5K to 2K with 2 days.
	Post price checked with Mazda. PRS + PAPER SURVEY BILLING
	SUBMIT LUMP SUM \$1700, 2DAYS
	red: 4100; 70%

Date/Time, File Pass to? ☐ : Prel. Report  
1) ☐ : Final Report

Days Of Repair: 2  
Resurvey No. of Trip: \_\_\_\_\_

Date/Time, File Return to?  
2) \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$)  
☐ : Interview (\$)

Survey Fee:	
Transportation:	
S + RS \$	
Photos	

JWG INTERNATIONAL PTE LTD  
10 ANG MO KIO INDUSTRIAL PARK 2A  
#03-03 ANG MO KIO AUTOPOINT  
SINGAPORE 568047



VICOM LTD  
385 Sin Ming Drive Singapore 575718

Mainline (65) 6458 4555  
Facsimile (65) 6458 1040

www.vicom.com.sg  
Company Registration No. 198103320K

## SURVEY REPORT

### GENERAL INFORMATION

VAC Ref. No.	: 570521	Claim No.	: NOT AVAILABLE
Accident Date	: 01/09/2021	Claim Type	: THIRD PARTY
Assignment Date	: 08/09/2021	Policy No.	:
Survey Date	: 07/09/2021	Finalised Dt.:	11/09/2021
Survey Report Date	: 13/09/2021		

### VEHICLE PARTICULARS

Vehicle No.	: SMU8882D	Chassis No.	: BMLFP101399
Registration Date	: 07/06/2019	Engine No.	: S530435641
Make	: MAZDA	Engine Cap.	: 1498 CC
Model	: AXELA	Transmission	: AUTOMATIC
		Colour	: SILVER

### CONDITION OF VEHICLE DURING SURVEY (VISUAL and STATIC TEST ONLY)

Foot Brake	: SERVICEABLE	Steering	: SERVICEABLE
Hand Brake	: SERVICEABLE	Modification	: NONE
Mileage	: 96279		

<u>TYRES</u>	<u>SIZE</u>	<u>MAKE</u>	<u>BALANCE (mm)</u>
FRONT RH	205/60 R16	BRIDGESTONE	7
FRONT LH	205/60 R16	BRIDGESTONE	7
REAR RH	205/60 R16	BRIDGESTONE	8
REAR LH	205/60 R16	BRIDGESTONE	8

### SURVEY CONDUCTED AT

JWG INTERNATIONAL PTE LTD  
10 ANG MO KIO INDUSTRIAL PARK 2A  
#03-03 ANG MO KIO AUTOPOINT  
SINGAPORE 568047

### REMARKS

[1] Workshop Estimate : S\$ 12,260.00  
[2] Our Adjustment : S\$ 5,800.00  
[3] Repair Period : 04 days  
[4] We have not authorised repairs. This survey was carried out on without prejudice basis.

**VICOM LTD**  
**SURVEY REPORT**  
**Annex C: Conclusion**

SMU8882D @ 01/09/2021

**ASSESSOR'S REPORT**

At the place of inspection, we saw this vehicle sustained front o/s portion damage.

The damages seen during our survey were front o/s wing mirror assy, front o/s fender, front o/s head lamp, front bumper assy and surrounding areas. A fuller detailed description of the damages is in Annex A of this survey report.

**ASSESSOR'S RECOMMENDATION**


Jwg International Pte Ltd estimated a repair cost of S\$12,260.00. We adjusted it to S\$7,280.00 on a part-by-part basis.

Although this vehicle was registered on 07/06/2019, a relatively brand new vehicle, we explore repairs on lump-sum basis.

We assess a lumpsum repair cost of S\$5,800.00 and is accepted.

Accordingly, we recommend repairs to this vehicle be carried out on a lumpsum basis at S\$5,800.00.

The repairs would require a period of 04 working days.

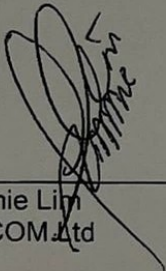

Tommie Lim  
for VICOM Ltd

VICOM LTD

SMU8882D @ 01/09/2021

## SURVEY REPORT

## Annex A: Adjustment on Spare Parts

#	Qty	Vehicle Parts Description	Condition	Workshop Estimate (S\$)	VAC Adjustment (S\$)
					1726.10
1	1	Front Right Hand Side Mirror Assy	Malfunctioned	2800.00	2800.00 ✓
2	1	Front Right Hand Fender	Repair	890.00	0.00 HN
3	1	Front Right Hand Headlamp	Grazed	3690.00	3690.00 R
4	1	Front Bumper	Deformed	1080.00	1080.00 R
5	1	Front Bumper Right Hand Side Retainer	Serviceable	90.00	0.00 HN
<b>Subtotal</b>				:	8550.00
Less 20 %					1710.00
<b>TOTAL</b>				:	6840.00
					1380.88
<b>SPECIAL NETT ITEM</b>					
1	1	Front Fender Inner Shield Clips	Cracked	50.00	14.00 HN
2	1	Front Bumper Clips	Cracked	50.00	20.00 SVL
<b>TOTAL</b>				:	100.00
					34.00
<b>TOTAL FOR SPARE PARTS</b>				:	6940.00
					6090.00

2 days

**VICOM LTD**  
**SURVEY REPORT**

SMU8882D @ 01/09/2021

**Annex B: Adjustment on Labour and Spray Painting**

#	Job Description	Workshop Estimate (S\$)	VAC Adjustment (S\$)
1	To remove all interior upholstery items to facilitate repairs	600.00	0.00 HH
2	To remove & panel beat all above damaged parts & panels	2000.00	<del>400.00</del> 300/-
3	To respray new paintwork for all damaged areas	2000.00	<del>500.00</del> 300/-
4	To tuff coat damaged areas	300.00	30.00 HH
5	To conduct computerised wheel alignment	120.00	60.00 HH
6	To computerise/ diagnose fault codes & control units. Reset all memories to factory default settings	300.00	<del>200.00</del> 150/-
<b>TOTAL FOR LABOUR AND SPRAY PAINTING</b>		<b>5320.00</b>	<b>1190.00</b>

**Summary**

Description	Workshop Estimate (S\$)	VAC Adjustment (S\$)
<b>TOTAL FOR SPARE PARTS</b>	<b>6940.00</b>	<b>6090.00</b>
<b>TOTAL FOR LABOUR AND SPRAY PAINTING</b>	<b>5320.00</b>	<b>1190.00</b>
<b>TOTAL REPAIR COST</b>	<b>12260.00</b>	<b>7280.00</b>

2130.00  
L/s 1700/-  
2 days.