



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2202100

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 12/04/2022
Reference CC6/CTI21009362/Aea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBE 5293M
Insured Veh. GBJ 5953R
Claim No. SNM21D205029/C02
Policy No. DMCVSNW00062492102
Accident Date 05/09/2021
Inspection Date 06/09/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI21009362/Aea3q2	
			Date: 12/04/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBJ 5953R	Veh. Inspected	GBE 5293M	
Policy No.	DMCVSNW00062492102	Coverage (\$)	0.00	
Claim No.	SNM21D205029/C02	Excess (\$)	0.00	
Assign From		Assign Date	06/09/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	KDH2010181038	Colour	SILVER	
Odometer	162289 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15C	BRIDGESTONE	6 mm	
L/H Front Tyre	195 R15C	BRIDGESTONE	6 mm	
R/H Rear Tyre	195 R15C	BRIDGESTONE	6 mm	
L/H Rear Tyre	195 R15C	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/09/2021	Inspection Date	06/09/2021	
Survey held at	YSK AUTO WORKSHOP 1 KAKI BUKIT AVE 6 @ AUTOBAY #01-71 SINGAPORE 417883			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 5293M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
2	REAR NUMBER PLATE LAMP @\$83.10	NOT NECESSARY	166.20	-
1	REAR BUMPER	DEFORMED	582.50	582.50
2	REAR BUMPER SIDE HOLDER @\$59.80	NECESSARY	119.60	119.60
1	REAR BUMPER REINFORCEMENT	DENTED	366.10	366.10
4	REAR BUMPER LOWER BRACKET @\$22.00	BENT (2 PCS ONLY)	88.00	44.00
1	REAR END PANEL OUTER	DENTED	580.10	580.10
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	645.10	-
1	REAR END PANEL TOP METAL STRIP	NOT NECESSARY	198.10	-
2	TAILLAMP @\$354.80	CRACKED	709.60	709.60
2	TAILLAMP LOWER APRON @\$94.60	TORN	189.20	189.20
2	TAILLAMP PANEL @\$341.00	TO REPAIR SEE LABOUR	682.00	-
1	TAILGATE	DISTORTED	1,739.00	1,739.00
1	TAILGATE LOCK	DAMAGED	279.40	279.40
1	TAILGATE LOCK COVER	NOT NECESSARY	35.00	-
1	TAILGATE WEATHERSTRIPE	CUT	386.20	386.20
1	TAILGATE OUTER MOULDING	CUT	322.40	322.40
1	TAILGATE INNER TRIM BOARD	NOT NECESSARY	159.00	-
1	TAILGATE GLASS	CUT	1,311.30	1,311.30
1	TAILGATE GLASS MOULDING	NECESSARY	125.00	125.00
1	TOYOTA LOGO	NECESSARY	68.50	68.50
1	HIACE STICKER	NECESSARY	46.50	46.50
1	REAR EXHAUST PIPE	NOT NECESSARY	598.50	-
	LESS 25% DISCOUNT		-	-1,717.35
			9,397.30	5,152.05
<u>SPECIAL NETT ITEMS</u>				
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	30.00	-
1	REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	60.00	60.00

Report Ref No. CC6/CTI21009362/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	30.00	-
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	60.00	60.00
1	70KM/H STICKER (SN)	NECESSARY	15.00	15.00
1	1250KG STICKER (SN)	NECESSARY	35.00	35.00
1	REAR CAMERA (SN)	NOT NECESSARY	450.00	-
1	FLOOR PANEL TOP WOODEN BOARD (SN)	NOT NECESSARY	580.00	-
			1,570.00	400.00
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER AND TAILLAMP PANEL.		1,400.00	800.00
	SPRAY PAINTING.		1,400.00	800.00
	WIRING.		100.00	30.00
	TO REMOVE REVERSE SENSOR .		100.00	50.00
	TO REMOVE REAR CAMERA.		100.00	50.00
	TO REMOVE UPHOLSTERY .		150.00	50.00
	TO REMOVE TAILGATE GLASS .		180.00	120.00
	TO TRANSFER TAILGATE FITTINGS .		150.00	80.00
	TO SPRAY TUFF COAT.		150.00	60.00
	TO REMOVE EXHAUST PIPE .	NOT NECESSARY	150.00	-
			3,880.00	2,040.00
GRAND TOTAL			14,847.30	7,592.05
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,000.00

Report Ref No. CC6/CTI21009362/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 5293M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

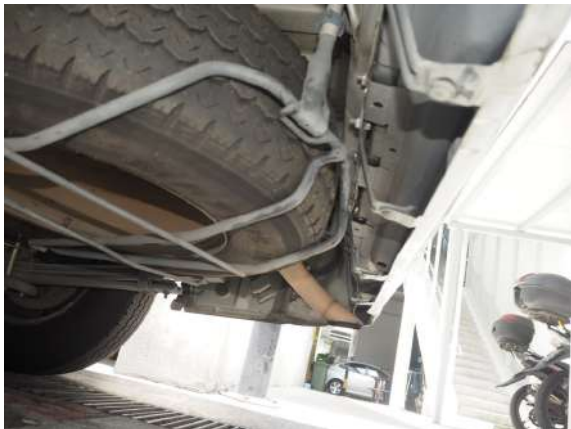



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 5293M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 5293M

RE-INSPECTION

