


REC BY: Thavan | CS/CTI 2609442 /UTC

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

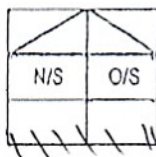

Bal. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 4 days Res.: Yes or No
 Turn Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMX 8224M Yr Rogt: 29 Oct 2014
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or

Make: Toyota Altis CVT c.c. 1598
 Colour: red A/C: Insured / Std / NI / NA
 Sp. Reading: 73839 T/Radio: Insured / Std / NI / NA

Eng/No: _____
 C/No: MR053REH104518663

Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16
 R: 205/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Continental

Front	Rear
R/Bal. <u>5</u> mm	R/Bal. <u>5</u> mm
L/Bal. <u>5</u> mm	L/Bal. <u>5</u> mm
D.O.A. <u>4/9/21</u>	D.O.I. <u>8/9/21 1200</u>

Survey held at jin Auto

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooltop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
part by part \$3237.45, 4days	
red: 862;21%	
4099.45	

Date/Time, File Pass to?

☐ : Prelim. Report
☐ : Final Report

Date/Time, File Return to?

Days Of Repair: 4

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + PS. \$ _____

Finings _____

Others _____

Total _____

Add Fee: ☐ Site Insp (\$ _____)
☐ Interview (\$ _____)
☐ Tech. Invs (\$ _____)
☐ Wheel end (\$ _____)

Report Format: _____

Letter Sign / RE: _____

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMX8224M
Repairer Reference: SMX8224M
Date calculated: 07/09/2021 10:17 AM

Full Report
Registration: SMX8224M
Printed: 07/09/2021 10:17 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMX8224M	Date of Incident:	04/09/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	COROLLA
Sub Model:	ALTIS CLASSIC
Model Sheet Number:	70 EW 20
Registration:	SMX8224M
VIN number:	MR053REH104518663
Odometer:	73827

Model Specs

FROM 10.2014	TWO COAT METALLIC	PREPARE OFF VEHICLE
--------------	-------------------	---------------------

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

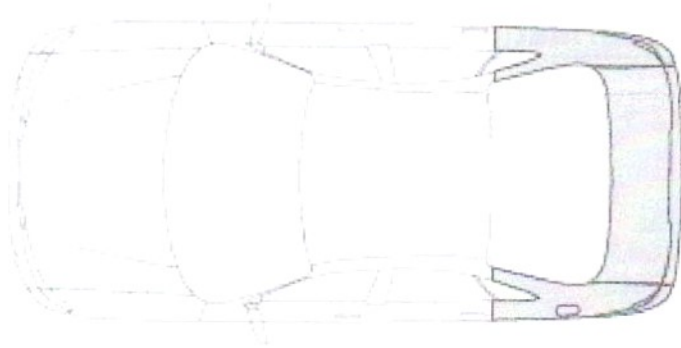

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290	RENEW END PANEL (REAR BUMPER REMOVED) INCLUDES: BOOT COMPARTMENT FLOOR MAT AND ALL TRIMS IN REPAIR AREA REMOVE AND REFIT NOT INCLUDED: R + R REAR SEAT		44.0	184.80
B360	RENEW BOOTLID INCLUDES: BOOTLID, TRIM BOOTLID, BOTH INN TAILLAMPS, BOTH NUMBER PLATE LAMP, LOCK BOOTLID AND REQUIRED ATTACHED PARTS R + R		11.0	46.20
NO NUMBER	R + R BOOT TRIM		6.0	25.20
B420	RENEW REAR BUMPER INCLUDES: BUMPER AND ALL REQUIRED ATTACHED PARTS R + R		6.0	25.20
NO NUMBER	R + R L/R BUMPER BRACKET		1.0	4.20
NO NUMBER	R + R R/R BUMPER BRACKET		1.0	4.20

Code	Description	WU	Price SGD
B410	R + R REAR BUMPER REINFORCEMENT	1.0	4.20
B407	R + R L/OUTER REAR LAMP INCLUDES:REQUIRED TRIMS REMOVE AND REFIT.	2.0	8.40
B407	R + R R/OUTER REAR LAMP INCLUDES:REQUIRED TRIMS REMOVE AND REFIT.	2.0	8.40
3901	REAR FLOOR PANEL REPAIR	20.0*✓	84.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		9.40	94.0
Total of Labour			394.80

Paint

Code	Description - TWO COAT METALLIC	WU	Price SGD
Paint Work		SYSTEM AZT Time Basis 10 WU/h	
	REAR PANEL NEW PART PAINTING	24.0	
	BOOTLID NEW PART PAINTING	17.0	
	REAR BUMPER NEW PART PAINT K1G/P	33.0	
	REAR FLOOR PANEL SURFACE PAINT	11.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	30.80
2931	BOOTLID NEW PART PAINTING	49.54
2581	REAR BUMPER NEW PART PAINT K1G/P	136.80
3901	REAR FLOOR PANEL SURFACE PAINT	35.61

Labour Cost - Paint		Hrs	WU	Price SGD
Factor		42.00 SGD/h		
Time Paint			85.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total		10 WU/h	11.80	118.0

Material Cost - Paint		Price SGD
New Part Painting		80.34
New Part Painting - Plastic K1G/PUR		136.80
Surface-/Blend Paint		35.61
Material-constant Metal Preparation		28.60
Material-constant Plastic		12.70
Total		294.05

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01 Price SGD
------	-------------	-------------	-------------	---

Code	Description	Part Number	Part Source	Price SGD
2581 ✓	REAR BUMPER	52159 02904	Original	Def ✓ 250.00
2617 ✓	L/R UPP BUMPER BRKT	52563 02250	Original	ncc ✓ 35.00
2618 ✓	R/R UPP BUMPER BRKT	52562 02250	Original	ncc ✓ 35.00
2619 ✓	L/R BUMPER BRACKET	52576 02140	Original	ncc ✓ 50.00
2620 ✓	R/R BUMPER BRACKET	52575 02140	Original	ncc ✓ 50.00
2625 ✓	L/R IMPACT DAMPER	52182 02160	Original	DT ✓ 80.00
2626 ✓	R/R IMPACT DAMPER	52181 02190	Original	DT ✓ 80.00
2640 ✓	REAR BUMPER SUPPORT	52023 02190	Original	DT ✓ 120.00
2711 ✓	REAR PANEL	58307 02380	Original	DT ✓ 280.00
2931 ✓	BOOTLID	64401 02B61	Original	Def ✓ 360.00
2944 ✓	BOOTLID SEAL	64461 02220	Original	ncc ✓ 105.00
2976 ✓	REAR LOCK CATCH	64621 33030	Original	r x 20.00
2977 ✓	BOOTLID LOCK	64600 02080	Original	sgm ✓ 160.00
2981 ✓	BOOTLID MOULDING	76801 02D20	Original	NN ncc ✓ 120.00
3015 ✓	REAR MANUFACT BADGE	75431 02090	Original	ncc ✓ 35.00
3017 ✓	BADGE MODEL	75442 02320	Original	ncc ✓ 30.00
3022 ✓	VERSION BADGE	75442 02340	Original	ncc ✓ 35.00
3026 ✓	EQUIPMENT BADGE	75444 02720	Original	nvt x 30.00
3287 ✓	L/R OUTER LAMP	81561 02780	Original	suc x 160.00
3288 ✓	R/R OUTER LAMP	81551 02780	Original	suc x 160.00
3289 ✓	L/R INNER LAMP	81591 02550	Original	suc x 150.00
3290 ✓	R/R INNER LAMP	81581 02550	Original	suc x 150.00
3585 ✓	L/INN T-LAMP GASKET	81584 02550	Original	AN ncc ✓ 15.00
3586 ✓	R/INN T-LAMP GASKET	81584 02550	Original	AN ncc ✓ 15.00
4985 ✓	INNER END PANEL TRIM	58387 02240	Original	DIS ✓ 35.00
1000 ✓	REAR REVERSE SENSOR	SENSOR	Original	cut ✓ 200.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal
Fixed Sundry Parts Price

Total 0.00
2,760.00
100.00
2,860.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	2,760.00	
Total Parts	100.00	2,860.00
Labour Time Base 10 WU/h		
Total 94.0 WU X 42.00 SGD/h	394.80	
Total of Labour		394.80
Paint Work Time Base 10 WU/h		
Labour Cost 118.0 WU X 42.00 SGD/h	495.60	
Material Cost	294.05	
Total Paint Including Material		789.65
Repair Cost Excludes GST		4,044.45
GST (+7.00%)		283.11
Repair Cost Included GST		4,327.56

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Jin Auto Services Pte Ltd

Blk 14 Defu Lane 10 #01-410/412

Singapore 539195

Tel: 6289 8126 Fax: 6287 0590

Email: Jin@jinauto.com.sg

Company Reg. No: 200704370C GST Reg.No: 200704370C

(SUPPLEMENTARY)

TP INSURER: China Taiping Insurance (Singapore) Pte. Ltd. (HQ)
SLH5787X

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	SMX8224M
Policy No:	DMHCSNA00009012101	Date of Loss:	04/09/2021
Vehicle Reg. No.:	SMX8224M	Driveable?	
Party At Fault:	THIRD PARTY		
Driver (TP):	WOO SENG FATT	Driver (Insured):	ROSLI BIN HASHIM
Make/Model:	TOYOTA COROLLA ALTIS, 1.6 (A)	Vehicle Reg. Date:	29/10/2014
Vehicle Colour:	RED		
Engine No:	1ZRY111507	Chassis No:	MR053REH104518663
Odometer:	1 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	10		
Description of Accident/Loss	REFER TO ATTACHED REPORT		
Present Location:	JIN AUTO SERVICES PTE LTD (DEFU)		

COST OF CLAIMS

	Amount
Parts	55.00
Miscellaneous Items	0.00
Labour	0.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	55.00
+ GST 7.00% (S\$)	3.85
Nett Amount (S\$)	58.85
+ Previous Estimates (S\$)	4,327.56
Claim Total (S\$)	4,386.41

REPAIR DETAILS**Reference****Part Source:** MRM-SG Version: 1.0 (Last Synchronised: 04 Oct 2021)**Parts:** 143 TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** Jin Auto Services Pte Ltd/SMX8224M/04/10/2021 11:36**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BOOTLID RUBBER	0.00	0.00	complete ✓ *55.00 F
Total Parts (S\$)						55.00

F=Franchise part.

Jin Auto Services Pte Ltd/SMX8224M/04/10/2021 11:36. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

There are no labour items selected.

Jin Auto Services Pte Ltd/SMX8224M/04/10/2021 11:36. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >