


**CARLINK CONSULTANCY**60 Hillside Drive  
Singapore 549009

Tel : 62856178

Fax : 62874788

**ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT**

Our Ref: CLM14366TP/T

<b>1 REFERENCE</b>			
Date of request	: 10th January 2019		
Requested by	: M/S Autow Recovery Services C/o Kaki Bukit Autohub, 2 Kaki Bukit Avenue 2, #01-17 Singapore 417921		
Type of claim	: Third party		
Workshop	: M/S TwinCar Automotive Pte Ltd Kaki Bukit Autohub, 2 Kaki Bukit Avenue 2, #01-17 Singapore 417921		
Date of survey	: 10th January 2019		
Accident date	: 3rd December 2018		
<b>2 DETAILS OF VEHICLE</b>			
Registration No.	: YM 6079 U		
Make & Model	: Isuzu NHR85EU3ES		
Date of registration	: 8th March 2007		
Engine No.	: 4JJ1450635		
Chassis No.	: JAANHR85E77100047		
Transmission	: Manual		
Colour	: Blue		
Speedometer reading	: 361042 Km		
<b>3 STATIC CHECK</b>			
Steering	: In order	Paintwork	: Good
Footbrake	: In order	Modification	: Nil
Handbrake	: In order	General condition	: Good
<b>4 TYRE CONDITION</b>			
	<u>Nearside/Make</u>	<u>Offside/Make</u>	<u>Size</u>
Front tyre	: 6mm/Bridgestone	6mm/Bridgestone	: 205-R16C
Rear tyre	: 6mm/CST tires	6mm/CST tires	: 185-R14C
<b>5 POINT OF IMPACT</b>			
See Annex(es) and Motor Accident Reports			
<b>6 REMARK</b>			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

Report No.

CLM14366TP/T

Vehicle No. YM6079U

Parts and Labour Assesment**PARTS**

Description of part	Repairer's Qty	Qty	Condition	Repairer's estimate	Our adjustment
LIFT FORK CRANE MAIN MEMBER	1	1	DISTORTED/SHIFTED	4,500.00	4,500.00
LIFT FORK MAIN HYDRAULIC CYLINDER JACK	1	1	DISTORTED/LEAKED	1,800.00	1,800.00
LIFT FORK MAIN SLIDING MEMBER CYLINDER JACK	1	1	DISTORTED/LEAKED	1,600.00	1,600.00
LIFT FORK OUTER MAIN MEMBER SLIDING MEMBER	1	1	DISTORTED	1,800.00	1,800.00
LIFT FORK T MEMBER	1	1	DISTORTED	2,800.00	2,800.00
LIFT FORK T MEMBER HYDRAULIC CYLINDER JACK	1	1	DISTORTED/LEAKED	1,600.00	1,600.00
REAR NUMBER PLATE	1	1	BENT/SLACK	35.00	35.00
REAR NUMBER PLATE LAMP	1	1	SLACK/FAULTY	67.00	67.00
Subtotal before discount				S\$ 14,202.00	S\$ 14,202.00
Percentage discount 0% and 0%				S\$ 0.00	S\$ 0.00
<b>Sub-total</b>				<b>S\$ 14,202.00</b>	<b>S\$ 14,202.00</b>
<b>Parts-total</b>				<b>S\$ 14,202.00</b>	<b>S\$ 14,202.00</b>

**LABOUR**

To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,800.00	1,500.00
To apply anti-rust chemical on repaired and replaced panel.	200.00	150.00
To dismantle and replaced lifting fork assy,pivot pin,hyraulic cylinder jacks,hyraulic hose and etc, and to check and align system for proper operation.	3,000.00	2,400.00
To check wiring system and light.	150.00	120.00
<b>Labour Total</b>	<b>S\$ 5,150.00</b>	<b>S\$ 4,170.00</b>
<b>Parts &amp; Labour Total</b>	<b>S\$ 19,352.00</b>	<b>S\$ 18,372.00</b>

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

**Hence, the recommended cost of repairs based on Lump Sum repairs is : S\$ 15,600.00 and the recommended number of working days for the repairs is within 14 day(s).**

PATRICK M. SURVEYOR )  
Automotive Appraiser

CARLINK CONSULTANTS





CARLINK CONSULTANTS

CARLINK CONSULTANCY



CARLINK CONSULTANCY




CARLINK CONSULTANCY

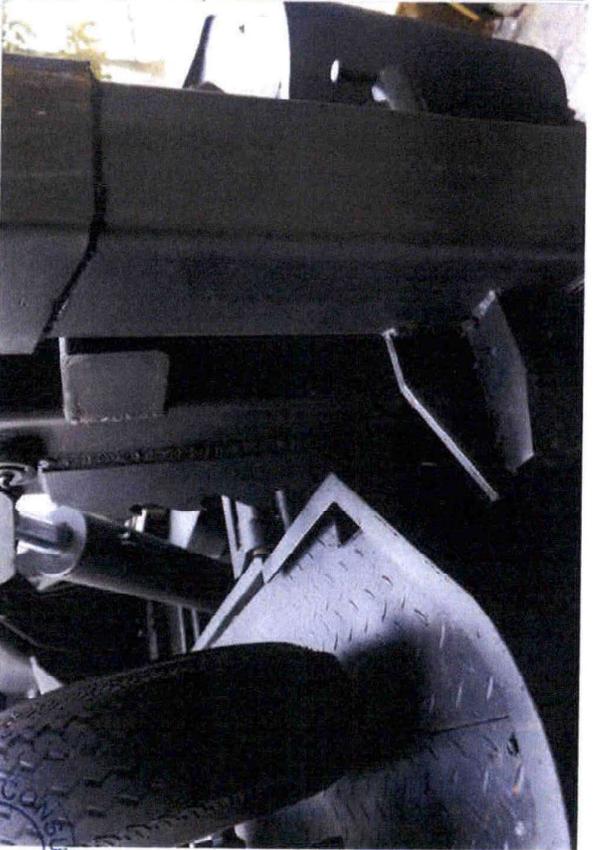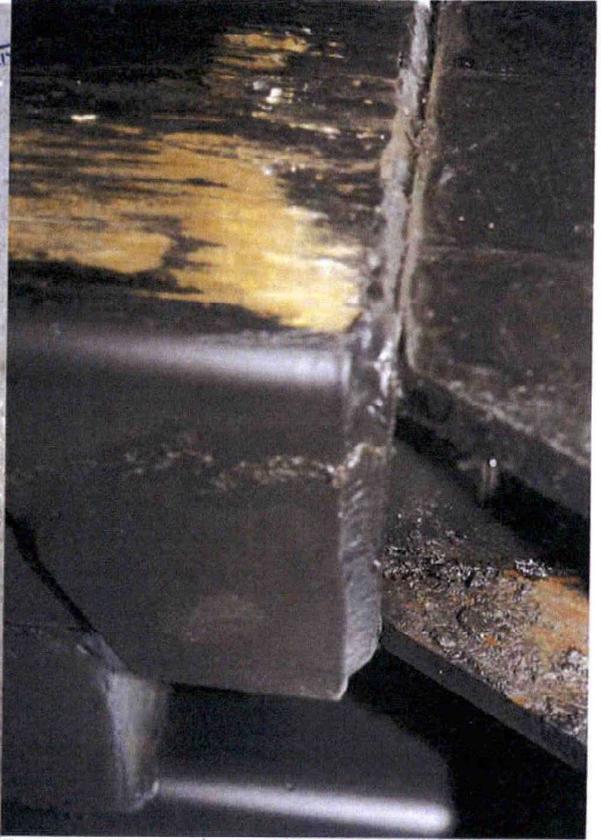

CARLINK CONSULTANCY




CARLINK COMPANY

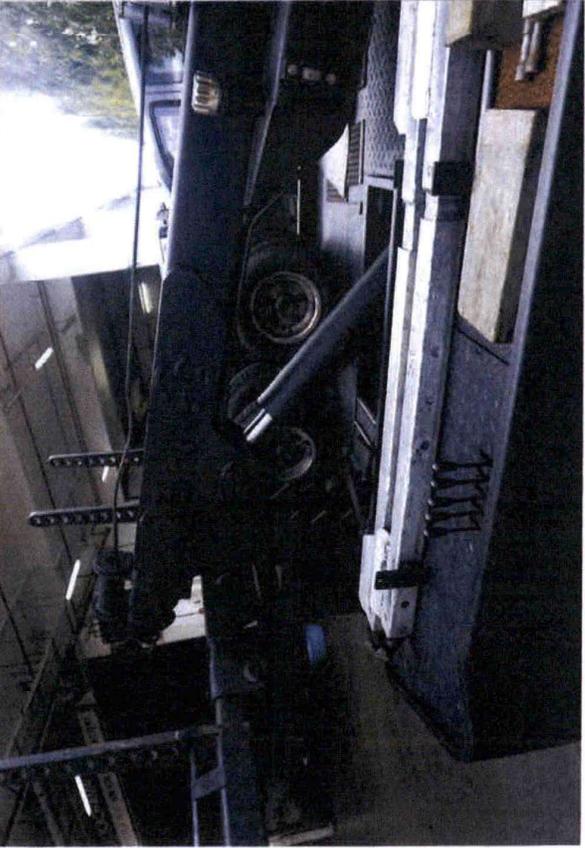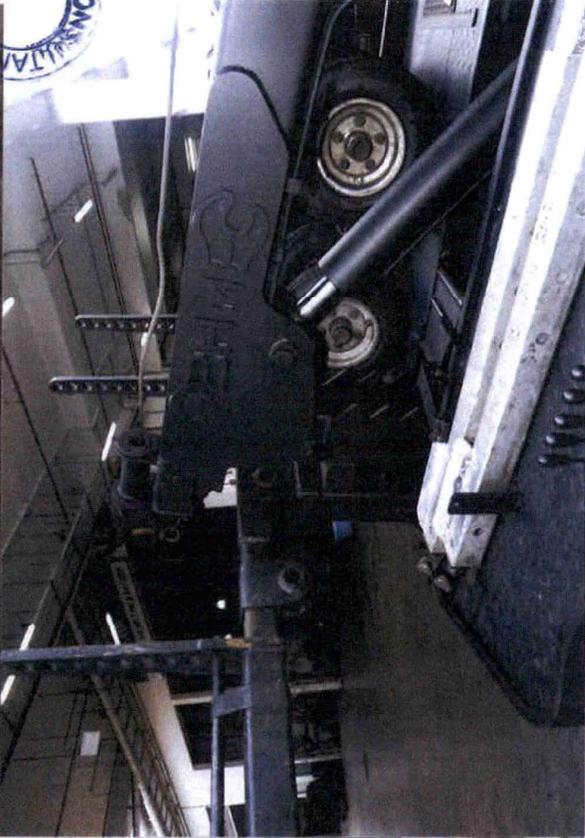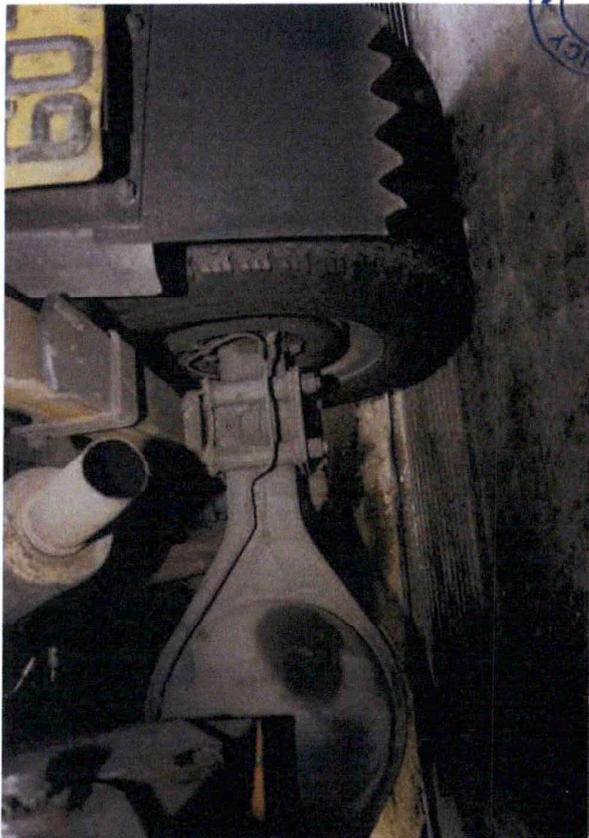

CARLINK COMPANY



CARLINK

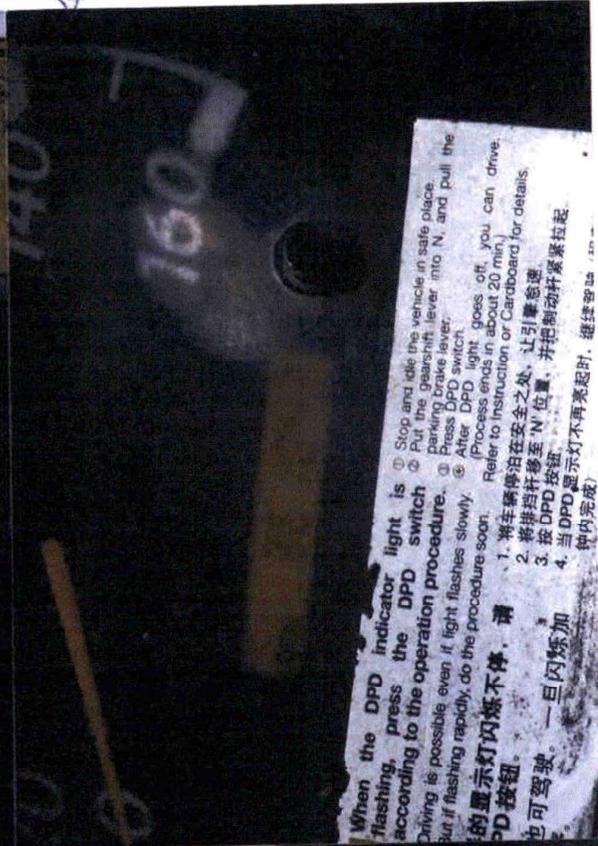

When the DPD indicator light is flashing, press the DPD switch according to the operation procedure. Driving is possible even if light flashes slowly. But, if flashing rapidly, do the procedure soon.


的显示灯闪烁不停，请尽快驾驶。一旦闪烁加剧，请尽快驾驶。

① Stop and idle the vehicle in safe place.  
② Put the gearshift lever into N, and pull the parking brake lever.  
③ After DPD switch (Pro) light goes off, you can drive. (Process ends in about 20 min.)  
Refer to instruction or Cardboard for details.

1. 将车辆停泊在安全之处，让引擎怠速。  
2. 将排挡杆移至 'N' 位置，并把制动杆紧紧拉起。  
3. 按 DPD 按钮。  
4. 当 DPD 显示灯不再亮起时，继续驾驶。（约 20 分钟内完成）




LTANCY

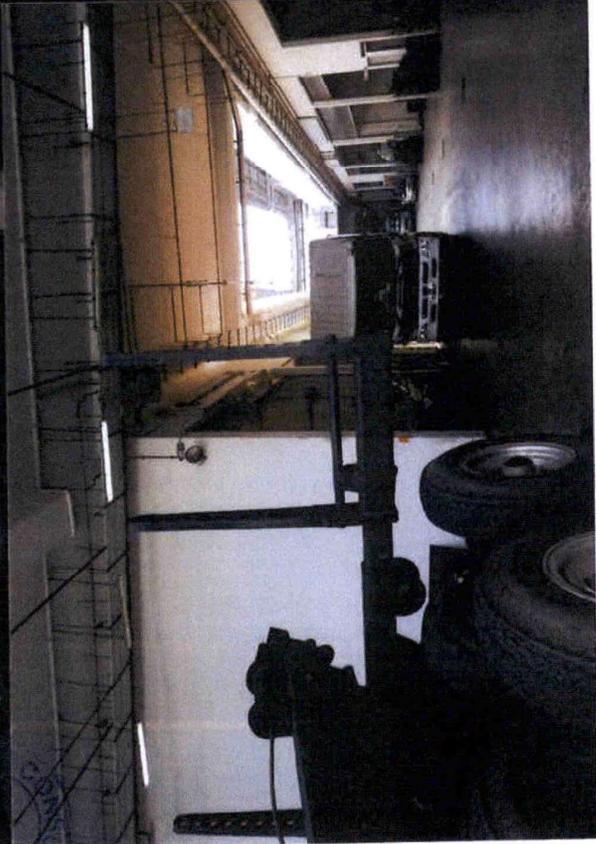

CARLINE CONSULTANCY



CARLINE CONSULTANCY

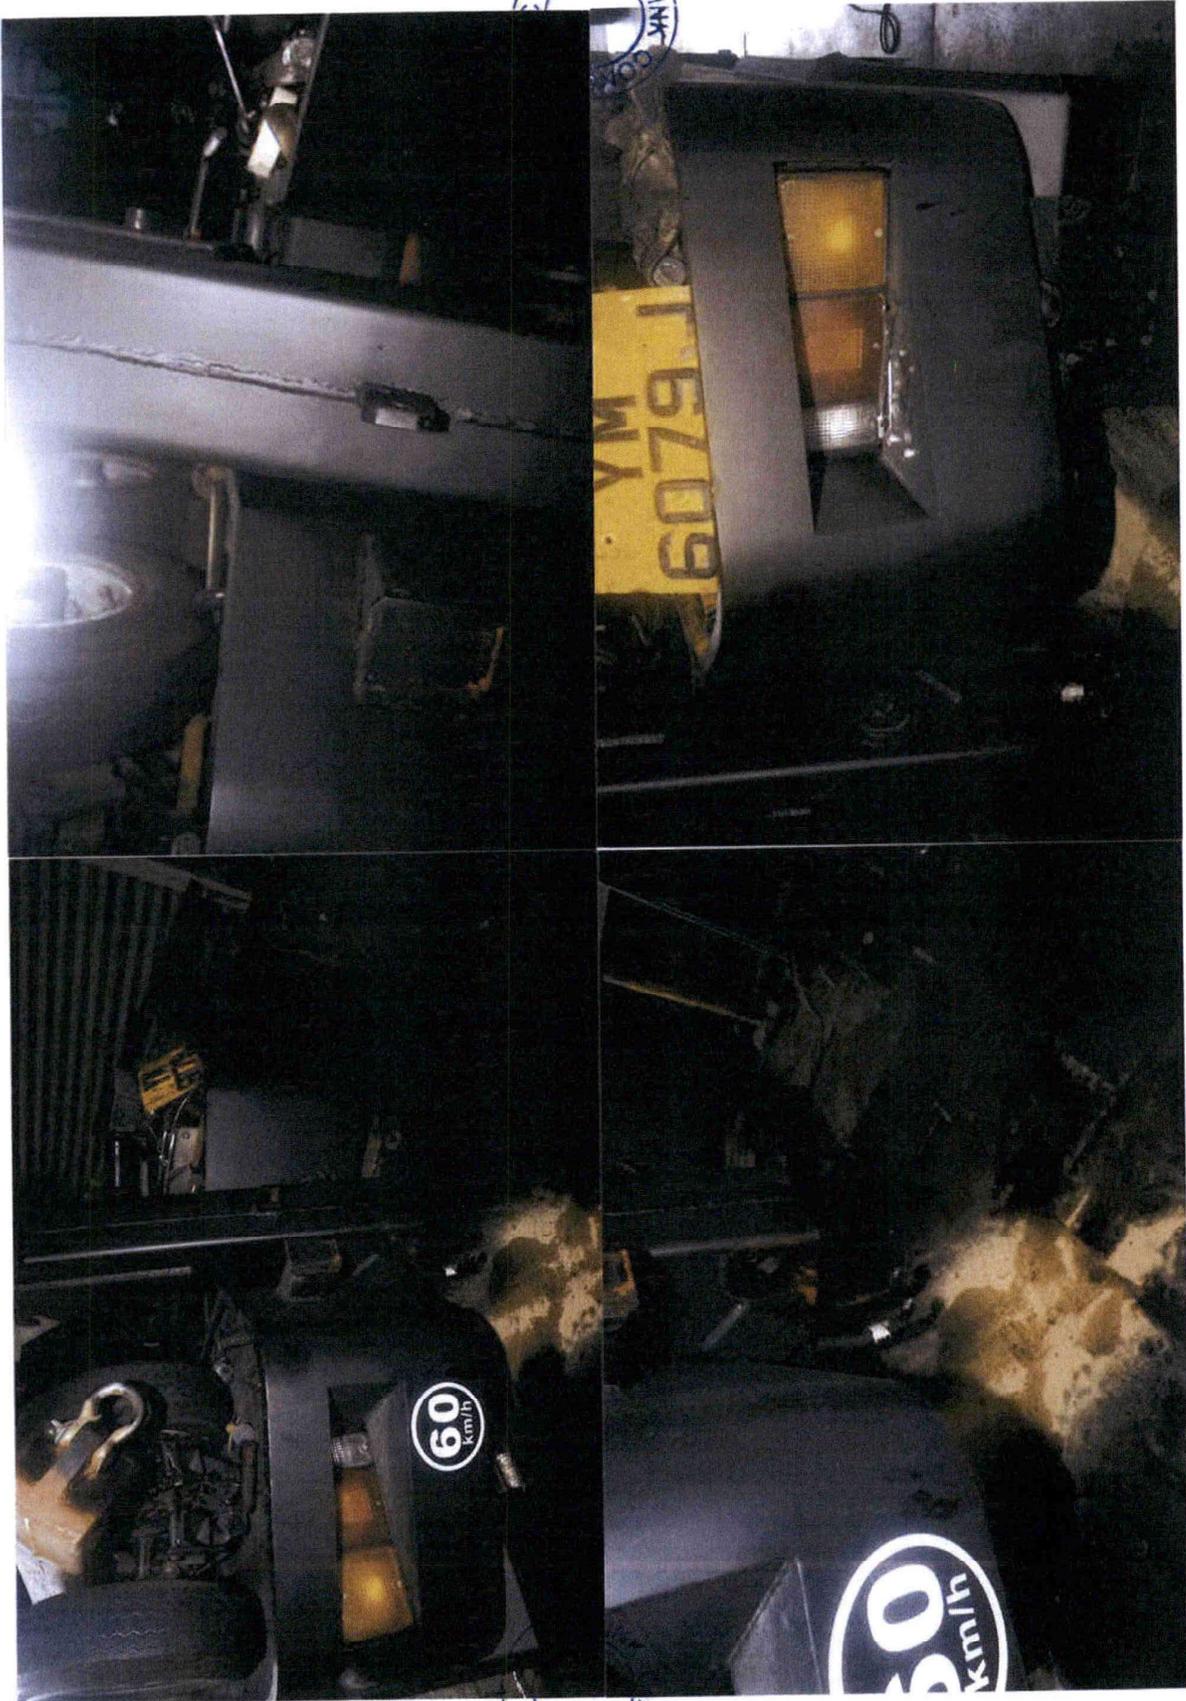

CARLINK

CONSULTANCY

CY \* CARLIN



CONSULTANCY

CONSULTANCY





CONSULTANCY

ALTANCY



NK CONSULT

ULTANCY CA

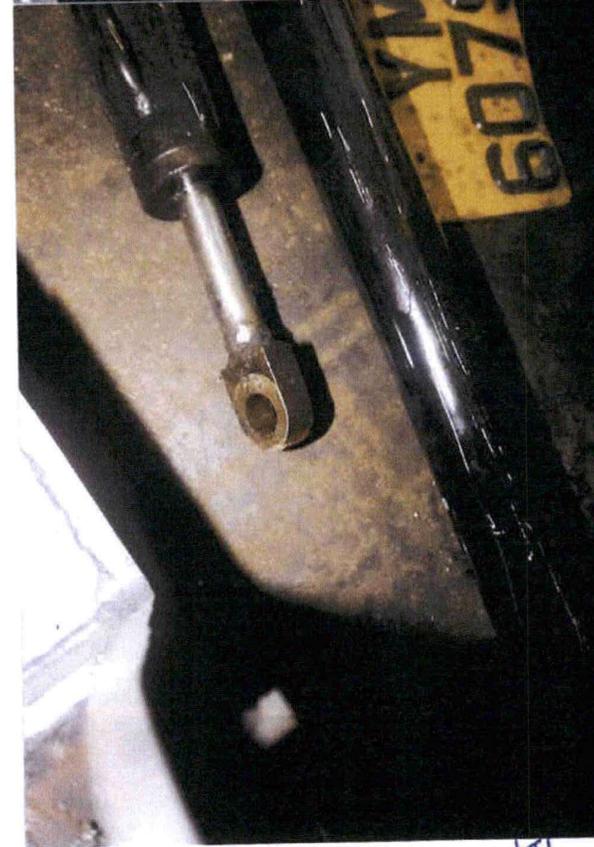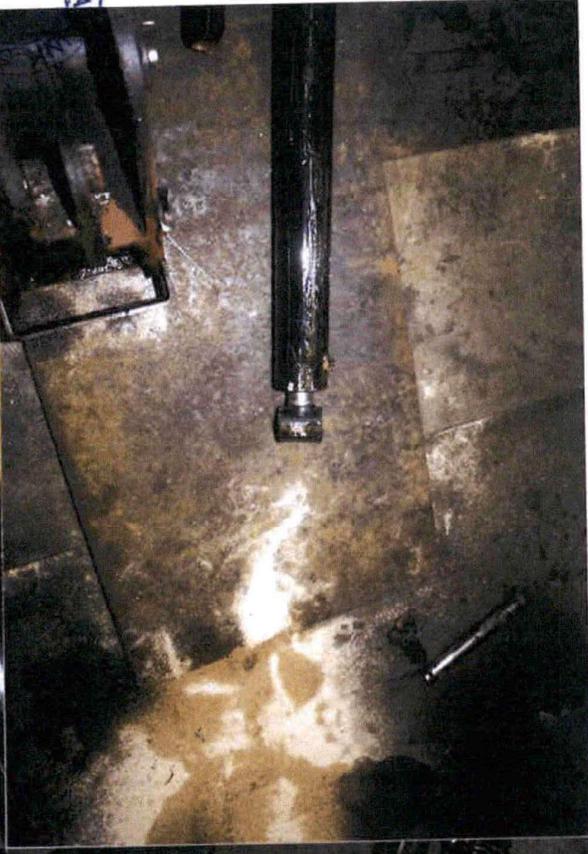



MX CONSULTA

CONSULTANCY  
CA




CONSULTANCY

CONSULTANCY

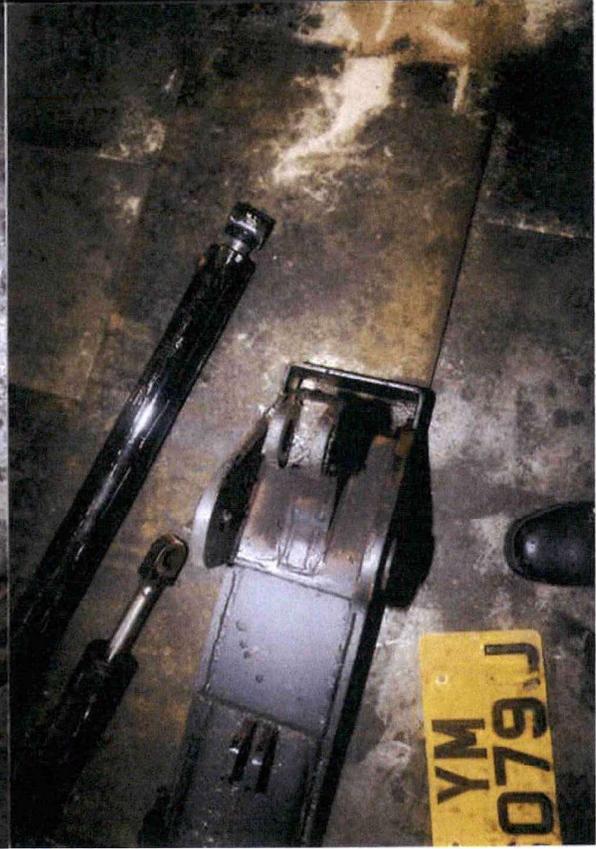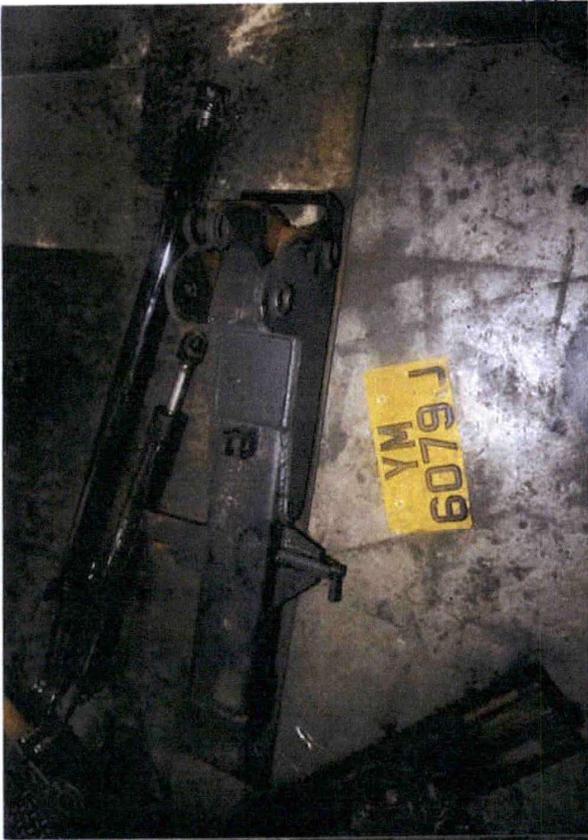


LINK CON

CARLINK CONSULTANTS


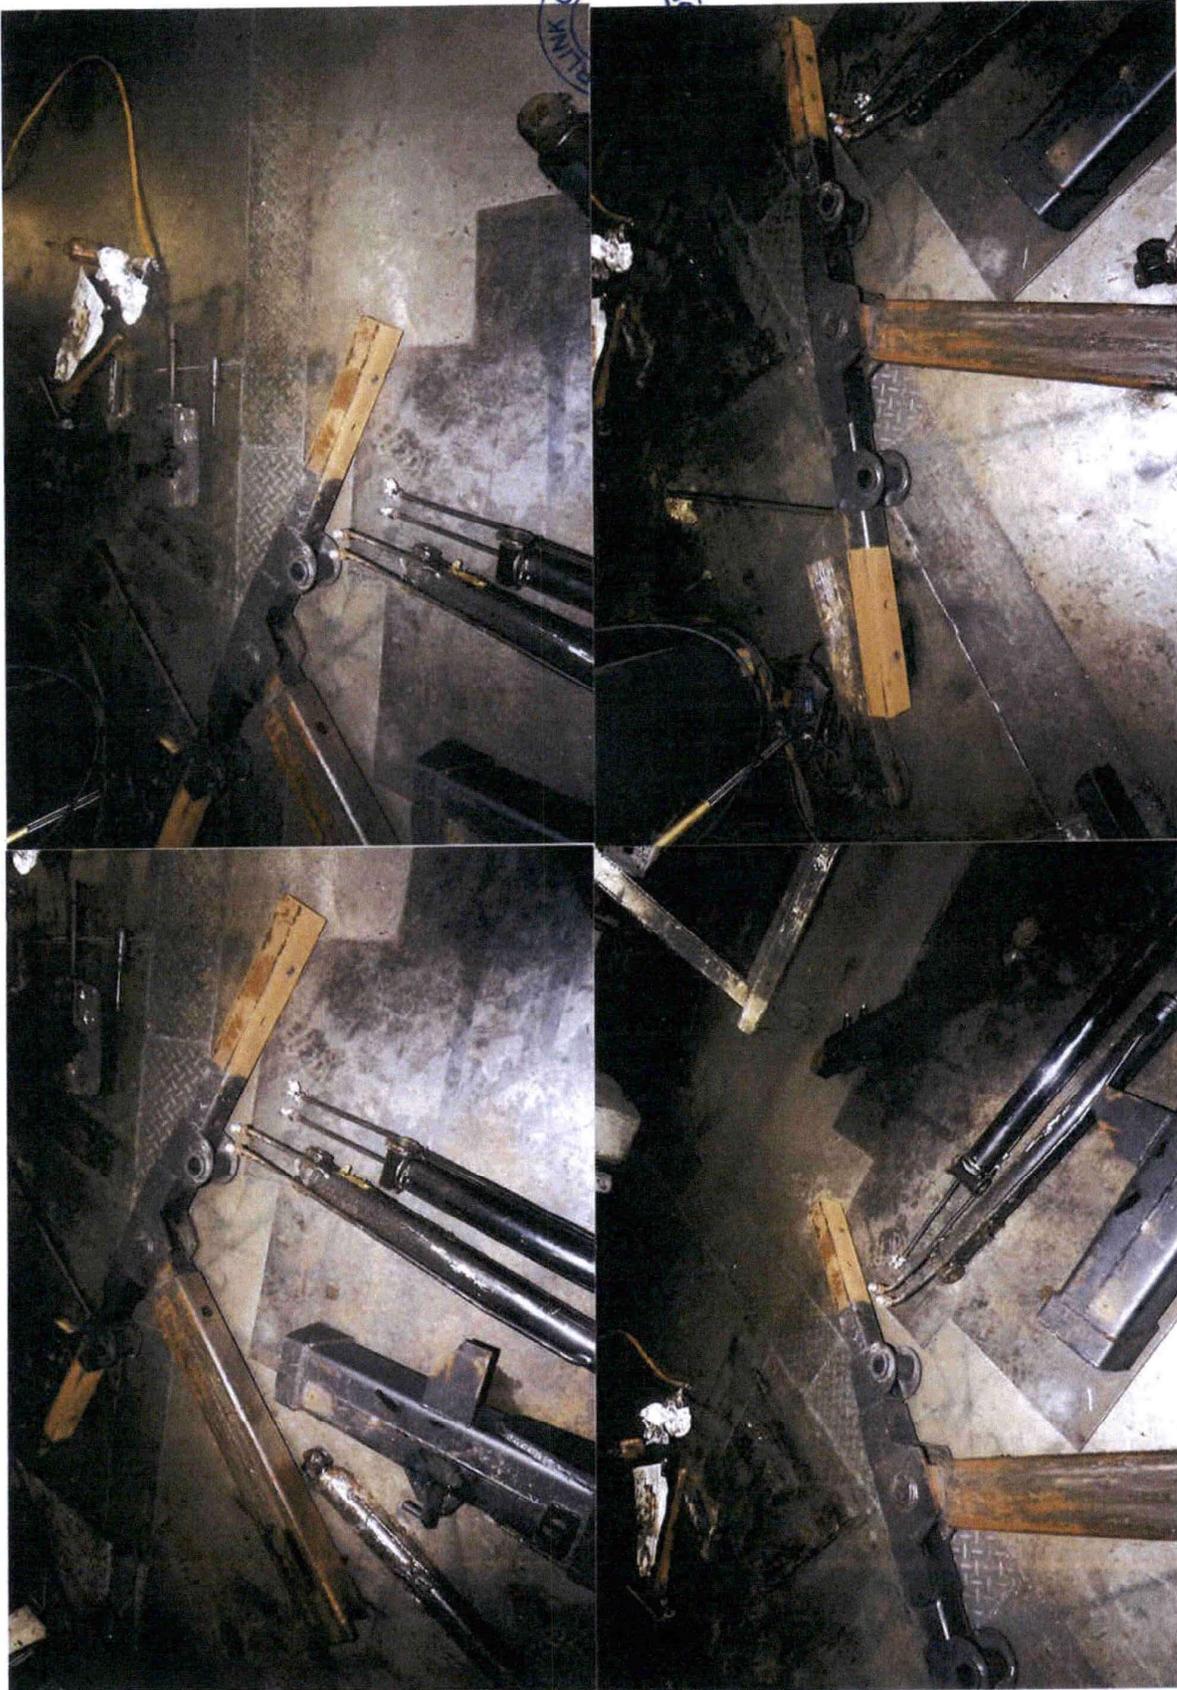


CARLINK

CARLINK CONSULTANCY

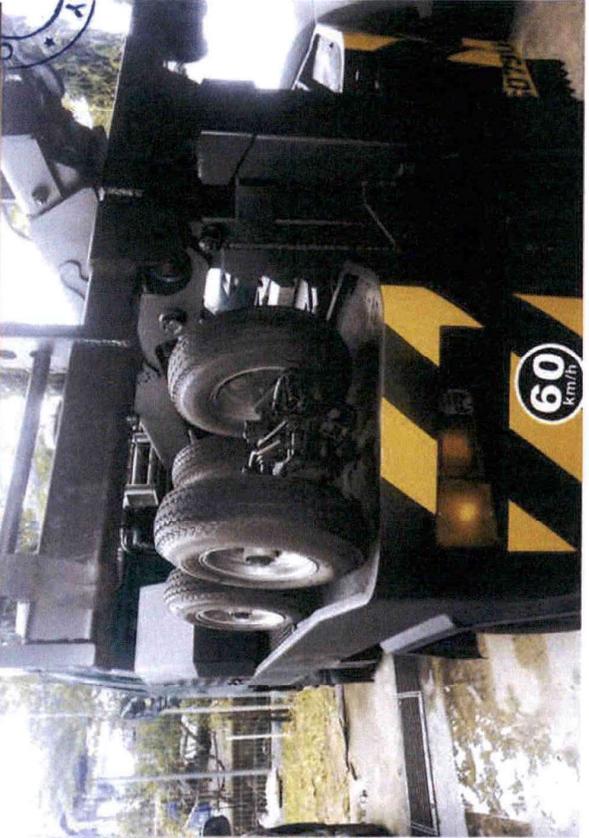

CARLINK CONSULTANCY

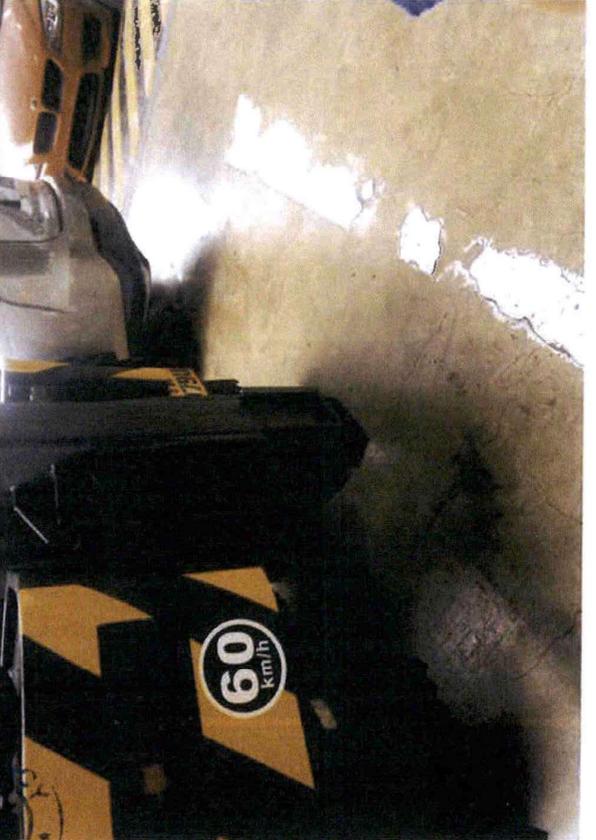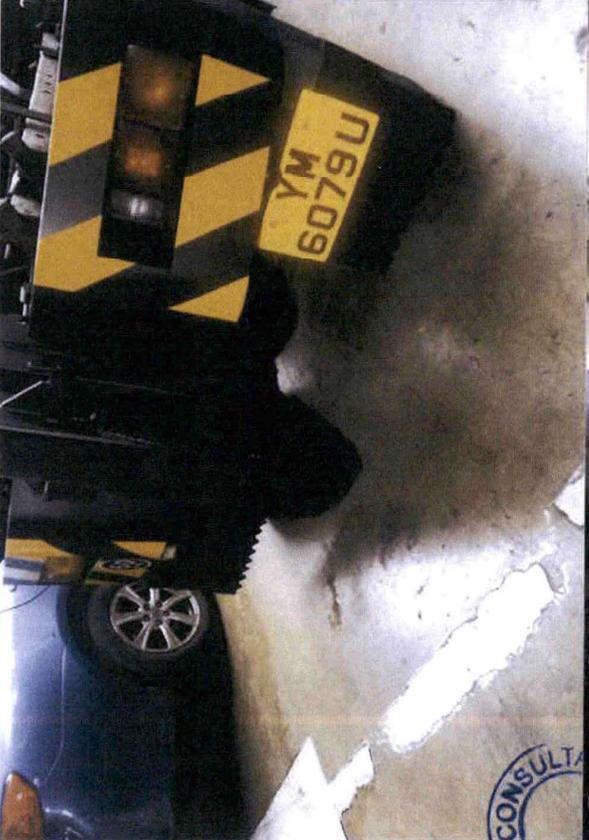

CONSULTANCY

CARLINK CONSULTANCY



CONSULTANCY  
CARLTON

