

CARLINK CONSULTANCY60 Hillside Drive
Singapore 549009

Tel: 62856178

Fax: 62874788

ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT

Our Ref: CLM14366TP/T

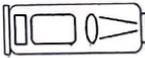
1 REFERENCE			
Date of request	: 10th January 2019		
Requested by	: M/S Autow Recovery Services C/o Kaki Bukit Autohub, 2 Kaki Bukit Avenue 2, #01-17 Singapore 417921		
Type of claim	: Third party		
Workshop	: M/S TwinCar Automotive Pte Ltd Kaki Bukit Autohub, 2 Kaki Bukit Avenue 2, #01-17 Singapore 417921		
Date of survey	: 10th January 2019		
Accident date	: 3rd December 2018		
2 DETAILS OF VEHICLE			
Registration No.	: YM 6079 U		
Make & Model	: Isuzu NHR85EU3ES		
Date of registration	: 8th March 2007		
Engine No.	: 4JJ1450635		
Chassis No.	: JAANHR85E77100047		
Transmission	: Manual		
Colour	: Blue		
Speedometer reading	: 361042 Km		
	reporting 357046		drive 3996 km
3 STATIC CHECK			
Steering	: In order	Paintwork	: Good
Footbrake	: In order	Modification	: Nil
Handbrake	: In order	General condition	: Good
4 TYRE CONDITION			
	<u>Nearside/Make</u>	<u>Offside/Make</u>	<u>Size</u>
Front tyre	: 6mm/Bridgestone	6mm/Bridgestone	: 205-R16C
Rear tyre	: 6mm/CST tires	6mm/CST tires	: 185-R14C
5 POINT OF IMPACT			
See Annex(es) and Motor Accident Reports			
6 REMARK			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

photo $17 \times 4 = 68 + 3 = 71$ pcsSubmit L/s \$8000
6 days

Report No.

CLM14366TP/T

Vehicle No. YM6079U

Parts and Labour Assessment**PARTS**

Description of part	Repairer's Qty	Qty	Condition	Repairer's estimate	Our adjustment
LIFT FORK CRANE MAIN MEMBER	1	1	DISTORTED/SHIFTED <i>Damaged</i>	4,500.00	4,500.00 ✓
LIFT FORK MAIN HYDRAULIC CYLINDER JACK	1	1	DISTORTED/LEAKED <i>Damaged</i>	1,800.00	1,800.00 ✓
LIFT FORK MAIN SLIDING MEMBER CYLINDER JACK	1	1	DISTORTED/LEAKED <i>Damaged</i>	1,600.00	1,600.00 ✓
LIFT FORK OUTER MAIN MEMBER	1	1	DISTORTED <i>Can't see Dged</i>	1,800.00	1,800.00 X
SLIDING MEMBER	1	1	DISTORTED <i>Repairable</i>	2,800.00	2,800.00 X
LIFT FORK T MEMBER	1	1	DISTORTED <i>Repairable</i>		
LIFT FORK T MEMBER HYDRAULIC CYLINDER JACK	1	1	DISTORTED/LEAKED <i>SVC</i>	1,600.00	1,600.00 X
REAR NUMBER PLATE	1	1	BENT/SLACK <i>dent</i>	35.00	35.00 ✓
REAR NUMBER PLATE LAMP	1	1	SLACK/FAULTY <i>not</i>	67.00	67.00 X
Subtotal before discount				SS 14,202.00	SS 14,202.00
Percentage discount 0% and 0%				SS 0.00	SS 0.00
Sub-total				SS 14,202.00	SS 14,202.00
Parts-total				SS 14,202.00	SS 14,202.00

LABOUR

- To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.
- To apply anti-rust chemical on repaired and replaced panel.
- To dismantle and replaced lifting fork assy, pivot pin, hydraulic cylinder jacks, hydraulic hose and etc, and to check and align system for proper operation.
- To check wiring system and light.

	1,800.00	1,500.00	1000
	200.00	150.00	X
	3,000.00	2,400.00	1000
	150.00	120.00	70
Labour Total	SS 5,150.00	SS 4,170.00	
Parts & Labour Total	SS 19,352.00	SS 18,372.00	

Results of inspection of the accident vehicle are as shown above,

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : SS 15,600.00 and the recommended number of working days for the repairs is within 14 day(s).


PATRICK'S SURVEYOR)
Automotive Appraiser

Carl Ink
Survey on 10-1-19

J.P. Knights
Survey 10-1-19
Disassemble 11-1-19
Address 16-1-19

10-05
2004

1/5 8000
61 hrs