

ASS. REC. BY:

REF:

AGL 2100 9660 / ke

Kennerth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop n/s _____ S&H

of _____

Insured: _____ 4736

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

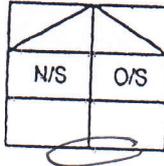

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 02 days Res.: Yes or No

Lum Sum: 1. B. / % 3 Val.: Yes or No

CA / REV / REP. 08728 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: STA 7888k Yr Regn: 08, 08

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toy Crown c.c. 2499

Colour: M.D. Brown A/C: Insured / Std / NI / NA

Sp. Reading: 168446 T/Radio: Insured / Std / NI / NA

Eng/No: _____ C/No: GRS 200 - 000 8981

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 235 / 35 ZR19

R: 275 / 30 ZR19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front: _____ Rear: _____

R/Bal: 6 mm R/Bal: 4 mm

L/Bal: 6 mm L/Bal: 4 mm

D.O.A. 14/9/21 D.O.I. 8/10/2021

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

8/10 Acc hung up no stock in local market, need to order over seas.

24/11 @ 2403.75 Cash

Date/Time, File Pass to?

: Prell. Report

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: : Site Insp (\$

: Interview (\$

: Tech Invs (\$

: Weekend (\$

Survey Fee:

Transportation: _____ \$ + RS. _____ \$

Fuel/Trs

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Table with 5 rows and 1 column for recording fees and totals.

Not Notified
Resurvey B&P painting
2 days



Koh Chik Hao Jason
26 Choa Chu Kang Grove #12-62
Singapore 688215

File No : SH/2021/080/10/001/TP
Date : 07-October-2021

2403.75

Estimated cost of repair for vehicle no : SJA7888K Toyota Crown
Accident involving vehicle no: SJA7888K & SLA1100R on 14.09.2021

Description	Quantity	Cost Price
Rear bumper	1	\$ <i>Br</i> 2,570.00 ✓
Rear bumper clips (1 set)	1	\$ <i>na</i> 35.00 ✓
Rear bumper reinforcement	1	\$ <i>R</i> 369.70 X
Rear end panel	1	\$ <i>R</i> 620.70 X
Rear boot inner lock	1	\$ <i>R</i> 1,057.00 X
Rear boot badge "Crown"	1	\$ <i>na</i> 46.20 X
Rear boot badge "Athlete"	1	\$ <i>na</i> 62.20 X
Rear boot emblem	1	\$ <i>na</i> 50.70 X
Rear boot chrome moulding	1	\$ <i>na</i> 501.70 X
		\$ 5,313.20
	Less 25%	\$ 1,328.30
		\$ 3,984.90

To remove rear damaged parts, to jack out rear end panel and rear floor panel and, to reweld, reshape and repair rear end panel, rear floor panel, rear body panel, to straighten out rear chassis member, to replace damaged parts and adjust rear body and boot alignment \$ *200* 550.00

To spray paint affected rear and inner damaged portion inclusive of preparatory works and material \$ *250* 650.00

To disconnect wire harness to facilitate repairs and check for damage and reconnect wiring system and check for full functionality \$ *na* 25.00 X

\$ 5,209.90

T/Party: AIG Asia Pacific Insurance Pte Ltd

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: