

ASS. REC. BY:

REF:

C12/21009792/Kt

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s Ding Aveof Photo

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 844k

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 10 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: YP 3004P Yr Regn: 03 16Type: M.Car / M.Cycle / Bus / Van / Motor / Taxi / Prime Mover /Truck / Trailer or CarMake: Mit Ganter c.c. 2998Colour: White A/C: Insured / Std / NI / NASp. Reading: 294585 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: 1-EB 21EA 20305Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / SRlm / STD A/Rlm orTyre Size: F: 195/85R15R: CD

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Komodo

Front

R/Bal. 9 mmL/Bal. 9 mmD.O.A. 5/9/21

Survey held at

Rear

R/Bal. 99 mmL/Bal. 99 mmD.O.I. 21/9/2021Des. of Damages Fr Rear / O/S / N/S / U/C / Rooftop or& etc

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date / Time	Action / Instruction
1	To check rear canopy & canopy spruce insured or not??

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

S - RS. SI

Fees:

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

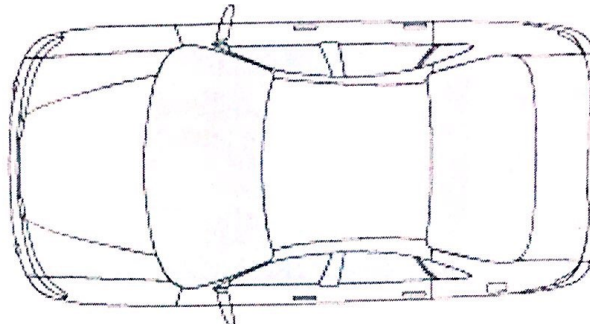

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT		2.0	8.40
NO NUMBER	L/CABIN BRACKET REMOVE AND REFIT		3.0	12.60
NO NUMBER	RIGHT CABIN BRACKET REMOVE AND REFIT		3.0	12.60
NO NUMBER	R + R FRONT TORSION BAR		5.0	21.00
NO NUMBER	RENEW FRONT LOWER CLOSING PANEL		36.0	151.20
NO NUMBER	RENEW RIGHT FRONT WHEELHOUSE CLOSING		19.0	79.80
NO NUMBER	R + R CAB BRACKET		16.0	67.20
NO NUMBER	L/R FRAME RUBBER BUSH REMOVE AND REFIT		3.0	12.60
NO NUMBER	R/R FRAME RUBBER BUSH REMOVE AND REFIT		3.0	12.60
NO NUMBER	R + R FUSE BOX		2.0	8.40
NO NUMBER	RENEW FRONT BUMPER		11.0	46.20
	INCLUDES: R + R NECESSARY ATTACHED PARTS			
NO NUMBER	RENEW FRONT PANEL CPL		75.0	315.00
NO NUMBER	R + R L/F REPEATER LAMP		4.0	16.80
NO NUMBER	R + R R/F REPEATER LAMP		4.0	16.80
NO NUMBER	R + R WINDSCREEN		25.0	105.00
	INCLUDES: COWL GRILLE, WIPER ARM AND WIPER LINKAGE REMOVE AND REFIT.			

Code	Description	WU	Price SGD
NO NUMBER	R + R L/F STEP	6.0	25.20
NO NUMBER	R + R R/F STEP BOARD	2.0	8.40
NO NUMBER	R + R R/R SKIRT COVER	7.0	29.40
NO NUMBER	R + R R/WING BRACKET STAY	2.0	8.40
NO NUMBER	R + R HORN	1.0	4.20
NO NUMBER	R + R WASHER RESERVOIR	2.0	8.40
NO NUMBER	R + R L/OUTER MIRROR BRACKET	3.0	12.60
NO NUMBER	R + R RIGHT FRONT DOOR	6.0	25.20
NO NUMBER	R + R R/DOOR HINGE/S	1.0	4.20
NO NUMBER	R + R L/INSTRUMENTS CARRIER REINF PANEL	5.0	21.00
NO NUMBER	R + R R/INSTRUMENTS CARRIER REINF PANEL	18.0	75.60
NO NUMBER	R + R L/INSTRUMENT PANEL BRACKET	2.0	8.40
NO NUMBER	R + R R/INSTRUMENT PANEL BRACKET	2.0	8.40
NO NUMBER	RENEW DASHBOARD	49.0	205.80
NO NUMBER	R + R STEERING WHEEL	3.0	12.60
NO NUMBER	R + R STEERING BOX	15.0	63.00
NO NUMBER	R + R POWER STEERING PUMP	4.0	16.80
NO NUMBER	R + R DRIVE BELT	2.0	8.40
NO NUMBER	R + R FAN COWL	3.0	12.60
NO NUMBER	R + R LEFT FRONT LOWER CONTROL ARM	6.0	25.20
NO NUMBER	R + R RIGHT FRONT LOWER CONTROL ARM	6.0	25.20
NO NUMBER	R + R L/F UPPER CONTROL ARM	8.0	33.60
NO NUMBER	R + R R/F UPPER CONTROL ARM	8.0	33.60
NO NUMBER	R + R RIGHT FRONT SHOCK ABSORBER	5.0	21.00
NO NUMBER	R + R R/F STEERING KNUCKLE	12.0	50.40
NO NUMBER	DETACH + REFIT L/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	DETACH + REFIT R/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	RENEW L/F WHEEL HUB/WHEEL BEARING	12.0	50.40
NO NUMBER	R + R L/F WHEEL	1.0	4.20
NO NUMBER	R + R R/F WHEEL	1.0	4.20
NO NUMBER	ADJUST HEADLAMPS	2.0	8.40
1001	FRT WINDSCREEN GLASS WINDSCREEN		200.00* 8/
1002	INSTRUMENT PANEL DASHBOARD		350.00* 25d
1003	ALIGN REAR CHASSIS REAR CHASSIS		1,000.00* ?
Labour Cost			
	Panel / Mechanical Labour	Hrs	WU
	Fixed Rate	40.70	407.0
			1,709.40
	Total of Labour		1550.00
			3,259.40

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description	WU	Price SGD
	R/F MUD FLAP BRKT SURFACE PAINT	4.0	
	L/F CORNER PANEL NEW PART PAINTING	7.0	
	R/F CORNER PANEL NEW PART PAINTING	7.0	
	FRONT PANEL CPL NEW PART PAINTING	27.0	
	LOWER FRONT PANEL SURFACE PAINT	4.0	
	CAB SUPPORT SURFACE PAINT	5.0	
	FRONT TORSION BAR SURFACE PAINT	4.0	
	L/CAB ATTACHMENT SURFACE PAINT	4.0	
	R/CAB ATTACHMENT SURFACE PAINT	4.0	
	R/F WHEELARCH PANEL SURFACE PAINT	4.0	

Code	Description	WU	Price SGD
	FRONT GRILLE NEW PART PAINT K1R	7.0	
	FRONT PANEL TRIM NEW PART PAINT K1R	5.0	

Paint Material Per Part

Code	Description	Price SGD
0828	R/F MUD FLAP BRKT SURFACE PAINT	0.53
0887	L/F CORNER PANEL NEW PART PAINTING	7.25
0888	R/F CORNER PANEL NEW PART PAINTING	7.25
0900	FRONT PANEL CPL NEW PART PAINTING	33.21
0931	LOWER FRONT PANEL SURFACE PAINT	3.87
2810	CAB SUPPORT SURFACE PAINT	6.69
2811	FRONT TORSION BAR SURFACE PAINT	2.29
2813	L/CAB ATTACHMENT SURFACE PAINT	0.70
2814	R/CAB ATTACHMENT SURFACE PAINT	0.70
4242	R/F WHEELARCH PANEL SURFACE PAINT	1.76
0410	FRONT GRILLE NEW PART PAINT K1R	32.73
092	FRONT PANEL TRIM NEW PART PAINT K1R	12.91

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		82.0	
Preparation Main Work Metal	1.70	17.0	71.40
Preparation Comp. Work Plastic	0.30	3.0	12.60
Total	10 WU/h	102.0	428.40

Material Cost - Paint

	Price SGD
New Part Painting	47.71
New Part Painting - Plastic K1R	36.64
Surface-/Blend Paint	16.54
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	127.99

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01	Price SGD
0257	FRONT NUMBER PLATE	NO NUMBER	Original	MIS	30.00 ✓
0258	FRT NO PLATE REINF	NO NUMBER	Original	NIP	20.00 X
0281	FRONT BUMPER	MC978515	Original	R	670.00 ✓
0282	CENTRE BUMPER COVER	ML301161	Original	NIP	55.00 X
0283	L/F BUMPER BRACKET	MK617973	Original	R	135.00 ✓
0284	R/F BUMPER BRACKET	MK617974	Original	R	135.00 ✓
0289	L/F BUMPER CORNER	MK617983	Original	Diy	248.00 ✓
0290	R/F BUMPER CORNER	MK617989	Original	MIS	248.00 ✓
0319	L/COVER BRACKET	MK580695	Original	NIP	60.00 X
0320	R/COVER BRACKET	MK580695	Original	NIP	60.00 X
0410	FRONT GRILLE	MC975208	Original	CAT	750.00 ✓

Code	Description	Part Number	Part Source	Price SGD
0431	FRONT MANUFACT	MK546616	Original	58.00 —
	BADGE			
0432	BADGE	MK546617	Original	85.00 —
0433	BADGE	MK675497	Original	58.00 —
0561	LEFT HEADLAMP ASSY	MK580525	Original	350.00 ?
0562	RIGHT HEADLAMP ASSY	MK580526	Original	350.00 —
0677	L/F INDICATOR	MK581219	Original	188.00 ?
0678	R/F INDICATOR	MK581220	Original	188.00 —
0717	L/POSITION LAMP	MK580529	Original	118.00 X
0718	R/POSITION LAMP	MK580530	Original	118.00 —
0826	R/F MUDFLAP	MC142140	Original	65.00 X
0828	R/F MUD FLAP BRKT	ML213529	Original	70.00 X
0830	R/F MUD PANEL	MK456198	Original	280.00 X
0887	L/F CORNER PANEL	MC976410	Original	320.00 X
0888	R/F CORNER PANEL	MC976411	Original	320.00 ?
0900	FRONT PANEL CPL	ML230262	Original	680.00 —
0931	LOWER FRONT PANEL	MK707589	Original	450.00 X
1392	FRONT PANEL TRIM	MC976000	Original	290.00 —
1401	WINDSCREEN	MK403591	Original	880.00 —
1410	WINDSCREEN SEAL	MX943765	Original	250.00 —
1411	WINDSCREEN BOND KIT	Z2156507		0.00 X
1436	WASHER CONTAINER	MK580578	Original	135.00 ?
	CPL			
1450	WIPER MOTOR	MK581044	Original	450.00 ?
1469	WIPER LINKAGE	MK580573	Original	420.00 ?
1488	R/UPPER DOOR HINGE	MK997204	Original	85.00 X
1496	R/LOWER DOOR HINGE	MK997204	Original	85.00 X
1737	L/DOOR MIRROR ASSY	MK486111	Original	120.00 —
1739	L/DOOR MIRROR ARM	MK547646	Original	450.00 X
1741	L/DOOR MIRROR COVER	MK547012	Original	90.00 X
2205	L/F STEP	MK677506	Original	340.00 X
2206	R/F STEP	MK677507	Original	340.00 —
2803	BONNET CATCH	MK623030	Original	450.00 —
2810	CAB SUPPORT	MK622579	Original	1,250.00 —
2811	FRONT TORSION BAR	MK622762	Original	450.00 ?
2813	L/CAB ATTACHMENT	MK622439	Original	250.00 ?
2814	R/CAB ATTACHMENT	MK622440	Original	250.00 ?
2819	L/R RUBBER MOUNTING	ML282432	Original	88.00 ?
2820	R/R RUBBER MOUNTING	ML282432	Original	88.00 ?
2825	L/F DAMPER BUFFER	MK622528	Original	155.00 ?
2826	R/F DAMPER BUFFER	MK622528	Original	155.00 ?
3404	R/F SIDE REFLECTOR	MK486520	Original	55.00 X
4242	R/F WHEELARCH PANEL	MK997121	Original	380.00 X
4327	L/BACKET CARRIER	MK620875	Original	180.00 ?
4328	R/BACKET CARRIER	MK620873	Original	180.00 ?
4329	L/IN INSTR PNL REINF	MK569098	Original	120.00 ?
4330	R/IN INSTR PNL REINF	MK569090	Original	220.00 ?
4331	INSTRUMENT PANEL	MK569703	Original	1,450.00 ?
4445	HEATER BLOWER	ML298307	Original	1,590.00 ?
7053	L/F LWR CONTROL ARM	MK527850	Original	380.00 ?
7054	R/F LWR CONTROL ARM	MK527855	Original	380.00 ?
7055	L/F UPP CONTROL ARM	ML326223	Original	350.00 ?
7056	R/F UPP CONTROL ARM	ML326223	Original	350.00 ?
7082	R/F STEERING KNUCKLE	MK527621	Original	550.00 ?
7088	R/FR SHOCK ABSORBER	MK459972	Original	250.00 ?
7131	L/F WHEEL HUB	MK527014	Original	480.00 ?

Front
Estimated Cost
OD/TP/WS/TP/R
To Insure
61
645
1004

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Description	Part Number	Part Source	Price SGD
R/F WHEEL HUB	MK527014	Original	480.00 ?
STEERING GEAR	MK590224	Original	1,850.00 ?
POWER STEERING PUMP	QC000052	Original	1,250.00 ?
HORN	MX916514	Original	150.00 ?
AIR INTAKE TUBE ASSY	AIR INTAKE TUBE	Original	CM 850.00 ✓
Savings Subtotal			0.00
Total			24,675.00

Code	Description	Price SGD
1000	R/STEEL BODY TRUNK REAR STEEL BODY	4,500.00* ?
	Total Extras	4,500.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	24,675.00	24,675.00
Labour Time Base 10 WU/h		
Total 407.0 WU X 42.00 SGD/h	1,709.40	
Fixed Rate	1,550.00	
Total of Labour		3,259.40
Total Of Extras		4,500.00
Paint Work Time Base 10 WU/h		
Labour Cost 102.0 WU X 42.00 SGD/h	428.40	
Material Cost	127.99	
Total Paint Including Material		556.39
Repair Cost Excludes GST		32,990.79
GST (+7.0%)		2,309.36
Repair Cost Included GST		35,300.15

Not Not hair
61 Pump & ?

Comments
* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note
No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: _____

Date: _____

Link to OneMotoring

Require PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

606W

Vehicle Details

Vehicle No.:

YP3004P

Vehicle to be Exported:

Yes

Intended Deregistration Date:

21 Sep 2021

Vehicle Make:

MITSUBISHI

Vehicle Model:

CANTER FEB21ER4SDEB (CBU)

Primary Colour:

White

Manufacturing Year:

2016

Engine No.:

4P10C04816

Chassis No.:

FEB21EA20505

Maximum Power Output:

\$32,798.00

Open Market Value:

27 May 2016

Original Registration Date:

27 May 2016

First Registration Date:

2

Transfer Count:

\$1,640.00

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

No

PARF Eligibility Expiry Date:

\$0.00

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

26 May 2026

COE Category:

C - Goods Vehicle & Bus

COE Period(Years):

10

PQP Paid:

\$37,260.00

COE Rebate Amount:

\$17,438.00

Total Rebate Amount:

\$17,438.00

The information contained herein is correct as at 10 Sep 2021

OK