



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2107877

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 16/11/2021
Reference CC3/CTI21009934/Ees3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 4734D
Insured Veh. GBF 1861U
Claim No. SNM21D205424/C02
Policy No. DMCVSN00087352104
Accident Date 22/09/2021
Inspection Date 23/09/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21009934/Ees3q2 Date: 16/11/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBF 1861U	Veh. Inspected	SHC 4734D
	Policy No.	DMCVSN00087352104	Coverage (\$)	0.00
	Claim No.	SNM21D205424/C02	Excess (\$)	0.00
	Assign From		Assign Date	23/09/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	JTDKN36U605767148	Colour	MAROON
	Odometer	924577 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	4 mm
	L/H Front Tyre	195/65 R15	SAILUN	4 mm
	R/H Rear Tyre	195/65 R15	SAILUN	4 mm
	L/H Rear Tyre	195/65 R15	SAILUN	4 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	22/09/2021	Inspection Date	23/09/2021
	Survey held at	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4734D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER REAR (DISC 25%)	BROKEN	458.60	343.95
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.92
1	TAIL LAMP RH (DISC 10%)	BROKEN	557.80	502.02
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	BUMPER REINFORCEMENT REAR	NOT NECESSARY	205.70	-
1	ARM SUB-ASSY ,RR BUMPER RH	NOT NECESSARY	139.60	-
1	ARM SUB-ASSY ,RR BUMPER RH	NOT NECESSARY	139.60	-
1	ANTENNA ,ELECTRICAL LOWER REAR	NOT NECESSARY	157.40	-
1	SENSOR REVERSE	NOT NECESSARY	180.00	-
1	BUMPER LIP COVER RR/RH	NOT NECESSARY	118.10	-
1	BUMPER LIP REAR	NOT NECESSARY	228.90	-
1	BATTERY CLAMP	NOT NECESSARY	16.10	-
1	BATTERY TRAY	NOT NECESSARY	42.80	-
1	FLOOR PANEL RR/RH	NOT NECESSARY	209.90	-
1	TAIL LAMP BRACKET ,RH	NOT NECESSARY	30.70	-
1	TROUGH ,BACK DOOR	NOT NECESSARY	110.90	-
1	FENDER RR/RH	NOT NECESSARY	766.80	-
1	SMRT LOGO	NOT NECESSARY	7.80	-
1	STICKER DECAL 6555 8888	NOT NECESSARY	21.60	-
1	FENDER LINER RR/RH	NOT NECESSARY	141.30	-
1	DUCT ASSY ,QUARTER	NOT NECESSARY	70.40	-
1	BUMPER SEAL ,RR RH	NOT NECESSARY	65.70	-
1	BUMPER SIDE RETAINER RR/RH	NOT NECESSARY	94.80	-
1	BUMPER SIDE RETAINER RR/LH	NOT NECESSARY	94.80	-
1	UNDER COVER SUBASSY ,RR FLOOR	NOT NECESSARY	514.50	-
1	TAILGATE OUTSIDE GARNISH	NOT NECESSARY	504.90	-
1	EMBLEM REAR	NOT NECESSARY	60.30	-
1	NAME PLATE (PRIUS)	NOT NECESSARY	60.80	-
1	NAME PLATE (TOYOTA)	NOT NECESSARY	51.90	-
1	SMRT LOGO	NOT NECESSARY	7.80	-

Report Ref No. CC3/CTI21009934/Ees3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STICKER DECAL 6555 8888	NOT NECESSARY	21.60	-
1	SPOILER REAR	NOT NECESSARY	953.70	-
1	END PANEL	NOT NECESSARY	602.10	-
1	SEALANT SIKAFLEX	NOT NECESSARY	37.00	-
1	END PANEL COVER ,DECK TRIM HOLE	NOT NECESSARY	46.10	-
1	END PANEL COVER ,DECK TRIM ,RR	NOT NECESSARY	121.10	-
1	TAILGATE DOOR WEATHERSTRIP	NOT NECESSARY	353.40	-
1	BOARD ASSY ,RR RH	NOT NECESSARY	379.20	-
1	SPACER ,RR FLOOR	NOT NECESSARY	130.60	-
1	PANEL ASSY ,DECK RH	NOT NECESSARY	307.00	-
1	BATTERY	NOT NECESSARY	278.00	-
1	BUMPER LIP COVER RR/RH	NOT NECESSARY	118.10	-
1	BUMPER REINFORCEMENT REAR	TO REPAIR SEE LABOUR	205.70	-
1	TAILGATE ASY	TO REPAIR SEE LABOUR	1,007.90	-
			9,809.00	1,016.97
	LABOUR			
	PANEL BEATING & BODY WORK .INCLUSIVE OF THE REPAIR OF BUMPER REINFORCEMENT REAR AND TAILGATE ASY .		1,195.00	400.00
	SPRAY PAINT.		2,754.00	550.00
	TO CHECK WIRING AND SYSTEM FUNCTION.		80.00	30.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.	NOT NECESSARY	100.00	-
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.	NOT NECESSARY	120.00	-
	TO REMOVE AND INSTALL LUGAAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	NOT NECESSARY	120.00	-
	TO INSPECT RR LIGHTING ,MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE.	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIT WIRE HARDESS.	NOT NECESSARY	200.00	-
	TO REPLACE SUNDRY PARTS.		100.00	10.00
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			4,849.00	990.00
GRAND TOTAL			14,658.00	2,006.97

Report Ref No. CC3/CTI21009934/Ees3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,800.00
---	--	--	-----------------

Report Ref No. CC3/CTI21009934/Ees3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4734D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

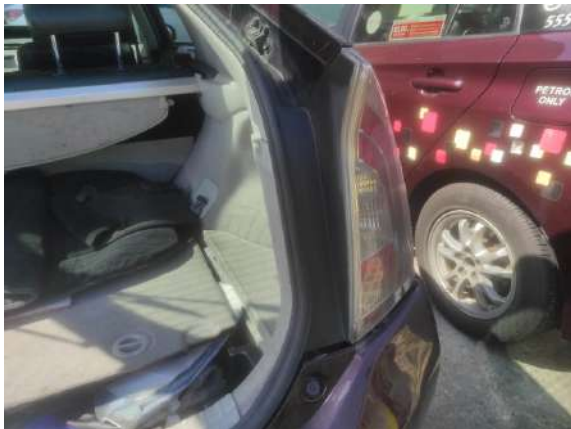



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4734D

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

