



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203792

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/06/2022
Reference CC3/CTI21010079/Gpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SH 7777D
Insured Veh. GBK 8789Z
Claim No. SNM21D205479/C02
Policy No. DMCVSNW00126422000
Accident Date 26/09/2021
Inspection Date 27/09/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21010079/Gpa3q2	
			Date: 20/06/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBK 8789Z	Veh. Inspected	SH 7777D	
Policy No.	DMCVSNW00126422000	Coverage (\$)	0.00	
Claim No.	SNM21D205479/C02	Excess (\$)	0.00	
Assign From		Assign Date	27/09/2021	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI AE IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	KMHC851CVHU022725	Colour	BLUE	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	6 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	6 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	6 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/09/2021	Inspection Date	27/09/2021	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SH 7777D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRT BUMPER COVER	CRACKED	430.90	430.90
10	FRT BUMPER CLIPS	NECESSARY	22.00	22.00
1	FRT BUMPER LOWER GRILLE MOULDING	DEFORMED	127.60	127.60
2	HEADLAMP LH RH @\$1993.65	CRACKED	3,987.30	3,987.30
1	HEADLAMP SUPPORT PANEL	NOT NECESSARY	949.30	-
1	RADIATOR GRILLE	CRACKED	1,409.10	1,409.10
1	FRT BUMPER MOULDING CENTRE UPP	NOT NECESSARY	368.50	-
1	FRT BUMPER SPONGE	CRACKED	186.90	186.90
1	FRT BUMPER REINFORCEMENT	BENT	1,075.10	1,075.10
2	FRT BUMPER REINFORCEMENT ABSORBER LH RH @\$186.50	NOT NECESSARY	373.00	-
1	FRT BUMPER MOULDING CENTRE UPPER	DEFORMED	368.50	368.50
1	FRT BUMPER TOWING COVER	NOT NECESSARY	29.00	-
1	FRT BUMPER LOWER STIFFNER	NOT NECESSARY	285.10	-
1	EMBLEM H	NECESSARY	31.30	31.30
2	FRT BUMPER TOP BRACKET LH RH @\$35.00	NOT NECESSARY	70.00	-
2	FRT BUMPER BRACKET LH RH @\$28.00	NOT NECESSARY	56.00	-
2	FRT BUMPER AIR DUCT LH RH @\$76.90	NOT NECESSARY	153.80	-
1	RADIATOR	NOT NECESSARY	710.50	-
1	RADIATOR INVERTER	NOT NECESSARY	884.80	-
1	COOLANT	NOT NECESSARY	45.00	-
1	AIRCON CONDENSER	NOT NECESSARY	663.60	-
2	ANTENNA ASSY SMARTKEY LH RH @\$80.20	NOT NECESSARY	160.40	-
1	COVER ASSY SCCC UNIT	NOT NECESSARY	767.30	-
1	FLAP ASSY ACTIVE AIR UPPER LH (ADDITIONAL)	BROKEN	356.00	356.00
1	FLAP ASSY ACTIVE AIR UPPER RH (ADDITIONAL)	BROKEN	356.00	356.00
1	UNIT ASSY -SMART CRUISE CONTROL (ADDITIONAL)	BENT	2,910.90	2,910.90
1	WIRING ASSY -FEM (ADDITIONAL)	NOT NECESSARY	229.10	-
1	FRT BUMPER CENTRE MOULDING (ADDITIONAL)	DEFORMED	44.00	44.00
1	FRT NUMBR PLATE GARNISH (ADDITIONAL)	MISSING	188.00	188.00

Report Ref No. CC3/CTI21010079/Gpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 20% DISCOUNT		-3,447.80	-2,298.72
			13,791.20	9,194.88
	<u>SPECIAL NETT ITEMS</u>			
1	FRT NUMBER PLATE WITH TRIM COVER (SN)	MISSING	55.00	55.00
			55.00	55.00
	<u>LABOUR</u>			
	PANEL BEATING.		1,100.00	350.00
	SPRAY PAINTING CHARGE.		300.00	250.00
	TOWING FEE.		60.00	60.00
	REMOVE/REFIX RADIATOR.	NOT NECESSARY	90.00	-
	CHECK ALL LIGHTING.		80.00	30.00
	RE-SET SMART CRUISE CONTROL SYSTEM.		120.00	50.00
			1,750.00	740.00
	GRAND TOTAL		15,596.20	9,989.88
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,000.00

Report Ref No. CC3/CTI21010079/Gpa3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 7777D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 7777D

RE-INSPECTION

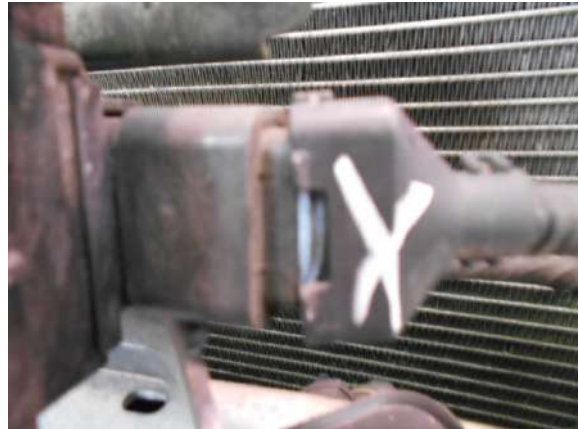



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SH 7777D

RE-INSPECTION

