



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

QBE INSURANCE (S) PTE LTD

INV No. AC2202674

1 RAFFLES QUAY #29-10 SOUTH TOWER
SINGAPORE 048583

INV Date 11/05/2022
Reference CC3/QBE21010320/Rpa3q2
Code QBE

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 4657T
Insured Veh. YP 1471L
Claim No. VC014803
Policy No. 8-V0016982-MVA-R003
Accident Date 01/10/2021
Inspection Date 05/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (S) PTE LTD 1 RAFFLES QUAY #29-10 SOUTH TOWERSINGAPORE 048583			Ref: CC3/QBE21010320/Rpa3q2 Date: 11/05/2022 Code: QBE	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 1471L	Veh. Inspected	SHC 4657T	
Policy No.	8-V0016982-MVA-R003	Coverage (\$)	0.00	
Claim No.	VC014803	Excess (\$)	0.00	
Assign From		Assign Date	05/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA TAXI	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	JTDKN36U605750673	Colour	MAROON	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	6 mm	
L/H Front Tyre	195/65 R15	SAILUN	6 mm	
R/H Rear Tyre	195/65 R15	SAILUN	6 mm	
L/H Rear Tyre	195/65 R15	SAILUN	6 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	01/10/2021	Inspection Date	05/10/2021	
Survey held at	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4657T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	MOULDING ,BACK WINDOW OUTSIDE LH NO.2 (DISC 25%)	NECESSARY	29.40	22.05
1	MOULDING ,BACK WINDOW LOWER NO.2 (DISC 25%)	NECESSARY	29.40	22.05
1	DAM ,BACK DOOR GLASS ADHESIVE ,NO .2 (DISC 25%)	NECESSARY	17.40	13.05
1	TAILGATE LOWER WINDOW GLASS (DISC 25%)	NECESSARY	721.30	540.98
1	MOULDING BACK WINDOW ,LOWER NO.1(DISC 25%)	NECESSARY	29.40	22.05
1	TAILGATE DOOR GLASS MOULDING ,RH (DISC 25%)	NECESSARY	29.40	22.05
1	TAIL GATE DOOR GLASS MOULDING LH (DISC 25%)	NECESSARY	29.40	22.05
1	DAM,BACK DOOR GLASS ADHESIVE NO.1(DISC 25%)	NECESSARY	27.30	20.48
1	TAILGATE ASY (DISC 25%)	BENT	1,007.90	755.93
1	BUMPER LIP REAR (DISC 25%)	DEFORMED	228.90	171.68
1	BUMPER REAR (DISC 25%)	DEFORMED	458.60	343.95
1	TAILGATE BOARD ASSY (DISC 25%)	DEFORMED	246.90	185.18
1	MOULDING ,BACK WINDOW ,OUTSIDE RH NO.2 (DISC 25%)	NECESSARY	29.40	22.05
1	TAILGATE DOOR WEATHERSTRIP (DISC 25%)	NECESSARY	353.40	265.05
1	TAILGATE OUTSIDE GARNISH (DISC 25%)	SCRATCHED	504.90	378.68
1	EMBLEM REAR (DISC 25%)	NECESSARY	60.30	45.23
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	NAME PLATE (PRIUS) (DISC 25%)	NECESSARY	60.80	45.60
1	NAME PLATE (TOYOTA) (DISC 25%)	NECESSARY	51.90	38.93
1	END PANEL (DISC 25%)	BENT	602.10	451.58
1	END PANEL COVER ,DECK TRIM HOLE (DISC 25%)	DEFORMED	46.10	34.58
1	END PANEL COVER ,DECK TRIM ,RR (DISC 25%)	DEFORMED	121.10	90.83
1	BUMPER REINFORCEMENT REAR (DISC 25%)	BENT	205.70	154.28
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	ARM SUB-ASSY ,RR BUMPER RH (DISC 25%)	BENT	139.60	104.70
1	ARM SUB-ASSY ,RR BUMPER LH (DISC 25%)	BENT	139.60	104.70
1	BUMPER LIP COVER RR/RH (DISC 25%)	SCRATCHED	118.10	88.58
1	TAILGATE TRIM ,LOWER (DISC 25%)	SCRATCHED	180.70	135.53
1	BOX ,RR FLOOR ,BOARD (DISC 25%)	CRACKED	679.60	509.70

Report Ref No. CC3/QBE21010320/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ANTENNA ,ELECTRICAL LOWER REAR (DISC 10%)	CRACKED	157.40	141.66
1	TAIL LAMP RH (DISC 10%)	CRACKED	557.80	502.02
1	ADVERTISEMENT STICKER (SN)	NECESSARY	296.88	296.88
3	SEALANT W/SCREEN @\$37.00 (SN)	NECESSARY	111.00	111.00
1	NUMBER PLATE (SN)	NECESSARY	15.00	15.00
1	NUMBER PLATE FRAME (SN)	NECESSARY	12.00	12.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT SIKAFLEX (SN)	NECESSARY	37.00	37.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	SENSOR REVERSE (SN)	DISTORTED	180.00	180.00
1	TAILGATE DOOR GLASS	NOT NECESSARY	1,090.90	-
1	UNDER COVER SUBASSY ,RR FLOOR	NOT NECESSARY	514.50	-
1	BUMPER SIDE RETAINER RR/RH	NOT NECESSARY	94.80	-
1	BUMPER SIDE RETAINER RR/LH	NOT NECESSARY	94.80	-
1	BUMPER SEAL ,RR RH	NOT NECESSARY	65.70	-
1	BUMPER SEAL ,RR LH	NOT NECESSARY	88.90	-
1	WIRE ,FRAME	NOT NECESSARY	1,680.90	-
1	BATTERY TRAY	NOT NECESSARY	42.80	-
1	BATTERY CLAMP	NOT NECESSARY	16.10	-
1	BATTERY	NOT NECESSARY	278.00	-
1	PANEL ASSY ,DECK RH	NOT NECESSARY	307.00	-
1	PANEL ASSY ,DECK LH	NOT NECESSARY	307.00	-
1	BOX ,DECK FLOOR ,LH	NOT NECESSARY	196.80	-
1	BOX ,DECK FLOOR COVER LH	NOT NECESSARY	230.10	-
1	SPACER ,RR FLOOR	NOT NECESSARY	130.60	-
1	BOARD ASSY ,RR RH	NOT NECESSARY	379.20	-
1	STICKER DECAL 6555 8888	NOT NECESSARY	21.60	-
1	SMRT LOGO	NOT NECESSARY	7.80	-
1	FENDER LINE RR/RH	NOT NECESSARY	141.30	-
1	FENDER RR/RH	NOT NECESSARY	766.80	-
1	TROUGH ,BACK DOOR	NOT NECESSARY	110.90	-
1	TAIL LAMP BRACKET ,RH	NOT NECESSARY	30.70	-

Report Ref No. CC3/QBE21010320/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL LAMP RH	NOT NECESSARY	557.80	-
1	SEALANT W/SCREEN	NOT NECESSARY	37.00	-
1	QUARTER GLASS RR/LH	NOT NECESSARY	168.10	-
1	TROUGH BACK DOOR LH	NOT NECESSARY	110.90	-
1	STICKER DECAL 6555 8888	NOT NECESSARY	21.60	-
1	SMRT LOGO	NOT NECESSARY	7.80	-
1	TAILGATE TRIM ,LH	NOT NECESSARY	85.90	-
1	TAILGATE TRIM ,LOWER	NOT NECESSARY	180.70	-
1	TAILGATE TRIM RH	NOT NECESSARY	88.30	-
1	TAILGATE TRIM ,UPPER	NOT NECESSARY	49.60	-
1	WIRE BACK DOOR NO.1	NOT NECESSARY	582.40	-
1	CAMERA ASSY ,TELEVISION ,RR	NOT NECESSARY	1,436.60	-
1	SWITCH ASSY ,BACK DOOR OPENER	NOT NECESSARY	146.10	-
1	3RD BRAKE LAMP	NOT NECESSARY	231.30	-
1	TAIL LAMP LH	NOT NECESSARY	548.40	-
1	TAIL LAMP BRACKET ,LH	NOT NECESSARY	30.70	-
1	FENDER RR/LH	NOT NECESSARY	766.80	-
1	FENDER LINER R/LH	NOT NECESSARY	141.30	-
1	QUARTER GLASS RR/RH	NOT NECESSARY	488.20	-
1	SEALANT W/SCREEN	NOT NECESSARY	37.00	-
2	TAILGATE DOOR HINGE LH/RH	NOT NECESSARY	58.30	-
1	TAILGATE DOOR LOCK	NOT NECESSARY	444.10	-
1	TAILGATE DOOR STAY LH	NOT NECESSARY	241.50	-
1	TAILGATE DOOR STAY RH	NOT NECESSARY	241.50	-
1	TAILGATE LOCK COVER	NOT NECESSARY	15.70	-
1	STRIKER BACK DOOR	NOT NECESSARY	48.90	-
1	LICENSE PLATE LAMP	NOT NECESSARY	35.70	-
1	REINFORCEMENT ,RR	NOT NECESSARY	34.60	-
1	SPARE TYRE PANEL	NOT NECESSARY	667.70	-
1	CUSHION SPARE WHEEL	NOT NECESSARY	230.80	-
1	PROTECTOR ,SPARE	NOT NECESSARY	143.70	-
1	CARRIER ,SPARE	NOT NECESSARY	19.70	-
1	TYRE	NOT NECESSARY	126.74	-

Report Ref No. CC3/QBE21010320/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	WHEEL ,DISC	NOT NECESSARY	1,490.20	-
1	BREAKDOWN SIGN	NOT NECESSARY	35.00	-
1	MEMBER SUB-ASSY ,RR LH	NOT NECESSARY	174.10	-
1	MEMBER SUB-ASSY ,RR RH	NOT NECESSARY	174.10	-
1	FLOOR PANEL RR/LH	NOT NECESSARY	102.00	-
1	BOARD ,RR FLOOR	NOT NECESSARY	392.30	-
1	BOX ,RR FLOOR BOARD	NOT NECESSARY	679.60	-
1	BOX ,DECK FLOOR ,RR	NOT NECESSARY	649.70	-
1	FLOOR PANEL RR/RH	NOT NECESSARY	209.90	-
1	BUMPER LIP COVER RR/RH	NOT NECESSARY	118.10	-
1	BUMPER LIP COVER RR/LH	NOT NECESSARY	72.20	-
1	ANTENNA ELECTRICAL LOWER REAR	NOT NECESSARY	157.40	-
1	ARM SUB-ASSY ,RR BUMPER RH	NOT NECESSARY	139.60	-
1	ARM SUB-ASSY ,RR BUMPER LH	NOT NECESSARY	139.60	-
1	SPOILER REAR	TO REPAIR SEE LABOUR	953.70	-
1	SOLAR FILM (SN)	NECESSARY	125.00	125.00
1	SOLAR FILM (SN)	NOT NECESSARY	350.00	-
1	SOLAR FILM (SN)	NOT NECESSARY	250.00	-
			28,568.22	6,232.49
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF SPOILER REAR .		1,521.00	600.00
	SPRAY PAINT.		3,672.00	700.00
	TOWING CHARGE.		56.00	40.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.	NOT NECESSARY	200.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION .	NOT NECESSARY	80.00	-
	TO DO WHEEL ALIGNMENT /TYRE BALANCING.	NOT NECESSARY	120.00	-
1	TO ALIGN CHASSIS .	NOT NECESSARY	350.00	-
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	40.00
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.		120.00	60.00
	TO INSPECT RR LIGHTING ,MECHANISM & WATER TEST RR LIGHTING FOR LEAKAGE.		120.00	30.00

Report Ref No. CC3/QBE21010320/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIX REAR WINDSCREEN .		240.00	180.00
	TO REMOVE & REFIT REAR QUARTER GLASS RH .	NOT NECESSARY	120.00	-
	TO REMOVE & REFIT REAR QUARTER GLASS LH	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIT WIRE HARDESS.	NOT NECESSARY	250.00	-
	TO REPLACE SUNDRY PARTS .	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
			7,249.00	1,650.00
GRAND TOTAL			35,817.22	7,882.49
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,800.00

Report Ref No. CC3/QBE21010320/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4657T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

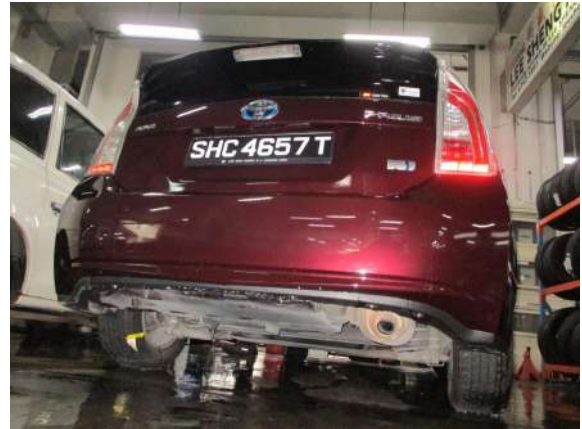



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

