



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2200856

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 16/02/2022
Reference CC4/LPC21010428/Ees3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLL 9044J
Insured Veh. XD 7971X
Claim No. 21/21/21/VC00/025021
Policy No. Z/21/VC00/112477
Accident Date 08/10/2021
Inspection Date 13/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21010428/Ees3q2 Date: 16/02/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 7971X	Veh. Inspected	SLL 9044J	
Policy No.	Z/21/VC00/112477	Coverage (\$)	0.00	
Claim No.	21/21/21/VC00/025021	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	11/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	HONDA CIVIC	c.c	1597	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	MRHFC5650GT001032	Colour	SILVER	
Odometer	80645 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/50 R17	YOKOHAMA	4 mm	
L/H Front Tyre	215/50 R17	YOKOHAMA	4 mm	
R/H Rear Tyre	215/50 R17	YOKOHAMA	4 mm	
L/H Rear Tyre	215/50 R17	YOKOHAMA	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	08/10/2021	Inspection Date	13/10/2021	
Survey held at	KAH MOTOR CO SDN BERHAD NO. 255 ALEXANDRA ROAD SINGAPORE 159937			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLL 9044J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	LID COMP TRUNK (SN)	DENTED	416.17	416.17
1	HINGE COMPR TRUNK (SN)	NOT NECESSARY	38.32	-
1	HINGE COMPL TRUNK (SN)	NOT NECESSARY	38.32	-
2	STOPPER TRUNK LID (SN)	NOT NECESSARY	7.80	-
1	STRIKERTRUNK LID (SN)	NOT NECESSARY	6.07	-
1	LOCK ASSYTRUNK (SN)	NOT NECESSARY	63.67	-
1	WEATHERSTRIPTRUNK LID (SN)	TORN	52.50	52.50
1	GARNISH ASSYRR .LICENSE (SN)	BROKEN	86.10	86.10
1	EMBLEM SETRR (SN)	NECESSARY	10.05	10.05
1	EMBLEMRR (SN)	NECESSARY	9.37	9.37
1	LIGHT ASSYR LID (SN)	BROKEN	104.70	104.70
1	LIGHT ASSYL LID (SN)	BROKEN	104.70	104.70
1	TAILLIGHT ASSYR (SN)	BROKEN	223.80	223.80
1	TAILLIGHT ASSYL (SN)	BROKEN	240.82	240.82
1	CAMERA ASSYRR VIEW (SN)	NOT NECESSARY	270.15	-
1	FACE ASSY ,RR BUMPER (SN)	DENTED	462.90	462.90
1	GARNISH ,RR BUMPER LOWER (SN)	NOT NECESSARY	31.20	-
1	GARNISH,R.RR.BUMPER SIDE (SN)	NOT NECESSARY	6.67	-
1	GARNISH,L.RR.BUMPER SIDE (SN)	NOT NECESSARY	6.67	-
1	BEAM COMPRR BUMPER (SN)	DENTED	141.00	141.00
1	SPACERR.RR.BUMPER SIDE (SN)	BROKEN	8.62	8.62
1	SPACERL.RR.BUMPER SIDE (SN)	BROKEN	8.62	8.62
7	CLIP ,BUMPER SPACERR.RR.BUMPER SIDE (SN)	NECESSARY	12.07	12.07
1	PANEL SETR.RR.OUTSIDE (SN)	NOT NECESSARY	609.22	-
1	PANEL SETL.RR.OUTSIDE (SN)	NOT NECESSARY	609.22	-
1	NUMBER PLATE WITH CASING -L (SN)	CUT	45.00	45.00
1	SUNDRIES (SN)	NECESSARY	100.00	50.00
1	LINING ASSYRR.PANEL (ADDITIONAL)	CRUSHED	37.72	37.72
			3,751.45	2,014.14

Report Ref No. CC4/LPC21010428/Ees3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	INSPECT RR LIGHTING MECHANISMS .PERFORM WATER .		280.00	280.00
	REMOVE & RENEW REVERSE SENSORS.		280.00	280.00
	REMOVE INSTALL & CALIBRATE REAR VIEW CAMERA.		560.00	560.00
	RESET VEHICLE SMART ENTRY SYSTEM.		560.00	560.00
	REMOVE & TRANSFER ITEMS TO NEW TRUNK LID .		560.00	480.00
	BODY UNDERSIDE COATING.		380.00	350.00
	BODY JOINT SEALANT TRUNK LID .		120.00	100.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS.		650.00	560.00
	STRAIGHTEN ALIGN RR PANEL RR FENDER .		5,200.00	1,300.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS.		4,160.00	2,080.00
			12,750.00	6,550.00
	GRAND TOTAL		16,501.45	8,564.14
RECOMMENDED COST OF REPAIRS				8,564.14

Report Ref No. CC4/LPC21010428/Ees3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 9044J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

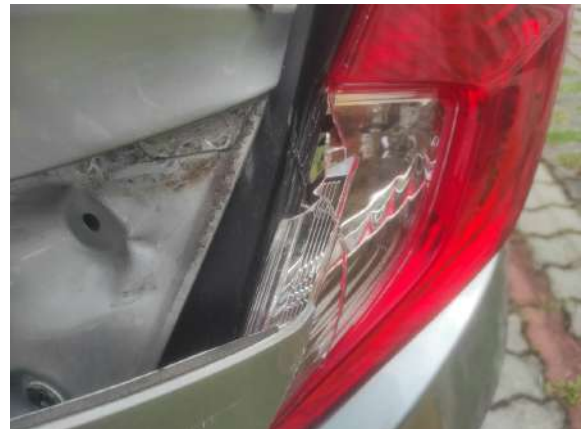



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 9044J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

