



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: Jezpreet Kaur Dhillon
C/o: 7 Soon Lee Street #01-32
Ispace (S) 627608

Date of report: 30.06.2021
Date of request: 07.06.2021
Date of inspection: 07.06.2021
Date of accident: 01.06.2021
Claim type: Third Party Claim

Report No: AAS/2021/130

Particulars of affected vehicle:

Registration no: SLC3430P
Make/Model: Toyota Harrier (A)
Year of registration: 2016
Colour: Pink

Odometer: 49211 km
Engine Capacity: 1986 cc
Engine no: 3ZRB754544
Chassis no: ZSU600074875

Condition of tires:

Front Left: 6mm
Make: Falken
Rear Left: 6mm
Make: Falken

Front Right: 6mm
Make: Falken
Rear Right: 6mm
Make: Falken

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork : Good
Paintwork : Good
Handbrake : In order
Footbrake : In order
Steering : In order
Apparent engine modification : Nil

The Assignment

The inspection was conducted at M/s. SK Garage
7 Soon Lee Street #01-32
Ispace (S) 627608

(Subsequent inspection was conducted)

Assessment

Repairer's estimate: \$ 13,929.75

Revised estimate: \$ 8,600.00

Recommended reserve: \$ 6,900.00 (Lump sum)

Estimated normal duration of repairs : 7 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: SLC3430P

Report No: AAS/2021/130

W/O PREJUDICE

Point of impact

At the rear portion.

General description of damages

The tailgate, tailgate garnish, tailgate lamp LH, tail lamp LH, rear bumper, rear bumper lower spoiler, rear end panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s SK Garage as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$8,600.00

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$6,900.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 7 working days.

I have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 52 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Seah
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SLC3430P

Report No: AAS/2021/130

Appraisement Schedule

| S/N | Parts Description | Qty | Condition | | Repairer's Est | Revised Est |
|---------------------|-----------------------------|------|-------------------|-----------|-------------------------|---------------|
| 1 | Tailgate | 1 | Dented | | \$ 2,698.00 1750 | \$ 2,698.00 |
| 2 | Tailgate glass moulding | 1 | Necessary | | \$ 133.00 | \$ 133.00 ✓ |
| 3 | Tailgate sub garnish | 1 | Cracked | | \$ 803.00 | \$ 803.00 ✓ |
| 4 | Tailgate emblem | 1 | Necessary | | \$ 64.00 | \$ 64.00 ✓ |
| 5 | Tailgate lamp LH/RH | 2 | LH Cracked | \$ 559.00 | \$ 1,118.00 422 | \$ 559.00 |
| 6 | Tailgate lock | 1 | Refit | | \$ 597.00 | - |
| 7 | Tailgate striker | 1 | Refit | | \$ 44.00 | - |
| 8 | Tailgate weather-strip | 1 | Refit | | \$ 401.00 | - |
| 9 | Tailgate trim board | 1 | Refit | | \$ 767.00 | - |
| 10 | Tail lamp LH/RH | 2 | LH Cracked | \$ 793.00 | \$ 1,586.00 505 | \$ 793.00 |
| 11 | Rear bumper | 1 | Dented | | \$ 1,283.00 | \$ 1,283.00 ✓ |
| 12 | Rear bumper lower | 1 | Refit | | \$ 791.00 | - |
| 13 | Rear bumper reflector LH/RH | 2 | Refit | \$ 59.00 | \$ 118.00 | - |
| 14 | Rear bumper absorber | 1 | Dented/Cracked | | \$ 193.00 | \$ 193.00 ✓ |
| 15 | Rear bumper support LH/RH | 2 | Cracked/Necessary | \$ 60.00 | \$ 120.00 | \$ 120.00 ✓ |
| 16 | Rear bumper retainer LH/RH | 2 | Cracked/Necessary | \$ 57.00 | \$ 114.00 | \$ 114.00 ✓ |
| 17 | Rear end panel | 1 | Dented/Repair | | \$ 770.00 | - |
| 18 | Rear end panel trim | 1 | Refit | | \$ 613.00 | - |
| Total: | | | | | \$ 12,213.00 | \$ 6,760.00 |
| -25% | | | | | \$ 3,053.25 | \$ 1,690.00 |
| List total: | | | | | \$ 9,159.75 | \$ 5,070.00 |
| 1 | Tailgate glass sealant | 1 | Necessary | | \$ 60.00 | \$ 40.00 ✓ |
| 2 | Rear bumper clips | 1set | Necessary | | \$ 50.00 | \$ 30.00 ✓ |
| 3 | Reverse sensor | 1set | Malfunctioned | | \$ 300.00 200 | \$ 250.00 |
| 4 | Rear bumper lower spoiler | 1 | Cracked | | \$ 850.00 600 | \$ 850.00 |
| 5 | Joint sealant | 1 | Not Necessary | | \$ 60.00 | - |
| Special nett total: | | | | | \$ 1,320.00 | \$ 1,170.00 |
| Parts Total: | | | | | \$ 10,479.75 | \$ 6,240.00 |



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS

180 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SLC3430P

Report No: AAS/2021/130

S/N Labour Description

Repairer's Est Revised Est

| | | | | |
|---|--|-------------|-------|------------|
| 1 | Remove & reinstall rear trimmings. | \$ 150.00 | 30 ✓ | \$ 80.00 |
| 2 | Remove & transfer tailgate component. (Include tailgate spoiler) | \$ 120.00 | 80 ✓ | \$ 120.00 |
| 3 | Remove & transfer tailgate glass. | \$ 180.00 | 120 ✓ | \$ 150.00 |
| 4 | Remove & transfer reverse camera. | \$ 120.00 | 50 ✓ | \$ 80.00 |
| 5 | Renew reverse sensor. | \$ 80.00 | 30 ✓ | \$ 50.00 |
| 6 | Supply sealant, renew rear bumper lower spoiler. | \$ 200.00 | 30 ✓ | \$ 150.00 |
| 7 | Rust proofing on rear affected & replacement panels. | \$ 100.00 | | \$ 30.00 ✓ |
| 8 | Spray painting on rear affected & replacement panels. | \$ 1,300.00 | 900 ✓ | \$ 950.00 |
| 9 | Conduct panel beating, straightening, cutting & reforming. Renew rear damaged parts. Re-align all affected area. | \$ 1,200.00 | 600 ✓ | \$ 750.00 |

Labour Total: \$ 3,450.00 \$ 2,360.00

Grand Total: \$ 13,929.75 \$ 8,600.00

The final adjusted lump sum amount is \$6,900.00

Under normal circumstances, the repair should be completed within a reasonable period of 7 working days.

6 days ✓

52 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.

SK GARAGE TRADING

7 Soon Lee Street #01-32 iSPACE Singapore 627608

2 July 2021

Bill To

Jezpreet Kaur Dhillon

REPAIR BILL FOR VEHICLE NO. SLC 3430P

| No | Descriptions | Amount S\$ |
|--------------|---|------------|
| 1 | Lump Sum Repair cost as per surveyor report | \$6,900.00 |
| Total Amount | | \$6,900.00 |

Enquire Vehicle's Insurance Particulars

Enquire Vehicle's Insurance Particulars (As At 01 Jun 2021 / 15:19:00)

Vehicle Insurance Details

Vehicle No.:

XE1865D

Make Description/Model:

ISUZU / CYH52S

Insurance Company Name:

LONPAC INSURANCE BHD

Business Transaction Reference No.:


20210605121801052669

Please retain the business transaction reference number for Enquire Vehicle Owner Details (if required).

Save as PDF

OK →


Print

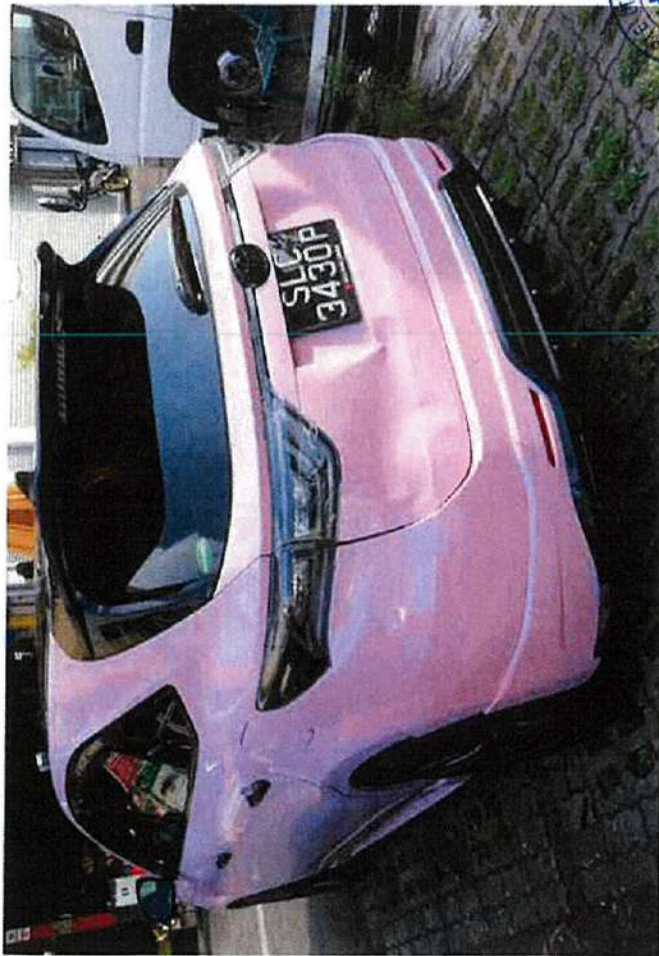



TOYOTA MOTOR CORPORATION JAPAN
 MODEL DBA-ZSU60W-ANXMP
 ENGINE 3ZR-FAE 1986 mL
 FRAME No. ZSU60-0074875
 COLOR TRIM PLANT OPTION
 202 FA20 A31
 K114 -01A 570





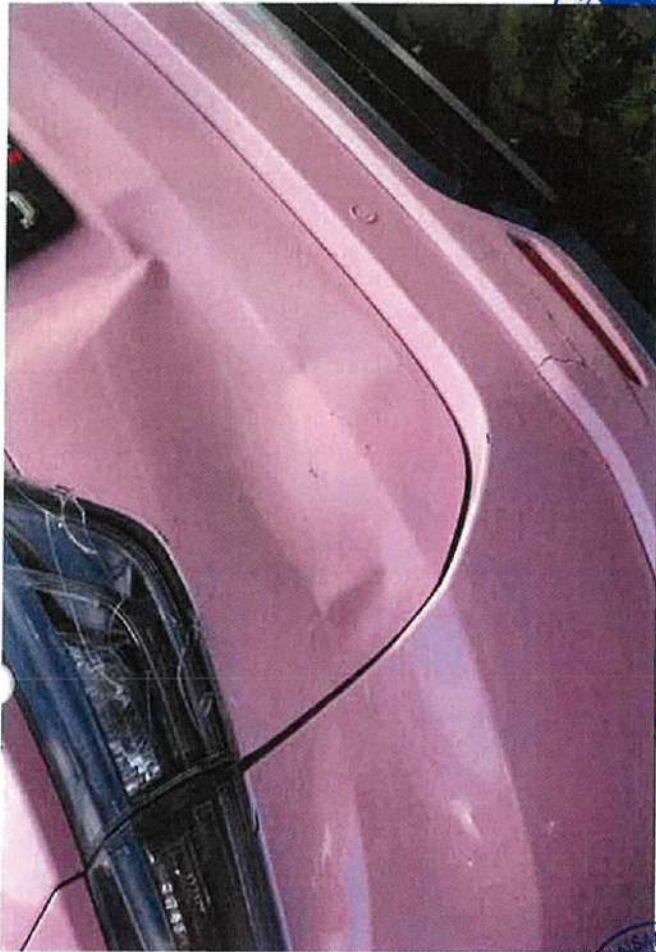

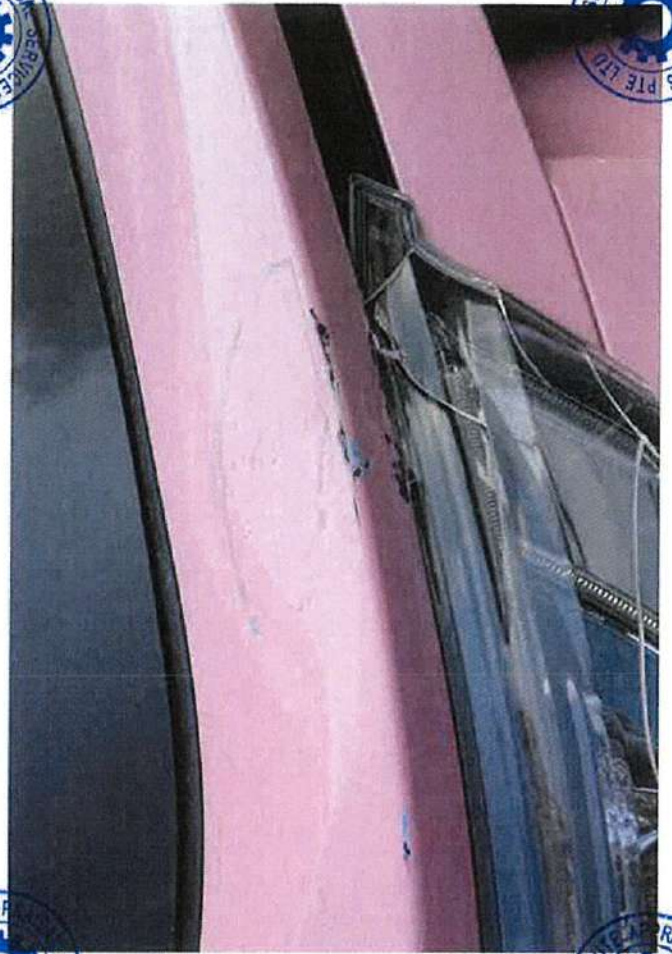

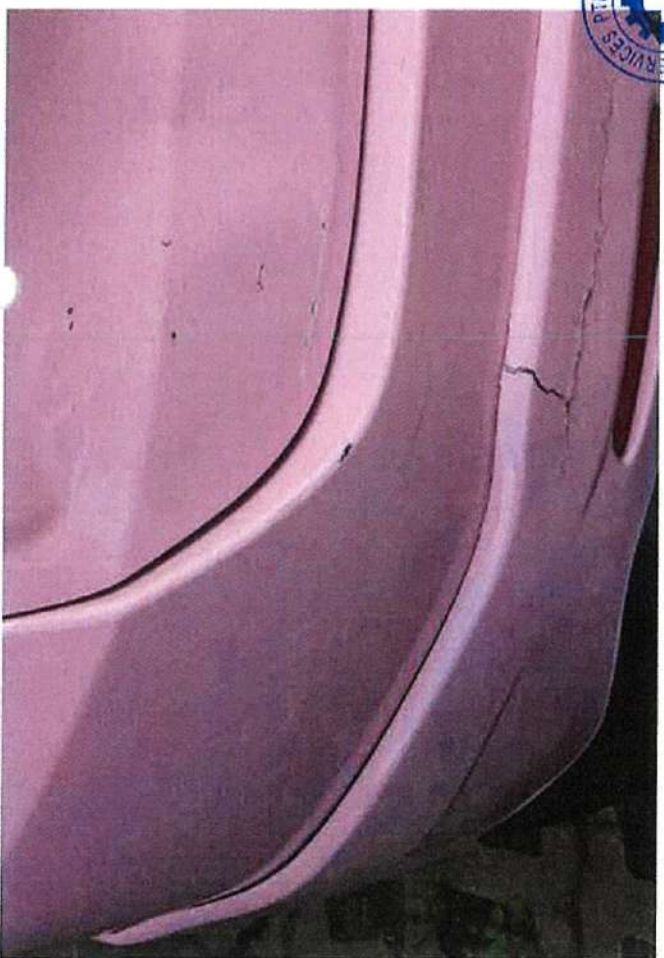

3433
HUAYANG







