



6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Claim Reference : -  
Insured Vehicle No. : -  
Thirty Party Veh No. : -  
Officer-In-Charge : -

Our Reference : KAAS/KT/6279/6767/TP/08.21  
Invoice No. : 6279  
Date : 06 September 2021

To: Skyway Motor Pte Ltd  
c/o 25 Kaki Bukit Road 4  
#01-55, Synergy @ Kaki Bukit  
Singapore 417800

INVOICE	
PARTICULARS	AMOUNT
Vehicle No. : SNA 6767K Make/Model : Honda Fit Basic 1.3 CVT	
<input checked="" type="checkbox"/> Inspection of Vehicle	
<input checked="" type="checkbox"/> Appraisal Report	
<input checked="" type="checkbox"/> 64 Colored Photographs	SGD 634.00
<input checked="" type="checkbox"/> Transport charges	
<input checked="" type="checkbox"/> Re-inspection	
<input type="checkbox"/> Others ( Specify )	
Total	SGD 634.00

Dollars: Six Hundred and Thirty-Four Only

( Cheque should be crossed and make payable to " Kelvin Automotive Appraising Services " )



Kelvin Automotive Appraising Services



6 tampines st 73, #01-03, singapore 528825  
tel: 6746 2118 fax: 6746 1148  
reg no: 53058468m

Claim Reference : -  
Insured Vehicle No. : -  
Thirty Party Veh No. : -  
Officer-In-Charge : -

Our Reference : KAAS/KT/6279/6767/TP/08.21  
Date : 06 September 2021

To: Skyway Motor Pte Ltd  
c/o 25 Kaki Bukit Road 4  
#01-55, Synergy @ Kaki Bukit  
Singapore 417800

## VEHICLE APPRAISAL REPORT

Name of Workshop : Apex Motoring  
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800  
Date of Assignment : 16 August 2021  
Date of Accident : 15 August 2021  
Date of Inspection : 16 August 2021

### **PARTICULARS OF INSPECTED VEHICLE**

Registration No.	: SNA 6767K	Chassis Frame No.	: GR11020367
Make / Model	: Honda Fit Basic 1.3 CVT	Engine No. ( Logcard )	: L13B1526691
Year of Manufacture/Reg	: 2020	Odometer Reading	: 538 KM
Colour	: Red		
Class / Type	: Hatchback		

### **CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)**

General Condition : Good  
Paintwork : Good  
Market Value : -  
Scrap Value : -

### **CONDITION OF TYRES ON VEHICLE**

	<u>Make/Size</u>	<u>Thread Balance</u>
Front L	Bridgestone 185/60 R15	9 mm
Front R	Bridgestone 185/60 R15	9 mm
Rear L	Bridgestone 185/60 R15	9 mm
Rear R	Bridgestone 185/60 R15	9 mm

\*The above is an estimate of the remaining life of the tyre thread in millimeters

*The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.*



6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Our Reference : KAAS/KT/6279/6767/TP/08.21  
 Vehicle Number : SNA 6767K


### APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		<b>LIST ITEMS:-</b>			
1	1 pc	Rh rear fender	dented	\$ 1,500.50	repair
2	1 pc	Rh rear door	buckled	\$ 1,176.20	\$ 1,176.20
3	1 pc	Rh rear door window regulator	damaged	\$ 648.20	\$ 648.20
5	1 pc	Rh rear door weatherstrip	torn	\$ 152.10	\$ 152.10
6	1 pc	Rh front door	torn	\$ 1,224.20	\$ 1,224.20
7	1 pc	Rh front door window regulator	damaged	\$ 672.40	\$ 672.40
9	1 pc	Rh front door weatherstrip	deformed	\$ 158.90	\$ 158.90
10	1 pc	Rh front fender	buckled	\$ 696.50	\$ 696.50
11	1 pc	Rh front fender inner shield	deformed	\$ 237.80	\$ 237.80
12	1 pc	Rh rocker panel	dented	\$ 588.50	repair
13	1 pc	Rh front shock absorber	bent	\$ 547.60	\$ 547.60
14	1 pc	Rh front lower arm	bent	\$ 372.50	\$ 372.50
15	1 pc	Rh front wheel bearing with hub	damaged	\$ 394.10	\$ 394.10
16	1 pc	Wheel hub cap	cracked	\$ 262.20	\$ 262.20
				\$ 8,631.70	\$ 6,542.70
		Less 20%			\$ 1,308.54
				\$ 8,631.70	\$ 5,234.16
<b>Sub - Total</b>				\$ 8,631.70	\$ 5,234.16



### ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered **Diagonally to the RH Front from front to rear; left to right** portion of the vehicle.

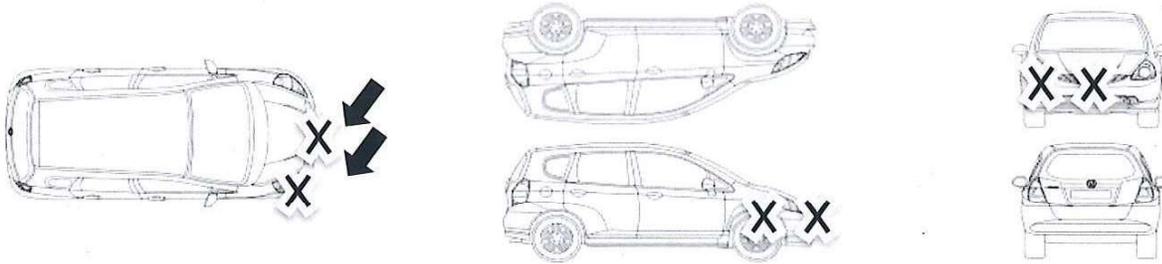

The general area of damages is at the **RH Front portion**  
( Please refer to the parts list and photographs as attached for more information )

### ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Apex Motoring** is \$ 11,771.70 .  
We have adjusted the cost to \$ 8,044.16 and the repairer has agreed to undertake the repairs at a **Contract Lump Sum of \$ 6,440.00** to a acceptable quality and standards.  
However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **8** working days.

**64** photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6279** for our services rendered and we thank you for engaging our services.

**KELVIN TEO**  
*Licensed Automotive Appraiser*  
*Nitec in Automotive Technology*  
*Cert. Crash Investigation & Reconstruction*  
*Dip MS*  
*MSAAA, AM SAE-A*

**NOTE :** This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.

