

(08/11/13) wef

ASS. REC. BY: Rou

REF:

369k

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SAR 668T

at Workshop m/s

of

Insured:

Policy No.

Claims No.


Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

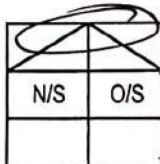Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No: SAR 668TYr Regn: 2017 DEC

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRIUS HYBRID 1800Tc.c 1798Colour: MAROON

A/C: Insured / Std / NI / NA

Sp.Reading: -

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: JTDKB3FU603579722

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / 8/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

31/10/21

D.O.I.

03/11/21

Survey held at

SMRTDes. of Damages: FR / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Prel. Report



: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Invs (\$



: Weekend (\$

) S + RS SI

) Photos

) Others

Report Format :

Lump Sum / I.B.I: (\$



Case Details

Case Reference Number : TAX/10/21/2070

Type of Repair : Accident Repair

Vehicle Registration Number : SHB668T

Company Type : Strides Taxi Pte Ltd

Estimation ID : EST-16551-ID

Assigned By : Taxi Claims Manager Team

Insurance Company Name : AIG Asia Pacific Insurance Pte Ltd

Accident Date and Time : 31/10/2021 11:20 AM

Vehicle Age(In Months) : 46

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

SMRT Recommendation										Surveyor Approval				
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			ROOF HEADLINING ASSY	1	2,059.50	2,059.50	25.00	1,544.63	Replace	1	1,544.63	Replace	des
One Time Key In	Main			PAD, FRONT SEAT BACK, RH	1	268.60	268.60	25.00	201.45	Replace	1	201.45	Replace	cut
One Time Key In	Main			COVER SUB-ASSY, FRONT SEAT BACK, RH	1	1,505.10	1,505.10	25.00	1,128.82	Replace	1	1,128.82	Replace	cut
One Time Key In	Main			PAD, FRONT SEAT BACK, LH	1	268.60	268.60	25.00	201.45	Replace	1	201.45	Replace	cut
One Time Key In	Main			COVER SUB-ASSY, FRONT SEAT BACK, LH	1	1,505.10	1,505.10	25.00	1,128.82	Replace	1	1,128.82	Replace	cut
One Time Key In	Main			SEAT BELT ASSY, REAR SEAT, RH	1	828.20	828.20	25.00	621.15	Replace	1	621.15	Replace	ACT
One Time Key In	Main			SEAT BELT ASSY, REAR SEAT, LH	1	838.20	838.20	25.00	628.65	Replace	1	628.65	Replace	ACT
One Time Key In	Main			ABSORBER, FR BUMPER	1	70.30	70.30	25.00	52.72	Replace	1	52.72	Replace	cut
One Time Key In	Main			EXTENSION SUB-ASSY, LH	1	116.30	116.30	25.00	87.22	Replace	1	87.22	Replace	cut
One Time Key In	Main			EXTENSION SUB-ASSY, RH	1	116.30	116.30	25.00	87.22	Replace	1	87.22	Replace	cut

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation											Surveyor Approval			
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks	
One Time Key In	Main		REINFORCEMENT FRONT LOWER	1	238.50	238.50	25.00	178.88	Replace	1	178.88	Replace	✓ bf	
One Time Key In	Main		ABSORBER, FR BUMPER LOWER	1	117.00	117.00	25.00	87.75	Replace	1	87.75	Replace	✓ cm	
One Time Key In	Main		SEAL, HOOD TO FR END	1	24.40	24.40	25.00	18.30	Replace	1	18.30	Replace	✓ nee	
One Time Key In	Main		COVER, RADIATOR	1	227.80	227.80	25.00	170.85	Replace	1	170.85	Replace	✓ cm	
One Time Key In	Main		EMBLEM ASSY FRONT	1	87.10	87.10	25.00	65.32	Replace	1	65.32	Replace	✓ nee	
One Time Key In	Main		GRILLE, RADIATOR	1	165.00	165.00	25.00	123.75	Replace	1	123.75	Replace	✓ cm	
One Time Key In	Main		GRILLE SUB-ASSY	1	335.60	335.60	25.00	251.70	Replace	1	251.70	Replace	✓ cm	
One Time Key In	Main		CLIPS PIECE, FRT & RR BUMPER	10	1.50	15.00	25.00	11.25	Replace	10	11.25	Replace	✓ nee	
One Time Key In	Main		COVER ASSY, ENGINE	1	180.10	180.10	25.00	135.07	Replace	1	135.07	Replace	✓ cm	
One Time Key In	Main		COVER ASSY, ENGINE UNDER CENTER SET	1	452.80	452.80	25.00	339.60	Replace	0	0	Check	✓ ?	
One Time Key In	Main		COVER, ENGINE UNDER SIDE RH	1	76.90	76.90	25.00	57.68	Replace	0	0	Check	✓ ?	
One Time Key In	Main		COVER, ENGINE UNDER SIDE LH	1	76.90	76.90	25.00	57.68	Replace	0	0	Check	✓ ?	
One Time Key In	Main		LAMP ASSY, FOG, RH	1	910.20	910.20	10.00	819.18	Replace	1	819.18	Replace	✓ cm	
One Time Key In	Main		LAMP ASSY, FOG, LH	1	910.20	910.20	10.00	819.18	Replace	1	819.18	Replace	✓ cm	
One Time Key In	Main		UNIT , HEADLAMP , LH	1	2,558.90	2,558.90	10.00	2,303.01	Replace	1	2,303.01	Replace	✓ cm	

Total Spare Part Cost 65,701.86

Surveyor Total 36,253.30

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 52,561.49

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval			
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		UNIT, HEADLAMP, RH	1	2,558.90	2,558.90	10.00	2,303.01	Replace	1	2,303.01	Replace	OK
One Time Key In	Main		COMPUTER SUB-ASSY, HEADLAMP, LH NO.1	1	486.40	486.40	10.00	437.76	Replace	0	0	Check	?
One Time Key In	Main		COMPUTER SUB-ASSY, HEADLAMP, RH NO.1	1	486.40	486.40	10.00	437.76	Replace	0	0	Check	?
One Time Key In	Main		HOOD SUB-ASSY	1	938.40	938.40	25.00	703.80	Replace	1	703.80	Replace	bu
One Time Key In	Main		INSULATOR, HOOD	1	393.90	393.90	25.00	295.42	Replace	1	295.42	Replace	TURN
One Time Key In	Main		HINGE ASSY, HOOD, RH	1	57.00	57.00	25.00	42.75	Replace	1	42.75	Replace	bf
One Time Key In	Main		HINGE ASSY, HOOD, LH	1	57.00	57.00	25.00	42.75	Replace	1	42.75	Replace	bf
One Time Key In	Main		CABLE ASSY, HOOD	1	53.20	53.20	25.00	39.90	Replace	0	0	Check	?
One Time Key In	Main		SUPPORT ASSY, HOOD	1	41.80	41.80	25.00	31.35	Replace	1	31.35	Replace	bu
One Time Key In	Main		LOCK ASSY, HOOD	1	131.10	131.10	25.00	98.32	Replace	1	98.32	Replace	bf
One Time Key In	Main		BRACE, HOOD LOCK SUPPORT	1	76.20	76.20	25.00	57.15	Replace	1	57.15	Replace	bf
One Time Key In	Main		FRONT REINFORCEMENT SIDE RH	1	128.20	128.20	25.00	96.15	Replace	0	0	Check	?
One Time Key In	Main		FRONT REINFORCEMENT SIDE LH	1	129.30	129.30	25.00	96.98	Replace	0	0	Check	?
One Time Key In	Main		SUPPORT S/A UPPER,	1	364.90	364.90	25.00	273.67	Replace	1	273.67	Replace	bf
One Time Key In	Main		SUPPORT S/A RH	1	237.00	237.00	25.00	177.75	Replace	1	177.75	Replace	bf

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval			
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		SUPPORT S/A LH	1	237.00	237.00	25.00	177.75	Replace	1	177.75	Replace ▾	St ✓
One Time Key In	Main		SUPPORT SUB-ASSY LOWER	1	397.40	397.40	25.00	298.05	Replace	1	298.05	Replace ▾	bf ✓
One Time Key In	Main		SUPPORT, RADIATOR UPPER RH	1	76.70	76.70	25.00	57.53	Replace	1	57.53	Replace ▾	ne ✓
One Time Key In	Main		SUPPORT, RADIATOR UPPER LH	1	76.70	76.70	25.00	57.53	Replace	1	57.53	Replace ▾	ne ✓
One Time Key In	Main		WINDSCREEN FRONT GLASS SUB-ASSY	1	1,626.40	1,626.40	25.00	1,219.80	Replace	1	1,219.80	Replace ▾	col ✓
One Time Key In	Main		SEALANT W/SCREEN	3	37.00	111.00	0.00	111.00	Replace	3	111.00	Replace ▾	ne ✓
One Time Key In	Main		WINDSCREEN FRONT DAM, WINDOW GLASS	1	44.00	44.00	25.00	33.00	Replace	1	33.00	Replace ▾	ne ✓
One Time Key In	Main		WINDSCREEN FRONT MOULDING, TOP FRONT	1	44.00	44.00	25.00	33.00	Replace	1	33.00	Replace ▾	ne ✓
One Time Key In	Main		MOULDING RH	1	83.30	83.30	25.00	62.47	Replace	0	0	Check ▾	?
One Time Key In	Main		MOULDING LH	1	83.30	83.30	25.00	62.47	Replace	0	0	Check ▾	?
One Time Key In	Main		CLIP, WINDSHIELD, RH & LH, NO.1	2	8.80	17.60	25.00	13.20	Replace	2	13.20	Replace ▾	ne ✓
One Time Key In	Main		CLIP, WINDSHIELD, RH & LH, NO.2	2	8.80	17.60	25.00	13.20	Replace	2	13.20	Replace ▾	ne ✓
One Time Key In	Main		CLIP, WINDSHIELD, RH & LH, NO.3	2	9.10	18.20	25.00	13.65	Replace	2	13.65	Replace ▾	ne ✓
One Time Key In	Main		COVER, RELAY BLOCK, UPPER	1	83.30	83.30	25.00	62.47	Replace	0	0	Check ▾	?
One Time Key In	Main		BLOCK ASSY, RELAY	1	76.80	76.80	25.00	57.60	Replace	0	0	Check ▾	?

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval				
	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			RELAY, INTEGRATION	1	245.60	245.60	10.00	221.04	Replace	0	0	Check	?
One Time Key In	Main			BLOCK ASSY, RELAY , NO.2	1	83.30	83.30	10.00	74.97	Replace	0	0	Check	?
One Time Key In	Main			HOLDER, FUSE RELAY BLOCK CONNECTOR	1	132.90	132.90	10.00	119.61	Replace	0	0	Check	?
One Time Key In	Main			COVER, RELAY BLOCK, LOWER	1	71.50	71.50	25.00	53.63	Replace	0	0	Check	?
One Time Key In	Main			COVER SUB-ASSY, FRONT PILLAR , UPR RH	1	96.90	96.90	25.00	72.68	Replace	1	72.68	Replace	MCS/
One Time Key In	Main			COVER SUB-ASSY, FRONT PILLAR , UPR LH	1	96.90	96.90	25.00	72.68	Replace	1	72.68	Replace	MCS/
One Time Key In	Main			COVER, FR BUMPER	1	495.50	495.50	25.00	371.63	Replace	1	371.63	Replace	hm/
One Time Key In	Main			SUPPORT, FR BUMPER RH	1	76.90	76.90	25.00	57.68	Replace	1	57.68	Replace	neu/
One Time Key In	Main			SUPPORT, FR BUMPER LH	1	82.30	82.30	25.00	61.72	Replace	1	61.72	Replace	neu/
One Time Key In	Main			COVER, FR BUMPER RH	1	28.10	28.10	25.00	21.08	Replace	1	21.08	Replace	MCS/
One Time Key In	Main			COVER, FR BUMPER LH	1	28.10	28.10	25.00	21.08	Replace	1	21.08	Replace	MCS/
One Time Key In	Main			BRACKET, FR BUMPER	1	99.80	99.80	25.00	74.85	Replace	1	74.85	Replace	neu/
One Time Key In	Main			NUMBER PLATE	1	35.00	35.00	0.00	35.00	Replace	1	35.00	Replace	MCS/
One Time Key In	Main			NUMBER PLATE FRAME	1	25.00	25.00	0.00	25.00	Replace	1	25.00	Replace	MCS/
One Time Key In	Main			REINFORCEMENT FRONT UPPER	1	691.10	691.10	25.00	518.33	Replace	1	518.33	Replace	bf/

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval			
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		SEAL, RADIATOR GRILLE	1	40.70	40.70	25.00	30.53	Replace	0	0	Check	?
One Time Key In	Main		WIPER GARNISH LOUVER SUB-ASSY	1	666.90	666.90	25.00	500.17	Replace	1	500.17	Replace	cm ✓
One Time Key In	Main		WIPER GARNISH SHIELD, COWL WATER, RH	1	18.90	18.90	25.00	14.17	Replace	0	0	Check	?
One Time Key In	Main		WIPER GARNISH SHIELD, COWL WATER, LH	1	18.90	18.90	25.00	14.17	Replace	1	14.17	Replace	cm ✓
One Time Key In	Main		SEAL, RADIATOR TO RH	1	24.80	24.80	25.00	18.60	Replace	0	0	Check	?
One Time Key In	Main		SEAL, RADIATOR TO LH	1	24.80	24.80	25.00	18.60	Replace	0	0	Check	?
One Time Key In	Main		GUIDE, RADIATOR AIR, RH	1	54.60	54.60	25.00	40.95	Replace	0	0	Check	?
One Time Key In	Main		GUIDE, RADIATOR AIR, LH	1	58.80	58.80	25.00	44.10	Replace	0	0	Check	?
One Time Key In	Main		GUIDE, RADIATOR AIR, UPPER	1	44.70	44.70	25.00	33.53	Replace	0	0	Check	?
One Time Key In	Main		RADIATOR ASSY	1	1,841.10	1,841.10	25.00	1,380.82	Replace	0	0	Check	?
One Time Key In	Main		FAN RADIATOR, RH	1	233.00	233.00	10.00	209.70	Replace	0	0	Check	?
One Time Key In	Main		FAN RADIATOR, LH	1	181.80	181.80	10.00	163.62	Replace	0	0	Check	?
One Time Key In	Main		FAN SHROUD RADIATOR	1	219.30	219.30	25.00	164.48	Replace	0	0	Check	?
One Time Key In	Main		GROMMET (FOR RADIATOR LOWER SUPPORT)	1	12.70	12.70	25.00	9.52	Replace	0	0	Check	?
One Time Key In	Main		CUSHION, (FOR RADIATOR UPPER SUPPORT)	1	9.80	9.80	25.00	7.35	Replace	0	0	Check	?

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval			
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		MOTOR, COOLING FAN , RH	1	443.40	443.40	10.00	399.06	Replace	0	0	Check	?
One Time Key In	Main		MOTOR, COOLING FAN , LH	1	543.50	543.50	10.00	489.15	Replace	0	0	Check	?
One Time Key In	Main		AIR CON COMPRESSOR ASSY	1	2,887.80	2,887.80	10.00	2,599.02	Replace	0	0	Not Give	xan
One Time Key In	Main		TUBE & ACCESSORY	1	574.40	574.40	25.00	430.80	Replace	0	0	Check	?
One Time Key In	Main		AIR CON CONDENSER ASSY	1	1,317.70	1,317.70	25.00	988.28	Replace	1	988.28	Replace	bf ✓
One Time Key In	Main		HOSE SUB-ASSY, DISCHARGE	1	337.10	337.10	25.00	252.83	Replace	0	0	Check	?
One Time Key In	Main		HOSE SUB-ASSY, SUCTION	1	541.90	541.90	25.00	406.42	Replace	0	0	Check	?
One Time Key In	Main		COOLANT	1	12.30	12.30	0.00	12.30	Replace	1	12.30	Replace	new ✓
One Time Key In	Main		PANEL ASSY, INSTRUMENT DASH BOARD UPPER	1	451.60	451.60	25.00	338.70	Replace	1	338.70	Replace	turn ✓
One Time Key In	Main		AIR BAG ASSY, INSTRUMENT PANEL PASSENGER	1	3,240.20	3,240.20	25.00	2,430.15	Replace	1	2,430.1	Replace	ACT ✓
One Time Key In	Main		WIRE ASSY, AIR BAG INSTRUMENT PANEL PASSENGER	1	24.00	24.00	10.00	21.60	Replace	1	21.60	Replace	new ✓
One Time Key In	Main		AIR BAG ASSY, INSTRUMENT PANEL, LOWER NO.1	1	1,593.60	1,593.60	25.00	1,195.20	Replace	1	1,195.2	Replace	ACT ✓
One Time Key In	Main		AIR BAG , COMPUTER ASSY	1	1,083.80	1,083.80	10.00	975.42	Replace	1	975.42	Replace	new ✓
One Time Key In	Main		AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD , RH	1	1,463.80	1,463.80	10.00	1,317.42	Replace	1	1,317.4	Replace	ACT ✓
One Time Key In	Main		AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD , LH	1	1,463.80	1,463.80	10.00	1,317.42	Replace	1	1,317.4	Replace	ACT ✓

Total Spare Part Cost 65,701.86

Surveyor Total 36,253.30

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 52,561.49

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval			
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		AIR BAG ASSY, FRONT SEAT , LH	1	850.00	850.00	10.00	765.00	Replace	1	765.00	Replace v	ACT /
One Time Key In	Main		AIR BAG ASSY, FRONT SEAT , RH	1	850.00	850.00	10.00	765.00	Replace	1	765.00	Replace v	ACT /
One Time Key In	Main		AIR BAG STEERING WHEEL DRIVER ,PAD ASSY,	1	2,377.30	2,377.30	10.00	2,139.57	Replace	1	2,139.57	Replace v	ACT /
One Time Key In	Main		CABLE SUB-ASSY, SPIRAL W/SENSOR	1	881.80	881.80	10.00	793.62	Replace	1	793.62	Replace v	ACT /
One Time Key In	Main		SEAT BELT ASSY, FRONT SEAT , RH	1	838.20	838.20	25.00	628.65	Replace	1	628.65	Replace v	ACT /
One Time Key In	Main		SEAT BELT ASSY, FRONT SEAT , LH	1	838.20	838.20	25.00	628.65	Replace	1	628.65	Replace v	ACT /
One Time Key In	Main		WIPER WASHER INLET	1	55.40	55.40	25.00	41.55	Replace	0	0	Check v	?
One Time Key In	Main		WIPER WASHER JAR	1	183.60	183.60	25.00	137.70	Replace	0	0	Check v	?
One Time Key In	Main		MOTOR AND PUMP ASSY, WINDSHIELD WASHER	1	245.00	245.00	10.00	220.50	Replace	0	0	Not Give v	ACT
One Time Key In	Main		NOZZLE, FRONT WASHER	1	34.10	34.10	25.00	25.58	Replace	0	0	Check v	?
One Time Key In	Main		HOSE, WINDSHIELD WASHER	1	14.00	14.00	25.00	10.50	Replace	0	0	Check v	?
One Time Key In	Main		JOINT, WINDSHIELD WASHER HOSE, NO.3	1	4.70	4.70	25.00	3.53	Replace	0	0	Check v	?
One Time Key In	Main		CUSHION HOOD BUMPER	1	8.50	8.50	25.00	6.38	Replace	1	6.38	Replace v	ACT /
One Time Key In	Main		GUIDE, RADIATOR AIR,	1	93.90	93.90	25.00	70.43	Replace	0	0	Check v	?
One Time Key In	Main		PIPE SUB-ASSY, SUCTION	1	389.60	389.60	25.00	292.20	Replace	0	0	Check v	?

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation											Surveyor Approval		
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		TANK, RESERVE SEALED W/O CAP	1	127.00	127.00	25.00	95.25	Replace	0	0	Check ☐	?
One Time Key In	Main		HOSE, WATER BY-PASS, NO.2	1	37.40	37.40	25.00	28.05	Replace	0	0	Check ☐	?
One Time Key In	Main		PIPE, WATER BY-PASS, NO.1	1	11.00	11.00	25.00	8.25	Replace	0	0	Check ☐	?
One Time Key In	Main		CLIP, (FOR WATER BY-PASS HOSE NO.4)	1	7.50	7.50	25.00	5.63	Replace	0	0	Check ☐	?
One Time Key In	Main		HOSE, WATER BY-PASS, NO.4	1	13.20	13.20	25.00	9.90	Replace	0	0	Check ☐	?
One Time Key In	Main		HOSE, WATER BY-PASS, NO.1	1	37.40	37.40	25.00	28.05	Replace	0	0	Check ☐	?
One Time Key In	Main		CLIP, (FOR WATER BY-PASS HOSE NO.1)	1	7.30	7.30	25.00	5.47	Replace	0	0	Check ☐	?
One Time Key In	Main		INLET, AIR CLEANER, NO 3	1	35.30	35.30	25.00	26.47	Replace	0	0	Check ☐	?
One Time Key In	Main		INLET, AIR CLEANER, NO 2	1	93.90	93.90	25.00	70.43	Replace	0	0	Check ☐	?
One Time Key In	Main		INLET, AIR CLEANER, NO 1	1	130.50	130.50	25.00	97.88	Replace	0	0	Check ☐	?
One Time Key In	Main		CLAMP (FOR AIR CLEANER INLET, NO.1)	1	7.10	7.10	25.00	5.32	Replace	0	0	Check ☐	?
One Time Key In	Main		HOSE, AIR CLEANER, NO.1	1	62.10	62.10	25.00	46.58	Replace	0	0	Check ☐	?
One Time Key In	Main		CLAMP (FOR AIR CLEANER HOSE, NO.1)	1	7.10	7.10	25.00	5.32	Replace	0	0	Check ☐	?
One Time Key In	Main		CLAMP (FOR AIR CLEANER HOSE, NO.2)	1	9.00	9.00	25.00	6.75	Replace	0	0	Check ☐	?
One Time Key In	Main		TUBE, UNION (FOR AIR CLEANER HOSE)	1	19.40	19.40	25.00	14.55	Replace	0	0	Check ☐	?

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation										Surveyor Approval				
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks	
One Time Key In	Main		RESONATOR, INTAKE AIR	1	14.90	14.90	25.00	11.18	Replace	0	0	Check	?	
One Time Key In	Main		CLAMP (FOR RESONATOR INTAKE AIR)	1	7.10	7.10	25.00	5.32	Replace	0	0	Check	?	
One Time Key In	Main		BRACKET, AIR CLEANER	1	26.90	26.90	25.00	20.17	Replace	0	0	Check	?	
One Time Key In	Main		AIR CLEANER ASSY	1	956.20	956.20	25.00	717.15	Replace	1	717.15	Replace	ca	
One Time Key In	Main		BATTERY	1	1,584.90	1,584.90	10.00	1,426.41	Replace	1	1,426.4	Replace	ca	
One Time Key In	Main		WIRE, ENGINE ROOM MAIN	1	6,138.00	6,138.00	10.00	5,524.20	Replace	0	0	Check	?	
One Time Key In	Main		WIRE, ENGINE, NO.3	1	260.40	260.40	10.00	234.36	Replace	0	0	Check	?	
One Time Key In	Main		WIRE, AIR CONDITIONER	1	445.70	445.70	10.00	401.13	Replace	0	0	Check	?	
One Time Key In	Main		FENDER SUB-ASSY, FR , RH	1	933.10	933.10	25.00	699.83	Replace	1	0	Repair	R	
One Time Key In	Main		EMBLEM, SIDE PANEL (HYBRID)	1	52.90	52.90	25.00	39.67	Replace	1	39.67	Replace	nee	
One Time Key In	Main		LINER, FR FENDER, RH	1	198.40	198.40	25.00	148.80	Replace	1	148.80	Replace	TURN	
One Time Key In	Main		PAD, FR WHEEL RH	1	57.70	57.70	25.00	43.28	Replace	1	43.28	Replace	nee	
One Time Key In	Main		WHEEL, DISC FRONT	1	1,555.10	1,555.10	25.00	1,166.32	Replace	0	0	Not Give	Xan	
One Time Key In	Main		HUB & BEARING ASSY, RH & LH	1	554.20	554.20	25.00	415.65	Replace	0	0	Not Give	Xan	
One Time Key In	Main		FENDER SUB-ASSY, FR , LH	1	933.10	933.10	25.00	699.83	Replace	1	699.83	Replace	hnn	

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation

Surveyor Approval

Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main		EMBLEM, SIDE PANEL (HYBRID)	1	52.90	52.90	25.00	39.67	Replace	1	39.67	Replace	new
One Time Key In	Main		LINER, FR FENDER, LH	1	194.30	194.30	25.00	145.73	Replace	1	145.73	Replace	form
One Time Key In	Main		PAD, FR WHEEL LH	1	57.70	57.70	25.00	43.28	Replace	1	43.28	Replace	new
One Time Key In	Main		WHEEL, DISC FRONT	1	1,555.10	1,555.10	25.00	1,166.32	Replace	0	0	Not Give	Xm
One Time Key In	Main		TYRE	1	126.74	126.74	0.00	126.74	Replace	0	0	Not Give	Xm
One Time Key In	Main		HUB & BEARING ASSY, RH & LH	1	554.20	554.20	25.00	415.65	Replace	0	0	Not Give	Xm
One Time Key In	Main		PANEL SUB-ASSY, FRONT DOOR LH	1	1,249.60	1,249.60	25.00	937.20	Replace	1	0	Repair	R
One Time Key In	Main		STICKER DECAL SMRT (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	new
One Time Key In	Main		HINGE ASSY, FRONT DOOR, UPPER LH	1	82.10	82.10	25.00	61.57	Replace	0	0	Check	?
One Time Key In	Main		HINGE ASSY, FRONT DOOR, LOWER LH	1	92.10	92.10	25.00	69.07	Replace	0	0	Check	?
One Time Key In	Main		CHECK ASSY, FRONT DOOR	1	153.50	153.50	25.00	115.13	Replace	0	0	Check	?
One Time Key In	Main		INVERTER WATER PUMP ASSY	1	432.00	432.00	25.00	324.00	Replace	0	0	Check	?
One Time Key In	Main		HOSE, HV WATER PUMP OUTLET	1	29.60	29.60	25.00	22.20	Replace	0	0	Check	?
One Time Key In	Main		HOSE, HV WATER PUMP INLET	1	37.90	37.90	25.00	28.42	Replace	0	0	Check	?
One Time Key In	Main		TANK ASSY, INVERTER RESERVE	1	371.30	371.30	25.00	278.48	Replace	0	0	Check	?

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

SMRT Recommendation													
Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Main			HOSE, INVERTER COOLING OUTLET	1	29.60	29.60	25.00	22.20	Replace	0	0	Check	?
One Time Key In	Main		HOSE, INVERTER RADIATOR INLET	1	40.70	40.70	25.00	30.53	Replace	0	0	Check	?
One Time Key In	Main		HOSE, INVERTER COOLING INLET	1	43.10	43.10	25.00	32.33	Replace	0	0	Check	?
One Time Key In	Main		COOLER, MOTOR COOLING	1	249.10	249.10	25.00	186.82	Replace	0	0	Check	?
One Time Key In	Main		HORN ASSY, HIGH	1	112.80	112.80	25.00	84.60	Replace	0	0	Check	?
One Time Key In	Main		HORN ASSY, LOW	1	112.80	112.80	25.00	84.60	Replace	0	0	Check	?
One Time Key In	Main		BRACKET, HORN	1	7.80	7.80	25.00	5.85	Replace	0	0	Check	?
One Time Key In	Main		HORN ASSY, SECURITY	1	112.80	112.80	25.00	84.60	Replace	0	0	Not Give	X11
One Time Key In	Main		BLOCK ASSY, FUSIBLE LINK	1	99.80	99.80	25.00	74.85	Replace	0	0	Not Give	X11
One Time Key In	Main		COVER, FUSIBLE LINK	1	28.30	28.30	25.00	21.23	Replace	0	0	Not Give	X11
One Time Key In	Main		PANEL, CONSOLE, UPPER	1	409.70	409.70	25.00	307.27	Replace	0	0	Not Give	X11
One Time Key In	Main		PILLAR, FRONT BODY, RH	1	339.40	339.40	25.00	254.55	Replace	0	0	Not Give	X11
One Time Key In	Main		PILLAR, FRONT BODY, LH	1	339.40	339.40	25.00	254.55	Replace	1	0	Repair	P
One Time Key In	Main		INVERTER ASSY	1	4,843.10	4,843.10	10.00	4,358.79	Replace	0	0	Check	?
One Time Key In	Main		PANEL SUB-ASSY, REAR DOOR, LH	1	1,243.90	1,243.90	25.00	932.93	Replace	0	0	Check	?

Total Spare Part Cost 65,701.86

Lump Sum Discount (%) 20.00

Final Spare Part Cost 52,561.49

Surveyor Total 36,253.30

Lump Sum Dis (%) 20

Final Sur Total 29,002.64

Costing Type	Portion	Material Number	Part Name	Qty	SMRT Recommendation				Final Price(\$)	Surveyor Approval				Remarks
					List Price Per Unit(\$)	List Price(\$)	Dis(%)			Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
One Time Key In	Main		HINGE ASSY, REAR DOOR, UPPER LH	1	83.30	83.30	25.00	62.47		Replace	0	0	Not Give	Xan
One Time Key In	Main		HINGE ASSY, REAR DOOR, LOWER LH	1	73.30	73.30	25.00	54.97		Replace	0	0	Not Give	Xan
One Time Key In	Main		CHECK ASSY, REAR DOOR	1	153.50	153.50	25.00	115.13		Replace	0	0	Not Give	Xan
One Time Key In	Main		COVER SUB-ASSY, ENGINE	1	262.70	262.70	25.00	197.02		Replace	1	197.02 0.00	Replace	can
One Time Key In	Main		BRACKET, ENGINE COVER	1	17.90	17.90	25.00	13.42		Replace	0	0	Check	?

Total Spare Part Cost 65,701.86

Surveyor Total 36,253.30

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 52,561.49

Final Sur Total 29,002.64

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT PORTION	1,521.00	1,000	✓
Total:			1,521.00	1,000.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPSRAY REAR DOOR LH	378.00	0	Xan
2	Main	TO REPSRAY FRONT BUMPER	378.00	200	✓
3	Main	TO RESPRAY FRONT BUMPER LOWER GRILLE	180.00	0	Xan
4	Main	TO RESPRAY FRONT SUPPORT PANEL	180.00	100	✓
5	Main	TO REPSRAY FRONT HOOD	378.00	200	✓
6	Main	TO RESPRAY FRONT FENDER LH	378.00	200	✓
7	Main	TO RESPRAY APRON PANEL LH	180.00	0	Xan
Total:			3,150.00	1,000.00	

Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
Main	TO RESPRAY FRONT FENDER RH	378.00	200 ✓	
Main	TO RESPRAY RIM	360.00	0 <i>Xm</i>	
10 Main	TO REPRAY FRONT PILLAR RH	180.00	0 <i>Xm</i>	
11 Main	TO RESPRAY FRONT PILLAR LH	180.00	100 ✓	
Total:		3,150.00	1,000.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0 <i>Xm</i>	
2	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	80 ✓	
3	Main	TO TOP UP A/C GAS	120.00	100 ✓	
4	Main	TO REMOVE AND REFIT FRONT SEAT BELT	120.00	60 ✓	
5	Main	TO REMOVE AND REPLACE REAR SEAT BELT	120.00	60 ✓	
6	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0 <i>Xm</i>	
7	Main	TO CHECK & RESET SYSTEM FUNCTION	350.00	200 ✓	
8	Main	TO REMOVE AND REFIX DASHBOARD	250.00	150 ✓	
9	Main	TO CONDUCT RADIATOR PRESSURE CHECK	100.00	40 ✓	
10	Main	TO REMOVE & REFIX FAN ENGINE & RADIATOR ASSY & INNER COOLER & AIR CON CONDENSER	100.00	60 ✓	
11	Main	TO REMOVE AND REFIT INVERTER CONVERTER	150.00	0 <i>Xm</i>	
12	Main	TOWING CHARGE	56.00	40 ✓	
13	Main	TO REPLACE SUNDRY PARTS	100.00	0 <i>Xm</i>	
14	Main	TO WASH AND VACUUM	60.00	0 <i>Xm</i>	
15	Main	TO REMOVE AND REFIT ENGINE WIRE ROOM	200.00	0 <i>Xm</i>	
16	Main	TO REMOVE AND REFIT WIRE HARNESS	120.00	0 <i>Xm</i>	
Total:			2,856.00	1,440.00	

Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
Main	TO REMOVE / REFIT WINDSCREEN	120.00	120.00 ✓	
Main	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	350.00	450 ✓	
19 Main	TO REMOVE AND REFIX AIR BAG SYSTEM	120.00	80 ✓	
20 Main	TO TRANSFER DOOR MECHANISM	120.00	0 <i>Yin</i>	
Total:		2,856.00	1,440.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	52,561.49	29,002.64
Total Labour Cost	1,521.00	1,000.00
Total Spray Painting	3,150.00	1,000.00
Other	2,856.00	1,440.00
Overall Total	60,088.49	32,442.64
Lump Sum Repair Option		☒
Lump Sum Total	60,100.00	32,450.00
Surveyor Approved Amount		32,450.00
No of Repair Days*	13	10
Remarks		LUMP SUM REPAIR / AFTER PAINT PHOTO / REQUEST NBV /
Surveyor Name		Rasul
Signature		<i>Rasul</i>

Survey Date

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey vehicle after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Save

Clear

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- Please report correctly the details of the accident to speed up the claims process.
- This Form must be completed by the Policyholder and/or the Authorised Driver
- Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- Any false reporting may be referred to the Police for investigation.
- This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	02/11/2021 13:48 (SGT)
Date of Accident	31/10/2021 19:20 (SGT)
Exact Location of Accident	Nicoll Hwy, Singapore
Additional Location Information	NICOLL HIGHWAY ESPLANADE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB668T
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	Strides Taxi Pte Ltd
Company Reg No	1XXXXX369K
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	(Office) +65-68662672

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1800

INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Type of Coverage	ThirdParty
Fleet Policy	Yes
Policy Number	D-21097466MFSH
Cover Note Number	-

DRIVER

Name of Driver	BOEY MUN CHIEW
NRIC No	SXXXX186F

Driving Pass	10/03/1961
Experience	Outdoor
	30/11/1987
	33 YEARS AND 11 MONTHS
Number	Male
Phone Number	(Phone) +65-68662672
Address	-
	AUTO-SVCS-TARC@SMRT.COM.SG
Pass complement	11
code	-
Is the driver the policyholder?	-
No, Relationship of the Driver with the Insured	No
Does Driver Own Other Vehicles?	Hirer
Vehicle Registration Number of Other Vehicle Owned by Driver	No
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Side Swipe
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	3
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	UNKNOWN
Gender	Male

PASSENGER 2

Name	UNKNOWN
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Tampines East Neighbourhood Police Post (e-Kiosk)
Police Station Address	Blk 263 Tampines Street 21 #01-138 Singapore 520263
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT - T/20211001/2000

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Registration Number	GBH2699E
Manufacturer	-
Model	-
Variant	-
Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	TOH KIAN KEAT
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	TOH KIAN KEAT
Gender	Male
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	GBH2699E
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	Yes

INJURED 2

Name of injured person	UNKNOWN
Gender	Male
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB668T
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	Yes

INJURED 3

Name of injured person	UNKNOWN
Gender	Female
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB668T
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	Yes

Raffle
Blvd


Esplanade

Harry J. B.

Ramsey

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There is no handwriting or other markings on the paper.

We declare the foregoing particulars are true in every respect.



Driver's Signature (if driver is not the policyholder) / Date & Time:

Wires and by Research; Centre
Experiments

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation**.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time

Sketch Plan

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel



SINGAPORE POLICE FORCE



T/20211101/2000

Police Station Of Origin:
Tampines N.P.C
6 Tampines Avenue 4 SINGAPORE 529682
Tel No: 1800-5871999

1 of 3

Report No. T/20211101/2000

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 01/11/2021 00:06		Vide Report No.: A/20211031/0127		Station Diary No.: 1	
Informant's Particulars					
Name of Informant: BOEY MUN CHIEW			Address: APT BLK 450G TAMPINES STREET 42 #06-378 SINGAPORE 527450		
ID Type / ID No.: NRIC NO / S1497186F			Contact No.: Home/Office: Mobile: 96669682		
Nationality: SINGAPORE CITIZEN			Email: hsentosa@hotmail.com		
Sex: Male	Age: 60	Date of Birth: 10/03/1961	Type of Informant: Driver		
Race: Chinese			Language: English		Institution / School Name:
Occupation: Taxi driver			Driving Licence Information: Class: 3		Date of Expiry:

General Information of the Accident

Type of Accident:	Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 31/10/2021 19:20	Type of Location: X-Junction
Location: BRAS BASAH ROAD				
Weather: Raining		Road Surface: Wet		Road Speed Limit:
Traffic Flow: Dual Carriage Way		Traffic Control: Traffic Light - Working		Traffic Volume Light
Type of Collision: Between Moving Vehicles - Head To Side				Anyone conveyed by ambulance No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
GBH2699E	Lorry	TOYOTA	DYNA 150 5MT	Silver	Seriously Damaged	1
SHB668T	Car	TOYOTA	PRIUS HYBRID 1.8 CVT	Maroon	Seriously Damaged	2

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20211101/2000

Police Station Of Origin:
Tampines N.P.C
6 Tampines Avenue 4 SINGAPORE 529682
Tel No: 1800-5871999

2 of 3

Report No. T/20211101/2000

CONTINUATION OF REPORT

Driver			
Name	TOH KIAN KEAT	ID No.	S9108400G
Related Vehicle	GBH2699E (Lorry)	Contact No	97496408
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	BOEY MUN CHIEW	ID No.	S1497186F
Related Vehicle	SHB668T (Car)	Contact No.	96669682
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 31/10/2021 at about 7.20pm, while I was driving along Nicole Highway heading towards Esplanade, I met with an accident with a lorry (GBH2699E) at the x-junction of Raffles Boulevard and Nicole Highway.

The collision cause serious damaged to my taxi whereas the lorry suffered some damages to the side and punctured tyres.

I wish to state that I am unsure if I had beat the red-light. However, I observed that the vehicles in front of me had all drove without stopping nor any sign of slowing down.

I wish to further state that I had applied my brakes. However, I was unable to break in time to avoid the collision.

I would like to add that though no one was observed to have suffered any injury visibly, my 2 passengers and the lorry's driver and passenger were conveyed to the hospital. Both our vehicles were towed.



**SINGAPORE
POLICE FORCE**



T/20211101/2000

Police Station Of Origin:
Tampines N.P.C
6 Tampines Avenue 4 SINGAPORE 529682
Tel No: 1800-5871999

3 of 3

Report No. T/20211101/2000

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature of Officer Recording The Report
G/
Sr Staff Sgt MOHAMED IDIL BIN
MOHAMED ALI

Signature Of Informant:

Signature Of Interpreter:
Not applicable

Date/Time
01/11/2021 00:06

Officer In Charge Of Case:
TP / GIT /
Sr Staff Sgt ABDUL RAHIM
Contact No.: 65476437



Classification Of Case:

Authentication Stamp
NP165



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	369K
Vehicle No.:	SHB668T
Vehicle to be Exported:	No
Intended Deregistration Date:	07 Nov 2021
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZR8287697
Chassis No.:	JTDKB3FU803579722
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	19 Dec 2017
First Registration Date:	19 Dec 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	18 Dec 2025
PARF Rebate Amount:	\$3,750.00
COE Expiry Date:	18 Dec 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$34,159.00
COE Rebate Amount:	\$17,561.00
Total Rebate Amount:	\$21,311.00

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 07 Nov 2021

OK