



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204940

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 11/08/2022
Reference CC3/CTI21011749/Rea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHF 1029K
Insured Veh. SMX 6558M
Claim No. SNM21D206524/C02
Policy No. DMPCSNW00040272100
Accident Date 12/11/2021
Inspection Date 15/11/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21011749/Rea3q2 Date: 11/08/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMX 6558M	Veh. Inspected	SHF 1029K
	Policy No.	DMPCSNW00040272100	Coverage (\$)	0.00
	Claim No.	SNM21D206524/C02	Excess (\$)	0.00
	Assign From		Assign Date	15/11/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS TAXI	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2014
	Chassis No.	JTDKN36U505754665	Colour	MAROON
	Odometer	732051 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	6 mm
	L/H Front Tyre	195/65 R15	SAILUN	6 mm
	R/H Rear Tyre	195/65 R15	SAILUN	6 mm
	L/H Rear Tyre	195/65 R15	SAILUN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	12/11/2021	Inspection Date	15/11/2021
	Survey held at	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 1029K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FENDER LINER PAD ,FR WHEEL ,LH (DISC 25%)	NECESSARY	49.30	36.98
1	FENDER LINER FRT /LH (DISC 25%)	CUT	171.70	128.78
1	BUMPER SUPPORT F/LH (DISC 25%)	CRACKED	76.40	57.30
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	BUMPER FRT (DISC 25%)	DEFORMED	482.00	361.50
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	FENDER FRT/LH (DISC 25%)	BENT	723.40	542.55
1	HEAD LAMP LH (DISC 10%)	CRACKED	945.20	850.68
1	STICKER DECAL SMRT (DOOR) (SN)	NECESSARY	60.00	60.00
1	ADVERTISEMENT STICKER (SN)	NECESSARY	296.88	296.88
1	WHEEL HUB FRT	NOT NECESSARY	549.70	-
1	TYRE	NOT NECESSARY	126.74	-
1	FENDER APRON SUB FRT/LH	NOT NECESSARY	637.80	-
1	SEAL ,FRONT FENDER TO COWL SIDE LH	NOT NECESSARY	15.20	-
1	PROTECTOR ,FRONT FENDER SIDE PANEL LH	NOT NECESSARY	114.50	-
1	WIRE ENGINE ROOM NO.3	NOT NECESSARY	242.00	-
1	BUMPER GRILLE SUB-ASSY ,LOWER	NOT NECESSARY	311.10	-
1	ARM SUB-ASSY ,FR BUMPER RH	NOT NECESSARY	250.40	-
1	ARM SUB-ASSY ,FR BUMPER LH	NOT NECESSARY	250.40	-
1	BUMPER REINFORCEMENT FRT	NOT NECESSARY	498.40	-
1	BUMPER SUPPORT F/RH	NOT NECESSARY	76.40	-
1	FENDER PROTECTOR FRT/LH UPPER	NOT NECESSARY	46.10	-
1	HEAD LAMP RH	NOT NECESSARY	945.20	-
1	COVER ,OUTER MIRROR ,LH	NOT NECESSARY	107.40	-
1	MIRROR LAMP LH	NOT NECESSARY	65.30	-
1	MIRROR ASSY ,LH	NOT NECESSARY	1,224.90	-
1	CHECK ASSY ,FR DOOR	NOT NECESSARY	150.30	-
1	HINGE UPPER LHF, DOOR	NOT NECESSARY	80.50	-
1	HINGE LOWER LHF DOOR	NOT NECESSARY	90.10	-
1	UNDER COVER SIDE /RH	NOT NECESSARY	46.10	-
1	UNDER COVER CENTER	NOT NECESSARY	448.30	-

Report Ref No. CC3/CTI21011749/Rea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BUMPER FRT ABSORBER LOWER	NOT NECESSARY	127.70	-
1	BUMPER LIP FRT	NOT NECESSARY	139.60	-
1	GRILLE ,RADIATOR LOWER NO .2	NOT NECESSARY	94.60	-
1	GRILLE ,RADIATOR	NOT NECESSARY	310.60	-
1	COVER ,RADIATOR	NOT NECESSARY	122.80	-
1	LENS & BODY ,FR TURN LH	NOT NECESSARY	511.80	-
1	FOG LAMP LH	NOT NECESSARY	280.10	-
1	WHEEL DISC FRONT	TO REPAIR SEE LABOUR	1,484.20	-
1	DOOR FRT/LH	TO REPAIR SEE LABOUR	894.40	-
			13,115.52	2,385.68
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF WHEEL DISC FRONT AND DOOR FRT/LH .		676.00	400.00
	SPRAY PAINT.		1,854.00	650.00
	TO DO WHEEL ALIGNMENT /TYRE BALANCING.		120.00	60.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).		120.00	30.00
	TO REMOVE AND REFIX WING MIRROR .	NOT NECESSARY	120.00	-
	TO TRANSFER DOOR MECHANISM .	NOT NECESSARY	120.00	-
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	40.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION.	NOT NECESSARY	80.00	-
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			3,350.00	1,180.00
GRAND TOTAL			16,465.52	3,565.68
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,000.00

Report Ref No. CC3/CTI21011749/Rea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHF 1029K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

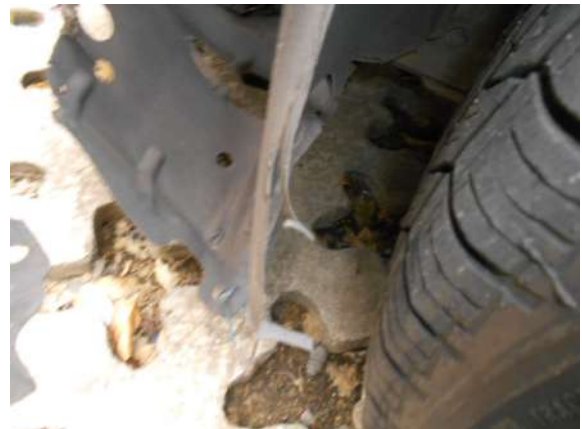



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

